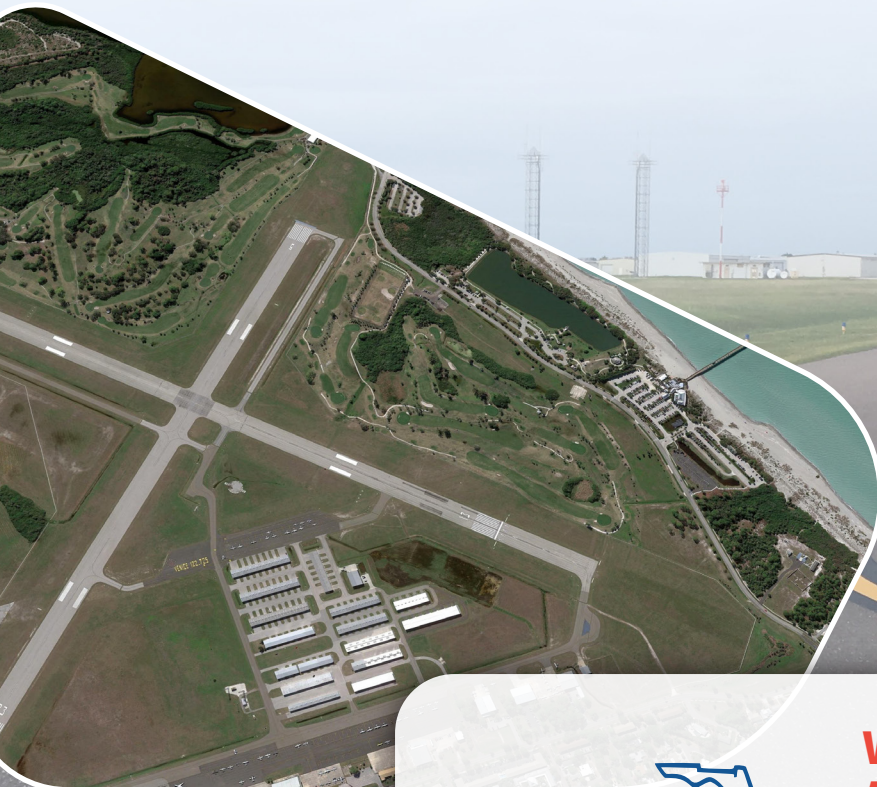


FLORIDA DEPARTMENT OF TRANSPORTATION
AVIATION AND SPACEPORTS OFFICE

Statewide Airfield Pavement Management Program

Airport Pavement Evaluation Report November 2019



**Venice Municipal
Airport (VNC)**
Reliever Airport
District 1





Florida Department of Transportation

Statewide Airfield Pavement Management Program

Prepared by:

*FDOT Aviation and Spaceports Office
605 Suwannee Street
Tallahassee, Florida 32399-0450*




OFFICE OF FREIGHT, LOGISTICS & PASSENGER OPERATIONS

Table of Contents


Executive Summary.....	10
Program Background.....	10
Summary of Results.....	11
Pavement Condition Index (Latest Inspection)	11
Forecasted Pavement Condition Index 2020-2029.....	13
Major Rehabilitation Planning 2020-2029	15
Summary of Venice Municipal Airport	16
Chapter 1 – Introduction	18
1.1 Background	18
1.2 Statewide Airfield Pavement Management Program (SAPMP) Update 2018-2019....	18
1.3 Organization	20
1.3.1 Florida Department of Transportation Aviation and Spaceports Office Program Manager	20
1.3.2 Participating Florida Public-Use and Publicly Owned Airports	20
1.3.3 Florida Department of Transportation District Offices.....	20
1.3.4 Consultant	20
1.4 Purpose of Airport Pavement Evaluation Report	22
1.5 History of the Program	22
1.6 Federal Aviation Administration (FAA)	24
1.7 FDOT SAPMP Objectives and Components	24
1.7.1 Program Objectives.....	24
1.7.2 Program Components	24
1.8 References	28
Chapter 2 – Methodology	30
2.1 Airfield Pavement Database	30
2.2 Airfield Pavement System Inventory	30
2.2.1 Pavement Management Program Network Definition Terminology.....	31
2.3 Airfield Pavement Structure	33
2.3.1 Pavement Structure Types	33
2.4 Airfield Pavement Work History.....	35
2.4.1 Airfield Pavement Record Keeping	35
2.5 Airfield Pavement Traffic	35
2.6 Airfield Pavement Condition Index (PCI) Survey.....	35
2.6.1 PCI Survey Methodology	35
2.6.2 Pavement Distress Types	37

2.6.3 PCI Survey Inspection Procedures	41
2.6.4 Updates to the ASTM D5340-12	42
Chapter 3 – Airfield Pavement System Inventory	45
3.1 Airfield Pavement Network Information	45
3.1.1 Previous and/or Anticipated Airfield Pavement Construction	45
3.1.2 Estimated Pavement Age	47
3.1.3 Functional Use Classification	49
3.1.4 Pavement Surface Type.....	50
3.1.5 Pavement System Inventory Details	51
Chapter 4 – Airfield Pavement Condition	57
4.1 Airfield Pavement Condition Index (Latest Inspection)	57
4.1.1 Network-Level Analysis	57
4.1.2 Branch-Level Analysis.....	57
4.1.3 Section-Level Analysis	60
4.2 Summary of Pavement Condition Evaluation Results	64
4.2.1 Network-Level Observations	64
4.2.2 Branch-Level Observations.....	64
4.3 Forecasted Pavement Conditions	66
4.3.1 Performance Models and Prediction Curves	66
4.3.2 Branch-Level Pavement Condition Forecast	66
4.3.3 Section-Level Pavement Condition Forecast.....	68
4.3.4 Forecasted PCI Considerations	72
Chapter 5 – Localized Maintenance and Repair Planning.....	74
5.1 Localized Maintenance and Repair	74
5.2 Localized Maintenance and Repair Policy	75
5.3 Localized Maintenance and Repair Analysis and Recommendations	79
Chapter 6 – Major Rehabilitation Planning.....	83
6.1 Major Rehabilitation	83
6.1.1 Critical PCI	85
6.1.2 FDOT Recommended Minimum Service-Level PCI	85
6.2 Major Rehabilitation Policy	86
6.2.1 Major Rehabilitation Pavement Section Development.....	86
6.2.2 Major Rehabilitation Planning-Level Unit Costs.....	88
6.3 Major Rehabilitation Needs	88
6.3.1 10-Year Unconstrained Budget Major Rehabilitation Needs	88
Chapter 7 – Conclusion.....	92
7.1 Recommendations	92
7.1.1 Continued PCI Survey Inspections	92
7.1.2 Localized Maintenance and Repair.....	92

7.1.3 Major Rehabilitation	92
7.1.4 Pavement Management System.....	92
7.2 Supporting Documents.....	93
001 – Airfield Pavement Network Definition Exhibit.....	93
002 – Airfield Pavement System Inventory Exhibit	93
003 – Airfield Pavement Condition Index Exhibit	93
004 – Airfield Pavement Major Rehabilitation Exhibit	93
Inspection Photograph Documentation.....	93
7.3 Conclusion	94

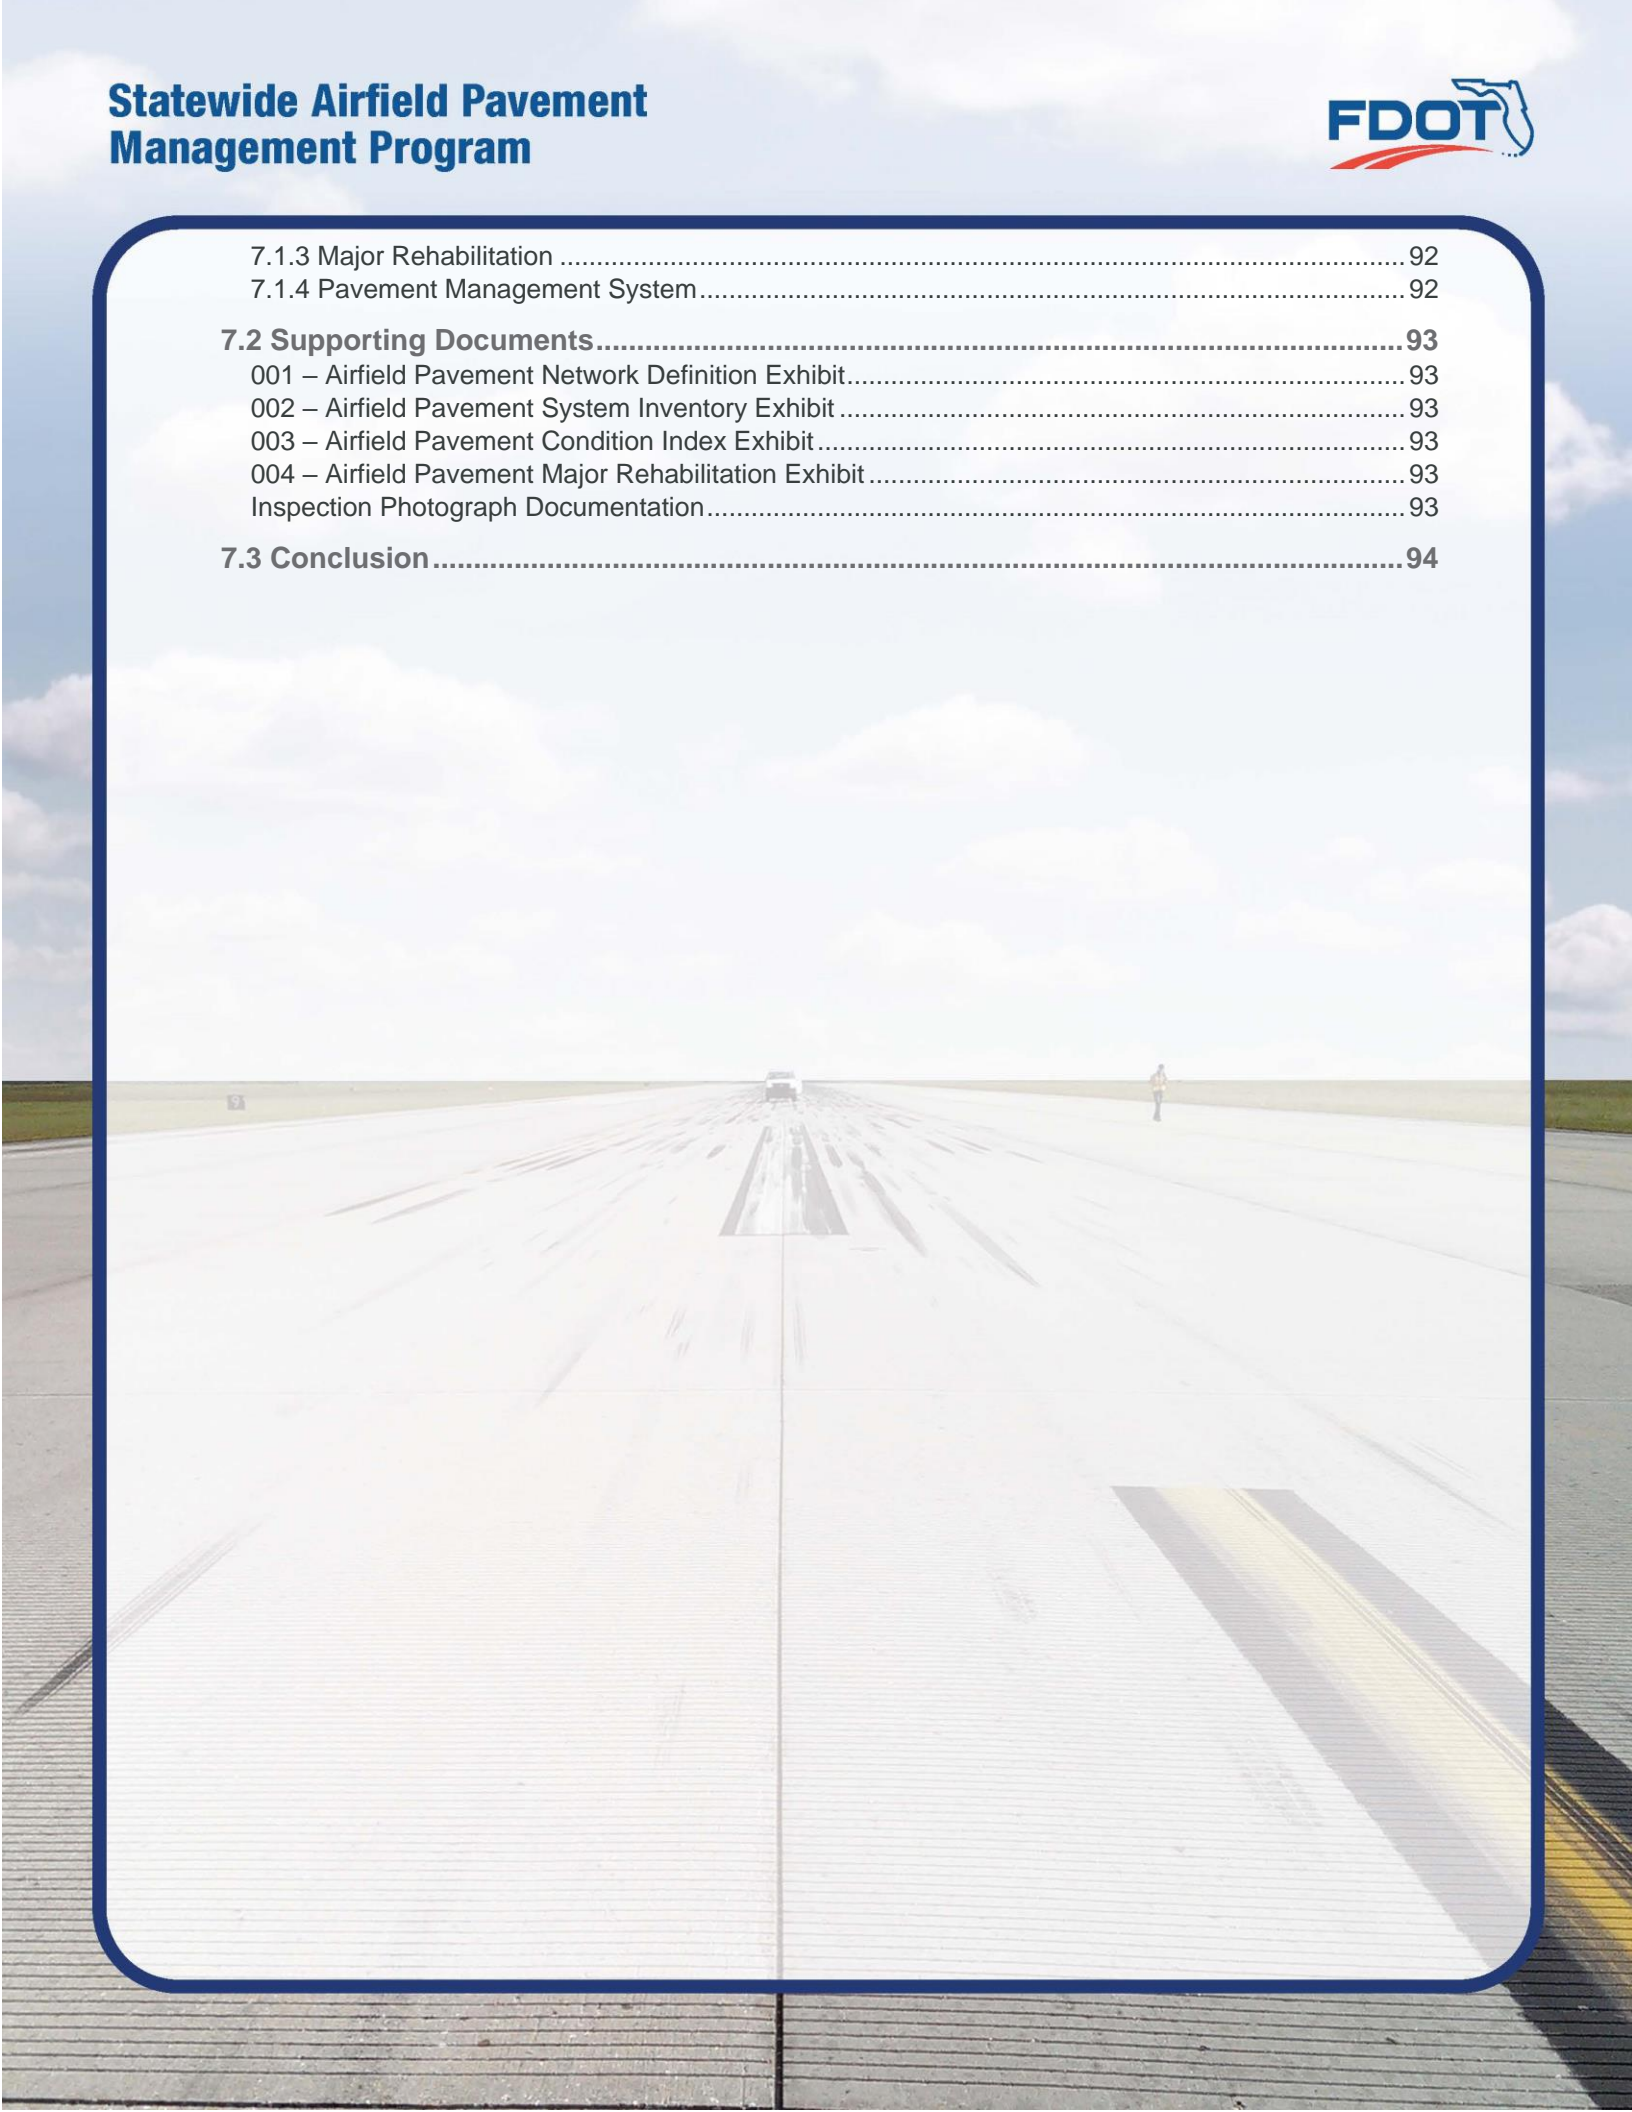

Appendix A	Airfield Pavement Analysis Tables
Appendix B	Airfield Pavement Localized Maintenance and Repair and Major Rehabilitation
Appendix C	Technical Exhibits
Appendix D	Inspection Photograph Documentation
Appendix E	Inspection Distress Details

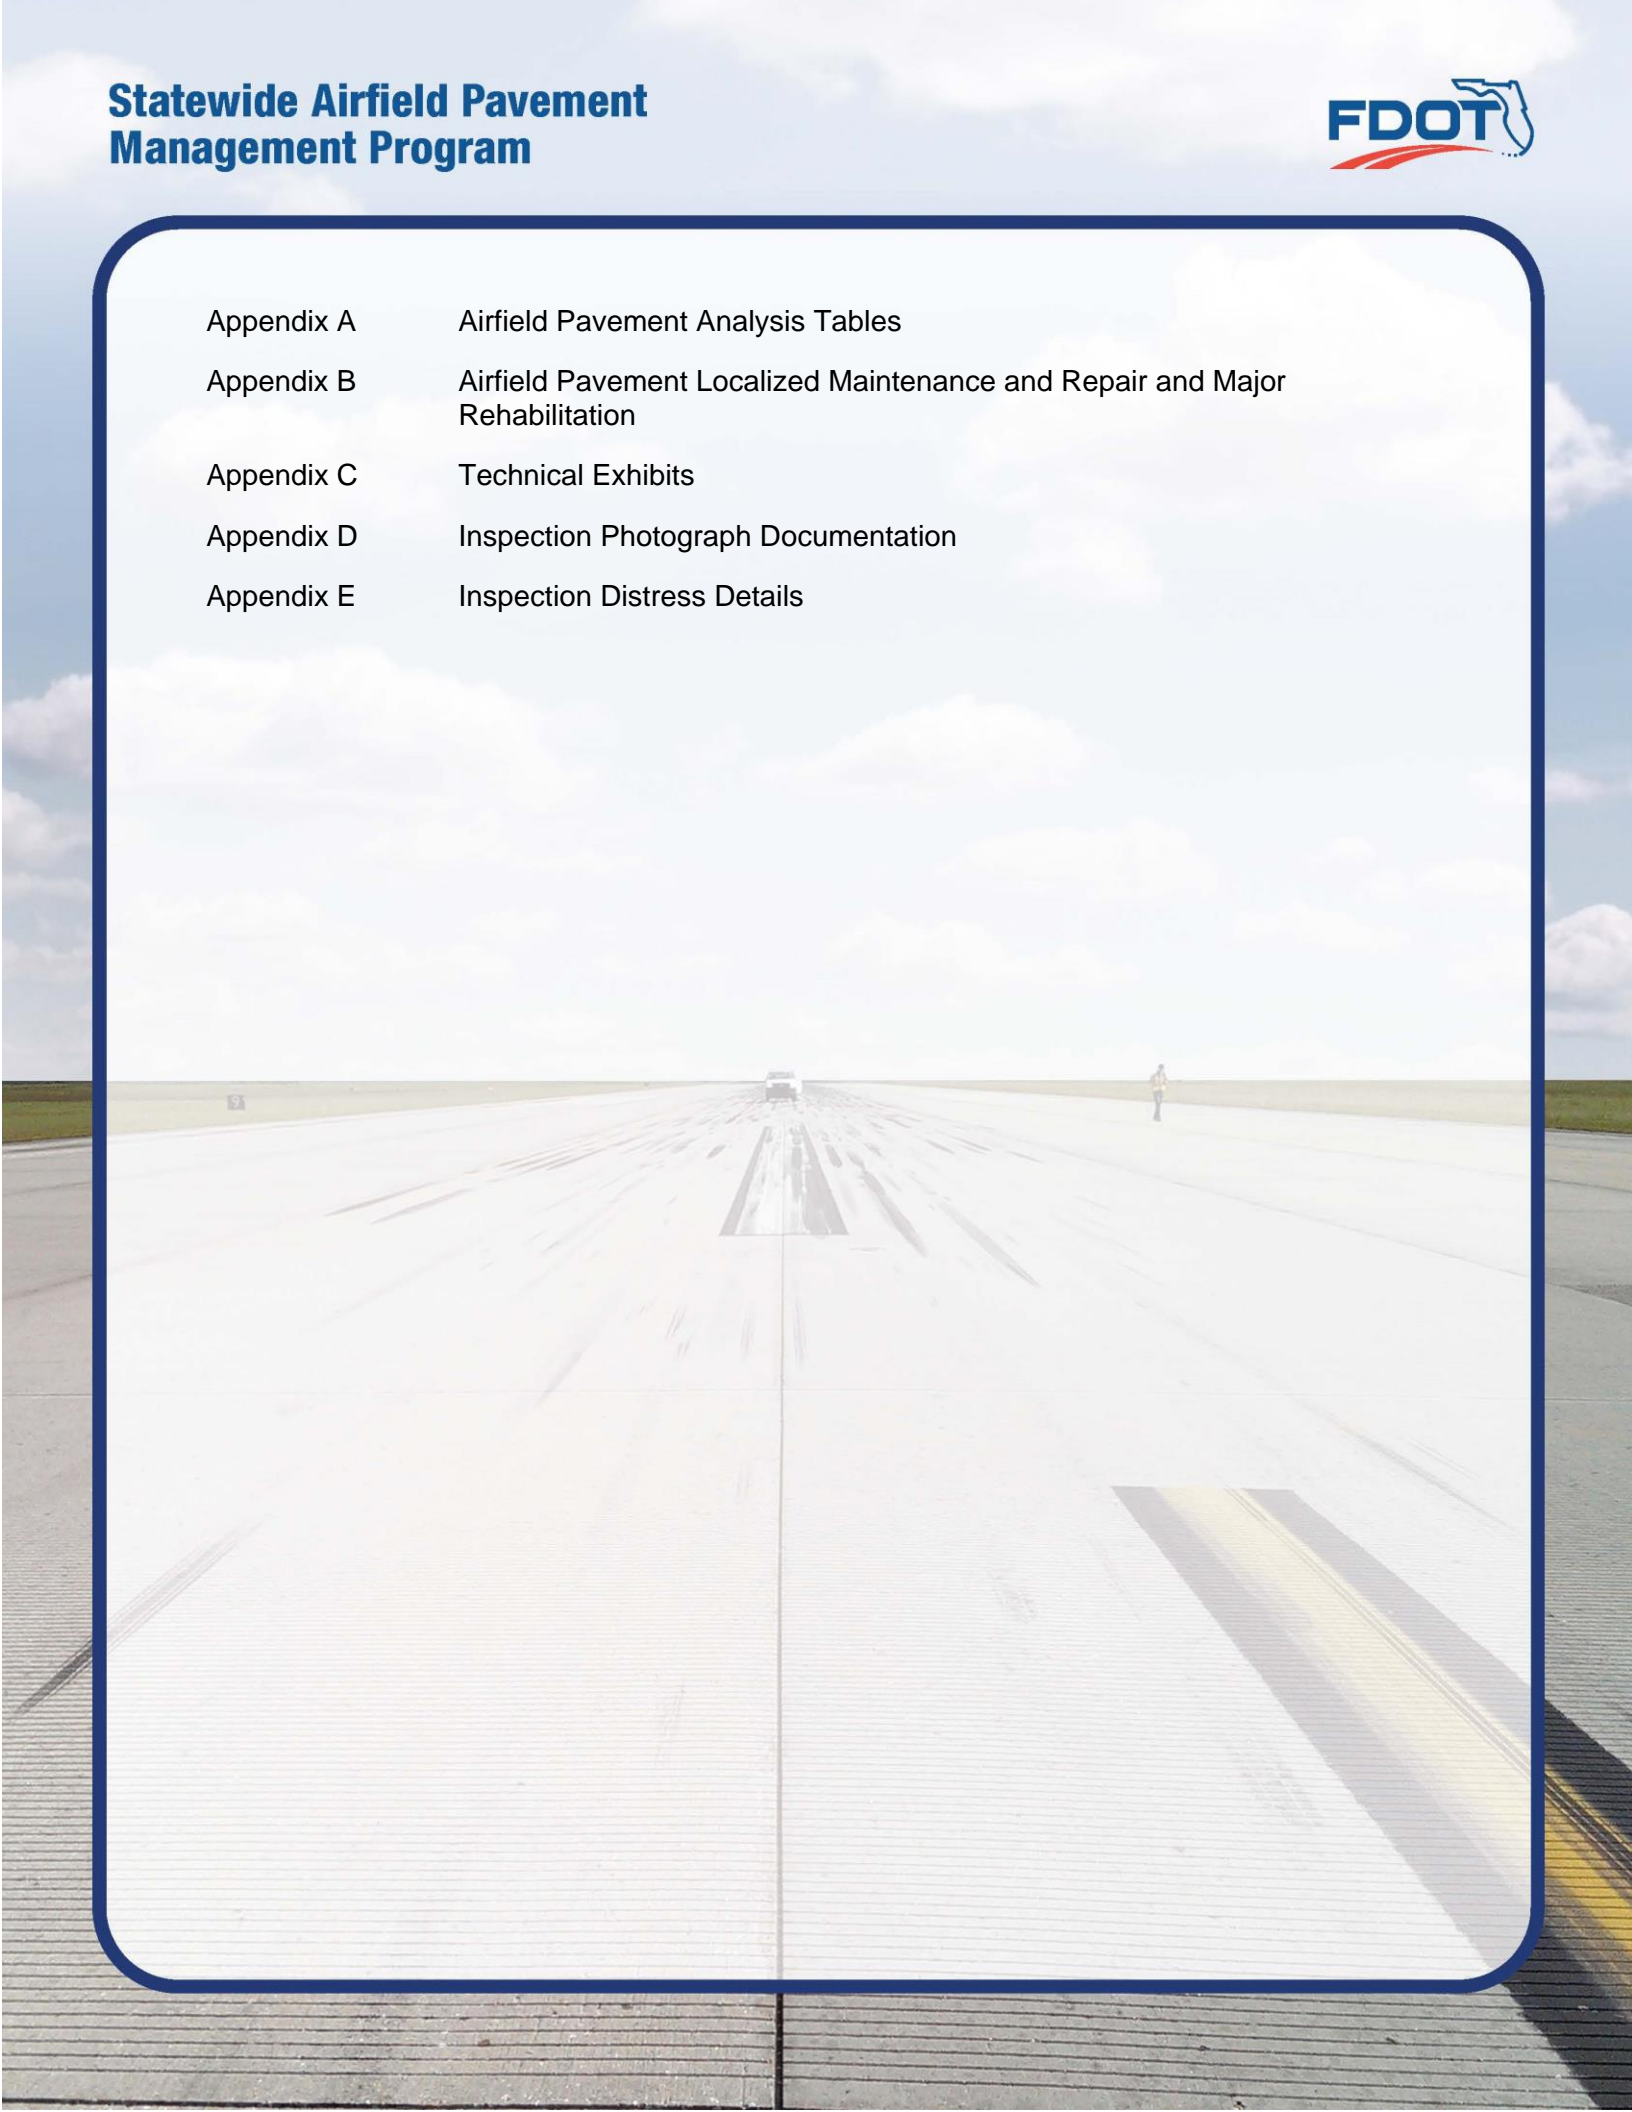

List of Figures

<i>Figure E-4 Major Rehabilitation Planning Annual Budget 2020-2029</i>	<i>16</i>
<i>Figure 1.2 Florida Aviation System (Facilities with Pavement) and FDOT Districts.....</i>	<i>19</i>
<i>Figure 1.7.2 (a) Typical Pavement Condition Life Cycle</i>	<i>25</i>
<i>Figure 1.7.2 (b) General Pavement Treatments by Condition Range.....</i>	<i>26</i>
<i>Figures 1.7.2 (c) Flexible Asphalt Concrete</i>	<i>27</i>
<i>Figures 1.7.2 (d) Rigid Portland Cement Concrete</i>	<i>27</i>
<i>Figure 3.1.1 (a) 2019 Airfield Pavement Network Definition Exhibit.....</i>	<i>46</i>
<i>Figure 3.1.1 (b) 2019 Airfield Pavement System Inventory Exhibit</i>	<i>47</i>
<i>Figure 3.1.2 Average Age of Pavements at Inspection</i>	<i>48</i>
<i>Figure 3.1.3 Airfield Pavement Functional Classification Use by Area</i>	<i>49</i>
<i>Figure 3.1.4 (a) Pavement Surface Type by Area (SF).....</i>	<i>50</i>
<i>Figure 3.1.4 (b) Pavement Surface Type by Area (%)</i>	<i>51</i>
<i>Figure 4.1.1 Latest Condition – Overall Network</i>	<i>57</i>
<i>Figure 4.1.2 (a) Latest Condition – Runway Pavements</i>	<i>58</i>
<i>Figure 4.1.2 (b) Latest Condition – Taxiway Pavements</i>	<i>58</i>
<i>Figure 4.1.2 (c) Latest Condition – Apron Pavements.....</i>	<i>59</i>
<i>Figure 4.1.3 2019 Airfield Pavement Condition Index Exhibit.....</i>	<i>63</i>
<i>Figure 4.2.2 Pavement Condition Summary by Facility Use.....</i>	<i>65</i>
<i>Figure 4.3.2 (a) Forecasted Runway Pavement Performance.....</i>	<i>66</i>
<i>Figure 4.3.2 (b) Forecasted Taxiway Pavement Performance</i>	<i>67</i>
<i>Figure 4.3.2 (c) Forecasted Apron Pavement Performance</i>	<i>67</i>
<i>Figures 6.1 (a) Major Rehabilitation Planning Decision Diagram, $PCI \leq$ Critical PCI.....</i>	<i>83</i>
<i>Figures 6.1 (b) Major Rehabilitation Planning Decision Diagram, $PCI >$ Critical PCI</i>	<i>84</i>
<i>Figure 6.3.1 (a) 10-Year Major Rehabilitation Needs by Program Year.....</i>	<i>90</i>
<i>Figure 6.3.1 (b) 10-Year Major Rehabilitation Needs by Program Year Exhibit.....</i>	<i>90</i>

List of Tables

<i>Table E-1 Pavement Condition Index Summary (Last Inspection) – Section Level.....</i>	<i>11</i>
<i>Table E-2 Pavement Condition Index Forecast 2020-2029.....</i>	<i>13</i>
<i>Table E-3 Major Rehabilitation Planning 2020-2029</i>	<i>15</i>
<i>Table 2.2.1 Airfield Pavement Database Network Definition Terminology.....</i>	<i>32</i>
<i>Table 2.6.2 (a) Pavement Distress Types – Flexible Asphalt Concrete-Surfaced Airfields</i>	<i>37</i>
<i>Table 2.6.2 (b) Pavement Distresses Possible Causes – Flexible Asphalt Concrete-Surfaced Airfields</i>	<i>38</i>
<i>Table 2.6.2 (c) Pavement Distresses Possible Effects – Flexible Asphalt Concrete-Surfaced Airfields</i>	<i>38</i>
<i>Table 2.6.2 (d) Pavement Distresses – Rigid Portland Cement Concrete-Surfaced Airfields</i>	<i>39</i>
<i>Table 2.6.2 (e) Pavement Distresses Possible Causes – Rigid Portland Cement Concrete-Surfaced Airfields</i>	<i>40</i>
<i>Table 2.6.2 (f) Pavement Distresses Possible Effects – Rigid Portland Cement Concrete-Surfaced Airfields</i>	<i>40</i>
<i>Table 2.6.3 (a) Recommended Sample Rate Schedule for Flexible Asphalt Concrete.....</i>	<i>41</i>
<i>Table 2.6.3 (b) Recommended Sample Rate Schedule for Rigid Portland Cement Concrete</i>	<i>41</i>
<i>Table 2.6.4 Summary of Updates to ASTM D5340-12</i>	<i>43</i>
<i>Table 3.1.1 Previous and/or Anticipated Airfield Pavement Construction</i>	<i>45</i>
<i>Table 3.1.5 Pavement System Inventory Details.....</i>	<i>52</i>
<i>Table 4.1.3 Latest Pavement Condition Index Summary</i>	<i>61</i>
<i>Table 4.3.3 Forecasted PCI 2020-2029</i>	<i>69</i>
<i>Table 5.2 (a) Localized Maintenance and Repair – Flexible Asphalt Concrete</i>	<i>75</i>
<i>Table 5.2 (b) Localized Maintenance and Repair – Rigid Portland Cement Concrete.....</i>	<i>76</i>
<i>Table 5.2 (c) Localized Repair Planning-Level Unit Costs – Flexible Asphalt Concrete....</i>	<i>78</i>

<i>Table 5.2 (d) Localized M&R Planning-Level Unit Costs – Rigid Portland Cement Concrete</i>	<i>78</i>
<i>Table 5.3 (a) Summary of Airport Localized M&R Planning Cost and Quantity at Network Level</i>	<i>79</i>
<i>Table 5.3 (b) Summary of Airport Localized M&R Planning Cost and Quantity at Section Level</i>	<i>80</i>
<i>Table 5.3 (c) Summary of Localized Maintenance</i>	<i>81</i>
<i>Table 6.1.2 FDOT Recommended Minimum Service-Level PCI</i>	<i>85</i>
<i>Table 6.2.1 (a) Conceptual Pavement Section for Major Rehabilitation – Flexible Asphalt Concrete</i>	<i>86</i>
<i>Table 6.2.1 (b) Conceptual Pavement Section for Major Rehabilitation – Rigid Portland Cement Concrete</i>	<i>87</i>
<i>Table 6.2.2 Reliever (RL) Major Rehabilitation Planning-Level Unit Cost by Pavement Type</i>	<i>88</i>
<i>Table 6.3.1 10-Year Major Rehabilitation Needs</i>	<i>89</i>



Executive Summary





Executive Summary

Program Background

Airport airfield pavement infrastructure facilities represent a large capital investment in the Florida Airport System. Timely and appropriate maintenance and strategic rehabilitation are essential as repair costs increase significantly in proportion to deterioration. Airport pavement distresses can also contribute to the development of loose debris and decreased ride quality, which can be a safety concern for aircraft operations.

In 2016, the Florida Department of Transportation (FDOT) Aviation and Spaceports Office (ASO) selected Kimley-Horn and Associates, Inc. with subconsultants Airfield Pavement Management Systems, LLC and AVCON, Inc. to provide professional services in support of FDOT in the continued efforts of performing a system update to the Statewide Airfield Pavement Management Program (SAPMP). This work is to be completed from fiscal year 2016 through fiscal year 2019. The SAPMP has 95 public use airport facilities throughout the seven FDOT Districts that participate in the system update. The results of this system update for this specific airport are presented in this report and can be utilized by FDOT and the Federal Aviation Administration (FAA) to identify, prioritize, and schedule pavement maintenance, repair, and major rehabilitation projects.

Pavement condition was assessed utilizing the pavement condition index (PCI) methodology as defined in the FAA Advisory Circular **150/5380-7B “Airport Pavement Management Program (PMP)”** using the documented procedures set forth by ASTM **D5340-12 “Standard Test Method for Airport Pavement Condition Index Surveys.”**

Pavement deterioration, in accordance with the ASTM D5340-12, was characterized in terms of distinct distress types, severity level of distress, and quantity of distress. This information is utilized to calculate a PCI numeric that represents the overall condition of the pavement in a numeric index that ranges from 0 (a condition category of FAILED) to 100 (GOOD). The PCI methodology analyzes an overall measure of the pavement condition and provides an indication of the degree of maintenance, repair, or rehabilitation efforts that will be required to sustain functional pavement.

The tasks required for the system update at each participating airport consist of the following:

- Obtain recent and anticipated airfield pavement construction work data.
- Update airport airfield pavement system inventory records (construction history, identification, geometry, and facility classification).
- Perform PCI Survey Inspections at each participating airport.
- Update the FDOT SAPMP PAVER™ database system.
- Update the FDOT SAPMP GIS Airfield Navigation GPS enabled Maps.
- Update airfield pavement performance models and pavement condition forecasting.
- Identification of planning-level maintenance, repair, and major rehabilitation to address pavement needs based on functional PCI analysis.
- Development of planning-level opinion of probable construction costs for pavement rehabilitation.



Summary of Results

Pavement Condition Index (Latest Inspection)

Table E-1 Pavement Condition Index Summary (Last Inspection) – Section Level

Network ID	Branch Name	Branch Use	Section ID	Area (SF)	PCI	Condition Rating
VNC	RUNWAY 13-31	RUNWAY	6105	413,900	76	Satisfactory
VNC	RUNWAY 13-31	RUNWAY	6110	196,950	74	Satisfactory
VNC	RUNWAY 13-31	RUNWAY	6115	30,000	67	Fair
VNC	RUNWAY 13-31	RUNWAY	6120	20,000	61	Fair
VNC	RUNWAY 13-31	RUNWAY	6125	30,000	68	Fair
VNC	RUNWAY 13-31	RUNWAY	6130	20,000	63	Fair
VNC	RUNWAY 13-31	RUNWAY	6135	26,100	93	Good
VNC	RUNWAY 13-31	RUNWAY	6140	13,050	90	Good
VNC	RUNWAY 13-31	RUNWAY	6145	64,500	100	Good
VNC	RUNWAY 13-31	RUNWAY	6150	32,250	100	Good
VNC	RUNWAY 5-23	RUNWAY	6205	255,000	90	Good
VNC	RUNWAY 5-23	RUNWAY	6210	350,820	94	Good
VNC	RUNWAY 5-23	RUNWAY	6215	18,000	94	Good
VNC	RUNWAY 5-23	RUNWAY	6220	27,000	92	Good
VNC	RUNWAY 5-23	RUNWAY	6225	18,000	94	Good
VNC	RUNWAY 5-23	RUNWAY	6230	27,000	94	Good
VNC	RUNWAY 5-23	RUNWAY	6240	13,680	86	Good
VNC	RUNWAY 5-23	RUNWAY	6250	18,000	94	Good
VNC	GA T-HANGARS	TAXIWAY	605	17,687	69	Fair
VNC	GA T-HANGARS	TAXIWAY	610	42,593	66	Fair
VNC	GA T-HANGARS	TAXIWAY	620	103,188	54	Poor
VNC	GA T-HANGARS	TAXIWAY	705	36,074	79	Satisfactory
VNC	GA T-HANGARS	TAXIWAY	708	11,509	68	Fair
VNC	GA T-HANGARS	TAXIWAY	710	42,414	49	Poor
VNC	GA T-HANGARS	TAXIWAY	715	12,818	92	Good
VNC	GA T-HANGARS	TAXIWAY	720	5,418	92	Good
VNC	GA T-HANGARS	TAXIWAY	725	17,455	94	Good
VNC	GA T-HANGARS	TAXIWAY	730	18,001	59	Fair
VNC	GA T-HANGARS	TAXIWAY	735	21,879	100	Good
VNC	TAXIWAY A	TAXIWAY	105	55,145	94	Good
VNC	TAXIWAY A	TAXIWAY	110	53,584	89	Good
VNC	TAXIWAY A	TAXIWAY	115	52,281	92	Good
VNC	TAXIWAY A	TAXIWAY	120	9,988	90	Good
VNC	TAXIWAY A	TAXIWAY	125	5,738	66	Fair



Network ID	Branch Name	Branch Use	Section ID	Area (SF)	PCI	Condition Rating
VNC	TAXIWAY B	TAXIWAY	220	30,324	100	Good
VNC	TAXIWAY B	TAXIWAY	225	12,448	91	Good
VNC	TAXIWAY B	TAXIWAY	230	17,274	100	Good
VNC	TAXIWAY B	TAXIWAY	235	23,085	100	Good
VNC	TAXIWAY C	TAXIWAY	315	84,284	94	Good
VNC	TAXIWAY D	TAXIWAY	400	39,559	100	Good
VNC	TAXIWAY D	TAXIWAY	405	76,074	100	Good
VNC	TAXIWAY D	TAXIWAY	410	18,193	94	Good
VNC	TAXIWAY E	TAXIWAY	505	62,102	94	Good
VNC	TAXIWAY E	TAXIWAY	510	10,168	92	Good
VNC	TAXIWAY E	TAXIWAY	515	22,576	94	Good
VNC	TAXIWAY E	TAXIWAY	550	9,260	94	Good
VNC	TAXIWAY F	TAXIWAY	450	11,590	100	Good
VNC	APRON	APRON	4102	164,918	100	Good
VNC	APRON	APRON	4103	45,587	100	Good
VNC	APRON	APRON	4105	112,872	21	Serious
VNC	APRON	APRON	4107	90,832	100	Good
VNC	APRON	APRON	4115	35,804	4	Failed
VNC	APRON	APRON	4120	57,693	100	Good
VNC	APRON	APRON	4125	53,301	91	Good
VNC	APRON	APRON	4127	19,505	100	Good
VNC	APRON	APRON	4130	5,580	94	Good
VNC	APRON	APRON	4140	73,011	93	Good
VNC	CENTER APRON (OLD RW9-27)	APRON	4405	120,111	100	Good
VNC	CENTER APRON (OLD RW9-27)	APRON	4415	46,412	100	Good
VNC	RUN-UP APRON AT ENDS OF TW A	APRON	5105	26,551	94	Good
VNC	RUN-UP APRON AT ENDS OF TW A	APRON	5110	19,846	94	Good



Forecasted Pavement Condition Index 2020-2029

Table E-2 Pavement Condition Index Forecast 2020-2029

Network ID	Branch ID	Section ID	Last PCI	Forecasted PCI									
				2020	2021	2022	2023	2024	2025	2026	2027	2028	2029
VNC	AP	4102	100	95	93	90	88	86	84	81	79	77	75
VNC	AP	4103	100	93	90	88	86	84	81	79	77	75	74
VNC	AP	4105	21	19	18	16	15	14	13	11	10	9	8
VNC	AP	4107	100	93	90	88	86	84	81	79	77	75	74
VNC	AP	4115	4	2	1	0	0	0	0	0	0	0	0
VNC	AP	4120	100	95	93	90	88	86	84	81	79	77	75
VNC	AP	4125	91	88	86	83	81	79	77	75	73	72	70
VNC	AP	4127	100	93	91	89	86	84	82	80	78	76	73
VNC	AP	4130	94	91	88	86	84	82	80	78	76	74	72
VNC	AP	4140	93	90	87	85	83	81	79	77	75	73	71
VNC	AP CENTER	4405	100	93	90	88	86	84	81	79	77	75	74
VNC	AP CENTER	4415	100	93	90	88	86	84	81	79	77	75	74
VNC	AP RU	5105	94	91	88	86	84	82	80	78	76	74	72
VNC	AP RU	5110	94	91	88	86	84	82	80	78	76	74	72
VNC	RW 13-31	6105	76	74	73	71	70	69	68	67	66	65	65
VNC	RW 13-31	6110	74	72	71	70	69	68	67	66	65	64	63
VNC	RW 13-31	6115	67	65	65	64	63	62	62	61	60	60	59
VNC	RW 13-31	6120	61	60	59	58	58	57	56	56	55	54	53
VNC	RW 13-31	6125	68	66	66	65	64	63	62	62	61	60	60
VNC	RW 13-31	6130	63	62	61	60	60	59	58	58	57	56	56
VNC	RW 13-31	6135	93	90	87	85	83	82	80	78	77	75	74
VNC	RW 13-31	6140	90	87	85	83	81	79	78	76	75	73	72
VNC	RW 13-31	6145	100	94	92	90	87	85	83	81	79	78	76
VNC	RW 13-31	6150	100	94	92	90	87	85	83	81	79	78	76
VNC	RW 5-23	6205	90	87	85	83	81	79	77	76	74	73	72
VNC	RW 5-23	6210	94	91	88	86	84	82	81	79	77	76	74
VNC	RW 5-23	6215	94	91	89	86	84	82	80	78	77	75	74
VNC	RW 5-23	6220	92	89	87	84	82	80	79	77	75	74	73
VNC	RW 5-23	6225	94	91	89	86	84	82	80	78	77	75	74
VNC	RW 5-23	6230	94	91	89	86	84	82	80	78	77	75	74
VNC	RW 5-23	6240	86	83	81	79	77	76	74	73	72	71	70
VNC	RW 5-23	6250	94	91	89	86	84	82	80	78	77	75	74
VNC	T-HANG	605	69	67	66	65	63	62	61	60	59	58	57
VNC	T-HANG	610	66	64	63	62	61	60	58	57	56	55	54
VNC	T-HANG	620	54	52	51	51	50	49	48	47	46	46	45



Network ID	Branch ID	Section ID	Last PCI	Forecasted PCI									
				2020	2021	2022	2023	2024	2025	2026	2027	2028	2029
VNC	T-HANG	705	79	77	75	74	73	71	70	69	67	66	65
VNC	T-HANG	708	68	66	65	64	62	61	60	59	58	57	56
VNC	T-HANG	710	49	48	47	46	45	44	44	43	42	42	41
VNC	T-HANG	715	92	90	88	86	85	83	82	80	79	77	76
VNC	T-HANG	720	92	90	88	86	85	83	82	80	79	77	76
VNC	T-HANG	725	94	92	90	88	87	85	84	82	81	79	78
VNC	T-HANG	730	59	58	57	56	55	54	53	52	51	50	49
VNC	T-HANG	735	100	96	94	93	91	89	88	86	85	83	82
VNC	TW A	105	94	92	90	88	87	85	84	82	81	79	78
VNC	TW A	110	89	87	85	84	82	81	79	78	76	75	73
VNC	TW A	115	92	90	88	86	85	83	82	80	79	77	76
VNC	TW A	120	90	88	86	85	83	81	80	79	77	76	74
VNC	TW A	125	66	64	64	63	62	61	60	59	59	58	57
VNC	TW B	220	100	94	93	91	89	88	86	85	83	82	80
VNC	TW B	225	91	89	87	85	84	82	81	79	78	77	75
VNC	TW B	230	100	94	93	91	89	88	86	85	83	82	80
VNC	TW B	235	100	95	93	92	90	88	87	85	84	82	81
VNC	TW C	315	94	92	90	88	87	85	84	82	81	79	78
VNC	TW D	400	100	95	93	92	90	88	87	85	84	82	81
VNC	TW D	405	100	95	93	92	90	88	87	85	84	82	81
VNC	TW D	410	94	92	90	88	87	85	84	82	81	79	78
VNC	TW E	505	94	92	90	88	87	85	84	82	81	79	78
VNC	TW E	510	92	90	88	86	85	83	82	80	79	77	76
VNC	TW E	515	94	92	90	88	87	85	84	82	81	79	78
VNC	TW E	550	94	92	90	88	87	85	84	82	81	79	78
VNC	TW F	450	100	95	93	92	90	88	87	85	84	82	81




Major Rehabilitation Planning 2020-2029

Table E-3 Major Rehabilitation Planning 2020-2029

Program Year	Network ID	Branch ID	Section ID	Surface	Area (SF)	PCI Before	Rehabilitation Type	Planning Cost
2020	VNC	AP	4105	PCC	112,872	19	PCC Reconstruction	\$ 2,258,000.00
2020	VNC	AP	4115	PCC	35,804	2	PCC Reconstruction	\$ 717,000.00
2020	VNC	RW 13-31	6120	APC	20,000	60	AC Restoration	\$ 191,000.00
2020	VNC	RW 13-31	6130	APC	20,000	62	AC Restoration	\$ 191,000.00
2020	VNC	T-HANG	610	AC	42,593	64	AC Restoration	\$ 405,000.00
2020	VNC	T-HANG	620	AC	103,188	52	AC Restoration	\$ 981,000.00
2020	VNC	T-HANG	710	AC	42,414	48	AC Restoration	\$ 429,000.00
2020	VNC	T-HANG	730	AAC	18,001	58	AC Restoration	\$ 172,000.00
2020	VNC	TW A	125	AAC	5,738	64	AC Restoration	\$ 55,000.00
2022	VNC	RW 13-31	6115	APC	30,000	64	AC Restoration	\$ 286,000.00
2022	VNC	T-HANG	708	AC	11,509	64	AC Restoration	\$ 110,000.00
2023	VNC	RW 13-31	6125	APC	30,000	64	AC Restoration	\$ 286,000.00
2023	VNC	T-HANG	605	AC	17,687	63	AC Restoration	\$ 169,000.00
2028	VNC	RW 13-31	6110	AAC	196,950	64	AC Restoration	\$ 1,872,000.00

*All planning cost values have been rounded to the nearest thousand-dollar.

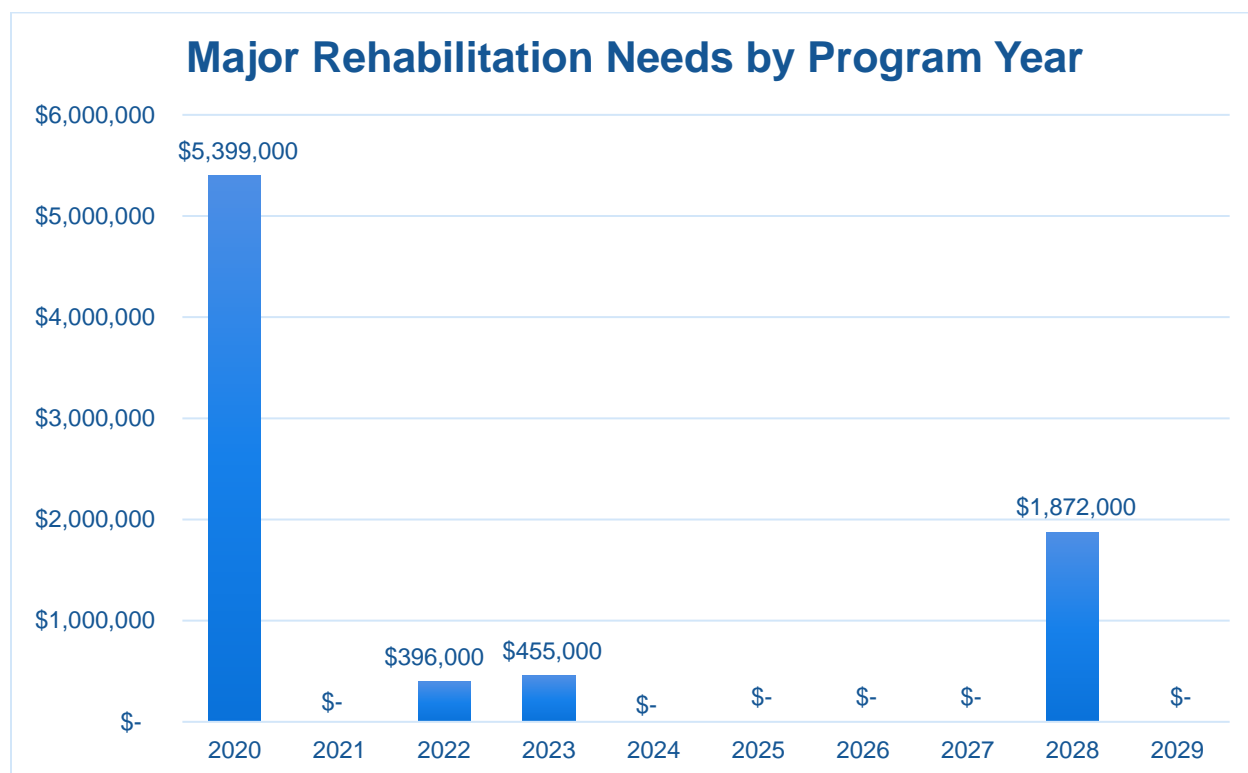
*Figure E-4 Major Rehabilitation Planning Annual Budget 2020-2029*

Summary of Venice Municipal Airport

Venice Municipal Airport was inspected in November 2018 – the overall weighted PCI value was 84, a condition rating of Satisfactory. The results of the maintenance, repair, and major rehabilitation analysis identified \$1,640,620 in localized M&R needs based on current conditions and a 10-Year major rehabilitation need of \$8,122,000 based on forecasted conditions. The current major rehabilitation needs based on the latest inspection consist of \$5,399,000 for pavements below critical condition.

Localized maintenance and repair identified within this report are categorized as preventive or stopgap; the FDOT SAPMP has defined maintenance policies based on FAA recommendations. Major rehabilitation is identified within the FDOT SAPMP as major construction activity that would result in an improvement or resetting of the pavement section's PCI to a value of 100. Such activities could include: mill and hot-mix asphalt overlay, rigid pavement repair and slab replacement, and full-depth reconstruction. It is recommended that the airport use this as a planning tool for future project development and prioritization – all localized maintenance and repair and major rehabilitation recommendations should be considered as planning-level only. All final localized maintenance, repair, and major rehabilitation is subject to change based on airport prioritization and further design-level evaluation.

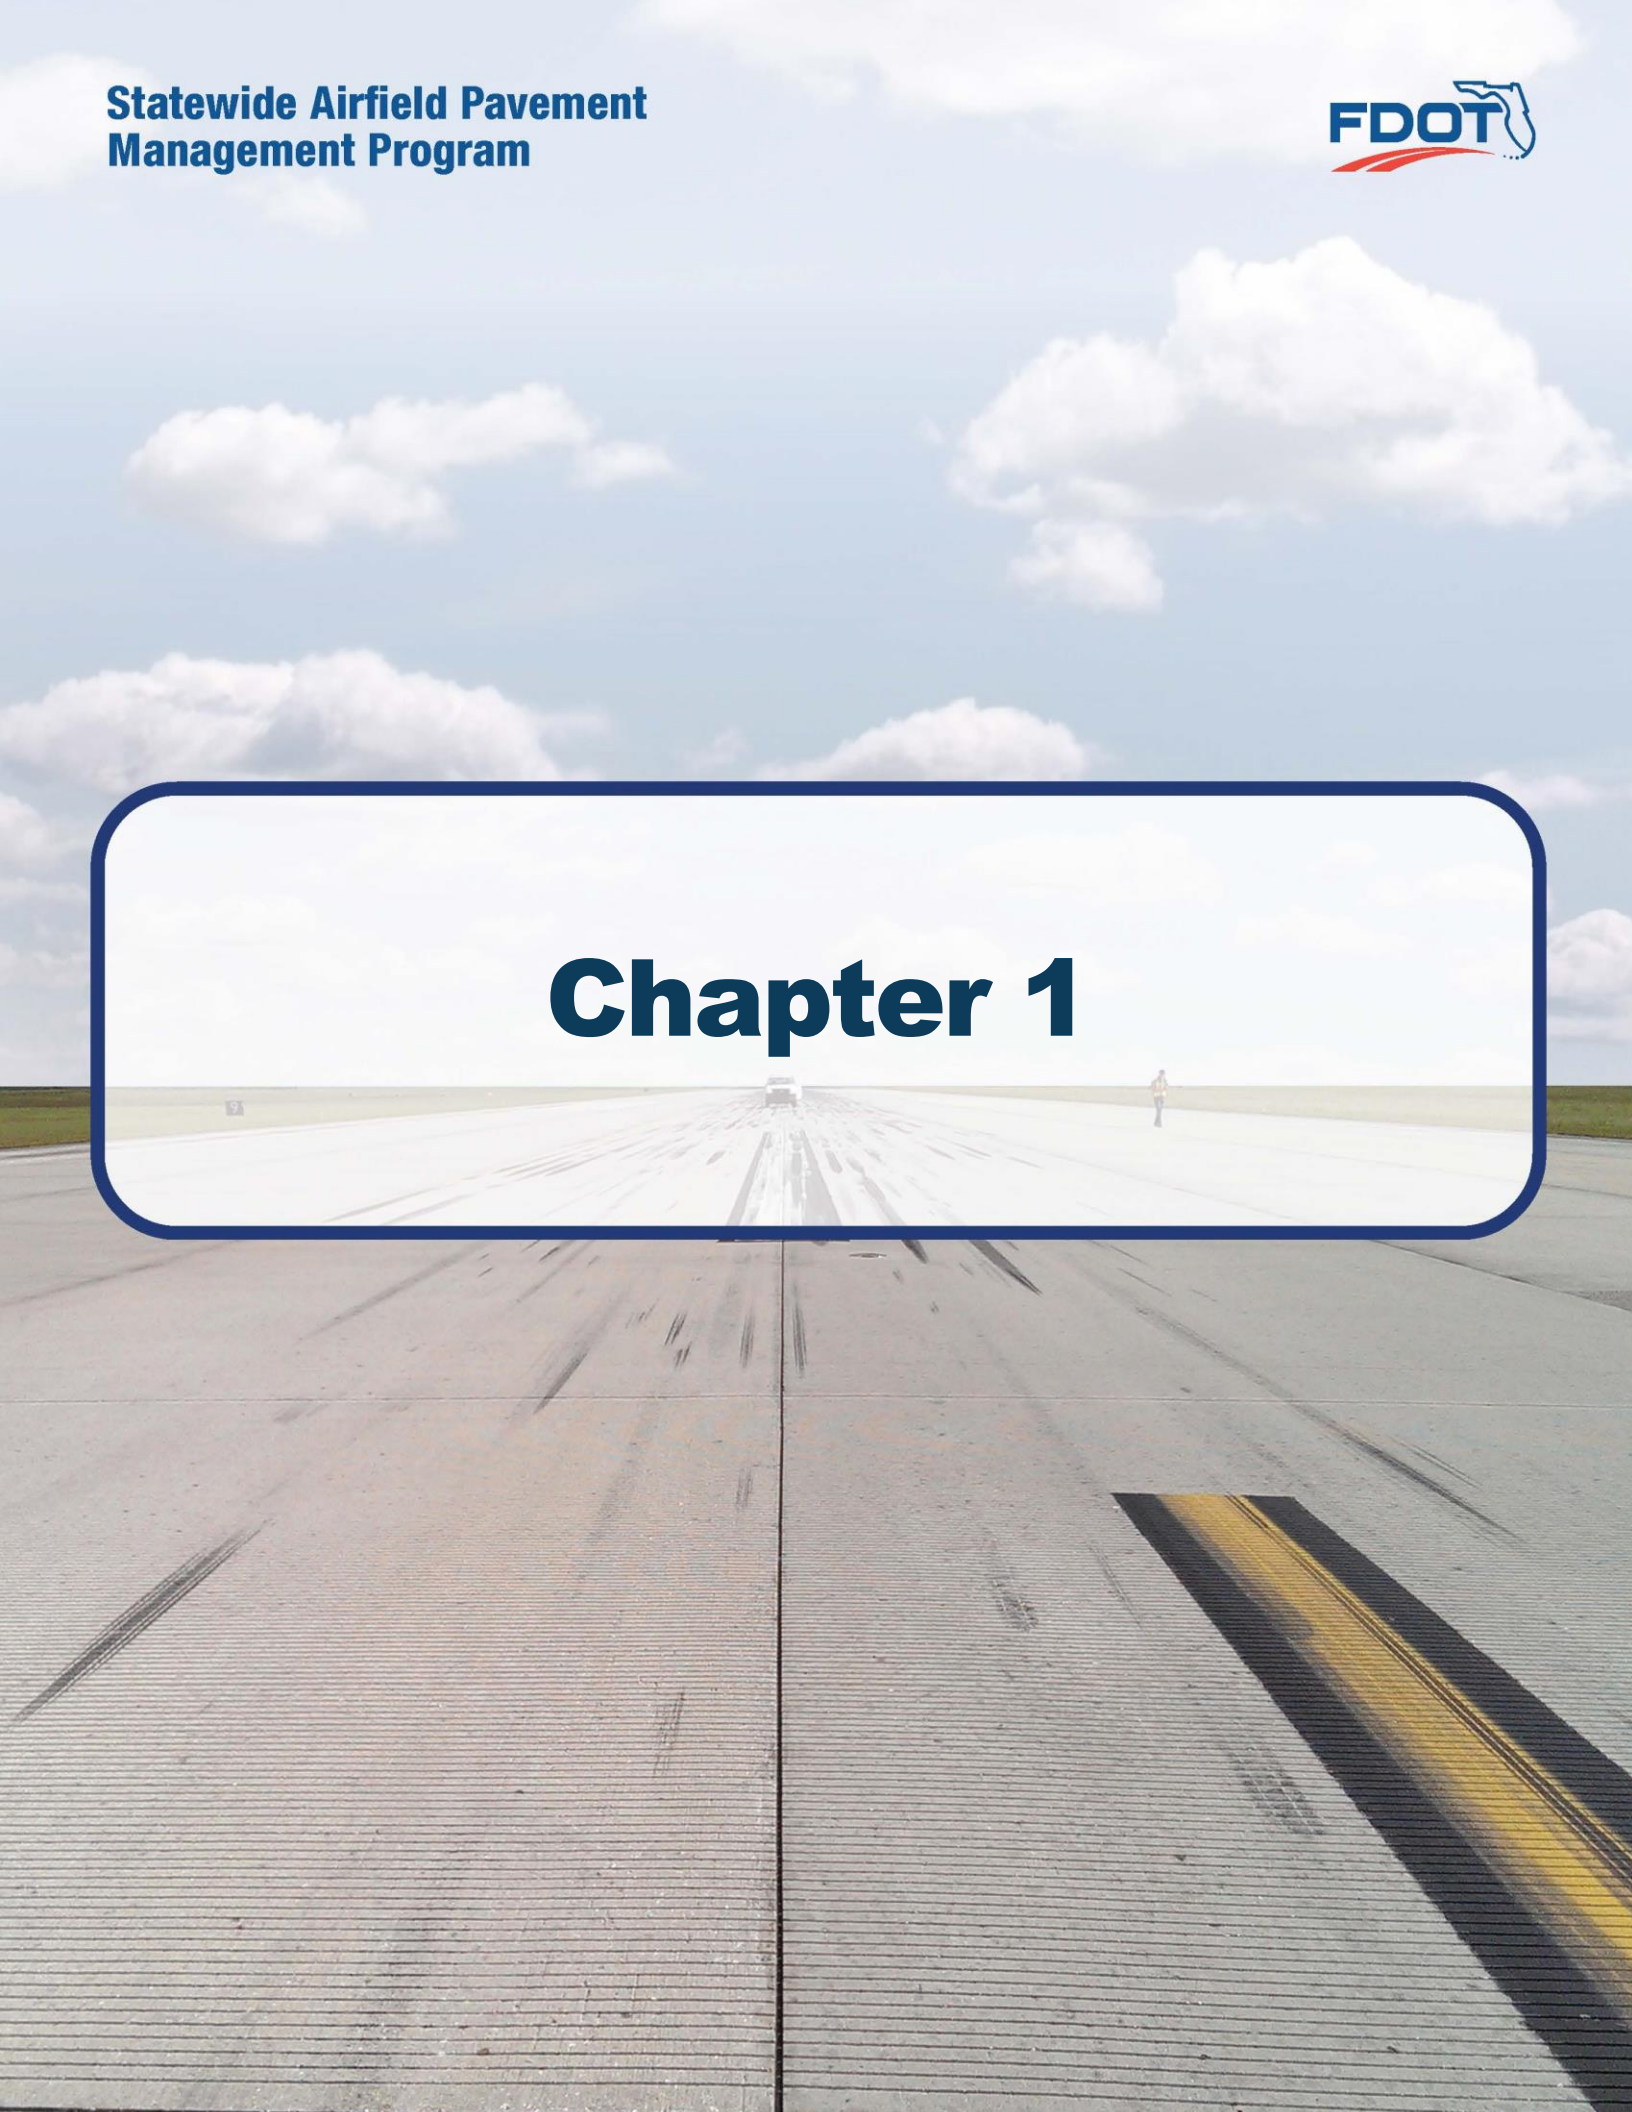Chapter 1





Chapter 1 – Introduction

1.1 Background

The State of Florida has 128 public airports of which 100 public-use airports are recognized as part of the Federal Aviation Administration's (FAA) National Plan of Integrated Airport Systems (NPIAS) that are vital to the Florida economy as well as the economy of the United States. The Florida Aviation System (FAS) provides opportunities for the State to capitalize on an increasingly global marketplace. Florida's system of commercial service and general aviation (GA) airports are important to businesses throughout the entire State. Air travel is essential to tourism, Florida's number one industry.

There are millions of square feet of pavement infrastructure that consists of runways, taxiways, aprons, ramps, and other areas of airports that are vital to the support and safety of aircraft operations. Timely pavement maintenance, repair and major rehabilitation of these pavements will support the airport in operating safely, efficiently, economically and without excessive down time.

In general, adherence to the FAA Advisory Circulars are mandatory for all projects funded with federal grant monies through the Airport Improvement Program (AIP) and with revenue from the Passenger Facilities Charges (PFC) Program. Further information is detailed in FAA Grant Assurance No. 11 "Pavement Maintenance," No. 34 "Policies, Standards, and Specifications," and PFC Assurance No. 9 "Standards and Specifications." The Florida Department of Transportation (FDOT) performs the Statewide Airfield Pavement Management Program (SAPMP) System Updates for the benefit of participating public-use and publicly owned airports through the Aviation and Spaceports Office (ASO).


The SAPMP addresses the requirements of maintaining an effective pavement management program for the participating airports at the network level. Network-level management of pavement assets provides insight for short-term and long-term budget needs, understanding of the overall condition of the network (current and future), and pavement facilities that are subject for project consideration. A network-level evaluation can be supportive in the identification of maintenance, repair, and major rehabilitation needs and budgetary planning-level opinions of probable construction costs.

1.2 Statewide Airfield Pavement Management Program (SAPMP) Update 2018-2019

In 1992, the FDOT established the Statewide Airfield Pavement Management Program (SAPMP) to provide program managers, District Aviation and Spaceport Offices, and airport operators a system to proactively manage airport airfield pavement infrastructure within the Florida Aviation System. The SAPMP performs network-level Pavement Condition Index (PCI) survey inspections for airport facilities that are categorized as General Aviation (GA), Reliever (RL), and Commercial (PR). Currently, the program consists of 95 actively participating public-use airports with pavement facilities and provides users with comprehensive data to better manage pavement assets.



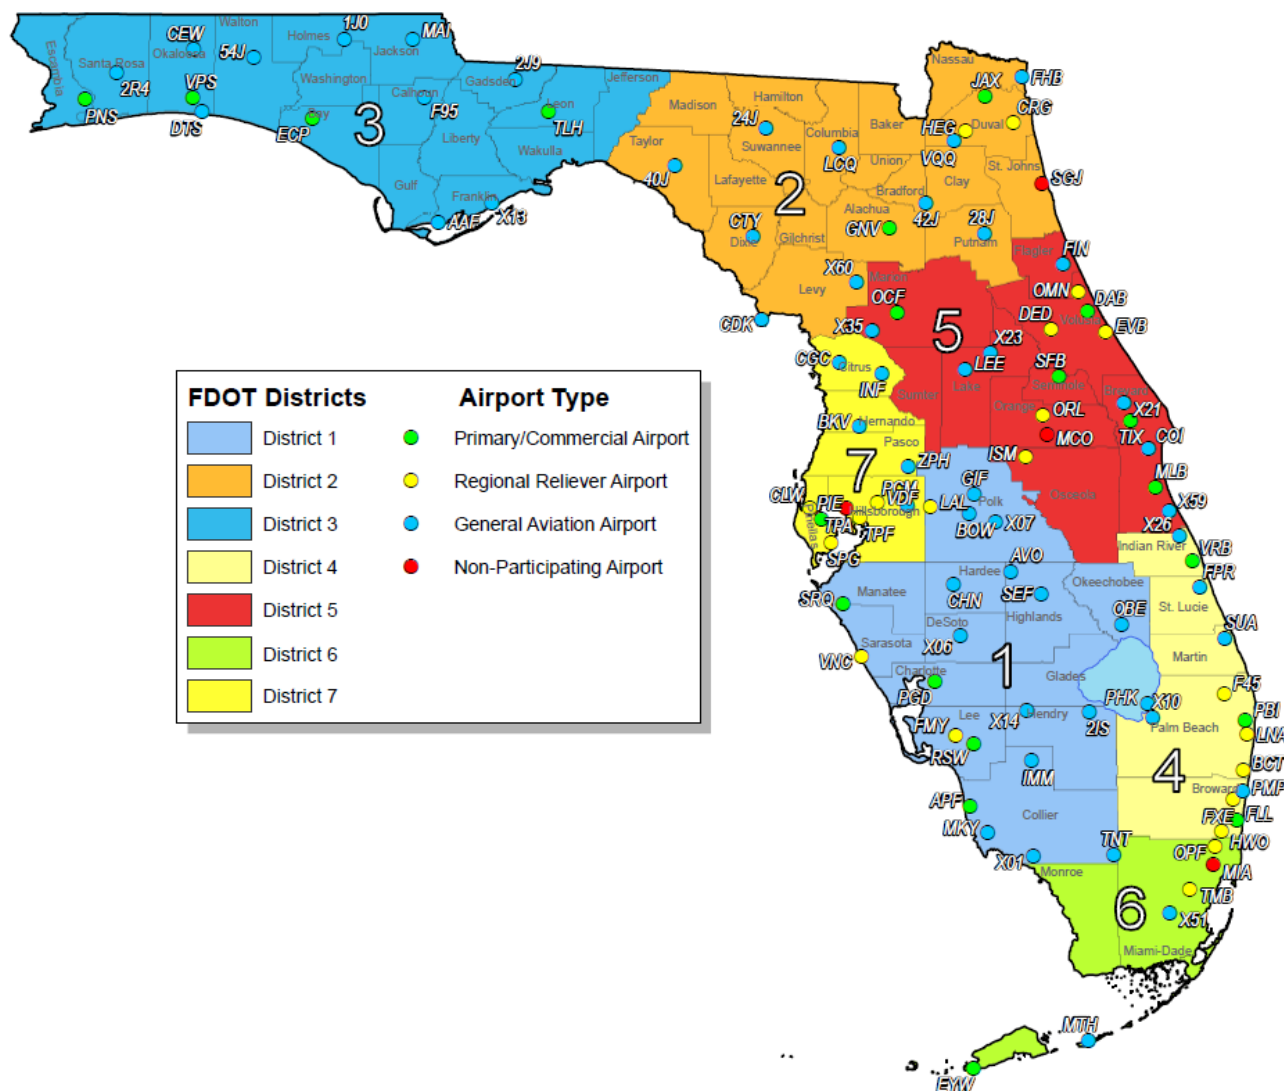Figure 1.2 Florida Aviation System (Facilities with Pavement) and FDOT Districts



In 2016, the Florida Department of Transportation Aviation and Spaceports Office contracted Kimley-Horn and Associates, Inc. along with subconsultants Airfield Pavement Management Systems, LLC and AVCON, Inc. to provide professional services in support of FDOT in the continued efforts of performing a system update to the SAPMP. This work is to be completed from fiscal year 2016 through fiscal year 2019.



1.3 Organization

1.3.1 Florida Department of Transportation Aviation and Spaceports Office Program Manager

The FDOT Aviation and Spaceports Office (ASO) Aviation Engineering Manager serves as the Program Manager (ASO-PM) for the SAPMP. The ASO-PM monitors the work performed by the designated Consultant for the program. The ASO-PM has review and approval authority for each program task and manages the program's day-to-day details and pertinent updates.

The ASO-PM reports updates and milestones to the FDOT State Aviation and Spaceports Manager and Development Administrator.

1.3.2 Participating Florida Public-Use and Publicly Owned Airports

The airports are the end-user and beneficiary of the SAPMP. The SAPMP provides a specific Airport Pavement Evaluation Report that meets the requirements of the FAA Advisory Circular **150/5380-7B "Airport Pavement Management Program (PMP)."** Individual participating airports will be provided a final Airport Pavement Evaluation Report by the designated Consultant that is specific to each airport's airfield pavement condition index survey. The ASO-PM has full authority and final approval of each report prior to finalization. In advance of each PCI survey and prior to completion of each Airport Pavement Evaluation Report, participating airports are asked to provide the necessary record documentation for the proper analysis efforts. Relevant record documentation artifacts may consist of but are not limited to: Airport Layout Plans (ALP), Construction Bid Tabulations, As-Built Construction Drawings, Engineer's Reports, and/or field pavement inspection reports.

1.3.3 Florida Department of Transportation District Offices

The seven (7) FDOT District Offices, specifically the Aviation representatives (currently the Freight and Logistics personnel), provide essential support to the SAPMP update and the ASO-PM. Each District supports the SAPMP's on-going efforts by providing local construction cost information throughout the State. The construction cost information, typically consisting of plans and bid tabulations, are used as the basis of the development maintenance, repair, and major rehabilitation opinions of probable construction costs for planning purposes. Each District Office receives copies of individual Airport Pavement Evaluation Reports for the participating airport facilities located within their respective Districts.

1.3.4 Consultant

The Consultant, Kimley-Horn and Associates, Inc., provides technical and administrative support to the ASO-PM for the SAPMP update. The support consists of airfield pavement system inventory updates, performance of PCI Surveys in accordance with ASTM **D5340-12 "Standard Test Method for Airport Pavement Condition Index Surveys,"** evaluation and reporting of the pavement condition in accordance with the FAA Advisory Circular **150/5380-7B "Airport Pavement Management Program (PMP)."**

The Consultant Team consists of Kimley-Horn, Airfield Pavement Management Systems, LLC., and AVCON, Inc.



A brief description of the general scope of work undertaken to update the SAPMP includes but is not limited to:

- ▶ **Research and evaluation of existing record documentation** was performed to identify construction projects that have taken place since the most recent major update of the SAPMP. This data is used to update the pavement inventory and network definition.
- ▶ **An update to the existing Network Definition Map** was made to reflect geometric changes, pavement composition updates, and section characterization. Furthermore, an update to the PCI Survey sample units were made to reflect the field investigation efforts.
- ▶ **A functional pavement evaluation with PCI Survey inspections** was completed on all airfield pavements maintained by the Airport. The PCI Survey procedure, as defined by ASTM D5340-12, was used as the basis of the functional pavement evaluation. For this specific evaluation, the sample units defined by prior studies were inspected as to better develop performance models for prediction curves. Pavement subject to construction or anticipated construction during scheduled PCI Survey inspection or within 2 years were omitted from inspection based on confirmation of airport personnel.
- ▶ **Condition Analysis** was performed based on the distress data observed, rated, measured, and recorded in accordance with the ASTM D5340-12 for the calculation of PCI values and ratings. The results of the current condition analysis were used in concert with the historic PCI Survey data and construction work history to develop performance models to forecast future PCI values for each section for a 10-year study duration.
- ▶ **Maintenance, Repair, and Rehabilitation Planning** was performed predicated on the results of the condition analysis with updated policies and planning-level unit costs. The policies, or M&R policies, have been updated to reflect standard practices for maintenance, repair, and major rehabilitation as defined by the FAA **AC 150/5380-6C “Guidelines and Procedures for Maintenance of Airport Pavements.”** Planning-level unit costs were developed based on representative construction bid tabulations provided by participating airports. The bid tabulations consisted of limited airfield pavement construction projects that took place between 2009 and 2015 at participating airports.



1.4 Purpose of Airport Pavement Evaluation Report

The individual airport airfield pavement evaluation report discusses the work performed, a summary of findings, condition analysis results, and recommendations for maintenance, repair, and major rehabilitation (M&R) planning associated with the SAPMP system update. It also briefly describes the procedures used to ensure that the appropriate engineering and scientific standards of care, quality, budget, schedules, and safety requirements were implemented during the performance of this work.

The purpose of this Airfield Pavement Evaluation Report is to achieve the following:

- Describe the goals, procedures, and purpose of the SAPMP
- Provide a brief technical explanation of the pavement management methodology, standard practices, and objectives
- Analyze pavement distresses data for the determination of pavement conditions and for identification of airfield pavement maintenance, repair, and major rehabilitation needs based on functional PCI trends

The identification of rehabilitation needs has been determined at the planning level. Design-level investigation is recommended prior to developing construction-level design documents and budgets.

In compliance with FAA Grant Assurances 11 and 19; the FDOT SAPMP provides airports with airfield pavement evaluation reports in accordance with FAA **AC 150/5380-7B Airport Pavement Management Program (PMP)** and **AC 150/5380-6C Guidelines and Procedures for Maintenance of Airport Pavements**. The application of the results of a PCI survey are for planning purposes and are limited to the visual observation of deteriorated pavements in limited sampling; design-level investigation is recommended in accordance with the FAA procedures defined in **AC 5320-6F Airport Pavement Design and Evaluation** and **AC 150/5370-11B Use of Nondestructive Testing in the Evaluation of Airport Pavements**. The aforementioned ACs provide the design-level material properties of in-situ pavement and subgrade layers for the determination of appropriate rehabilitation actions. The FDOT Statewide Airfield Pavement Management Program is organized to provide airports with planning-level data and does not intend to preclude the responsible engineer in performing the appropriate level of investigation and analysis in determining the appropriate design details of a pavement rehabilitation. It would not be advisable to solely base design-level rehabilitation without the appropriate level of investigation and determination of pavement deterioration beyond that of a visual functional condition assessment.

1.5 History of the Program

In 1992, the FDOT implemented the SAPMP to understand the pavement conditions at public airports in the FAS, systematically update pavement infrastructure information, and assist airport operators with recommendations of pavement maintenance, repair, and major rehabilitation needs. The 1992 SAPMP implementation provided the FDOT and the participating airports valuable information for establishing and performing timely and appropriate pavement rehabilitation.



During the 1992-1993 implementation and again during the 1998-1999 updates; the SAPMP performed the development with proprietary software for pavement management system analysis. This development allowed for the creation of pavement management database file system populated with airport attributes and condition data. The pavement management database was used to establish maintenance, repair, and rehabilitation policies; consider planning-level unit costs; and develop recommendations for performing pavement maintenance. This system, known as AIRPAV, was initially developed during the 1992-1993 SAPMP implementation for the analysis of distress data. The AIRPAV system was used again in the 1998-1999 SAPMP update.

In 2004, the SAPMP system update included the review of the AIRPAV software compared to other industry available non-proprietary software packages. As a result of this review, MicroPAVER™ (currently known as PAVER™) was selected for implementation of the system update. MicroPAVER™ was developed by the U.S. Army Corps of Engineers Construction Engineering Research Laboratory for pavement management. Data from the 1998-1999 FDOT SAPMP update, which was built upon the initial 1992-1993 implementation of AIRPAV, was reviewed and converted to be compatible with the MicroPAVER™ system. This data conversion included all documented pavement facilities, classifications, types, histories, geometries, PCI condition data and pertinent attributes gathered from airport feedback at the time. This information was used to develop the inventory of each participating airport's pavement facilities in a consistent format. This was the development of Airfield Pavement Network Definition Exhibits. These inventory exhibits visually depicted the branch, section, and sample units that were based upon the pavement construction history and composition information provided by each airport.

In the 2006-2008 system update, the SAPMP was updated again with continued use of the MicroPAVER™ system. Based on the distress data collected, a maintenance repair and major rehabilitation planning program was developed for each airport. As part of this SAPMP update, the procedures for the inspection and the collection of the pavement distress data were documented, and an interactive website (<http://www.dot.state.fl.us/aviation/pavement.shtm>) was established for input of data.

In the 2010-2012 system update, the SAPMP was updated using new global positioning system (GPS) integrated technology to digitally collect pavement distress data. Interactive geographic information system (GIS) map files were developed from updated Airfield Pavement Network Definition Exhibits to aid pavement condition inspectors in the collection of sample distress data. The data collected was utilized to develop pavement performance models to predict future pavement PCI values and make recommendations for major rehabilitation.

In the 2013-2015 system update, the SAPMP integrated PAVER™ and FieldInspector™ with the use of GPS and GIS capable field tablets. Furthermore, the update included continued adherence to the ASTM **D5340-12 "Standard Test Method for Airport Pavement Condition Index Surveys."** The ASTM update consisted of refinement of distress definition types and deduction values for select asphalt concrete and Portland Cement Concrete distresses.



1.6 Federal Aviation Administration (FAA)

Currently, airports participating in the Airport Improvement Program (AIP) Grant Program are required by the FAA to develop and implement a pavement maintenance program to be eligible for funding (FAA Advisory Circular **150/5380-6C “Guidelines and Procedures for Maintenance of Airport Pavements”** and **150/5380-7B “Airport Pavement Management Program (PMP)”**). This program requires detailed inspection of airfield pavement conditions by trained personnel. The inspections are required to be performed at least once a year using the PASER method or every three years if the pavement is inspected as defined by the PCI survey procedure in accordance with the ASTM **D5340-12 “Standard Test Method for Airport Pavement Condition Index Surveys.”**

In general, adherence to the Advisory Circulars are mandatory for all projects funded with federal grant monies through the AIP program and with revenue from the Passenger Facilities Charges (PFC) Program. Further information is detailed in FAA Grant Assurance No. 11 “Pavement Maintenance,” No. 34 “Policies, Standards, and Specifications,” and PFC Assurance No. 9 “Standards and Specifications.”

1.7 FDOT SAPMP Objectives and Components

The FDOT SAPMP is a program that provides the FAS support in implementing and/or maintaining a network-level Pavement Management Program in a consistent and regularly scheduled manner.

In accordance with FAA AC **150/5380-7B “Airport Pavement Management Program (PMP)”** an effective Pavement Management Program consists of a system that achieves specific objectives. The FDOT SAPMP objectives are as follows:

1.7.1 Program Objectives

- 1 A systematic means for collecting and storing information regarding existing pavement structure and condition.
- 2 An objective and repeatable system for evaluating pavement condition.
- 3 Procedures for predicting future pavement condition.
- 4 Procedures for modeling both past and future pavement performance conditions.
- 5 Procedures to determine the budget requirements to meet management objectives, such as the maintenance, repair, and major rehabilitation budget required to keep a pavement at a specified PCI level or the budget required to improve to target PCI level.
- 6 Procedures for formulating and prioritizing maintenance, repair, and major rehabilitation projects.

The objectives are accomplished by the following components:

1.7.2 Program Components

- A. Database
- B. Pavement Inventory
- C. Pavement Structure
- D. Pavement Work History
- E. Pavement Condition Data




F. Pavement Performance Modeling for the Prediction/Forecast of PCI

G. Maintenance, Repair, and Major Rehabilitation Policies and Budget Simulation

A well-maintained network-level pavement management program may provide airport staff a better understanding of the airfield pavement performance for developing and planning for specific maintenance, repair, and major rehabilitation projects. The understanding of specific distress types and severities will assist the airport in addressing pavement maintenance and repair with the appropriate treatments as defined by the FAA Advisory Circular **150/5380-6C “Guidelines and Procedures for Maintenance of Airport Pavements.”** The development of projects with an understanding of system inventory, deterioration details, and pavement condition forecasts may assist airport staff in developing practical rehabilitation actions and budgets. Furthermore, the understanding of pavements’ past performance and forecasted condition may assist airport staff in addressing pavement rehabilitation in a timely and cost-effective manner. **Figure 1.7.2 (a) Typical Pavement Condition Life Cycle**, which is based on the FAA Advisory Circular **150/5380-7B “Airport Pavement Management Program (PMP).”** **Figure 1.7.2 (a) Typical Pavement Condition Life Cycle**, depicts a general duration of a pavement section and identifies the ideal condition to perform rehabilitative treatments at an optimal cost rather than allowing significant increase in rate of deterioration that would result in increased costs.

Figure 1.7.2 (a) Typical Pavement Condition Life Cycle

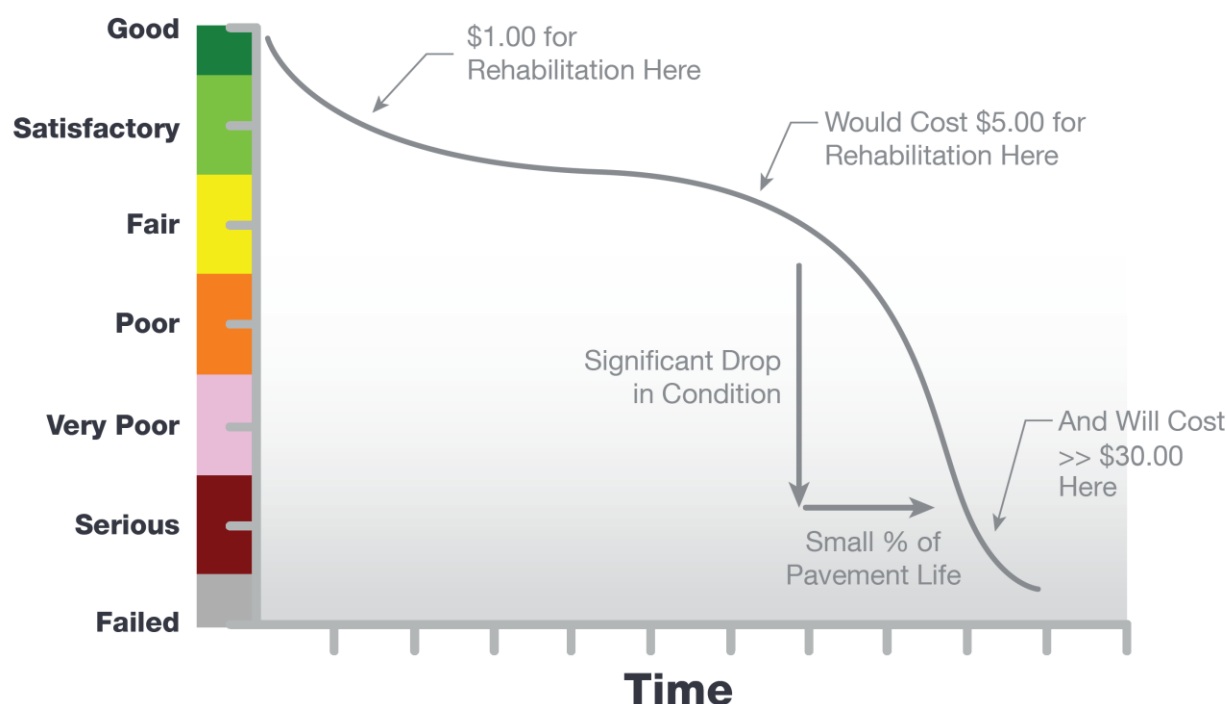


**Figure is for conceptual purposes only – unit costs are not specific to airfield pavements (AC vs PCC).*

Figure 1.7.2 (b) General Pavement Treatments by Condition Range depicts generic flexible asphalt concrete (AC) pavement treatments that are effective at specific condition ranges. This graphic is a general concept and will vary based on pavement surface type and overall



composition. The intent is to convey various treatment types that would be effective based on the condition of the pavement along the deterioration model.



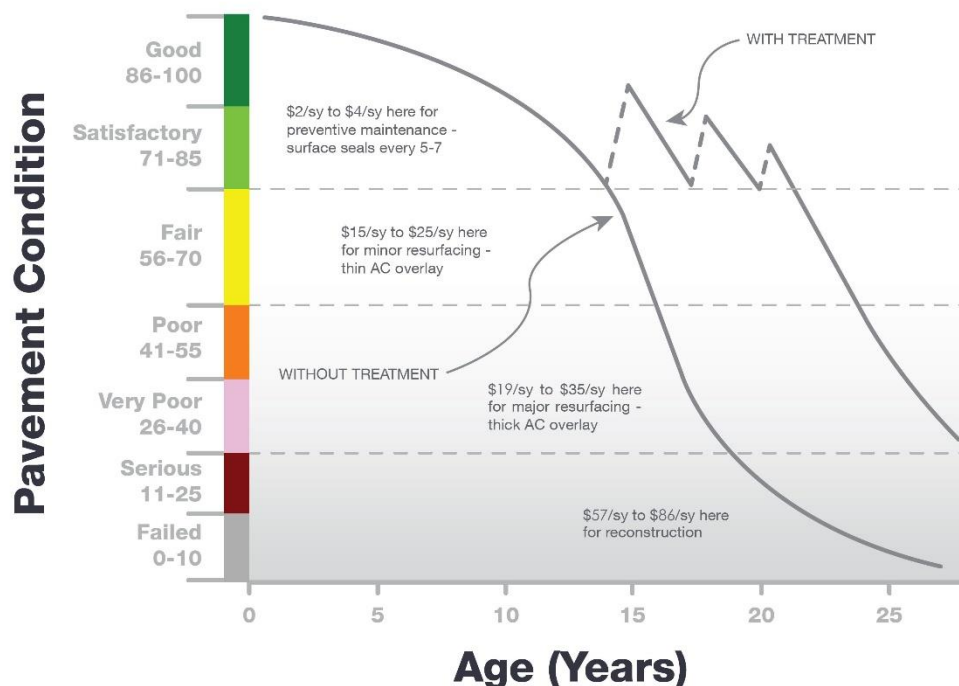

Figure 1.7.2 (b) General Pavement Treatments by Condition Range







Pavement maintenance, repair, and major rehabilitation would be quite anticipatory if all pavements behaved as depicted in **Figures 1.7.2 (a) and 1.7.2 (b)**, however pavement condition performance vary significantly based on several factors. Factors that contribute to a pavement section's condition and deterioration performance may include: functional design life, material type, material construction quality, climatic conditions, aircraft loading type and frequency, non-aircraft loading type and frequency, maintenance history, subgrade conditions, and other infrastructure in the vicinity. The list of factors is not all-inclusive of all factors that may contribute to a pavement's life cycle, it is intended to clarify that unique conditions certainly will affect a pavement's deterioration.

Figures 1.7.2 (c) and 1.7.2 (d), depict visual conditions of pavement facilities, for both AC and PCC respectively, with approximated PCI ranges and corresponding repair and rehabilitation measures.


Figures 1.7.2 (c) Flexible Asphalt Concrete

	PCI Range	Representative PCI	Representative Pavement Surface	Rehabilitation Activities
Routine Maintenance	86-100	90		Pavements with PCI values above 85, or 'Good', may require periodic joint/crack sealing and local patching.
Pavement Preservation	65-85	70		Pavements with PCI conditions ranging from 'Fair' to 'Satisfactory' may require surface treatments (seal coat), thin overlays, and/or joint/crack sealing.
Major Rehabilitation	40-64	50		Pavements that have deteriorated below a PCI 65 (but above 39), or within the range of 'Very Poor' to 'Fair' conditions, may require major rehabilitation such as pavement mill and overlay or partial full-depth reconstruction.
Major Reconstruction	0-39	15		Pavements that have deteriorated below a PCI 40, or within the range of 'Failed' to 'Very Poor' conditions, may require major reconstruction.

Figures 1.7.2 (d) Rigid Portland Cement Concrete

	PCI Range	Representative PCI	Representative Pavement Surface	Rehabilitation Activities
Routine Maintenance	86-100	90		Pavements with PCI values above 85, or 'Good', may require periodic joint/crack sealing and local patching.
Pavement Preservation	65-85	70		Pavements with PCI conditions ranging from 'Fair' to 'Satisfactory' may require patches and/or joint/crack sealing.
Major Rehabilitation	40-64	50		Pavements that have deteriorated below a PCI 65 (but above 39), or within the range of 'Very Poor' to 'Fair' conditions may require major rehabilitation such as slab replacement and PCC restoration activity.
Major Reconstruction	0-39	15		Pavements that have deteriorated below a PCI 40, or within the range of 'Failed' to 'Very Poor' conditions, may require major reconstruction.




1.8 References

The following reference documents were referenced as specific guidelines and procedures for maintaining airport pavements; establishing an effective pavement maintenance program; and identifying specific pavement distresses, probable causes of distresses, inspection guidelines, and recommended methods of repair:

- ASTM D5340-12 “Standard Test Method for Airport Pavement Condition Index Surveys.”
- FAA Advisory Circular 150/5380-7B “Airport Pavement Management Program.”
- FAA Advisory Circular 150/5380-6C “Guidelines and Procedures for Maintenance of Airport Pavements.”
- FAA Advisory Circular 150/5320-6F “Airport Pavement Design and Evaluation.”
- Department of the Air Force, Air Force Civil Engineer Center “Engineering Technical Letter (ETL) 14-3: Preventive Maintenance Plan (PMP) for Airfield Pavements.”
- Unified Facilities Criteria (UFC) 3-260-16FA 16 “Airfield Pavement Condition Survey Procedures Pavements.”
- Unified Facilities Criteria (UFC) 3-260-03 “Airfield Pavement Evaluation.”
- Pavement Management for Airports, Roads, and Parking Lots 2nd Edition, M.Y. Shahin.

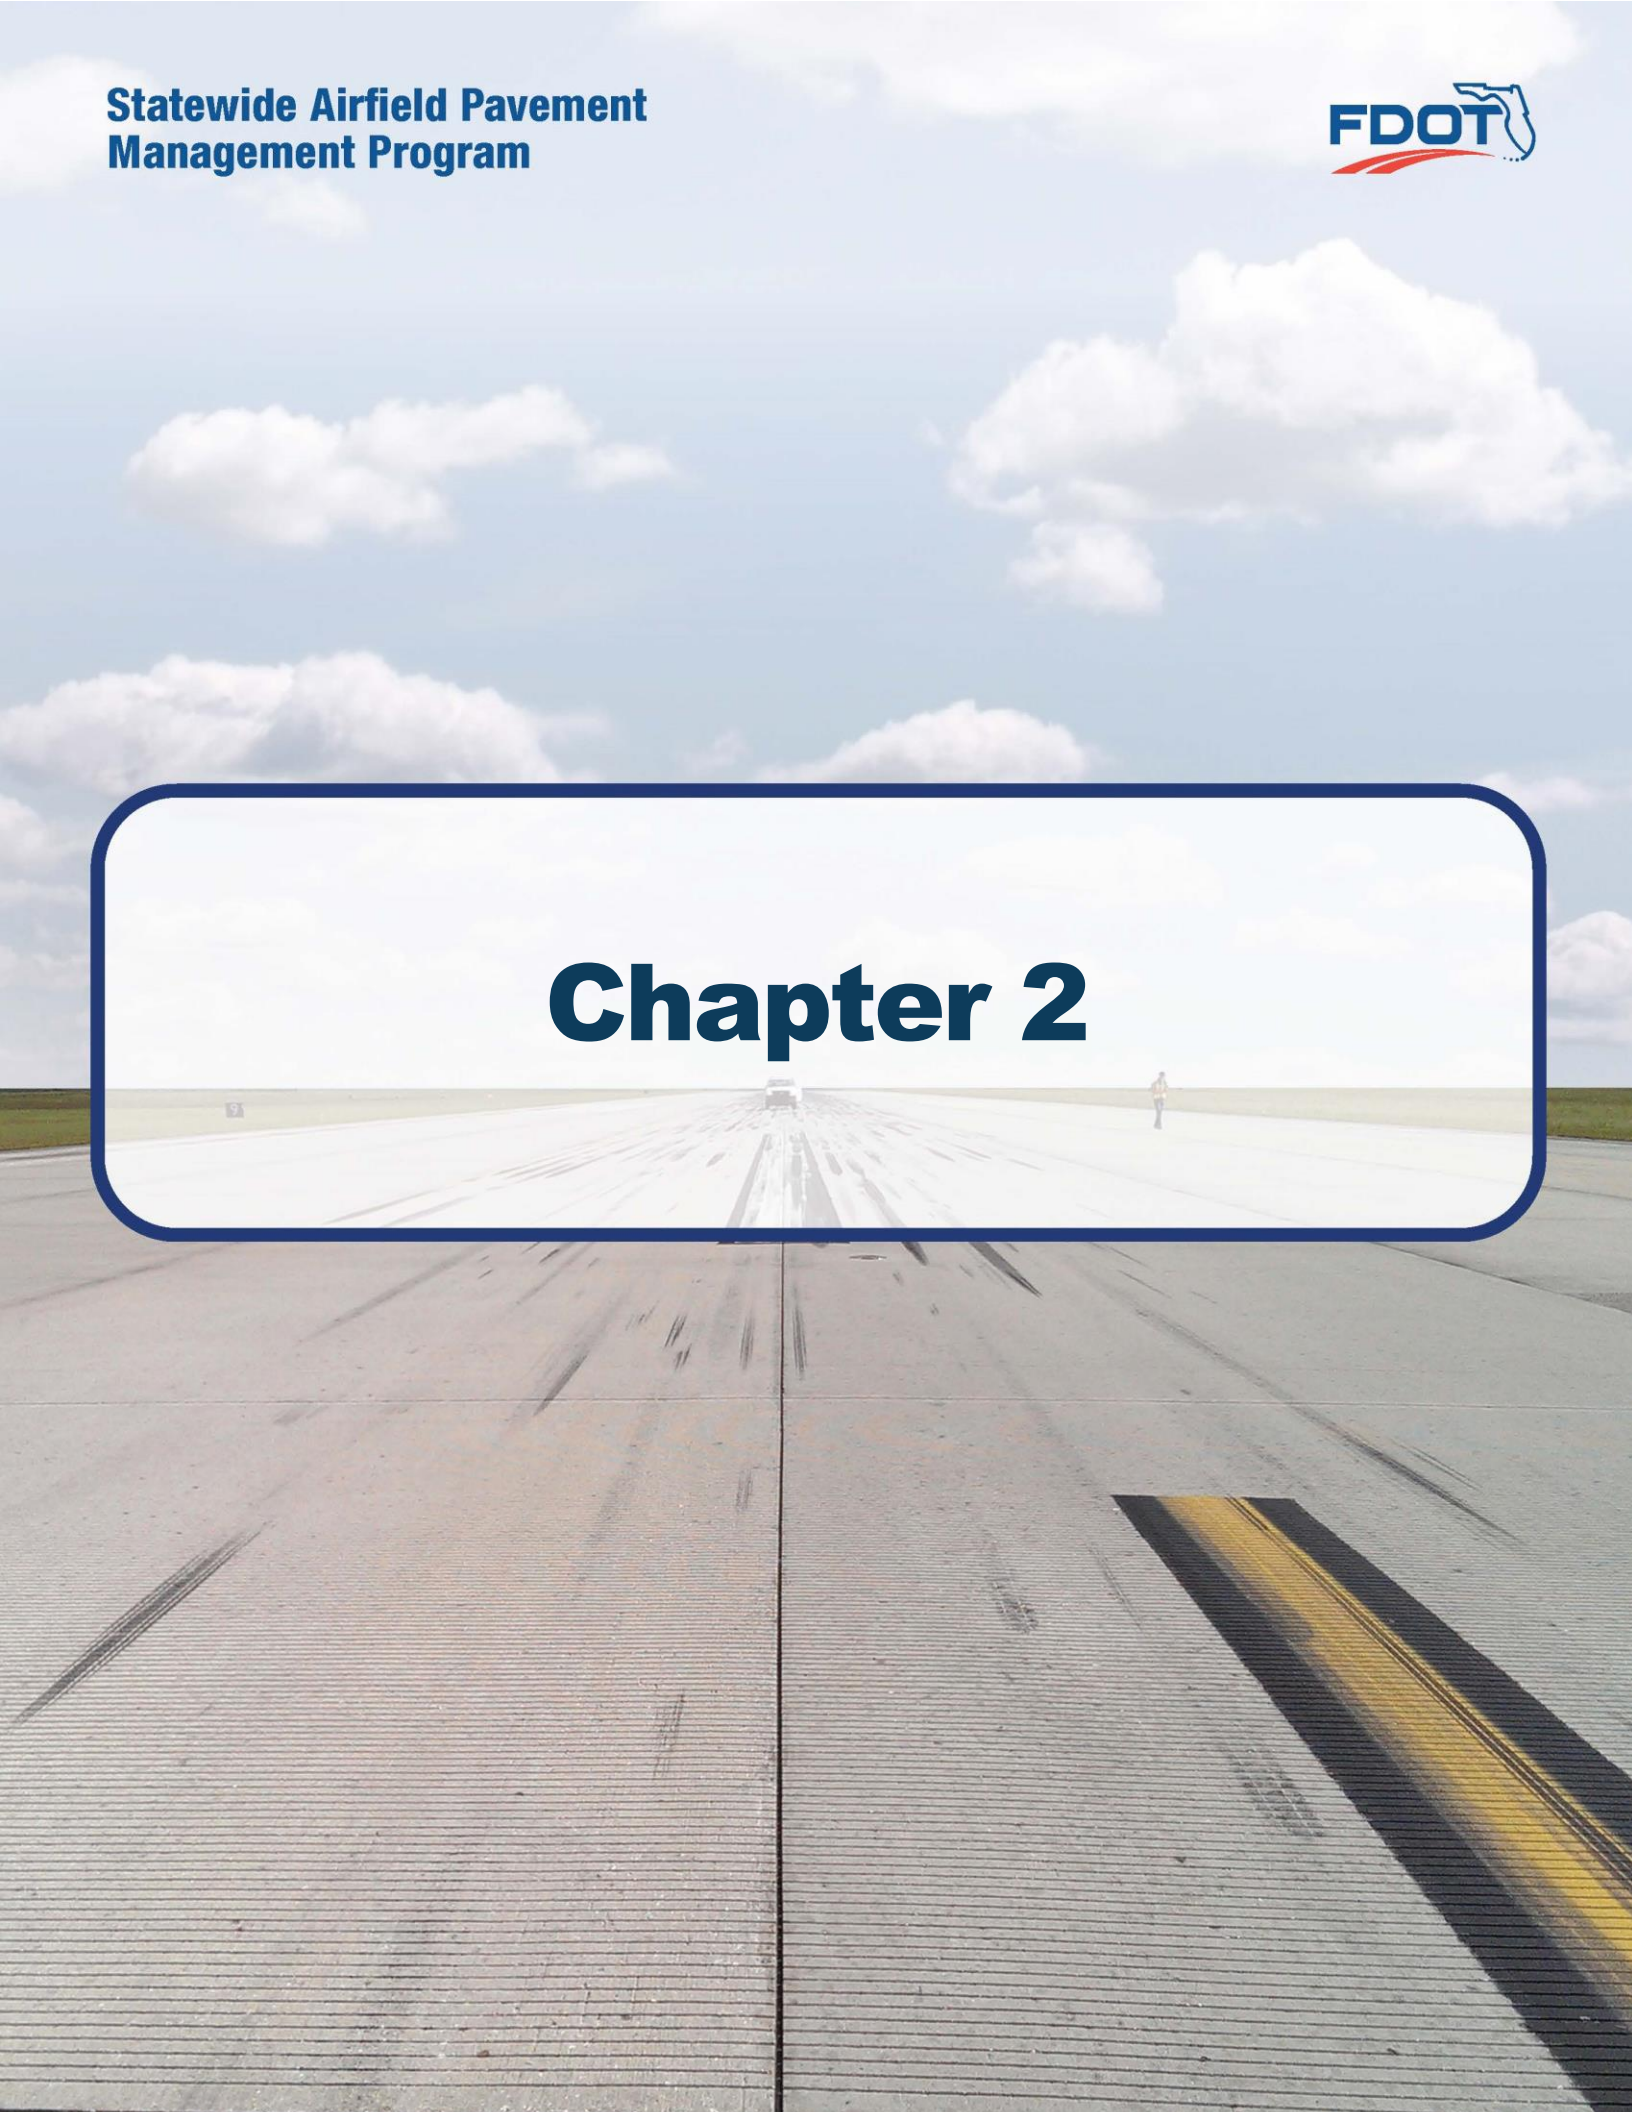Chapter 2





Chapter 2 – Methodology

An effective pavement management program incorporates the regular collection of pavement condition information and communication of information to appropriate sponsors. This chapter of the report defines the specific methods utilized as part of the SAPMP System Update to meet the requirements of an effective pavement management system as defined by the FAA Advisory Circular **150/5380-7B “Airport Pavement Management Program (PMP).”**

2.1 Airfield Pavement Database

The SAPMP program has historically utilized PAVER™ (formerly MicroPAVER™); the current update has maintained the use of the PAVER™ 7.0 version of the software. The PAVER™ software application was developed by the U.S. Army Construction Engineering Research Laboratory sponsored by the FAA, Federal Highway Administration, U.S. Army, U.S. Air Force, and the U.S. Navy to meet the objectives of an effective pavement management system. The SAPMP consists of a network-level database of the airport's airfield pavement facilities that are part of the program. PAVER™ can achieve the following pavement management objectives: a manageable inventory system, the analysis of the current condition of pavements in accordance with the ASTM D5340, the development of pavement performance models to forecast conditions, and the development of maintenance, repair, and major rehabilitation recommendations based on budgetary scenarios.

PAVER™ inventory management is based on a tiered organizational structure that consists of networks, branches, and sections, with the section being the smallest unit of management. Critical elements of an effective pavement management program are maintained within the network-level PAVER™ database. These elements typically consist of pavement inventory characteristics, pavement structure, work history, historic condition records, and analytical customization.

The SAPMP System Update consisted of the conversion of the previous database from a PAVER™ version 6.5 to a version 7.0.

2.2 Airfield Pavement System Inventory

An airfield pavement system inventory typically maintains the location of all runways, taxiways, and aprons; geometric characteristics; type of pavement structure, year of construction and/or last major rehabilitation; and general composition details of the pavement.

The pavement inventory for an airport's airfield is an assembly of pavement infrastructure information that builds an inventory of branches and sections that codifies the airport's airfield pavement network. General geometry characteristics, estimated length, width, functional classification, pavement surface type, and operational function are among the characteristics identified at this initial phase in the pavement management process. The development of a pavement inventory that reasonably reflects the airport's airfield pavement facilities that are maintained by the airport provides a defined scope of the inspection and analysis efforts. As in the past, the SAPMP scope of work is specific to the airport-maintained airfield pavements as defined in the field network definition exhibits presented to current airport personnel.



A critical input to the pavement system inventory and network definition in the development of the SAPMP update is the date of last major rehabilitation/construction performed on the pavement assets that would set the asset at a PCI of 100 and a condition rating of Good. The airport provided a limited combination of record drawings, reports, and staff input that was pertinent information in developing the construction history of the airport's pavements from inception. Major rehabilitation/construction activities performed in the last 24-months or anticipated in the next 24-months are assumed to restore the PCI to 100. These activities include; pavement overlay, mill and replace, mill and overlay, new construction, and/or complete reconstruction.

Aerial imagery was obtained through the FDOT Surveying & Mapping Office's *Aerial Photo Look Up System (APLUS)*. This spatially projected imagery was utilized with computer-aided drafting software (AutoCAD) in concert with geographical information system software (ArcGIS) to develop a planning-level representative model that reasonably reflects the pavement assets at the airport.

2.2.1 Pavement Management Program Network Definition Terminology

There are several terms that are common in the communication of the results of the SAPMP System Update, these terms are defined as follows:

Pavement Network

A pavement network is a logical unit for organizing pavements into a structure for pavement management. A network will typically consist of one or more pavement *branches*, which are typically comprised of one or many pavement *sections*. The network is the starting point of the hierarchy of pavement management organization. For example, a network can be all the pavements within an airport's airfield or all the pavements in a statewide program. For the FDOT SAPMP, a network represents an individual airport's airfield pavement facilities maintained by the airport.

The SAPMP System Update consists of research and evaluation of existing record documentation for the participating airports' airfield facilities. The pavement network is typically limited to the pavement facilities subject to aircraft use that is also maintained by the airport owner and eligible for public funding.

Pavement Branch

A pavement branch, also known as a facility, is a logical unit of generally identifiable pavement of a network with distinct functional classification. For example, within an airfield each runway, taxiway, or apron is considered a branch. A branch must consist of at least one section.

Pavement Section

A pavement section, also known as a feature, is the most specific management unit when considering the application and selection of maintenance, repair, and/or major rehabilitation treatments on an area of pavement within a branch. Each branch consists of at least one section, but may consist of more if pavement feature characteristics are distinct throughout the branch. Characteristics considered when subdividing branches into sections include, but are not limited to: pavement structure, type, age, condition, and function; traffic composition and frequency (current and future); geometric location; construction history; and other related



infrastructure features (e.g. drainage). A pavement section is defined as a subordinate of a pavement branch, which is a subordinate of a “parent” pavement network.

Pavement Sample Unit

A pavement sample unit is a subdivision of a pavement section that has a standard size range: twenty (20) continuous slabs (± 8 slabs) for Portland Cement Concrete (PCC) pavement and 5,000 contiguous square feet ($\pm 2,000$ ft²) for flexible asphalt concrete (AC) or porous friction course pavements.

Table 2.2.1 Airfield Pavement Database Network Definition Terminology

PMS Network Level	Common Definition	Airport Example
Network	Overall pavement assets maintained by the Airport	“Tallahassee International Airport – Airfield Pavements”
Branch Name	Commonly defined asset name as established by Airport and by use	“Runway 18-36”
Branch ID	Codified shorthand name for commonly defined asset established for database identification	“RW 18-36” RW, Branch Use, “Runway” 18-36, Runway Facility
Section ID	Codified identification for pavement asset that is distinct by the following: <ul style="list-style-type: none">• Pavement Composition• Construction Work History• Aircraft Traffic• Condition Records	“6105”
Sample Unit	A numeric identification of an area of pavement (5,000 \pm 2,000 SF of AC or 20 \pm 8 slabs of PCC) that has been inspected in accordance with ASTM D5340-12.	“300”



2.3 Airfield Pavement Structure

2.3.1 Pavement Structure Types

Airport airfield pavements are constructed to provide adequate support for the loads imposed by aircraft and produce a firm, stable, smooth, all-year, all-weather surface free of debris or other particles that may be blown or dislocated by propeller wash or jet blast. Typical pavement planning and design requires coordination of factors that include but are not limited to; subgrade conditions, material layer types, aircraft fleet mix (type, frequency, and traffic growth), and functional use. A pavement structure is composed of constructed layers that consist of subgrade, subbase, base course, structural courses, and surfaces courses. For the FDOT SAPMP, two major pavement structure types are classified for evaluation and analysis: Flexible Asphalt Concrete Surface and Rigid Portland Cement Concrete Surface. Additionally, Composite Structures known as Whitetopping Pavements are also present at limited airports within the Florida Airports System; these unique pavement structures are evaluated separately.

Flexible Asphalt Concrete Surface

A pavement comprised of aggregate mixture with an asphalt cement binder. The FDOT SAPMP consists of three (3) asphalt concrete surface types: Asphalt Concrete (AC), Asphalt Concrete Overlaid on Asphalt Concrete (AAC), and Asphalt Concrete Overlaid on Portland Cement Concrete (APC).

Asphalt Concrete (AC)

A flexible pavement section consisting of aggregate mixture with asphalt cement binder layered on engineered base course material that is layered on subbase and subgrade soil material.

Asphalt Concrete Overlaid on Asphalt Concrete (AAC)

A flexible pavement section consisting of aggregate mixture with asphalt cement binder layered on an existing flexible AC pavement section. Flexible airfield pavement sections are AAC when a pavement rehabilitation consists of a pavement milling operation and a resurfacing of asphalt layers; or a direct overlay of asphalt concrete without surface preparation.

Asphalt Concrete Overlaid on Portland Cement Concrete (APC)

A flexible pavement section consisting of aggregate mixture with asphalt cement binder layered on an existing Rigid PCC pavement section. This unique pavement composition may result in distinct pavement distress manifestations known as reflective joint cracking.



Rigid Portland Cement Concrete Surface

A pavement comprised of aggregate mixture with a Portland Cement binder. The FDOT SAPMP recognizes Portland Cement Concrete (PCC) as the primary rigid pavement section.

Portland Cement Concrete (PCC)

A rigid pavement section composed of Portland cement concrete placed on a granular or treated base course that is supported on a compacted subgrade. The concrete surface must provide a texture of nonskid qualities, prevent the infiltration of surface water into the subgrade, and provide structural support to the airplanes. Rigid pavement construction requires the layout of appropriately designed joint spacing.

Composite Structure – Whitetopping Pavement

A composite pavement comprised of relatively thin Portland Cement Concrete overlaid on an existing flexible asphalt concrete pavement structure. There are three (3) types of Whitetopping Pavements; Conventional (WHT), Thin (TWT), and Ultra-Thin (UTW).

Conventional Whitetopping (WHT)

A composite pavement structure consisting of a modified PCC overlaid on an existing flexible AC pavement section area. The modified PCC layer is typically greater than 8 inches in thickness.

Thin Whitetopping (TWT)

A composite pavement structure consisting of a modified PCC overlaid on an existing flexible asphalt concrete pavement section. The modified PCC layer is typically between 4 and 8 inches in thickness.

Ultra-Thin Whitetopping (UTW)

A composite pavement structure consisting of a modified PCC overlaid on an existing flexible asphalt concrete pavement section. The Portland Cement Concrete layer is typically between 2 and 4 inches in thickness.



2.4 Airfield Pavement Work History

2.4.1 Airfield Pavement Record Keeping

It is strongly recommended that airports maintain records of all airfield construction and maintenance related to the pavement facilities. A history of all maintenance and repair performed and its associated costs (construction and soft costs) can provide valuable information on the effectiveness of various treatments on pavements. An airport should maintain detailed records of maintenance (routine, emergency, and proactive) activities. The records should consist of the following:

1. Location and Limits of Work.
2. Types and Severity of Distresses Repaired.
3. Type of Work.
4. Cost of Work.
5. Supporting Documents (contract documents, construction drawings, specifications, bid tabulations, repair product, photograph records, etc.).

2.5 Airfield Pavement Traffic

A pavement section is typically designed to meet the needs of the user (airlines, air cargo, general aviation, and/or military) in providing a safe, smooth, operational surface. Pavement deterioration generally occurs gradually through increased roughness and/or fatigue cracking caused by successive and heavy aircraft traffic.

This study does not consist of a study or analysis of each individual airport's airfield aircraft fleet mix or traffic operations. However, it is strongly recommended that airports incorporate the requirements of FAA Advisory Circular **150/5320-6F Airport Pavement Design and Evaluation** when developing design-level rehabilitation activities. The AC provides guidance on incorporation of aircraft traffic fleet mix data.

2.6 Airfield Pavement Condition Index (PCI) Survey

2.6.1 PCI Survey Methodology

In adherence to the FAA Advisory Circular **150/5380-7B "Airport Pavement Management Program (PMP),"** the FDOT SAPMP utilizes the PCI Survey Method of inspection to collect pavement distress data and analyze the condition. The PCI Survey Inspection procedure is a visual statistical sampling of pavements for recording primary distress types (e.g. cracking and deformation), associated severities, and quantities as defined by the ASTM D5340-12. This effort is the primary means of obtaining and recording pavement distress data. The survey inspection consists primarily of visual inspection of pavement surfaces for signs of distress and deterioration resulting from loading (aircraft) and environmental influences.

A visual pavement condition survey provides an indication of the cause and rate of deterioration of a pavement section from a functional point of view and can be an indicator of structural distress. The functional condition analysis assesses the rating of the operational surface. A visual PCI Survey Inspection does not predict the remaining structural life of a pavement section, or its ability to support loads. The functional condition determined by the PCI method



can provide a cost-effective means to plan for pavement rehabilitation projects. The timely application of pavement rehabilitation may lead to the extension of functional life of individual pavement sections. This method varies from structural evaluation; functional condition is limited to visually observed distresses and indicative modes of pavement deterioration. A formal structural evaluation analyzes subsurface conditions, material characteristics, and qualitative pavement structure attributes. A structural evaluation may consist of; subsurface geotechnical exploration, falling weight deflectometer testing, petrographic testing, material coring, and/or flexural testing.



2.6.2 Pavement Distress Types

For each section, the severity and quantity of defined distresses are recorded and then analyzed in accordance with the ASTM D5340-12 standard. The standard identifies 17 distinct flexible asphalt concrete distress types and 16 distinct rigid Portland Cement Concrete distress types.

Table 2.6.2 (a) Pavement Distress Types – Flexible Asphalt Concrete-Surfaced Airfields

Distress	Common Distress Mechanisms
Alligator Cracking	Load / Fatigue
Bleeding	Construction Quality/ Mix Design
Block Cracking	Climate / Age
Corrugation	Load / Construction Quality
Depression	Load / Subsurface
Jet Blast	Aircraft
Joint Reflection - Cracking	Climate / Subsurface Pavement / Traffic Load
Longitudinal/Transverse Cracking	Climate / Construction Quality
Oil Spillage	Aircraft / Vehicle
Patching	Utility / Pavement Repair / Age
Polished Aggregate	Repeated Traffic Loading
Raveling	Climate / Age
Rutting	Load / Fatigue
Shoving	PCC Pavement Growth / Movement
Slippage Cracking	Load / Pavement Bond / Mix Design
Swelling	Climate / Subsurface
Weathering	Climate / Age



Table 2.6.2 (b) Pavement Distresses Possible Causes – Flexible Asphalt Concrete-Surfaced Airfields

Classification by Possible Causes			
Load	Climate / Durability	Moisture / Drainage	Others
<ul style="list-style-type: none"> Alligator Cracking Corrugation Depression Patching of Load-based distress Polished Aggregate Rutting Slippage Cracking 	<ul style="list-style-type: none"> Bleeding Block Cracking Joint Reflection Cracking L/T Cracking Patching of climate / durability-caused distresses Shoving from PCC Raveling Weathering Swelling 	<ul style="list-style-type: none"> Alligator Cracking Depression Patching of moisture / drainage caused distress Swelling Raveling Weathering 	<ul style="list-style-type: none"> Oil Spillage Jet Blast Erosion Polished Aggregate

Table 2.6.2 (c) Pavement Distresses Possible Effects – Flexible Asphalt Concrete-Surfaced Airfields

Classification by Possible Effects			
Roughness	Skid / Hydroplaning Potential	FOD Potential	Rate of Deterioration and Maintenance Requirements
<ul style="list-style-type: none"> Corrugation Depression Rutting Shoving of asphalt pavement Swelling Raveling Weathering 	<ul style="list-style-type: none"> Bleeding Depression Polished Aggregate Rutting 	<ul style="list-style-type: none"> Block Cracking Joint Reflection Cracking L/T Cracking Slippage Cracking 	<ul style="list-style-type: none"> All Distresses



Table 2.6.2 (d) Pavement Distresses – Rigid Portland Cement Concrete-Surfaced Airfields

Distress	Common Distress Mechanisms
Blowup	Climate / ASR
Corner Break	Load Repetition / Curling Stresses
Linear Cracking	Load Repetition / Curling Stresses / Shrinkage Stresses
Durability Cracking	Freeze-Thaw Cycling
Joint Seal Damage	Material Deterioration / Construction Quality / Age
Small Patch	Pavement Repair
Large Patch/Utility Cut	Utility / Pavement Repair
Popout	Freeze-Thaw Cycling / ASR / Material Quality
Pumping	Load Repetition / Poor Joint Sealant
Scaling	Construction Quality / Freeze-Thaw Cycling
Faulting	Subgrade Quality / ASR / Inadequate Load Transfer
Shattered Slab	Overloading
Shrinkage Cracking	Construction Quality / Climate
Joint Spalling	Load Repetition / Infiltration of Incompressible Material / Deterioration of Dowel (Load Transfer) Bars
Corner Spalling	Load Repetition / Infiltration of Incompressible Material / Deterioration of Dowel (Load Transfer) Bars
Alkali-Silica Reaction (ASR)	Construction Quality / Climate / Chemical Reaction



Table 2.6.2 (e) Pavement Distresses Possible Causes – Rigid Portland Cement Concrete-Surfaced Airfields

Classification by Possible Causes			
Load	Climate / Durability	Moisture / Drainage	Others
<ul style="list-style-type: none"> • Corner Break • Shattered Slab • L/T/D Cracking • Pumping • Patching of Load-associated distress • Spalling 	<ul style="list-style-type: none"> • Blowup • "D" Cracking • Joint Seal Damage • Popouts • Scaling • Patch of Climate/Durability-associated distress • Shrinkage Cracking • Spalling • L/T/D Cracking 	<ul style="list-style-type: none"> • Corner Break • Shattered Slab • Pumping • Patching of Moisture/Drainage-associated distress 	<ul style="list-style-type: none"> • Settlement / Faulting

Table 2.6.2 (f) Pavement Distresses Possible Effects – Rigid Portland Cement Concrete-Surfaced Airfields

Classification by Possible Effects			
Roughness	Skid / Hydroplaning Potential	FOD Potential	Rate of Deterioration and Maintenance Requirements
<ul style="list-style-type: none"> • Blowup • Corner Break • L/T/D Cracking • Shattered Slab • Settlement / Faulting • Spalling 	<ul style="list-style-type: none"> • Settlement / Faulting • Spalling 	<ul style="list-style-type: none"> • Corner Break • L/T/D Cracking • "D" Cracking • Joint Seal Damage • Shattered Slab • Popouts • Scaling 	<ul style="list-style-type: none"> • All distresses



2.6.3 PCI Survey Inspection Procedures

Inspection Sampling Rate

The FDOT SAPMP performs PCI Survey Inspections on sample units defined in the previous update. The sample units are subject to change at the discretion of the inspection personnel and/or to major pavement rehabilitation treatments. Furthermore, access to the sample units based on accessibility or impacts to operations may affect the overall sampling rate effort at each airport. The following **Tables 2.6.3 (a) and (b)** define the sampling criteria used by the FDOT SAPMP. A higher sampling rate may be utilized to achieve a greater statistical confidence should the airport have the available resources to perform PCI Survey Inspections independent of the FDOT SAPMP.

Table 2.6.3 (a) Recommended Sample Rate Schedule for Flexible Asphalt Concrete

Number of Total Sample Units in Section	Sample Units to Inspect	
	Runways	Taxiways, Aprons, and Others
1 - 4	1	1
5 - 10	2	1
11 - 15	3	2
16 - 30	5	3
31 - 40	7	4
41 - 50	8	5
51 or more	20% but ≤20	10% but ≤10

Table 2.6.3 (b) Recommended Sample Rate Schedule for Rigid Portland Cement Concrete

Number of Total Sample Units in Section	Sample Units to Inspect	
	Runways	Taxiways, Aprons, and Others
1 - 3	1	1
4 - 6	2	1
7 - 10	3	2
11 - 15	4	2
16 - 20	5	3
21 - 30	7	3
31 - 40	8	4
41 - 50	10	5
51 or more	20% but ≤20	10% but ≤10



2.6.4 Updates to the ASTM D5340-12

Airfield pavement distresses and conditions were surveyed in accordance with the methods outlined in FAA Advisory Circular 150/5380-6C and ASTM D5340-12. These procedures define distress type, severity, and quantity for sampling areas within each defined pavement section area to analyze and determine the PCI value and condition rating. During the 2013-2015 System Update, the incorporation of the significant changes to the ASTM D5340 (version D5340-12) resulted in adjusted pavement condition indices on pavement sections subject to the distress types updated. Furthermore, the revision of the PCI deduction curves and the separation of distress types from the original, such as Weathering and Raveling, have in select cases increased the PCI value of the section without any rehabilitation performed.

Flexible Asphalt Concrete Pavement Distress Updates

The previous methodology which featured “(52) Weathering and Raveling” distress has been separated into two distresses “(52) Raveling” and “(57) Weathering.” Previously, areas that were recorded as “Weathering and Raveling” were considered as one distress with a high deduction. Based on the updated methodology, in certain situations where “Weathering” only exists and does not meet the definition of “Raveling,” the PCI deduction is not as high as the former “Weathering and Raveling.” Therefore, areas identified only as “(57) Weathering” based on current ASTM standards, which were previously identified as “(52) Weathering and Raveling,” may be subject to an improvement in PCI. In instances where pavement PCI has increased due to this update, it is not due to an improvement in actual condition, however indicative of the adjusted distress deterioration effects.

Rigid Portland Cement Concrete Pavement Distress Updates


The previous methodology defined “(70) Scaling” as a distress that consisted of surface deterioration caused by construction defects, material defects, and environmental factors. The distress included *Alkali-Silica Reaction*, also known as ASR. The current methodology has separated Alkali-Silica Reaction as a distress identified as “(76) Alkali-Silica Reaction / ASR.” As a result, the previous “(70) Scaling” numerical deduction contribution to the PCI has been reduced. Previous inspections that recorded “(70) Scaling,” and currently do not exhibit “(76) Alkali-Silica Reactivity / ASR” may potentially see an increase in PCI. Additionally, “(73) Shrinkage Cracks” has been redefined as “(73) Shrinkage Cracking”. Shrinkage Cracking is characterized in two forms; drying shrinkage and plastic shrinkage. Drying shrinkage occurs over time as moisture leaves the pavement, it develops when hardened pavement continues to shrink as excess water not needed for cement hydration evaporates. It forms when subsurface resistance to the shrinkage is present and may extend through the entire depth of the slab. Plastic shrinkage can be caused by both atmospheric conditions and construction. Plastic shrinkage caused by atmospheric conditions develops when there is rapid loss of water in the surface of recently placed pavement. High winds or low humidity are contributing factors to evaporation. These shrinkage cracks can appear as a series of parallel cracks, usually 1 to 3 feet apart and do not extend very deep into the pavement’s surface. Plastic shrinkage caused by construction can form from over finishing/overworking of the pavement during construction. These shrinkage cracks appear as a series of inter-connected hairline cracks, or pattern cracking, and are often observed throughout the majority of the slab surface. This condition is also referred to as map cracking or crazing.



Table 2.6.4 Summary of Updates to ASTM D5340-12

Distress Updates to Reflect ASTM 5340-12				
Use and Surface Type	Updated Distress	Former Distress in Prior to 5340-10	Deduction Curve	Potential Effect
AC/AAC/APC Airfield	(52) Raveling - Low	(52) Weathering and Raveling - Low	No Change	N/A
	(52) Raveling - Medium	(52) Weathering and Raveling - Medium	No Change	N/A
	(52) Raveling - High	(52) Weathering and Raveling - High	No Change	N/A
	(57) Weathering - Low	N/A – was part of 'Weathering and Raveling'	New	Increase in PCI with no maintenance
	(57) Weathering - Medium	N/A – was part of 'Weathering and Raveling'	New	Increase in PCI with no maintenance
	(57) Weathering - High	N/A – was part of 'Weathering and Raveling'	New	Increase in PCI with no maintenance
PCC Airfield	(70) Scaling - Low	(70) Scaling, Map Cracking, and Cracking - Low	New	Increase in PCI with no maintenance
	(70) Scaling - Medium	(70) Scaling, Map Cracking, and Cracking - Medium	New	Increase in PCI with no maintenance
	(70) Scaling - High	(70) Scaling, Map Cracking, and Cracking - High	New	Increase in PCI with no maintenance
	(76) Alkali Silica Reaction – Low	N/A – was part of 'Scaling, Map Cracking, and Cracking'	New	Increase in PCI with no maintenance
	(76) Alkali Silica Reaction – Medium	N/A – was part of 'Scaling, Map Cracking, and Cracking'	New	Increase in PCI with no maintenance
	(76) Alkali Silica Reaction – High	N/A – was part of 'Scaling, Map Cracking, and Cracking'	New	Increase in PCI with no maintenance
	(73) Shrinkage Cracking	(73) Shrinkage Cracking	No Change	Prior distress types identified as 'Scaling, Map Cracking, and Cracking' may now be identified as 'Shrinkage Cracking'

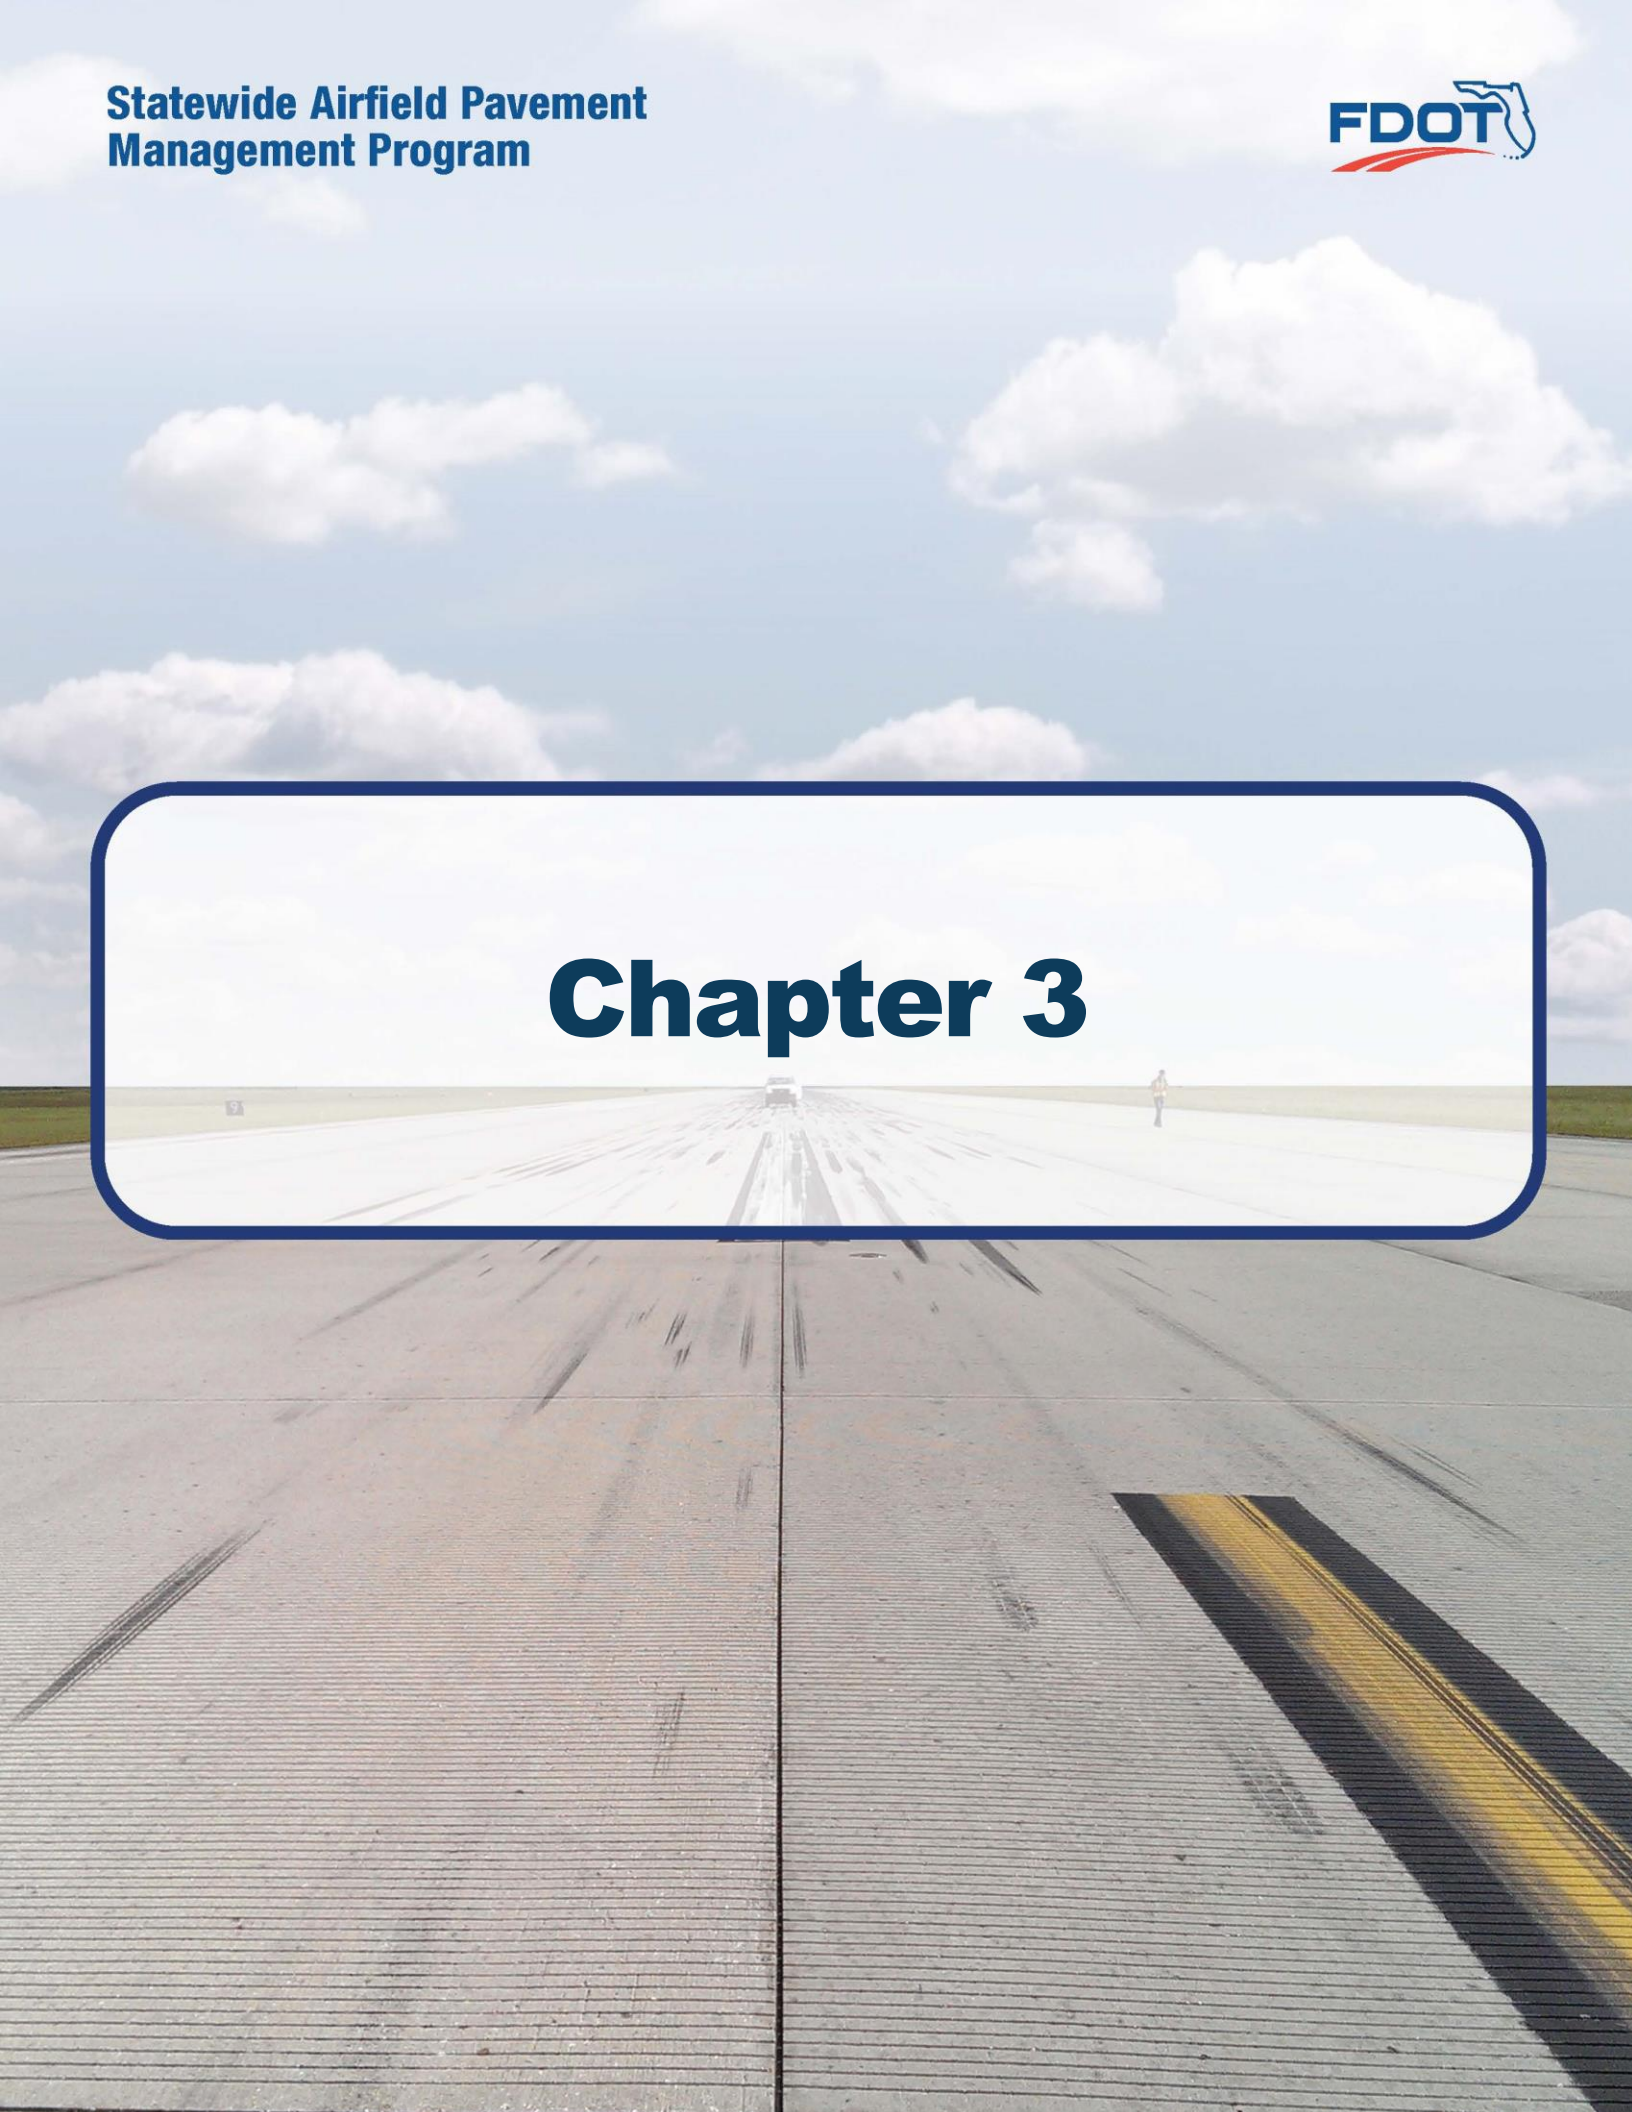Chapter 3





Chapter 3 – Airfield Pavement System Inventory

A significant element of an effective airfield pavement management system is the appropriate record keeping of changes due to construction or operational use of the pavement facilities. This chapter discusses the inventory data collected from the airport and summarizes network-level characteristics of the airport's airfield pavements. At the start of each FDOT SAPMP System Update, all airports are asked to review the existing Airfield Pavement Network Definition exhibit for accuracy. Furthermore, participating airports are asked to provide documentation for any recent or anticipated construction related to their airfield pavements.

3.1 Airfield Pavement Network Information

3.1.1 Previous and/or Anticipated Airfield Pavement Construction

Based on information provided by the airport, the following **Table 3.1.1** summarizes the airfield pavement construction projects that have been incorporated into the SAPMP database system since the 2013-2015 System Update. **Figure 3.1.1 (a)** and **Figure 3.1.1 (b)** provides an inset view of the 2019 Airfield Pavement Network Definition Exhibit and the 2019 Airfield Pavement System Inventory Exhibits that depict the updated network details for the airport reflected in the PAVER Database. Large format exhibits are referenced in **Appendix C Technical Exhibits**.

Table 3.1.1 Previous and/or Anticipated Airfield Pavement Construction


Year	General Work Description
2013	RW 5-23, TW A, TW B, TW D, TW E - Reconstruction: 4" P-401, 5" P-210
	RW 5-23, RW 13-31 - Mill and Overlay: 1" Mill and 1.5"-4" Overlay
	RW 5-23, TW E - Reconstruction: 4" P-401, 8" P-210
	T-HANG - Mill and Overlay: 1"-2" Mill and Overlay
2015	AP RU, AP - Reconstruction: 4" P-401, 8" P-211
	TW A, TW C - Reconstruction: 4" P-401, 8" P-210
	TW E - New Construction
2017	AP CENTER, TW B - Reconstruction: 4" P-401, 6" P-220
	AP - Reconstruction: 4" P-401, 6" P-219
	AP - Mill and Overlay
	TW B - Reconstruction: 4" P-401, 8" P-211
	RW 13-31, TW D - New Construction: 4" P-401, 8" P-211
	TW D, TW F - Reconstruction 4" P-401, 8" P-210
2018	AP - Reconstruction: 4" P-401, 6" P-219
	T-HANG - New Construction

The airport provided a limited combination of record drawings, reports, and staff input that was pertinent information in developing the construction history of the airport's pavements from



inception. Major rehabilitation/construction activities performed in the last 24-months or anticipated in the next 24-months are assumed to restore the PCI to 100. These activities include: pavement overlay, mill and replace, mill and overlay, new construction, and/or complete reconstruction. These pavements were not formally subject to a PCI Survey and actual conditions may vary. Furthermore, any localized maintenance or repair performed that would improve the PCI will be considered in the condition analysis, if performed within inspection areas.

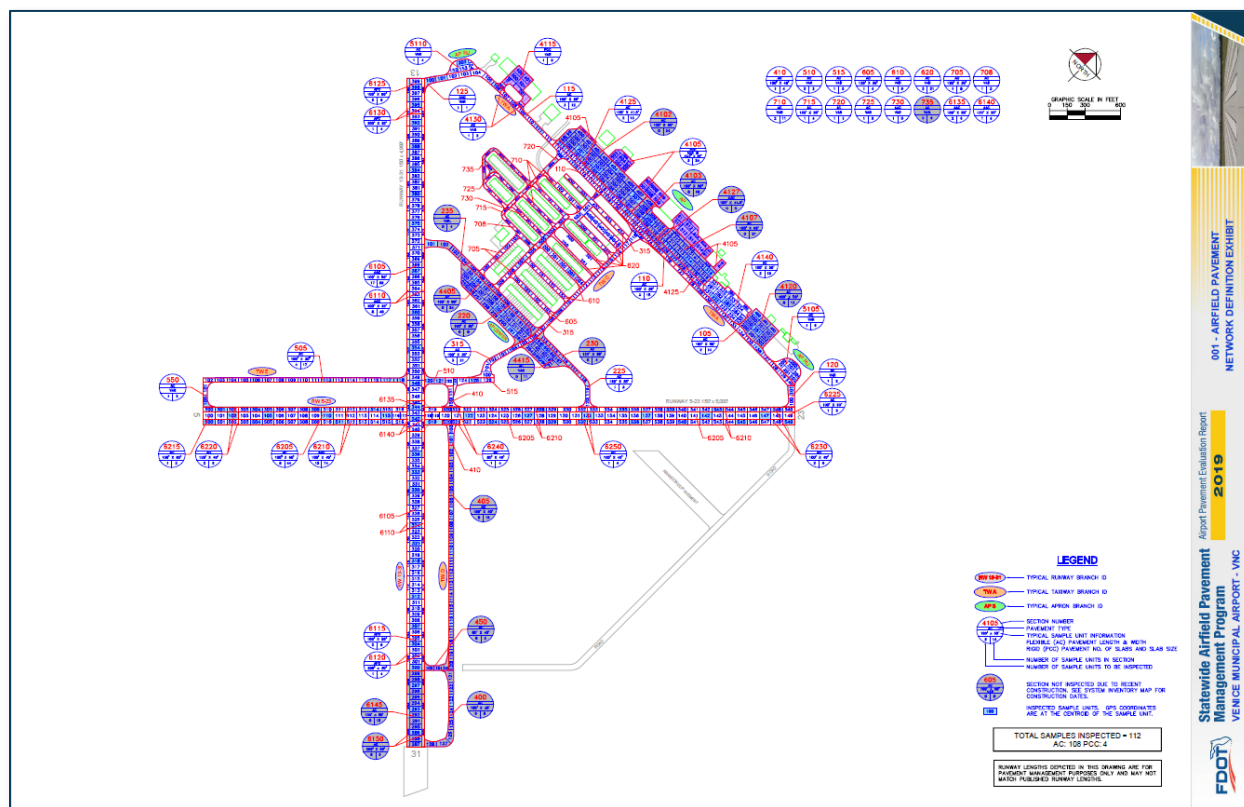
Figure 3.1.1 (a) 2019 Airfield Pavement Network Definition Exhibit



The Airfield Pavement Network Definition Exhibit provides details to the PCI Survey inspection efforts. The exhibit identifies the pavement facilities, surface type, section definition, and sample unit delineation.



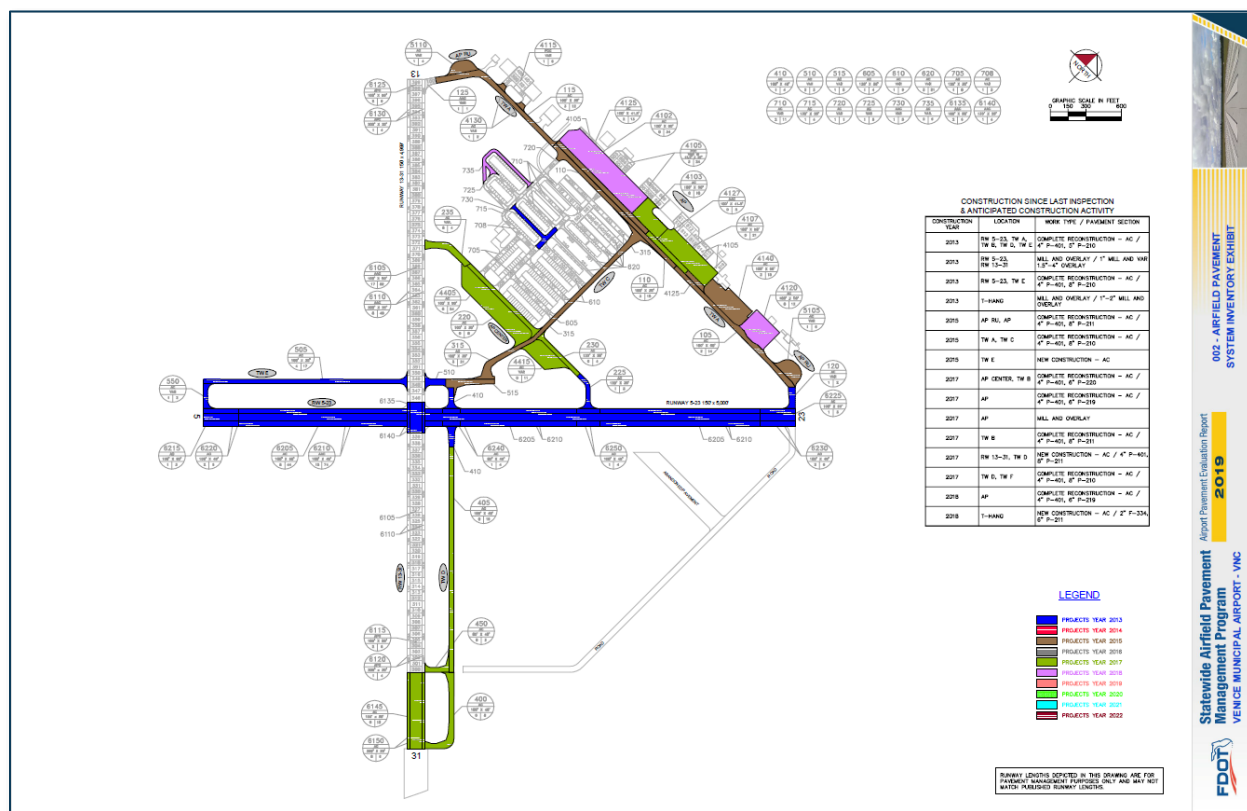
Figure 3.1.1 (b) 2019 Airfield Pavement System Inventory Exhibit



The Airfield Pavement System Inventory Exhibit provides details to the work history updates communicated by the Airport. The Exhibit provides the approximate limits of recent and/or anticipated construction on the airfield pavement facilities. The limits are based on documentation provided by the Airport and, if constructed, observed in the field.

3.1.2 Estimated Pavement Age

Standard pavement design practice considers a design life of a 20-year period. Design inputs typically require subgrade soil conditions, pavement section layer material characteristics, and anticipated loading (aircraft fleet mix) for the design-life period. Based on the review of the historic airfield pavement construction, **Figure 3.1.2** summarizes the average age of the pavement sections at the time of the PCI survey inspection. Age is determined to be the number of years since any major construction activity has occurred. This is intended to be a rough estimate based on interpretation of the limited data available at the time of report.

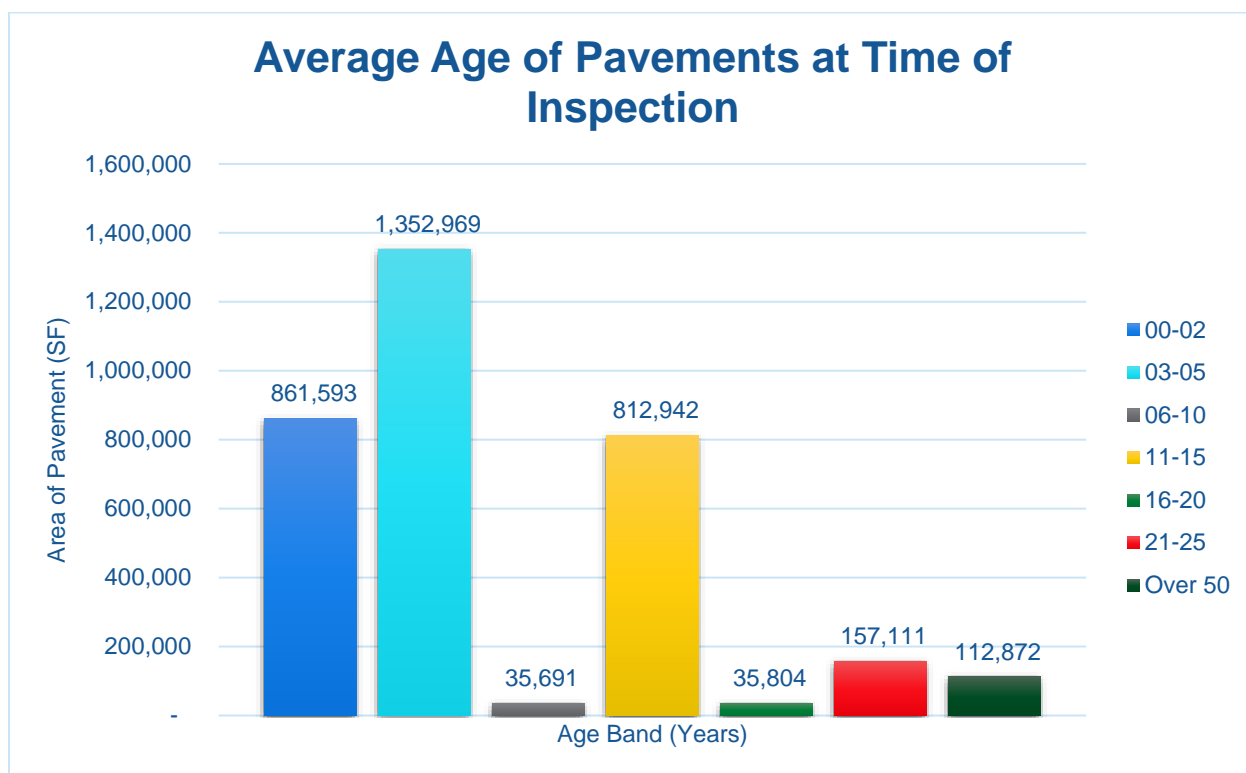*Figure 3.1.2 Average Age of Pavements at Inspection*


The estimation of the pavement age is based on information requested and provided by participating airports. Additionally, data collected in the prior system updates since 1992 have been relied upon.



3.1.3 Functional Use Classification

Pavements are subject to varying aircraft loading patterns based on utilization and overall operations. For this SAPMP Update, the following categories of airfield functional use have been identified and associated with the following possible pavement branch facilities: Apron, Runway, Taxiway, and Taxilane. **Figure 3.1.3** summarizes the identified pavements' functional use by area in square feet. The pavement areas reviewed exclude shoulder pavement facilities.

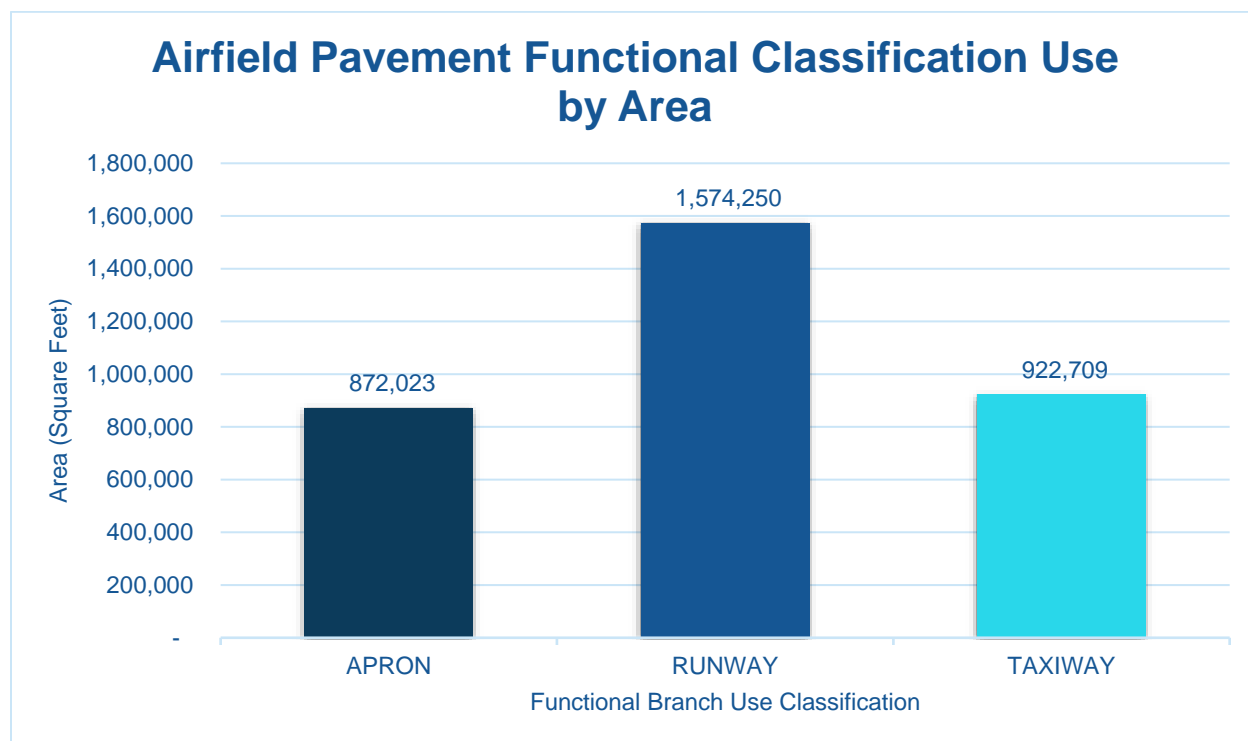Figure 3.1.3 Airfield Pavement Functional Classification Use by Area





3.1.4 Pavement Surface Type

The airfield pavement facility surface types within the SAPMP include four common types of pavement: Portland cement concrete (PCC), asphalt concrete (AC), asphalt concrete overlaid on asphalt concrete (AAC), and asphalt concrete overlaid on Portland cement concrete (APC).

Based on the record documentation incorporated within the SAPMP database throughout the years, the pavement surface types have been assigned to the various pavement sections in accordance to its work history composition. The following **Figures 3.1.4 (a) and (b)** summarize the applicable pavement types observed at this specific airport's airfield.

Figure 3.1.4 (a) Pavement Surface Type by Area (SF)


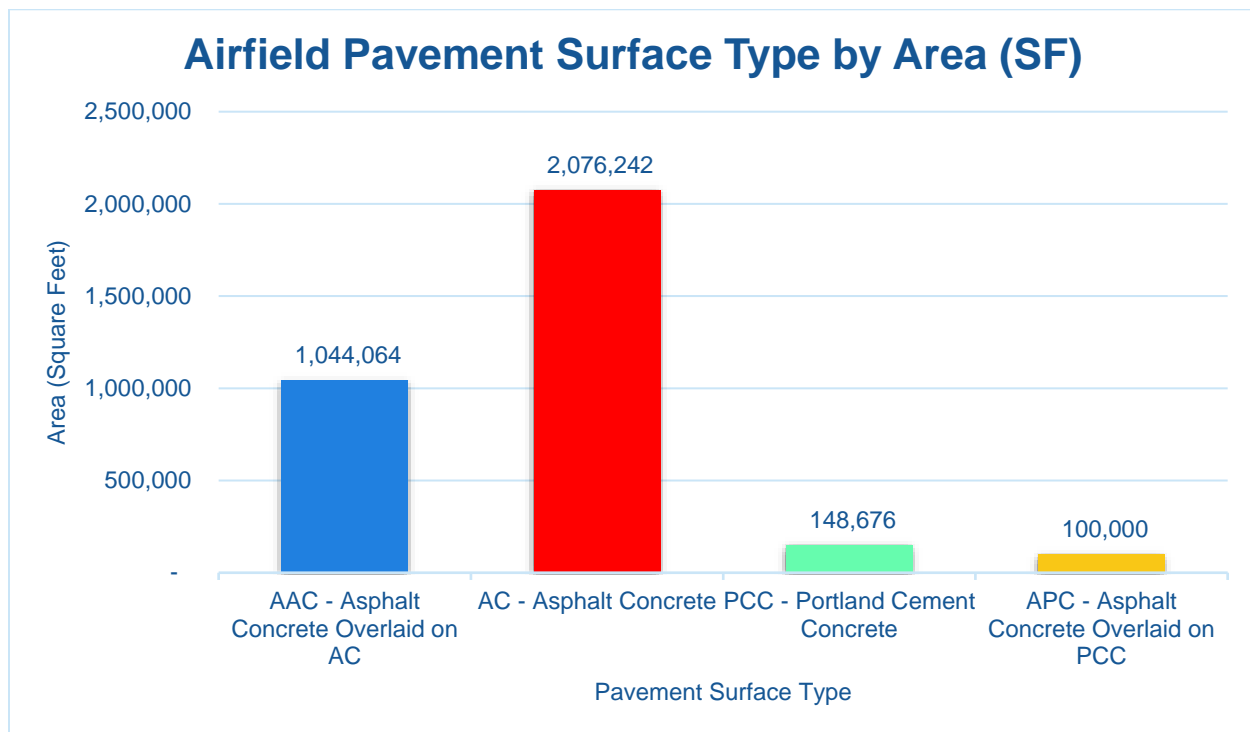




Figure 3.1.4 (b) Pavement Surface Type by Area (%)

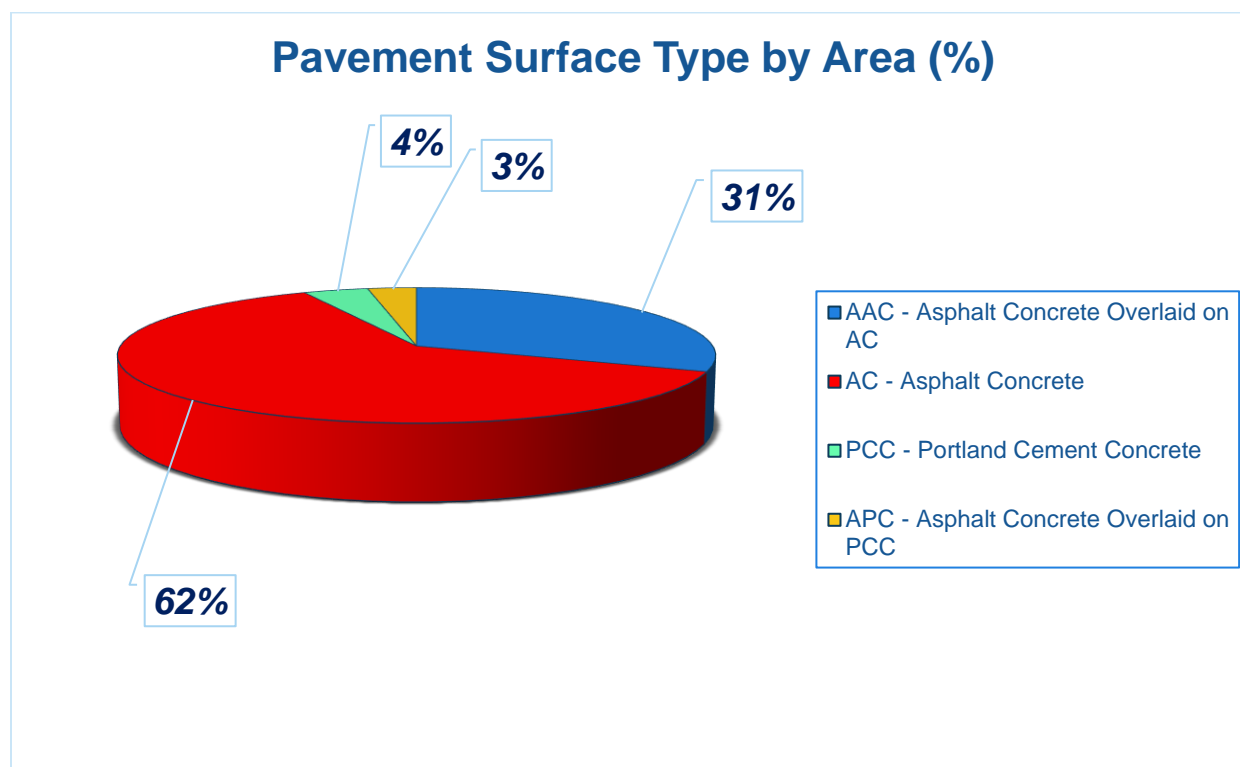

3.1.5 Pavement System Inventory Details

The following **Table 3.1.5** displays the section-level details assembled as part of this update. The section-level details are based on the record documentation provided by the airports to FDOT and from SAPMP System Updates. The details assembled rely on the accuracy and the adequacy of data provided; however, it should be noted that characteristics such as pavement areas may be based on aerial interpretation of spatially projected imagery. The accuracy of data is presented with the intention of a network planning-level document; should the airport elect to perform rehabilitation work, it is recommended that further investigation be performed at the project level for construction purposes.

In summary, the scope of the pavement inventory update resulted in the updating of select existing pavement geometry and the development of an AutoCAD model with spatial projection for use within GIS. **Appendix A** includes the Airfield Pavement Network Definition Exhibit and the Airfield Pavement System Inventory Exhibit which visually summarize the results of the Airfield Pavement System Inventory analysis and reporting.



Table 3.1.5 Pavement System Inventory Details

Network ID	Branch Name	Branch ID	Branch Use	Section ID	Length (FT)	Width (FT)	Area (SF)	Surface Type	Est. Last Construction Date
VNC	APRON	AP	APRON	4102	870	193	164,918	AC	1/1/2018
VNC	APRON	AP	APRON	4103	900	500	45,587	AC	1/1/2017
VNC	APRON	AP	APRON	4105	920	120	112,872	PCC	1/1/1942
VNC	APRON	AP	APRON	4107	565	160	90,832	AC	1/1/2017
VNC	APRON	AP	APRON	4115	275	150	35,804	PCC	12/25/1999
VNC	APRON	AP	APRON	4120	275	203	57,693	AC	1/1/2018
VNC	APRON	AP	APRON	4125	1,275	42	53,301	AC	1/1/2015
VNC	APRON	AP	APRON	4127	470	42	19,505	AAC	1/1/2017
VNC	APRON	AP	APRON	4130	200	50	5,580	AC	1/1/2015
VNC	APRON	AP	APRON	4140	450	180	73,011	AC	1/1/2015
VNC	CENTER APRON (OLD RW9-27)	AP CENTER	APRON	4405	1,200	100	120,111	AC	1/1/2017
VNC	CENTER APRON (OLD RW9-27)	AP CENTER	APRON	4415	300	150	46,412	AC	1/1/2017
VNC	RUN-UP APRON AT ENDS OF TW A	AP RU	APRON	5105	198	100	26,551	AC	1/1/2015
VNC	RUN-UP APRON AT ENDS OF TW A	AP RU	APRON	5110	100	200	19,846	AC	1/1/2015
VNC	RUNWAY 13-31	RW 13-31	RUNWAY	6105	4,139	100	413,900	AAC	12/1/2006
VNC	RUNWAY 13-31	RW 13-31	RUNWAY	6110	8,400	25	196,950	AAC	12/1/2006
VNC	RUNWAY 13-31	RW 13-31	RUNWAY	6115	300	100	30,000	APC	12/1/2006
VNC	RUNWAY 13-31	RW 13-31	RUNWAY	6120	800	25	20,000	APC	12/1/2006
VNC	RUNWAY 13-31	RW 13-31	RUNWAY	6125	300	100	30,000	APC	12/1/2006
VNC	RUNWAY 13-31	RW 13-31	RUNWAY	6130	800	25	20,000	APC	12/1/2006
VNC	RUNWAY 13-31	RW 13-31	RUNWAY	6135	1,000	100	26,100	AAC	1/1/2013
VNC	RUNWAY 13-31	RW 13-31	RUNWAY	6140	500	25	13,050	AAC	1/1/2013
VNC	RUNWAY 13-31	RW 13-31	RUNWAY	6145	645	100	64,500	AC	5/9/2017
VNC	RUNWAY 13-31	RW 13-31	RUNWAY	6150	1,290	25	32,250	AC	5/9/2017
VNC	RUNWAY 5-23	RW 5-23	RUNWAY	6205	4,149	100	255,000	AC	1/1/2013



Network ID	Branch Name	Branch ID	Branch Use	Section ID	Length (FT)	Width (FT)	Area (SF)	Surface Type	Est. Last Construction Date
VNC	RUNWAY 5-23	RW 5-23	RUNWAY	6210	8,100	25	350,820	AAC	1/1/2013
VNC	RUNWAY 5-23	RW 5-23	RUNWAY	6215	300	100	18,000	AC	1/1/2013
VNC	RUNWAY 5-23	RW 5-23	RUNWAY	6220	800	25	27,000	AC	1/1/2013
VNC	RUNWAY 5-23	RW 5-23	RUNWAY	6225	300	100	18,000	AC	1/1/2013
VNC	RUNWAY 5-23	RW 5-23	RUNWAY	6230	800	25	27,000	AC	1/1/2013
VNC	RUNWAY 5-23	RW 5-23	RUNWAY	6240	400	45	13,680	AC	1/1/2013
VNC	RUNWAY 5-23	RW 5-23	RUNWAY	6250	400	45	18,000	AC	1/1/2013
VNC	GA T-HANGARS	T-HANG	TAXIWAY	605	500	35	17,687	AC	1/1/2003
VNC	GA T-HANGARS	T-HANG	TAXIWAY	610	500	35	42,593	AC	1/1/2003
VNC	GA T-HANGARS	T-HANG	TAXIWAY	620	1,600	75	103,188	AC	12/25/1994
VNC	GA T-HANGARS	T-HANG	TAXIWAY	705	943	40	36,074	AC	1/1/2003
VNC	GA T-HANGARS	T-HANG	TAXIWAY	708	390	30	11,509	AC	12/25/1997
VNC	GA T-HANGARS	T-HANG	TAXIWAY	710	1,000	50	42,414	AC	12/25/1994
VNC	GA T-HANGARS	T-HANG	TAXIWAY	715	700	50	12,818	AC	1/1/2012
VNC	GA T-HANGARS	T-HANG	TAXIWAY	720	250	50	5,418	AC	1/1/2012
VNC	GA T-HANGARS	T-HANG	TAXIWAY	725	600	35	17,455	AC	1/1/2012
VNC	GA T-HANGARS	T-HANG	TAXIWAY	730	1,000	50	18,001	AAC	11/1/2013
VNC	GA T-HANGARS	T-HANG	TAXIWAY	735	870	25	21,879	AC	1/1/2018
VNC	TAXIWAY A	TW A	TAXIWAY	105	1,395	35	55,145	AC	1/1/2015
VNC	TAXIWAY A	TW A	TAXIWAY	110	1,450	35	53,584	AC	1/1/2015
VNC	TAXIWAY A	TW A	TAXIWAY	115	1,333	50	52,281	AC	1/1/2015
VNC	TAXIWAY A	TW A	TAXIWAY	120	200	50	9,988	AC	1/1/2013
VNC	TAXIWAY A	TW A	TAXIWAY	125	125	50	5,738	AAC	12/1/2006
VNC	TAXIWAY B	TW B	TAXIWAY	220	800	35	30,324	AC	1/1/2017
VNC	TAXIWAY B	TW B	TAXIWAY	225	350	35	12,448	AC	1/1/2013
VNC	TAXIWAY B	TW B	TAXIWAY	230	460	35	17,274	AC	1/1/2017




Network ID	Branch Name	Branch ID	Branch Use	Section ID	Length (FT)	Width (FT)	Area (SF)	Surface Type	Est. Last Construction Date
VNC	TAXIWAY B	TW B	TAXIWAY	235	230	50	23,085	AC	5/9/2017
VNC	TAXIWAY C	TW C	TAXIWAY	315	2,103	40	84,284	AC	1/1/2015
VNC	TAXIWAY D	TW D	TAXIWAY	400	645	50	39,559	AC	5/9/2017
VNC	TAXIWAY D	TW D	TAXIWAY	405	1,902	40	76,074	AC	5/9/2017
VNC	TAXIWAY D	TW D	TAXIWAY	410	200	35	18,193	AC	1/1/2013
VNC	TAXIWAY E	TW E	TAXIWAY	505	1,722	35	62,102	AC	1/1/2013
VNC	TAXIWAY E	TW E	TAXIWAY	510	175	50	10,168	AC	1/1/2013
VNC	TAXIWAY E	TW E	TAXIWAY	515	330	50	22,576	AC	1/1/2015
VNC	TAXIWAY E	TW E	TAXIWAY	550	208	37	9,260	AC	1/1/2013
VNC	TAXIWAY F	TW F	TAXIWAY	450	205	40	11,590	AC	5/9/2017



PAGE INTENTIONALLY LEFT BLANK

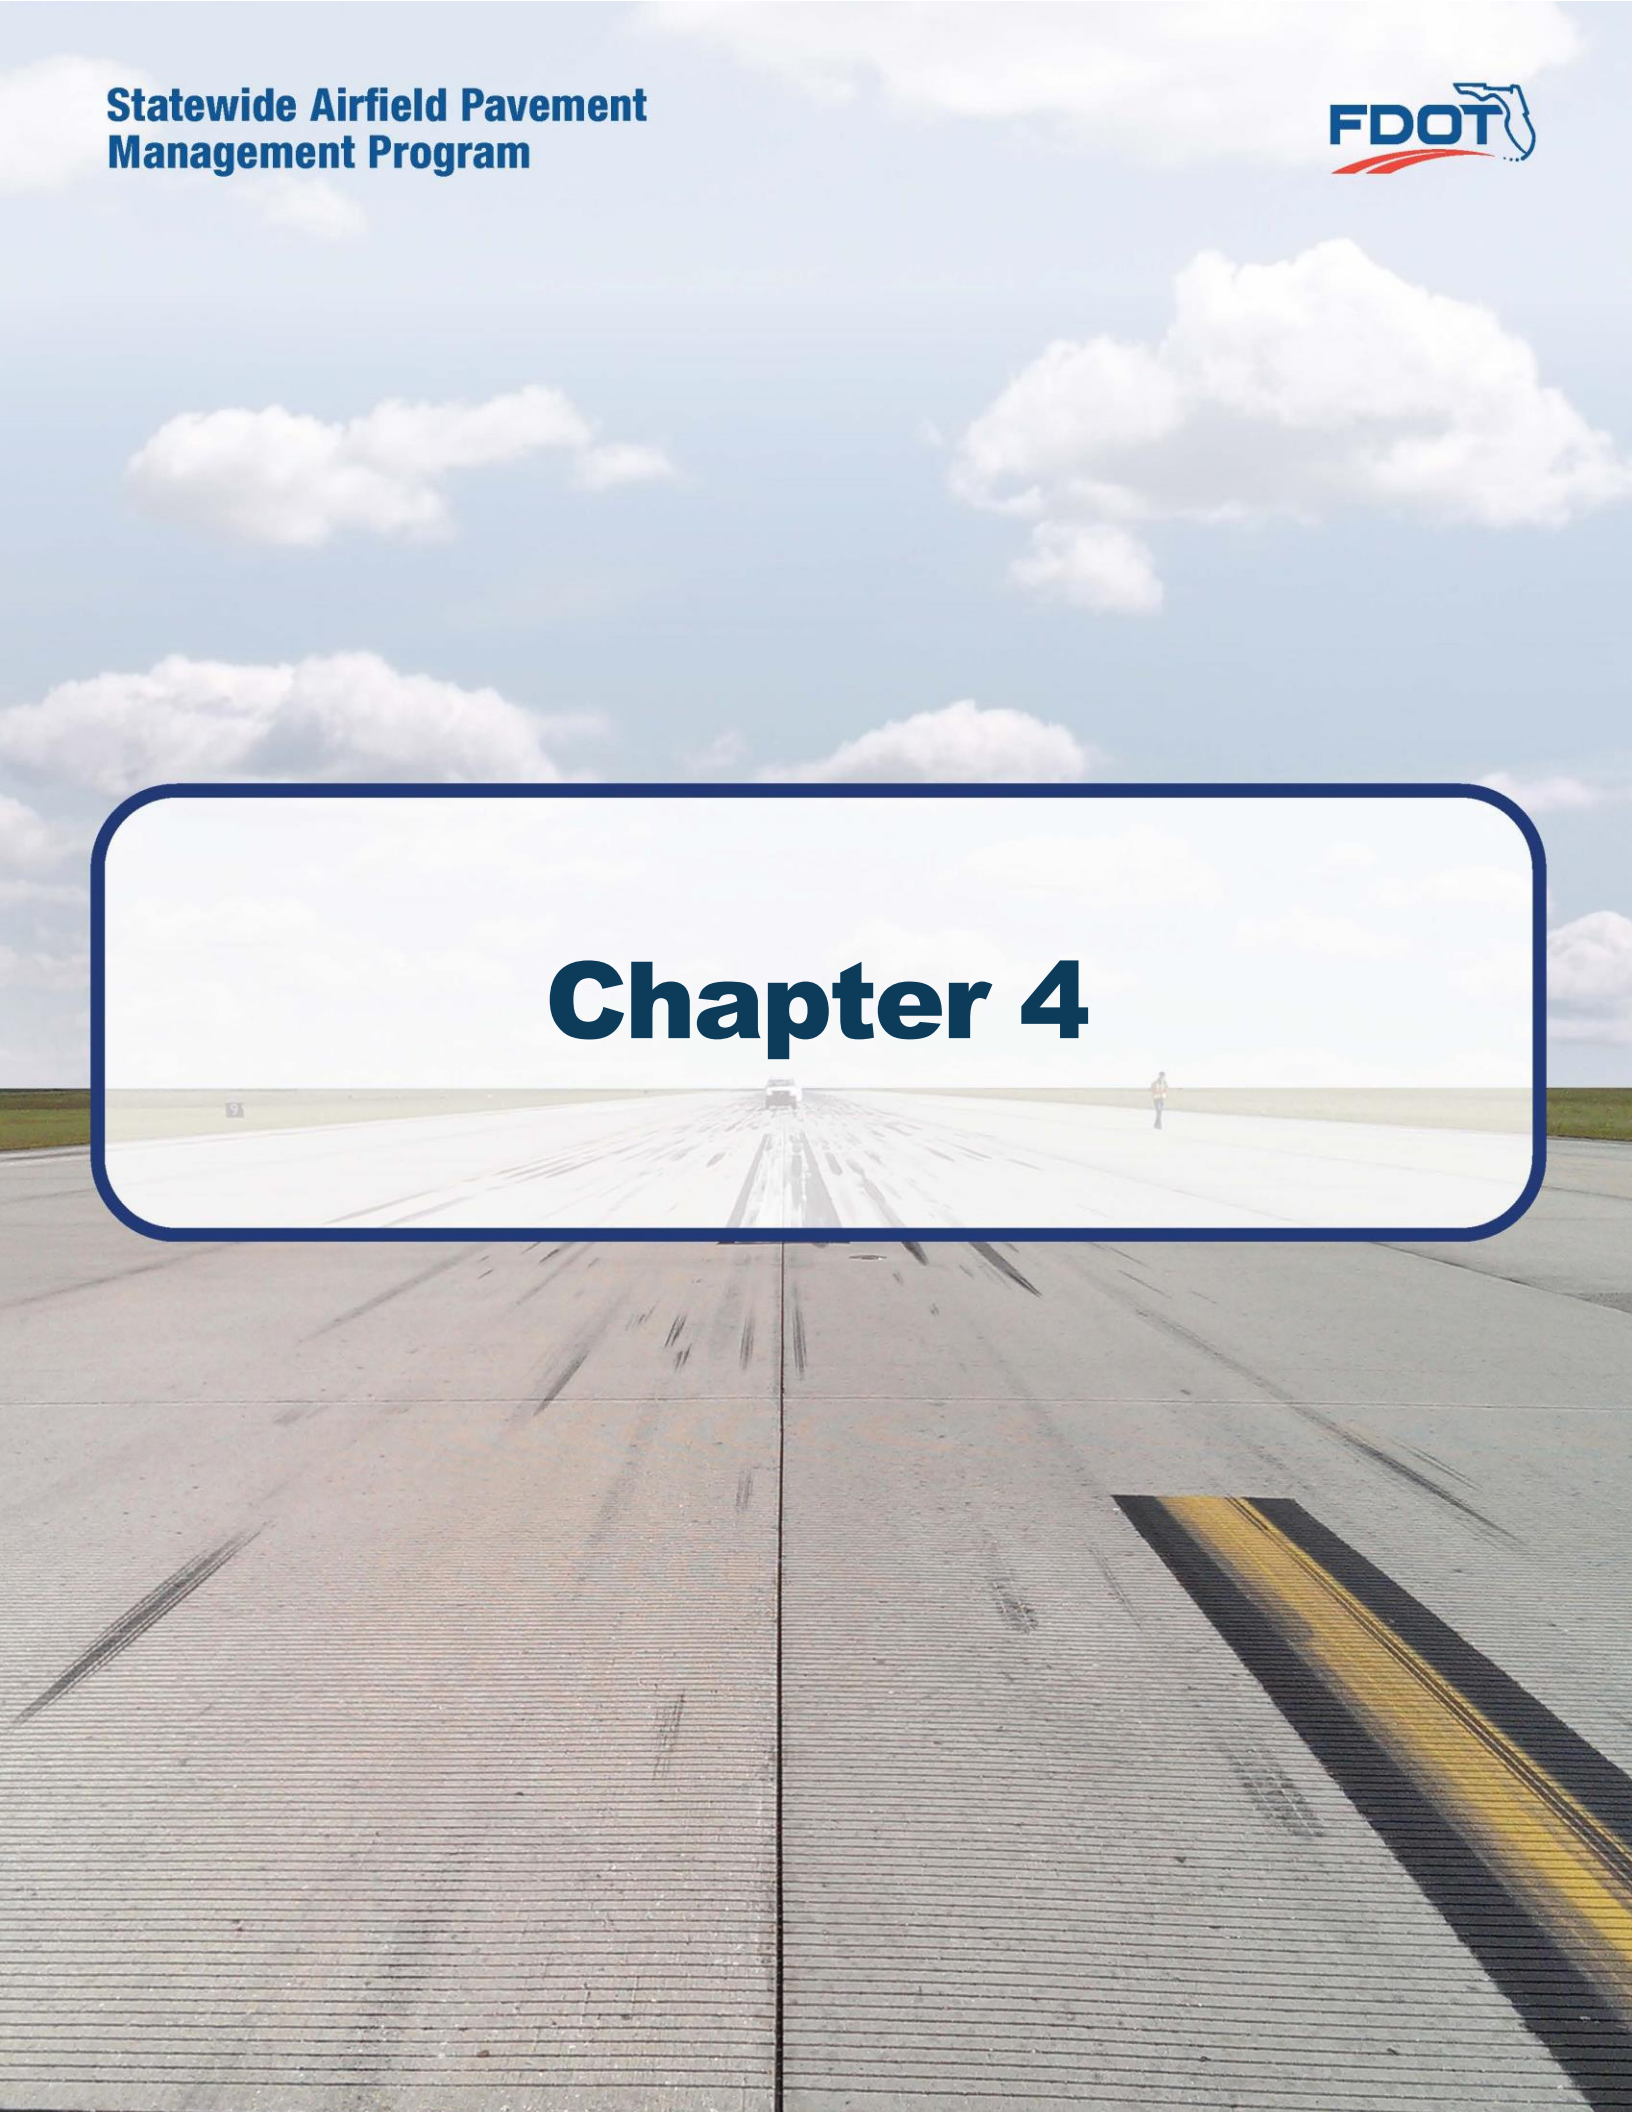Chapter 4





Chapter 4 – Airfield Pavement Condition


The examination of specific distress types (with causes attributed to load, climate, or other defined distress mechanism), determination of the severity of distress, and determination of the quantity of distress manifestation are required in the computation of a PCI value. The PCI provides valuable information that can be used to determine the existing condition of the pavement, possible cause of the pavement deterioration, and eventually aid in the planning of the rehabilitation of pavements. It should be noted that the PCI method of pavement condition evaluation is strictly a visual and functional evaluation. Further evaluation of the pavement condition may be necessary for design and/or project-level determination of pavement rehabilitation.

4.1 Airfield Pavement Condition Index (Latest Inspection)

4.1.1 Network-Level Analysis

The following **Figure 4.1.1** summarizes the network-level pavement condition analysis based on the most recent PCI Survey inspection results.

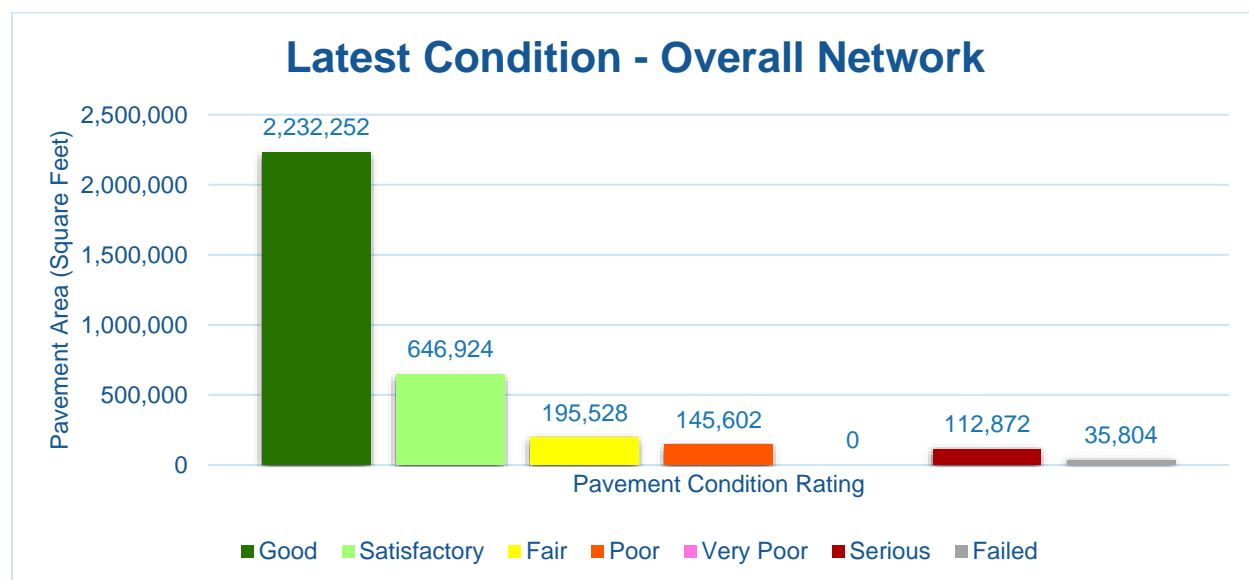Figure 4.1.1 Latest Condition – Overall Network



4.1.2 Branch-Level Analysis

The following **Figures 4.1.2 (a) through (c)** summarize the branch-level pavement condition analysis based on the most recent PCI Survey inspection results; the following Figures provide overall branch-level conditions by branch use.



Figure 4.1.2 (a) Latest Condition – Runway Pavements

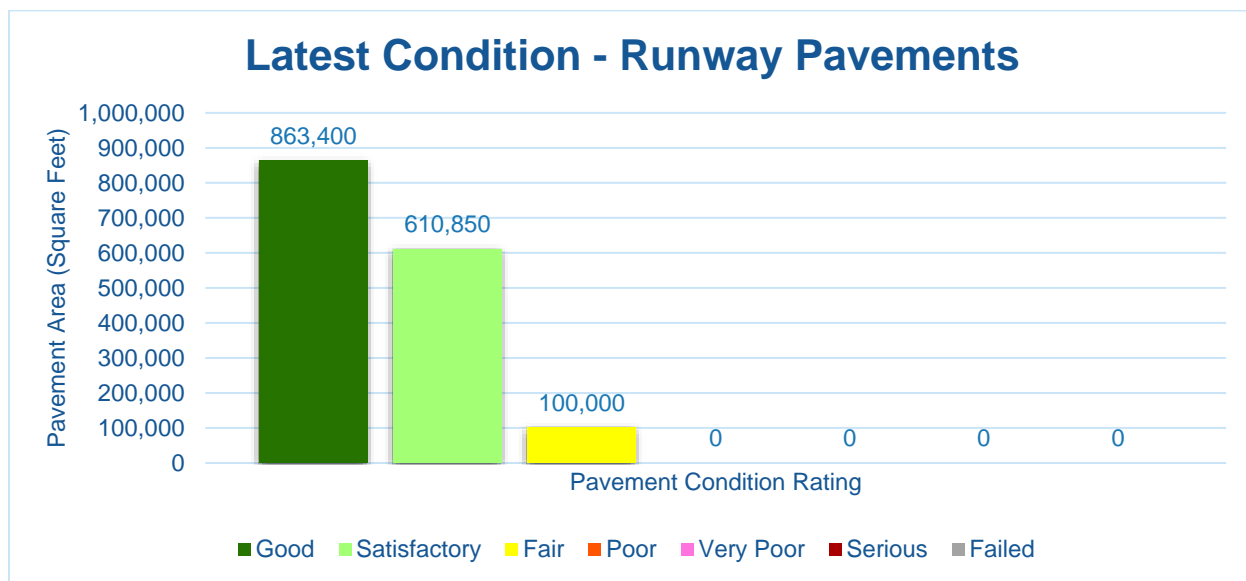


Figure 4.1.2 (b) Latest Condition – Taxiway Pavements


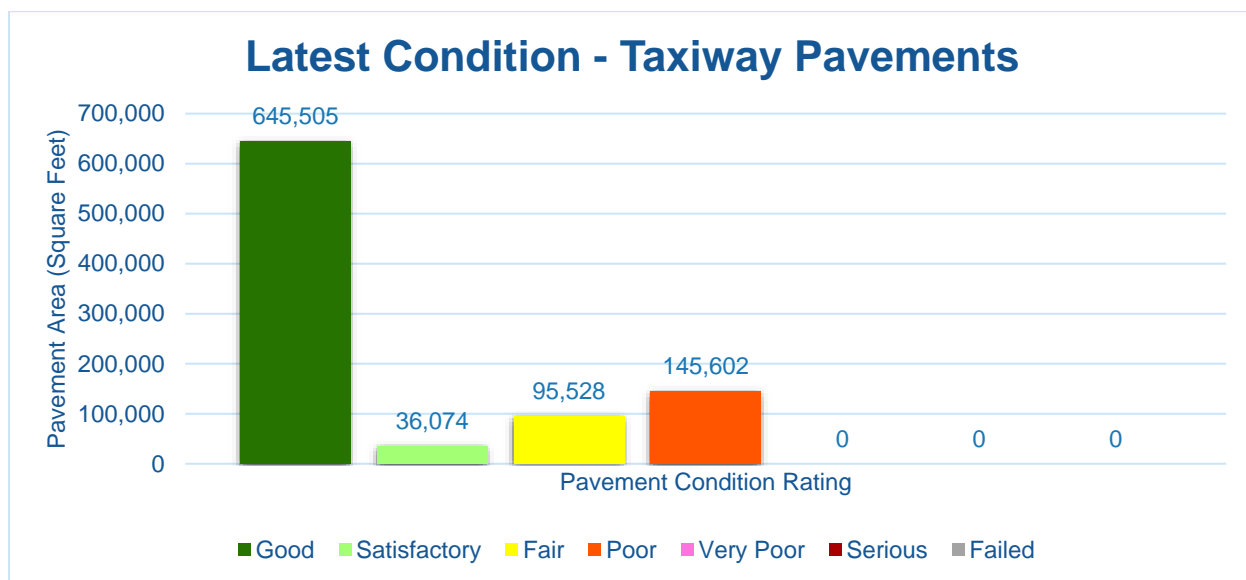




Figure 4.1.2 (c) Latest Condition – Apron Pavements

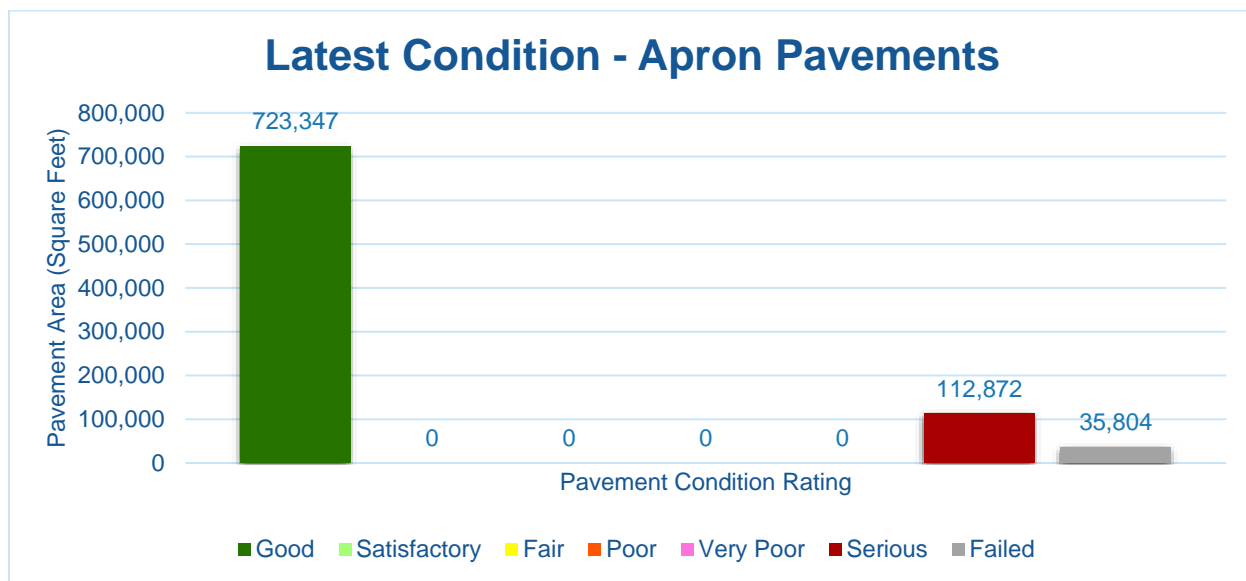



4.1.3 Section-Level Analysis

The following **Table 4.1.3** provides details for each pavement section of its area-weighted average PCI and the percent of distress which is related to load, climate, or other factors. The amount of distress attributed to the various causes provides insight into maintenance, repair, and rehabilitation needs. Load-related distress indicates that pavements are reaching the end of their structural design life, and for those pavements exhibiting a significant amount of these distress types, rehabilitation should be planned to strengthen or reconstruct the pavement.

Appendix C Technical Exhibits provides a technical exhibit that graphically depicts the PCI values and ratings determined from this SAPMP System Update.

Any pavement facilities subject to pavement construction within the past 2 years or anticipated for construction within the next year may have been omitted from inspection. Pavement subject to major rehabilitation will be set to a PCI of 100.



Table 4.1.3 Latest Pavement Condition Index Summary

Network ID	Branch ID	Branch Name	Branch Use	Section ID	Area (SF)	Surface	PCI	PCI Rating	PCI % Climate	PCI % Load	PCI % Other	Sample Units Inspected	Total Sample Units in Section
VNC	AP	APRON	APRON	4102	164,918	AC	100	Good	0%	0%	0%	0	34
VNC	AP	APRON	APRON	4103	45,587	AC	100	Good	0%	0%	0%	0	10
VNC	AP	APRON	APRON	4105	112,872	PCC	21	Serious	13%	61%	26%	3	24
VNC	AP	APRON	APRON	4107	90,832	AC	100	Good	0%	0%	0%	0	21
VNC	AP	APRON	APRON	4115	35,804	PCC	4	Failed	6%	61%	33%	1	6
VNC	AP	APRON	APRON	4120	57,693	AC	100	Good	0%	0%	0%	0	12
VNC	AP	APRON	APRON	4125	53,301	AC	91	Good	100%	0%	0%	2	13
VNC	AP	APRON	APRON	4127	19,505	AAC	100	Good	0%	0%	0%	0	5
VNC	AP	APRON	APRON	4130	5,580	AC	94	Good	100%	0%	0%	1	2
VNC	AP	APRON	APRON	4140	73,011	AC	93	Good	100%	0%	0%	2	15
VNC	AP CENTER	CENTER APRON (OLD RW9-27)	APRON	4405	120,111	AC	100	Good	0%	0%	0%	0	24
VNC	AP CENTER	CENTER APRON (OLD RW9-27)	APRON	4415	46,412	AC	100	Good	0%	0%	0%	0	11
VNC	AP RU	RUN-UP APRON AT ENDS OF TW A	APRON	5105	26,551	AC	94	Good	100%	0%	0%	1	6
VNC	AP RU	RUN-UP APRON AT ENDS OF TW A	APRON	5110	19,846	AC	94	Good	100%	0%	0%	1	4
VNC	RW 13-31	RUNWAY 13-31	RUNWAY	6105	413,900	AAC	76	Satisfactory	99%	0%	1%	17	82
VNC	RW 13-31	RUNWAY 13-31	RUNWAY	6110	196,950	AAC	74	Satisfactory	82%	0%	18%	8	40
VNC	RW 13-31	RUNWAY 13-31	RUNWAY	6115	30,000	APC	67	Fair	100%	0%	0%	2	6
VNC	RW 13-31	RUNWAY 13-31	RUNWAY	6120	20,000	APC	61	Fair	100%	0%	0%	1	4
VNC	RW 13-31	RUNWAY 13-31	RUNWAY	6125	30,000	APC	68	Fair	100%	0%	0%	2	6
VNC	RW 13-31	RUNWAY 13-31	RUNWAY	6130	20,000	APC	63	Fair	100%	0%	0%	1	4
VNC	RW 13-31	RUNWAY 13-31	RUNWAY	6135	26,100	AAC	93	Good	100%	0%	0%	2	6
VNC	RW 13-31	RUNWAY 13-31	RUNWAY	6140	13,050	AAC	90	Good	100%	0%	0%	1	4
VNC	RW 13-31	RUNWAY 13-31	RUNWAY	6145	64,500	AC	100	Good	0%	0%	0%	0	13
VNC	RW 13-31	RUNWAY 13-31	RUNWAY	6150	32,250	AC	100	Good	0%	0%	0%	0	6
VNC	RW 5-23	RUNWAY 5-23	RUNWAY	6205	255,000	AC	90	Good	100%	0%	0%	8	44
VNC	RW 5-23	RUNWAY 5-23	RUNWAY	6210	350,820	AAC	94	Good	100%	0%	0%	15	74
VNC	RW 5-23	RUNWAY 5-23	RUNWAY	6215	18,000	AC	94	Good	100%	0%	0%	1	3
VNC	RW 5-23	RUNWAY 5-23	RUNWAY	6220	27,000	AC	92	Good	100%	0%	0%	2	6
VNC	RW 5-23	RUNWAY 5-23	RUNWAY	6225	18,000	AC	94	Good	100%	0%	0%	1	3
VNC	RW 5-23	RUNWAY 5-23	RUNWAY	6230	27,000	AC	94	Good	100%	0%	0%	2	6
VNC	RW 5-23	RUNWAY 5-23	RUNWAY	6240	13,680	AC	86	Good	100%	0%	0%	1	4
VNC	RW 5-23	RUNWAY 5-23	RUNWAY	6250	18,000	AC	94	Good	100%	0%	0%	1	4
VNC	T-HANG	GA T-HANGARS	TAXIWAY	605	17,687	AC	69	Fair	100%	0%	0%	1	4
VNC	T-HANG	GA T-HANGARS	TAXIWAY	610	42,593	AC	66	Fair	91%	0%	9%	1	9
VNC	T-HANG	GA T-HANGARS	TAXIWAY	620	103,188	AC	54	Poor	94%	0%	6%	3	21
VNC	T-HANG	GA T-HANGARS	TAXIWAY	705	36,074	AC	79	Satisfactory	100%	0%	0%	1	8
VNC	T-HANG	GA T-HANGARS	TAXIWAY	708	11,509	AC	68	Fair	100%	0%	0%	1	3




Network ID	Branch ID	Branch Name	Branch Use	Section ID	Area (SF)	Surface	PCI	PCI Rating	PCI % Climate	PCI % Load	PCI % Other	Sample Units Inspected	Total Sample Units in Section
VNC	T-HANG	GA T-HANGARS	TAXIWAY	710	42,414	AC	49	Poor	100%	0%	0%	2	11
VNC	T-HANG	GA T-HANGARS	TAXIWAY	715	12,818	AC	92	Good	100%	0%	0%	1	4
VNC	T-HANG	GA T-HANGARS	TAXIWAY	720	5,418	AC	92	Good	100%	0%	0%	1	1
VNC	T-HANG	GA T-HANGARS	TAXIWAY	725	17,455	AC	94	Good	100%	0%	0%	1	5
VNC	T-HANG	GA T-HANGARS	TAXIWAY	730	18,001	AAC	59	Fair	100%	0%	0%	1	5
VNC	T-HANG	GA T-HANGARS	TAXIWAY	735	21,879	AC	100	Good	0%	0%	0%	0	6
VNC	TW A	TAXIWAY A	TAXIWAY	105	55,145	AC	94	Good	100%	0%	0%	2	14
VNC	TW A	TAXIWAY A	TAXIWAY	110	53,584	AC	89	Good	100%	0%	0%	3	15
VNC	TW A	TAXIWAY A	TAXIWAY	115	52,281	AC	92	Good	100%	0%	0%	3	12
VNC	TW A	TAXIWAY A	TAXIWAY	120	9,988	AC	90	Good	100%	0%	0%	1	2
VNC	TW A	TAXIWAY A	TAXIWAY	125	5,738	AAC	66	Fair	88%	0%	12%	1	1
VNC	TW B	TAXIWAY B	TAXIWAY	220	30,324	AC	100	Good	0%	0%	0%	0	8
VNC	TW B	TAXIWAY B	TAXIWAY	225	12,448	AC	91	Good	100%	0%	0%	1	3
VNC	TW B	TAXIWAY B	TAXIWAY	230	17,274	AC	100	Good	0%	0%	0%	0	4
VNC	TW B	TAXIWAY B	TAXIWAY	235	23,085	AC	100	Good	0%	0%	0%	0	4
VNC	TW C	TAXIWAY C	TAXIWAY	315	84,284	AC	94	Good	100%	0%	0%	3	21
VNC	TW D	TAXIWAY D	TAXIWAY	400	39,559	AC	100	Good	0%	0%	0%	0	8
VNC	TW D	TAXIWAY D	TAXIWAY	405	76,074	AC	100	Good	0%	0%	0%	0	19
VNC	TW D	TAXIWAY D	TAXIWAY	410	18,193	AC	94	Good	100%	0%	0%	1	4
VNC	TW E	TAXIWAY E	TAXIWAY	505	62,102	AC	94	Good	100%	0%	0%	4	17
VNC	TW E	TAXIWAY E	TAXIWAY	510	10,168	AC	92	Good	100%	0%	0%	2	2
VNC	TW E	TAXIWAY E	TAXIWAY	515	22,576	AC	94	Good	100%	0%	0%	1	5
VNC	TW E	TAXIWAY E	TAXIWAY	550	9,260	AC	94	Good	100%	0%	0%	1	2
VNC	TW F	TAXIWAY F	TAXIWAY	450	11,590	AC	100	Good	0%	0%	0%	0	3



Figure 4.1.3 is an inset view of the 2019 Airfield Pavement Condition Index Exhibit that visually represents the results of the latest PCI Survey inspection. A large format exhibit is located in **Appendix C Technical Exhibits**.

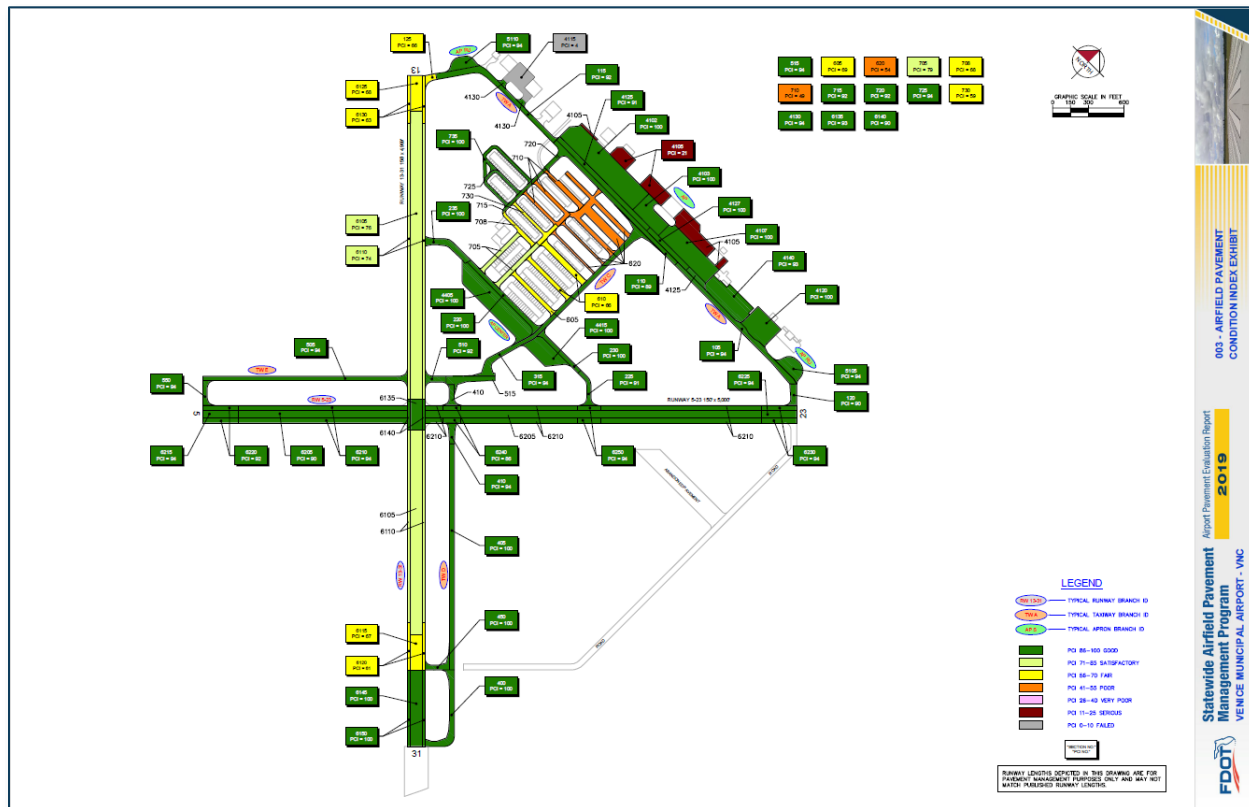Figure 4.1.3 2019 Airfield Pavement Condition Index Exhibit





4.2 Summary of Pavement Condition Evaluation Results

4.2.1 Network-Level Observations

The field PCI Survey performed at Venice Municipal Airport (VNC) was completed in November 2018. The resulting overall area-weighted average PCI value was 84 representing a condition rating of Satisfactory. Venice Municipal Airport is serviced by two runways; Runway 5-23 is 150-ft wide and 5,000-ft long and Runway 13-31 is 150-ft wide and 4,999-ft long. Due to recent construction, portions of Taxiway D, Runway 13-31, Center Apron, and the main apron were not inspected. The PCI has been set to 100, a condition rating of Good.

Based on the FAA 5010 Report as of 09/12/2019 the Airport has reported 60,834 operations for 12 months ending 10/12/2018.

4.2.2 Branch-Level Observations

The following branch-level observations are intended to be an overall summary of select pavement facilities identified during the PCI Survey; further detail at the section and sample-level may be referenced for all pavements assessed as part of this System Update. The branch-level observations discussed are limited to select branches based on use and condition.

Runway 13-31

Runway 13-31 consists of 10 sections constructed of AC, AAC, and APC. The last construction years range from 2006 to 2017. The area-weighted average PCI for Runway 13-31 is 77 representing a Satisfactory condition rating. The pavement distresses observed were related to Climate and Other distress classifications. Distresses observed on Runway 13-31 consist of Depression, Joint Reflection Cracking, Longitudinal & Transverse Cracking, Raveling, Swelling, and Weathering.

Runway 5-23

Runway 5-23 consists of 8 sections constructed of AC and AAC. The last construction year for Runway 5-23 was 2013. The area-weighted average PCI for Runway 5-23 is 92 representing a Good condition rating. The pavement distresses observed were related to Climate distress classifications. Distresses observed on Runway 5-23 consist of Longitudinal & Transverse Cracking, Patching, Raveling, and Weathering.

Taxiway A

Taxiway A consists of 5 sections constructed of AC and AAC. The last construction years range from 2006 to 2015. The area-weighted average PCI for Taxiway A is 90 representing a Good condition rating. The pavement distresses observed were related to Climate and Other distress classifications. Distresses observed on Taxiway A consist of Longitudinal & Transverse Cracking, Raveling, Swelling, and Weathering.

GA T-Hangars

Ga T-Hangars consists of 11 sections constructed of AC and AAC. The last construction years range from 1994 to 2018. The area-weighted average PCI for Ga T-Hangars is 66 representing a Fair condition rating. The pavement distresses observed were related to Climate and Other



distress classifications. Distresses observed on Ga T-Hangars consist of Block Cracking, Depression, Longitudinal & Transverse Cracking, Oil Spillage, Patching, Raveling, Weathering,

Apron

Apron consists of 10 sections constructed of AC, AAC, and PCC. The last construction years range from 1942 to 2018. The area-weighted average PCI for Apron is 79 representing a Satisfactory condition rating. The pavement distresses observed were related to Climate, Load, and Other distress classifications. Distresses observed on Apron consist of Longitudinal & Transverse Cracking, Weathering, Corner Break, Linear Cracking, Joint Seal Damage, Small Patch, Large Patch/Utility Cut, Faulting, Shattered Slab, Shrinkage Cracking, Joint Spall, and Corner Spall. Although a majority of the Apron was recently rehabbed, there are still areas north of the recent work that are contributing to lower PCI values.

Figure 4.2.2 Pavement Condition Summary by Facility Use

Facility Use	Area-Weighted Average PCI	Condition Rating
Runway	84	Satisfactory
Taxiway	84	Satisfactory
Apron	84	Satisfactory



4.3 Forecasted Pavement Conditions

4.3.1 Performance Models and Prediction Curves

Pavement Performance Models are developed from the distress data and historic construction records collected for the SAPMP. This data is consolidated in a database and organized by inspection/construction date, pavement type, age, and pavement use. The pavement Performance Models are used to develop broad Prediction Curves, alternatively known as deterioration curves or family curves. These Prediction Curves are utilized to develop forecasted PCI values based on historic trends and statistical models.

4.3.2 Branch-Level Pavement Condition Forecast

The following **Figures 4.3.2 (a) through (c)** depict the branch-level pavement condition forecast by Branch Use (Runway, Taxiway, and/or Apron). The forecasted conditions are for a 10-year duration starting in January 2020 through January 2029.

Figure 4.3.2 (a) Forecasted Runway Pavement Performance






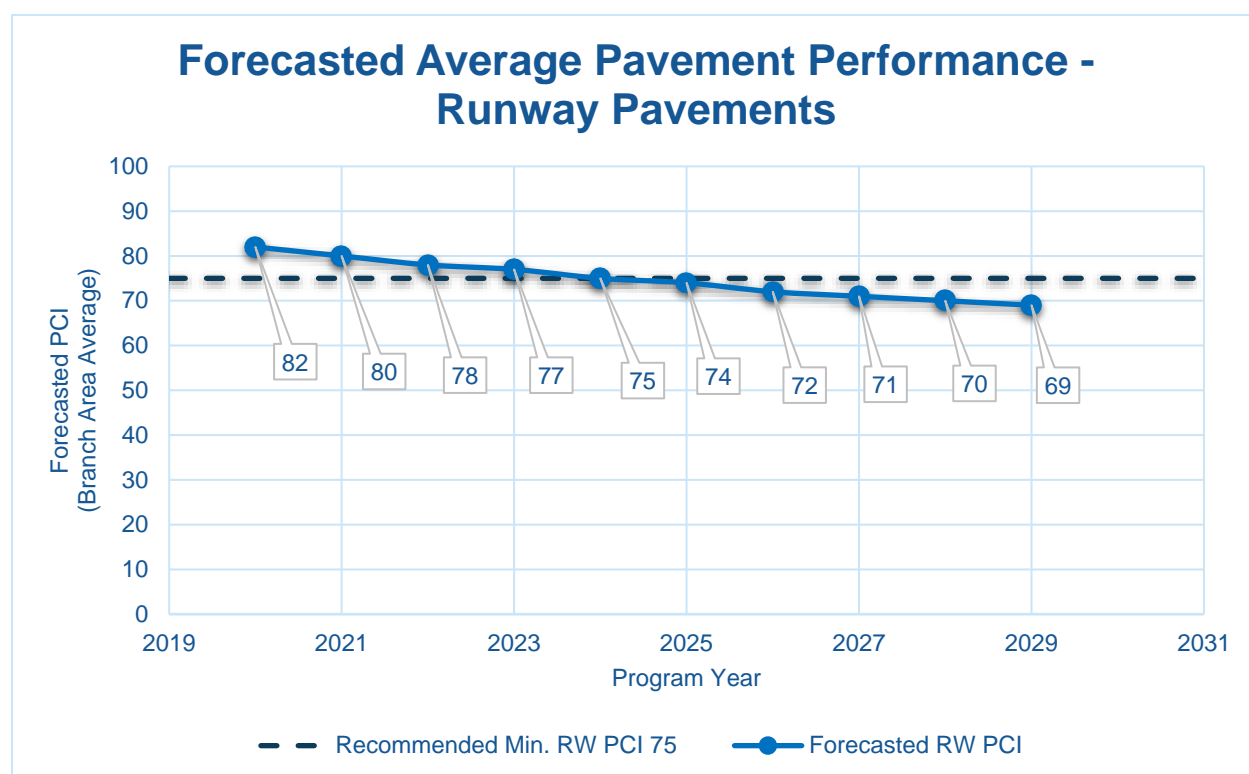Figure 4.3.2 (b) Forecasted Taxiway Pavement Performance


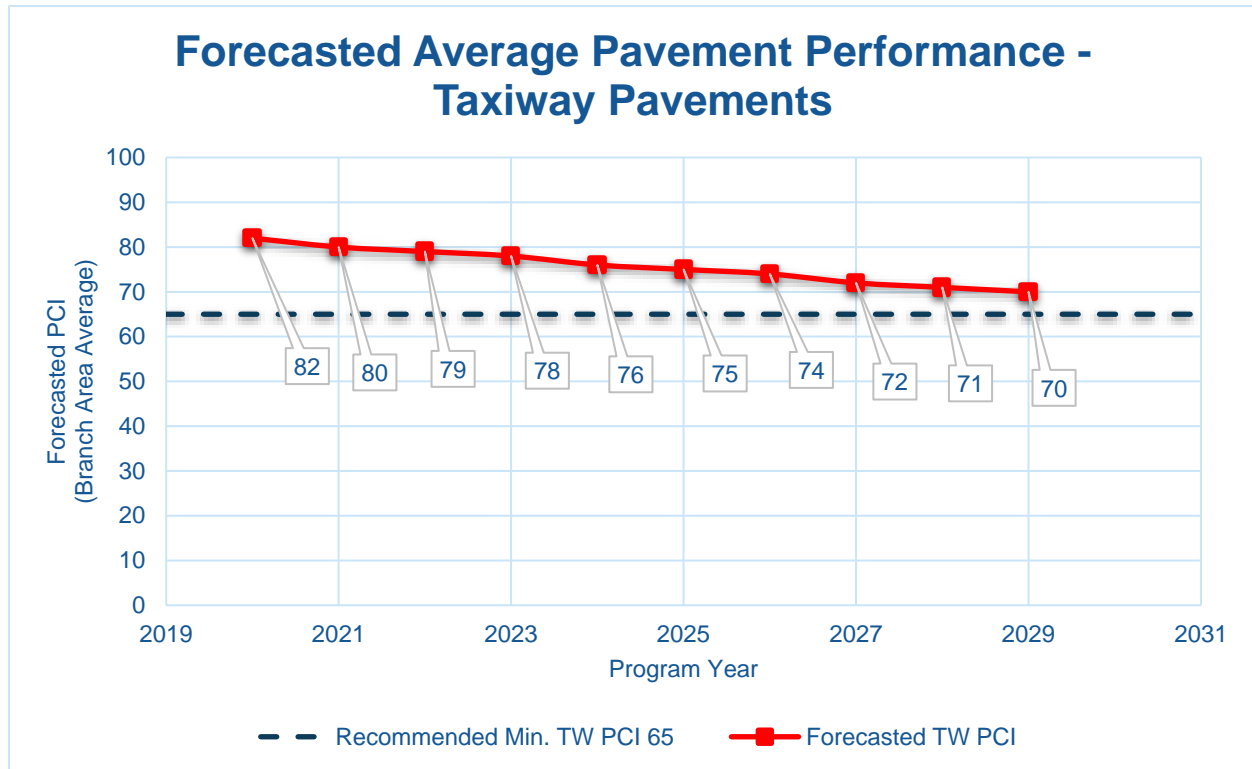


Figure 4.3.2 (c) Forecasted Apron Pavement Performance

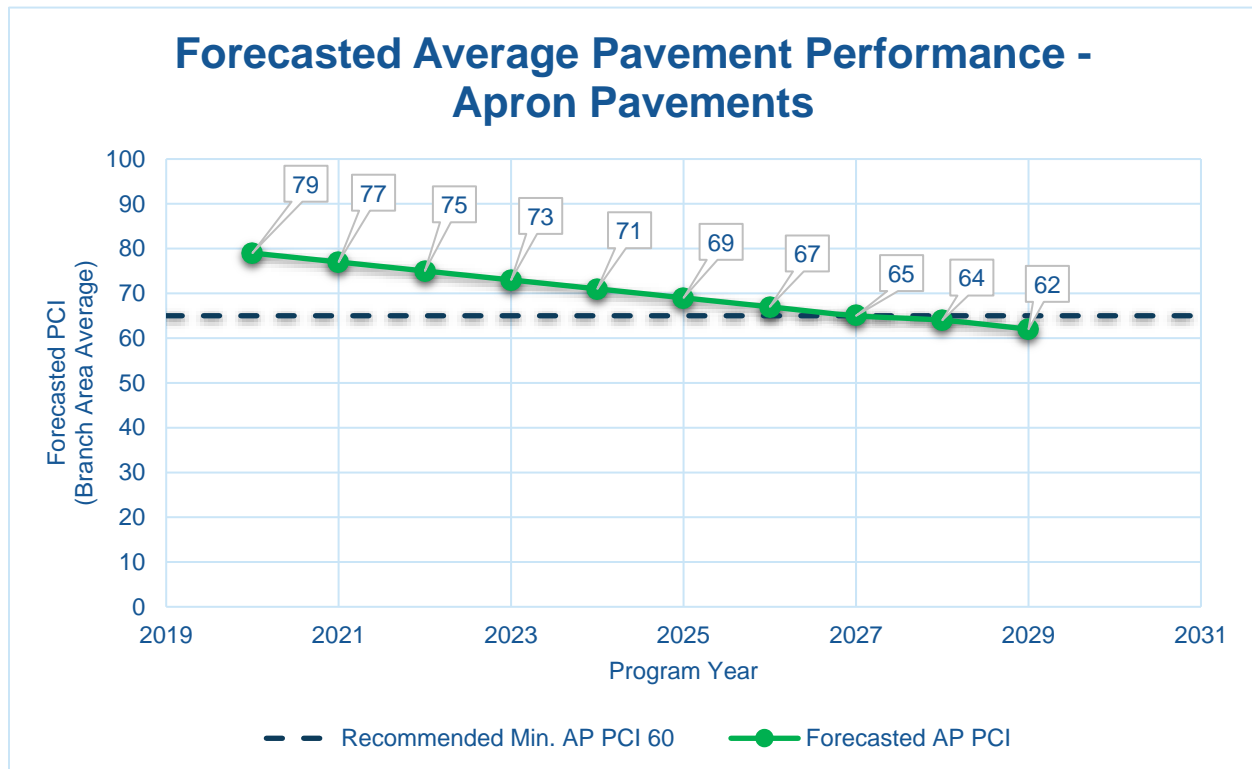



4.3.3 Section-Level Pavement Condition Forecast

The following **Table 4.3.3** provides detail to the forecasted PCI values for each section inspected. Please note the forecasted Branch- and Section-Level PCI's are for planning purposes and are subject to the sensitivities in changes in traffic and maintenance frequency. Airport staff should perform annual visual condition assessments to maintain recent understanding of pavement conditions.



Table 4.3.3 Forecasted PCI 2020-2029

Network ID	Branch ID	Section ID	Last PCI	Forecasted PCI									
				2020	2021	2022	2023	2024	2025	2026	2027	2028	2029
VNC	AP	4102	100	95	93	90	88	86	84	81	79	77	75
VNC	AP	4103	100	93	90	88	86	84	81	79	77	75	74
VNC	AP	4105	21	19	18	16	15	14	13	11	10	9	8
VNC	AP	4107	100	93	90	88	86	84	81	79	77	75	74
VNC	AP	4115	4	2	1	0	0	0	0	0	0	0	0
VNC	AP	4120	100	95	93	90	88	86	84	81	79	77	75
VNC	AP	4125	91	88	86	83	81	79	77	75	73	72	70
VNC	AP	4127	100	93	91	89	86	84	82	80	78	76	73
VNC	AP	4130	94	91	88	86	84	82	80	78	76	74	72
VNC	AP	4140	93	90	87	85	83	81	79	77	75	73	71
VNC	AP CENTER	4405	100	93	90	88	86	84	81	79	77	75	74
VNC	AP CENTER	4415	100	93	90	88	86	84	81	79	77	75	74
VNC	AP RU	5105	94	91	88	86	84	82	80	78	76	74	72
VNC	AP RU	5110	94	91	88	86	84	82	80	78	76	74	72
VNC	RW 13-31	6105	76	74	73	71	70	69	68	67	66	65	65
VNC	RW 13-31	6110	74	72	71	70	69	68	67	66	65	64	63
VNC	RW 13-31	6115	67	65	65	64	63	62	62	61	60	60	59
VNC	RW 13-31	6120	61	60	59	58	58	57	56	56	55	54	53
VNC	RW 13-31	6125	68	66	66	65	64	63	62	62	61	60	60
VNC	RW 13-31	6130	63	62	61	60	60	59	58	58	57	56	56
VNC	RW 13-31	6135	93	90	87	85	83	82	80	78	77	75	74
VNC	RW 13-31	6140	90	87	85	83	81	79	78	76	75	73	72
VNC	RW 13-31	6145	100	94	92	90	87	85	83	81	79	78	76
VNC	RW 13-31	6150	100	94	92	90	87	85	83	81	79	78	76
VNC	RW 5-23	6205	90	87	85	83	81	79	77	76	74	73	72



Network ID	Branch ID	Section ID	Last PCI	Forecasted PCI									
				2020	2021	2022	2023	2024	2025	2026	2027	2028	2029
VNC	RW 5-23	6210	94	91	88	86	84	82	81	79	77	76	74
VNC	RW 5-23	6215	94	91	89	86	84	82	80	78	77	75	74
VNC	RW 5-23	6220	92	89	87	84	82	80	79	77	75	74	73
VNC	RW 5-23	6225	94	91	89	86	84	82	80	78	77	75	74
VNC	RW 5-23	6230	94	91	89	86	84	82	80	78	77	75	74
VNC	RW 5-23	6240	86	83	81	79	77	76	74	73	72	71	70
VNC	RW 5-23	6250	94	91	89	86	84	82	80	78	77	75	74
VNC	T-HANG	605	69	67	66	65	63	62	61	60	59	58	57
VNC	T-HANG	610	66	64	63	62	61	60	58	57	56	55	54
VNC	T-HANG	620	54	52	51	51	50	49	48	47	46	46	45
VNC	T-HANG	705	79	77	75	74	73	71	70	69	67	66	65
VNC	T-HANG	708	68	66	65	64	62	61	60	59	58	57	56
VNC	T-HANG	710	49	48	47	46	45	44	44	43	42	42	41
VNC	T-HANG	715	92	90	88	86	85	83	82	80	79	77	76
VNC	T-HANG	720	92	90	88	86	85	83	82	80	79	77	76
VNC	T-HANG	725	94	92	90	88	87	85	84	82	81	79	78
VNC	T-HANG	730	59	58	57	56	55	54	53	52	51	50	49
VNC	T-HANG	735	100	96	94	93	91	89	88	86	85	83	82
VNC	TW A	105	94	92	90	88	87	85	84	82	81	79	78
VNC	TW A	110	89	87	85	84	82	81	79	78	76	75	73
VNC	TW A	115	92	90	88	86	85	83	82	80	79	77	76
VNC	TW A	120	90	88	86	85	83	81	80	79	77	76	74
VNC	TW A	125	66	64	64	63	62	61	60	59	59	58	57
VNC	TW B	220	100	94	93	91	89	88	86	85	83	82	80
VNC	TW B	225	91	89	87	85	84	82	81	79	78	77	75
VNC	TW B	230	100	94	93	91	89	88	86	85	83	82	80
VNC	TW B	235	100	95	93	92	90	88	87	85	84	82	81




Network ID	Branch ID	Section ID	Last PCI	Forecasted PCI									
				2020	2021	2022	2023	2024	2025	2026	2027	2028	2029
VNC	TW C	315	94	92	90	88	87	85	84	82	81	79	78
VNC	TW D	400	100	95	93	92	90	88	87	85	84	82	81
VNC	TW D	405	100	95	93	92	90	88	87	85	84	82	81
VNC	TW D	410	94	92	90	88	87	85	84	82	81	79	78
VNC	TW E	505	94	92	90	88	87	85	84	82	81	79	78
VNC	TW E	510	92	90	88	86	85	83	82	80	79	77	76
VNC	TW E	515	94	92	90	88	87	85	84	82	81	79	78
VNC	TW E	550	94	92	90	88	87	85	84	82	81	79	78
VNC	TW F	450	100	95	93	92	90	88	87	85	84	82	81



4.3.4 Forecasted PCI Considerations

As FDOT continues to update the SAPMP with future PCI Survey inspections and assembly of airfield pavement construction work history, the performance models will be further refined. With the refinement of additional PCI and work history data points, the forecasting of pavement conditions will continue to better reflect the performance trends of airfield pavements in the Florida Airports System. Forecasted or predicted pavement conditions for the airport are intended for planning purposes only. Design-level recommendations for pavement rehabilitation and/or reconstruction will require the appropriate application of the procedures defined in FAA **AC 150/5320-6F Airport Pavement Design and Evaluation** and **AC 150/5370-11B Use of Nondestructive Testing in the Evaluation of Airport Pavements** to determine structural and/or functional conditions at the time of project.

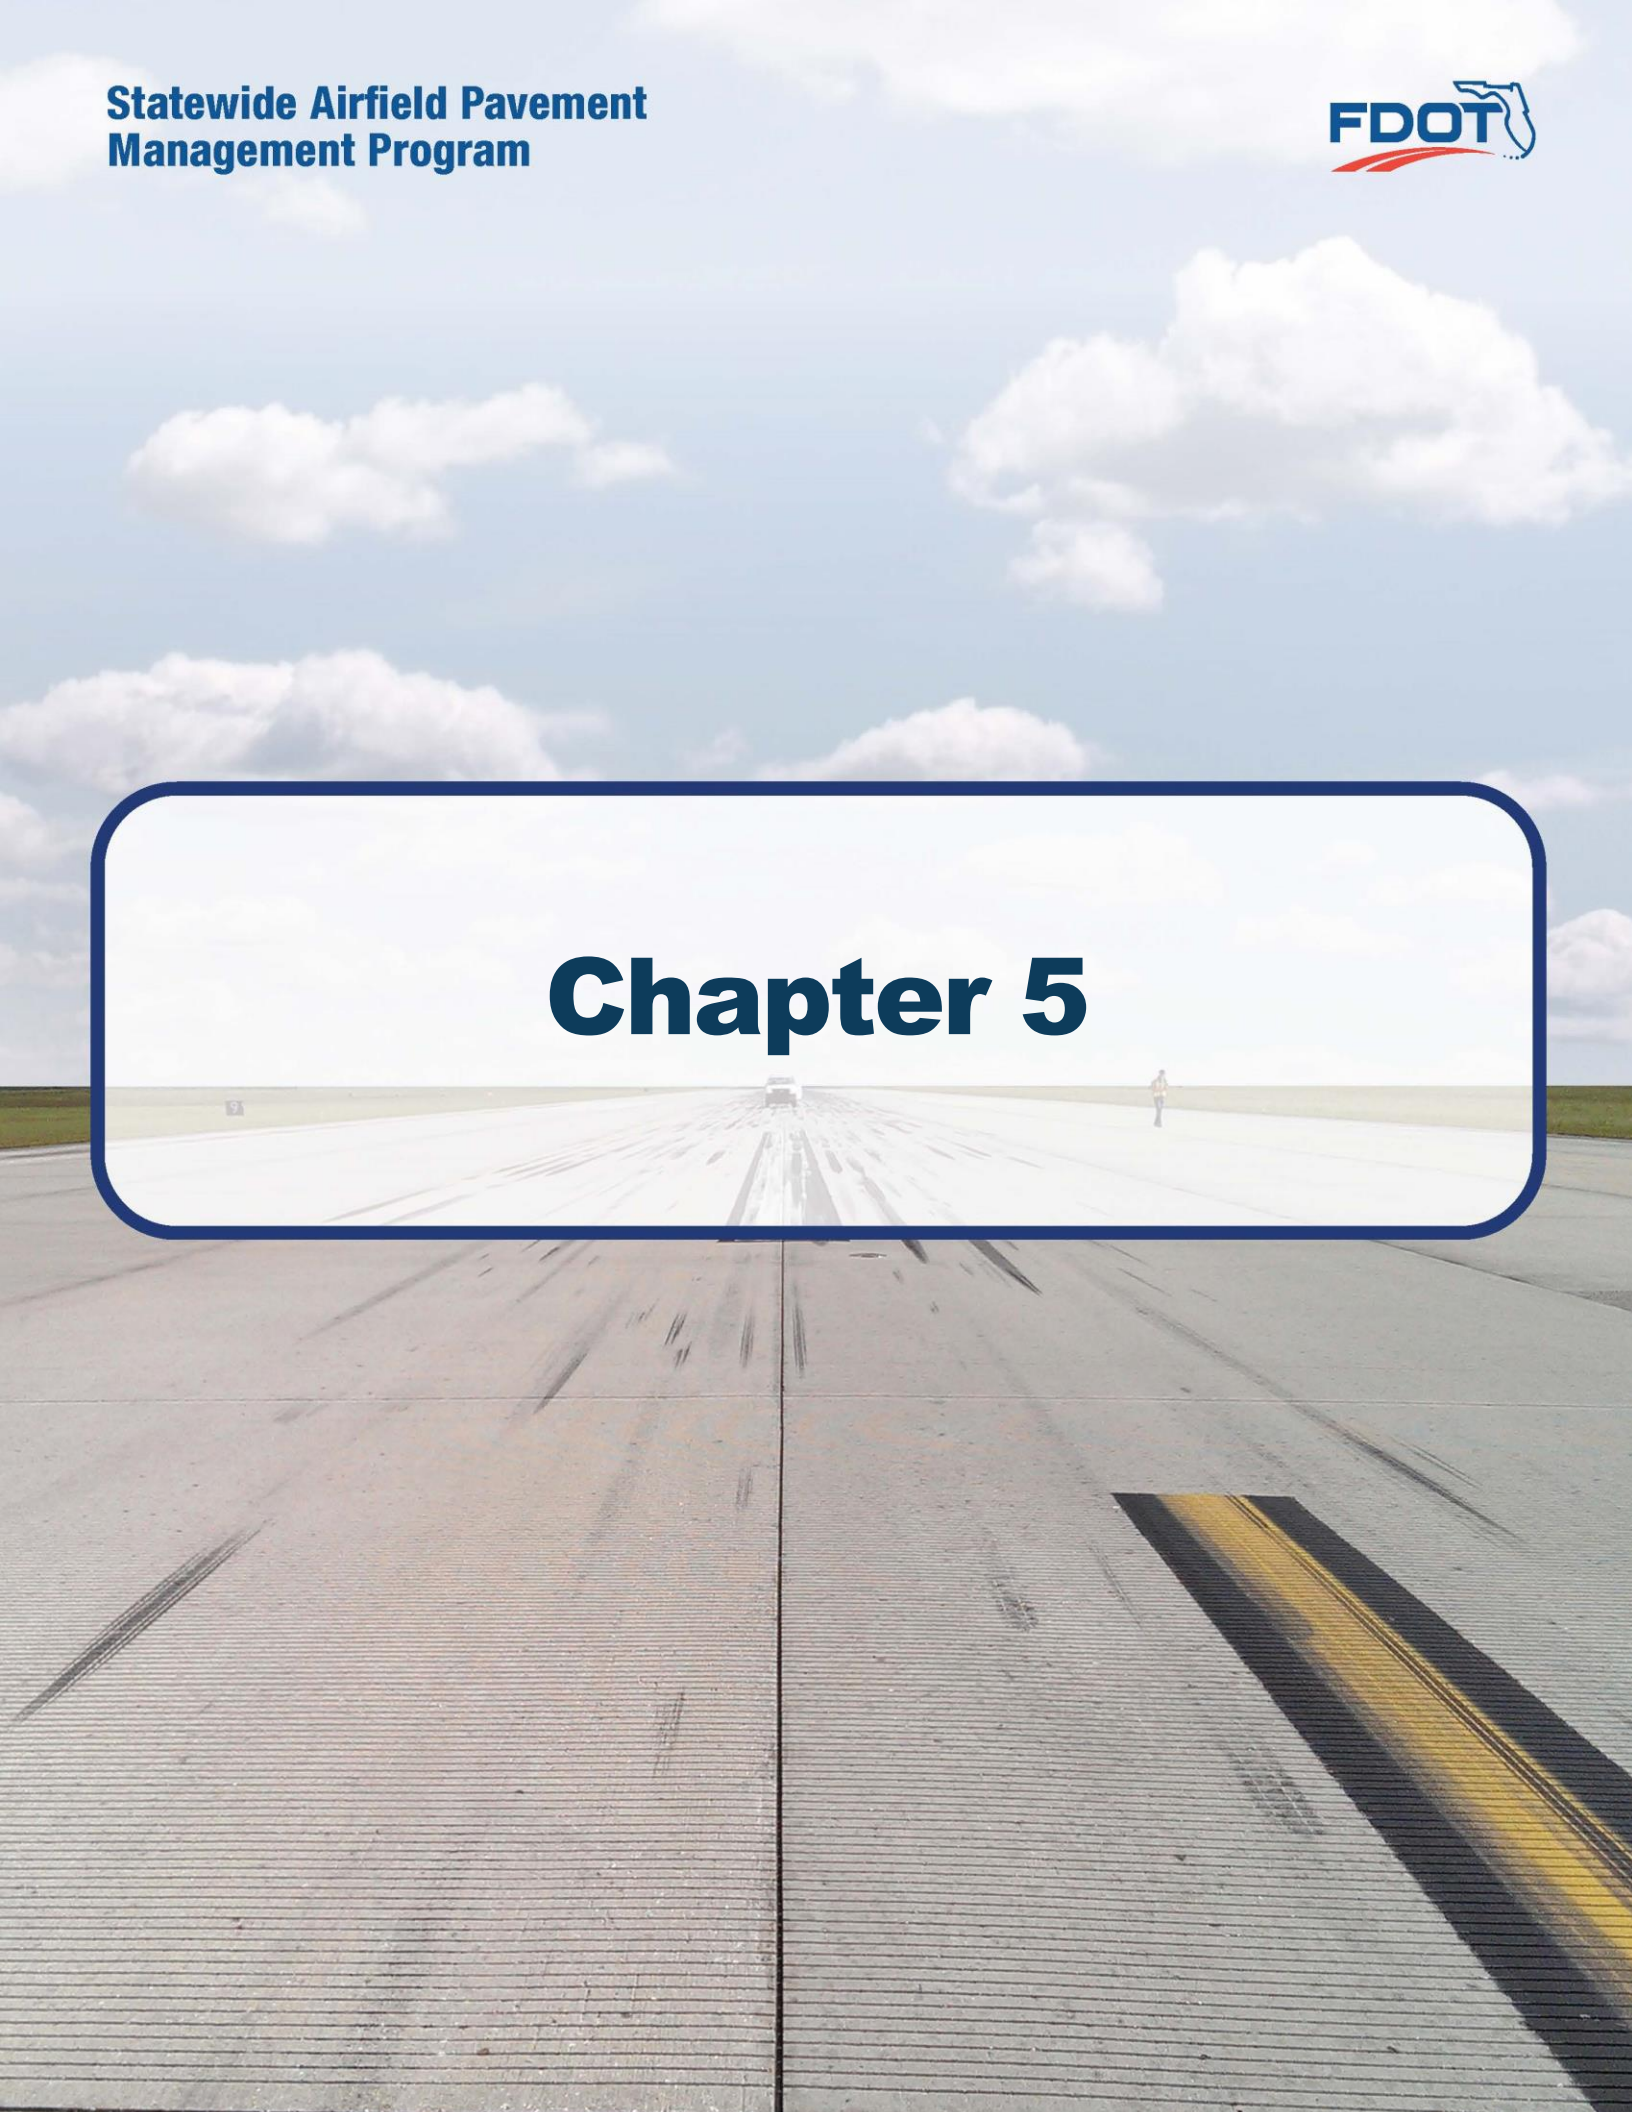Chapter 5





Chapter 5 – Localized Maintenance and Repair Planning

General Maintenance and Rehabilitation (M&R) methods are characterized under three broad categories: localized maintenance and repair, global treatments, and major rehabilitation.

- **Localized Maintenance and Repair** includes patching and crack sealing.
- **Global Treatments** include surface seals and rejuvenators for flexible pavements.
- **Major Rehabilitation** includes overlays, significant slab replacement, and reconstruction.

This chapter discusses the FDOT SAPMP Localized Maintenance and Repair Planning approach. Proactive localized maintenance and repair, specifically preservation, is highly recommended to the airports. However, it is certainly recognized that once pavements have deteriorated below a certain condition, the facility would benefit from a more substantial rehabilitation in lieu of localized efforts. Chapter 6 Major Rehabilitation Planning discusses the addressing of pavements through timely rehabilitation once it has deteriorated below a critical PCI where localized repairs may not be as cost effective.

5.1 Localized Maintenance and Repair

Localized maintenance and repair is best applied as a conservation measure and is oftentimes applied to slow the rate of deterioration of distressed pavements; however, may be applied as a temporary corrective measure in isolated areas. Localized maintenance and repair can be applied either as a safety (“stopgap”) measure or preventive measure. Example distress types subject to localized preventive maintenance and repair may consist of low-severity longitudinal and transverse cracking and low-severity weathering. In many cases however, localized stopgap repair is applied as a safety measure to address high-severity distress manifestations when major rehabilitation is not funded for a given section with a PCI value below critical PCI. Some agencies may elect to define both types; preventative and stopgap, as localized maintenance.

Localized Stopgap/Safety Maintenance and Repair

Localized Stopgap or Safety Maintenance and Repair is defined as the localized distress repair needed to keep pavements operational in a safe condition. These activities are typically applied to high-severity distresses or distresses affecting operational activities. Typical pavement section PCIs will range from 0 to 65.

Localized Preventive Maintenance and Repair

Localized Preventive Maintenance and Repair is defined as distress maintenance activities performed with the primary objective of slowing the rate of deterioration. These activities typically include crack sealing and patching. Typical pavement section PCIs will be above 65.



5.2 Localized Maintenance and Repair Policy

The resulting Localized Maintenance and Repair recommendations are identified based on the policy defined in **Table 5.2 (a)** and **Table 5.2 (b)**, for flexible asphalt concrete and rigid Portland cement concrete pavements, respectively. The activities identified were based on the research of practical pavement treatments in consideration of the FAA **AC 150/5380-6C “Guidelines and Procedures for Maintenance of Airport Pavements”** and the **FDOT Airfield Pavement Distress Repair Manual**. Additionally, the **Engineering Technical Letter (ETL) 14-3: Preventive Maintenance Plan (PMP) for Airfield Pavements** was referenced for conservative application of pavement treatments. The Localized Maintenance and Repair Policy and associated planning-level unit costs were developed in consideration of a network-level analysis – it is strictly intended to provide a glimpse of the condition of the airport pavements with a limited PCI survey effort.

The developed Localized Maintenance and Repair Policy and associated planning-level unit costs were based on a statewide consideration of pavement treatments and review of state construction costs for both Airfield Pavements and from the FDOT Historical Cost Information archives. Furthermore, a consideration of limited repair quantities was factored in the determination of conservative planning-level unit costs. The identified Localized maintenance activities for both preventive and stopgap activities are based on a statewide network approach; project-specific evaluation and maintenance quantities should be developed prior to any construction.

Table 5.2 (a) Localized Maintenance and Repair – Flexible Asphalt Concrete

Distress	Severity	Description	Code	Work Type	Work Unit
41	Low	ALLIGATOR CR	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
41	Medium	ALLIGATOR CR	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
41	High	ALLIGATOR CR	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
42	N/A	BLEEDING	FDOT-MO-PV	FDOT - MONITOR	N/A
43	Low	BLOCK CR	FDOT-MO-PV	FDOT - MONITOR	N/A
43	Medium	BLOCK CR	FDOT-CS-AC	FDOT - CRACK SEALING - AC	Ft
43	High	BLOCK CR	FDOT-PA-AP	FDOT - PATCHING - AC PARTIAL DEPTH	SqFt
44	Low	CORRUGATION	FDOT-ML-AC	FDOT - MILLING - AC	SqFt
44	Medium	CORRUGATION	FDOT-ML-AC	FDOT - MILLING - AC	SqFt
44	High	CORRUGATION	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
45	Low	DEPRESSION	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
45	Medium	DEPRESSION	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
45	High	DEPRESSION	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
46	N/A	JET BLAST	FDOT-PA-AP	FDOT - PATCHING - AC PARTIAL DEPTH	SqFt
47	Low	JT REF. CR	FDOT-MO-PV	FDOT - MONITOR	N/A
47	Medium	JT REF. CR	FDOT-CS-AC	FDOT - CRACK SEALING - AC	Ft
47	High	JT REF. CR	FDOT-CS-AC	FDOT - CRACK SEALING - AC	Ft



Distress	Severity	Description	Code	Work Type	Work Unit
48	Low	L & T CR	FDOT-MO-PV	FDOT - MONITOR	N/A
48	Medium	L & T CR	FDOT-CS-AC	FDOT - CRACK SEALING - AC	Ft
48	High	L & T CR	FDOT-CS-AC	FDOT - CRACK SEALING - AC	Ft
49	N/A	OIL SPILLAGE	FDOT-PA-AP	FDOT - PATCHING - AC PARTIAL DEPTH	SqFt
50	Low	PATCHING	FDOT-MO-PV	FDOT - MONITOR	N/A
50	Medium	PATCHING	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
50	High	PATCHING	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
51	N/A	POLISHED AG	FDOT-SS-LO	FDOT - SURFACE SEAL	SqFt
52	Low	RAVELING	FDOT-SS-LO	FDOT - SURFACE SEAL	SqFt
52	Medium	RAVELING	FDOT-PA-AP	FDOT - PATCHING - AC PARTIAL DEPTH	SqFt
52	High	RAVELING	FDOT-PA-AP	FDOT - PATCHING - AC PARTIAL DEPTH	SqFt
53	Low	RUTTING	FDOT-MO-PV	FDOT - MONITOR	N/A
53	Medium	RUTTING	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
53	High	RUTTING	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
54	Low	SHOVING	FDOT-MO-PV	FDOT - MONITOR	N/A
54	Medium	SHOVING	FDOT-ML-AC	FDOT - MILLING - AC	SqFt
54	High	SHOVING	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
55	N/A	SLIPPAGE CR	FDOT-PA-AP	FDOT - PATCHING - AC PARTIAL DEPTH	SqFt
56	Low	SWELLING	FDOT-MO-PV	FDOT - MONITOR	N/A
56	Medium	SWELLING	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
56	High	SWELLING	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
57	Low	WEATHERING	FDOT-MO-PV	FDOT - MONITOR	N/A
57	Medium	WEATHERING	FDOT-SS-LO	FDOT - SURFACE SEAL	SqFt
57	High	WEATHERING	FDOT-PA-AP	FDOT - PATCHING - AC PARTIAL DEPTH	SqFt

Table 5.2 (b) Localized Maintenance and Repair – Rigid Portland Cement Concrete

Distress	Severity	Description	Code	Work Type	Work Unit
61	Low	BLOW-UP	FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	SqFt
61	Medium	BLOW-UP	FDOT-PA-PF	FDOT - PATCHING - PCC FULL DEPTH	SqFt
61	High	BLOW-UP	FDOT-SL-PC	FDOT - SLAB REPLACEMENT - PCC	SqFt
62	Low	CORNER BREAK	FDOT-CS-PC	FDOT - CRACK SEALING - PCC	Ft
62	Medium	CORNER BREAK	FDOT-PA-PF	FDOT - PATCHING - PCC FULL DEPTH	SqFt
62	High	CORNER BREAK	FDOT-PA-PF	FDOT - PATCHING - PCC FULL DEPTH	SqFt
63	Low	LINEAR CR	FDOT-MO-PV	FDOT - MONITOR	N/A
63	Medium	LINEAR CR	FDOT-CS-PC	FDOT - CRACK SEALING - PCC	Ft
63	High	LINEAR CR	FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	SqFt



Distress	Severity	Description	Code	Work Type	Work Unit
64	Low	DURABIL. CR	FDOT-MO-PV	FDOT - MONITOR	N/A
64	Medium	DURABIL. CR	FDOT-PA-PF	FDOT - PATCHING - PCC FULL DEPTH	SqFt
64	High	DURABIL. CR	FDOT-SL-PC	FDOT - SLAB REPLACEMENT - PCC	SqFt
65	Low	JT SEAL DMG	FDOT-JS-PC	FDOT - JOINT SEAL - PCC	Ft
65	Medium	JT SEAL DMG	FDOT-JS-PC	FDOT - JOINT SEAL - PCC	Ft
65	High	JT SEAL DMG	FDOT-JS-PC	FDOT - JOINT SEAL - PCC	Ft
66	Low	SMALL PATCH	FDOT-MO-PV	FDOT - MONITOR	N/A
66	Medium	SMALL PATCH	FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	SqFt
66	High	SMALL PATCH	FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	SqFt
67	Low	LARGE PATCH	FDOT-MO-PV	FDOT - MONITOR	N/A
67	Medium	LARGE PATCH	FDOT-PA-PF	FDOT - PATCHING - PCC FULL DEPTH	SqFt
67	High	LARGE PATCH	FDOT-PA-PF	FDOT - PATCHING - PCC FULL DEPTH	SqFt
68	N/A	POPOUTS	FDOT-PO-FL	FDOT - POPOUT FILLER	SqFt
69	N/A	PUMPING	FDOT-SB-PC	FDOT - SLAB STABILIZATION - PCC	SqFt
70	Low	SCALING	FDOT-MO-PV	FDOT - MONITOR	N/A
70	Medium	SCALING	FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	SqFt
70	High	SCALING	FDOT-SL-PC	FDOT - SLAB REPLACEMENT - PCC	SqFt
71	Low	FAULTING	FDOT-MO-PV	FDOT - MONITOR	N/A
71	Medium	FAULTING	FDOT-GR-PP	FDOT - GRINDING (LOCALIZED)	Ft
71	High	FAULTING	FDOT-GR-PP	FDOT - GRINDING (LOCALIZED)	Ft
72	Low	SHAT. SLAB	FDOT-CS-PC	FDOT - CRACK SEALING - PCC	Ft
72	Medium	SHAT. SLAB	FDOT-SL-PC	FDOT - SLAB REPLACEMENT - PCC	SqFt
72	High	SHAT. SLAB	FDOT-SL-PC	FDOT - SLAB REPLACEMENT - PCC	SqFt
73	N/A	SHRINKAGE CR	FDOT-MO-PV	FDOT - MONITOR	N/A
74	Low	JOINT SPALL	FDOT-CS-PC	FDOT - CRACK SEALING - PCC	Ft
74	Medium	JOINT SPALL	FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	SqFt
74	High	JOINT SPALL	FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	SqFt
75	Low	CORNER SPALL	FDOT-CS-PC	FDOT - CRACK SEALING - PCC	Ft
75	Medium	CORNER SPALL	FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	SqFt
75	High	CORNER SPALL	FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	SqFt
76	Low	ASR	FDOT-MO-PV	FDOT - MONITOR	N/A
76	Medium	ASR	FDOT-PA-PF	FDOT - PATCHING - PCC FULL DEPTH	SqFt
76	High	ASR	FDOT-SL-PC	FDOT - SLAB REPLACEMENT - PCC	SqFt



Table 5.2 (c) Localized Repair Planning-Level Unit Costs – Flexible Asphalt Concrete

Code	Name	Cost	Units
FDOT-SS-LO	FDOT - SURFACE SEAL	\$0.55	SqFt
FDOT-ML-AC	FDOT - MILLING - AC	\$2.00	SqFt
FDOT-GR-PP	FDOT - GRINDING (LOCALIZED)	\$2.00	Ft
FDOT-CS-AC	FDOT - CRACK SEALING - AC	\$3.00	Ft
FDOT-MO-PV	FDOT - MONITOR	\$0.00	SqFt
FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	\$9.00	SqFt
FDOT-PA-AP	FDOT - PATCHING - AC PARTIAL DEPTH	\$4.00	SqFt

Table 5.2 (d) Localized M&R Planning-Level Unit Costs – Rigid Portland Cement Concrete

Code	Name	Cost	Units
FDOT-PA-PF	FDOT - PATCHING - PCC FULL DEPTH	\$150.00	SqFt
FDOT-SL-PC	FDOT - SLAB REPLACEMENT - PCC	\$30.00	SqFt
FDOT-SB-PC	FDOT - SLAB STABILIZATION - PCC	\$30.00	SqFt
FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	\$72.00	SqFt
FDOT-PO-FL	FDOT - POPOUT FILLER	\$0.05	SqFt
FDOT-GR-PP	FDOT - GRINDING (LOCALIZED)	\$2.00	Ft
FDOT-CS-PC	FDOT - CRACK SEALING - PCC	\$4.25	Ft
FDOT-MO-PV	FDOT - MONITOR	\$0.00	N/A
FDOT-JS-PC	FDOT - JOINT SEAL - PCC	\$2.75	Ft

*PCC Patching (Full Depth and Partial Depth) consider high-early-strength and high-performing repair material.



5.3 Localized Maintenance and Repair Analysis and Recommendations

The SAPMP provides a planning-level estimation of Localized Maintenance and Repair based on the results of the latest PCI Survey Inspection performed at the airport. Based on the limited sample units inspected, a statistical extrapolation of distresses at the section level is used to estimate the quantities of recommended repair activities based on the policies defined in **5.2 Localized M&R Policy**. The PCI Survey Inspections did not consist of 100% inspection of all sample units; therefore, the section-level distress quantities used to estimate the Localized Maintenance and Repair needs are for conceptual planning purposes. The accuracy of the extrapolated distresses, and therefore work quantities, is subject to the amount of sample units inspected and the concentration of distress types observed in sample units. **Appendix B** provides the estimated Localized Maintenance and Repair based on this SAPMP's PCI Survey Inspection efforts. Localized Preventive Maintenance and Repair is typically applied to pavements that are in a condition at or above the Critical PCI of 65. Localized Stopgap Maintenance and Repair is typically applied to pavements that are below the Critical PCI of 65. It is recommended that airport staff evaluate the application of Localized Maintenance and Repair in concert with the planning of Major Rehabilitation efforts identified in Chapter 6 Major Rehabilitation Planning. Pavements with Stopgap recommendations that are subject to near-term Major Rehabilitation efforts may remove the need to perform localized maintenance efforts.

The following **Table 5.3 (a)** summarizes the anticipated Localized Maintenance and Repair efforts based on the PCI Survey Inspection efforts performed at this airport as part of this SAPMP System Update. The following table depicts planning-level costs rounded to the nearest ten dollars.

Table 5.3 (a) Summary of Airport Localized M&R Planning Cost and Quantity at Network Level

Work Description	Work Category	Rough Estimate of Work Quantity	Work Units	Planning Material Cost
FDOT - SURFACE SEAL	PREVENTIVE	253,295	SqFt	\$ 139,320.00
FDOT - CRACK SEALING - AC	PREVENTIVE	315	Ft	\$ 950.00
FDOT - PATCHING - AC PARTIAL DEPTH	PREVENTIVE	290	SqFt	\$ 1,150.00
FDOT - PATCHING - AC FULL DEPTH	PREVENTIVE	190	SqFt	\$ 1,690.00
FDOT - SURFACE SEAL	STOPGAP	133,595	SqFt	\$ 73,480.00
FDOT - PATCHING - PCC FULL DEPTH	STOPGAP	4,100	SqFt	\$ 614,840.00
FDOT - PATCHING - PCC PARTIAL DEPTH	STOPGAP	1,340	SqFt	\$ 96,290.00
FDOT - CRACK SEALING - PCC	STOPGAP	6,370	Ft	\$ 27,080.00
FDOT - SLAB REPLACEMENT - PCC	STOPGAP	17,430	SqFt	\$ 522,790.00
FDOT - PATCHING - AC FULL DEPTH	STOPGAP	1,160	SqFt	\$ 10,420.00
FDOT - PATCHING - AC PARTIAL DEPTH	STOPGAP	26,515	SqFt	\$ 106,050.00
FDOT - CRACK SEALING - AC	STOPGAP	180	Ft	\$ 540.00
FDOT - JOINT SEAL - PCC	STOPGAP	16,735	Ft	\$ 46,020.00



The following **Table 5.3 (b)** provides further breakdown of the anticipated planning-level cost at the section level for the pavements exhibiting distresses that would benefit from Localized M&R. The table shows the approximate improved “End Condition” of the section after the application of Localized M&R. The following table depicts planning-level costs rounded to the nearest ten dollars.

Table 5.3 (b) Summary of Airport Localized M&R Planning Cost and Quantity at Section Level

Network ID	Branch ID	Section ID	Area (SF)	Start Condition	End Condition	Cost
VNC	AP	4102	164,918	100	100	\$ -
VNC	AP	4103	45,587	100	100	\$ -
VNC	AP	4105	112,872	21	57	\$ 316,470.00
VNC	AP	4107	90,832	100	100	\$ -
VNC	AP	4115	35,804	4	55	\$ 990,630.00
VNC	AP	4120	57,693	100	100	\$ -
VNC	AP	4125	53,301	91	91	\$ -
VNC	AP	4127	19,505	100	100	\$ -
VNC	AP	4130	5,580	94	94	\$ -
VNC	AP	4140	73,011	93	93	\$ -
VNC	AP CENTER	4405	120,111	100	100	\$ -
VNC	AP CENTER	4415	46,412	100	100	\$ -
VNC	AP RU	5105	26,551	94	94	\$ -
VNC	AP RU	5110	19,846	94	94	\$ -
VNC	RW 13-31	6105	413,900	76	89	\$ 61,550.00
VNC	RW 13-31	6110	196,950	74	82	\$ 14,250.00
VNC	RW 13-31	6115	30,000	67	87	\$ 16,600.00
VNC	RW 13-31	6120	20,000	61	86	\$ 11,380.00
VNC	RW 13-31	6125	30,000	68	88	\$ 8,260.00
VNC	RW 13-31	6130	20,000	63	81	\$ 5,800.00
VNC	RW 13-31	6135	26,100	93	93	\$ -
VNC	RW 13-31	6140	13,050	90	90	\$ -
VNC	RW 13-31	6145	64,500	100	100	\$ -
VNC	RW 13-31	6150	32,250	100	100	\$ -
VNC	RW 5-23	6205	255,000	90	92	\$ 660.00
VNC	RW 5-23	6210	350,820	94	94	\$ 240.00
VNC	RW 5-23	6215	18,000	94	94	\$ -
VNC	RW 5-23	6220	27,000	92	92	\$ -
VNC	RW 5-23	6225	18,000	94	94	\$ -
VNC	RW 5-23	6230	27,000	94	94	\$ -
VNC	RW 5-23	6240	13,680	86	86	\$ -
VNC	RW 5-23	6250	18,000	94	94	\$ -




Network ID	Branch ID	Section ID	Area (SF)	Start Condition	End Condition	Cost
VNC	T-HANG	605	17,687	69	82	\$ 9,730.00
VNC	T-HANG	610	42,593	66	93	\$ 24,580.00
VNC	T-HANG	620	103,188	54	70	\$ 116,460.00
VNC	T-HANG	705	36,074	79	85	\$ 2,450.00
VNC	T-HANG	708	11,509	68	81	\$ 1,510.00
VNC	T-HANG	710	42,414	49	63	\$ 55,910.00
VNC	T-HANG	715	12,818	92	92	\$ -
VNC	T-HANG	720	5,418	92	92	\$ -
VNC	T-HANG	725	17,455	94	94	\$ -
VNC	T-HANG	730	18,001	59	64	\$ 1,020.00
VNC	T-HANG	735	21,879	100	100	\$ -
VNC	TW A	105	55,145	94	94	\$ -
VNC	TW A	110	53,584	89	89	\$ -
VNC	TW A	115	52,281	92	92	\$ -
VNC	TW A	120	9,988	90	94	\$ 110.00
VNC	TW A	125	5,738	66	83	\$ 3,170.00
VNC	TW B	220	30,324	100	100	\$ -
VNC	TW B	225	12,448	91	94	\$ 70.00
VNC	TW B	230	17,274	100	100	\$ -
VNC	TW B	235	23,085	100	100	\$ -
VNC	TW C	315	84,284	94	94	\$ -
VNC	TW D	400	39,559	100	100	\$ -
VNC	TW D	405	76,074	100	100	\$ -
VNC	TW D	410	18,193	94	94	\$ -
VNC	TW E	505	62,102	94	94	\$ -
VNC	TW E	510	10,168	92	92	\$ -
VNC	TW E	515	22,576	94	94	\$ -
VNC	TW E	550	9,260	94	94	\$ -
VNC	TW F	450	11,590	100	100	\$ -

The following **Table 5.3 (c)** provides a summary of the anticipated planning-level costs for Localized Preventive Maintenance and Repair and Localized Stopgap Maintenance and Repair. The following table depicts planning-level costs rounded to the nearest ten dollars.

Table 5.3 (c) Summary of Localized Maintenance

Work Category	Cost
Preventive	\$ 143,110.00
Stopgap	\$ 1,497,510.00
Planning-Level Localized M&R Needs =	\$ 1,640,620.00

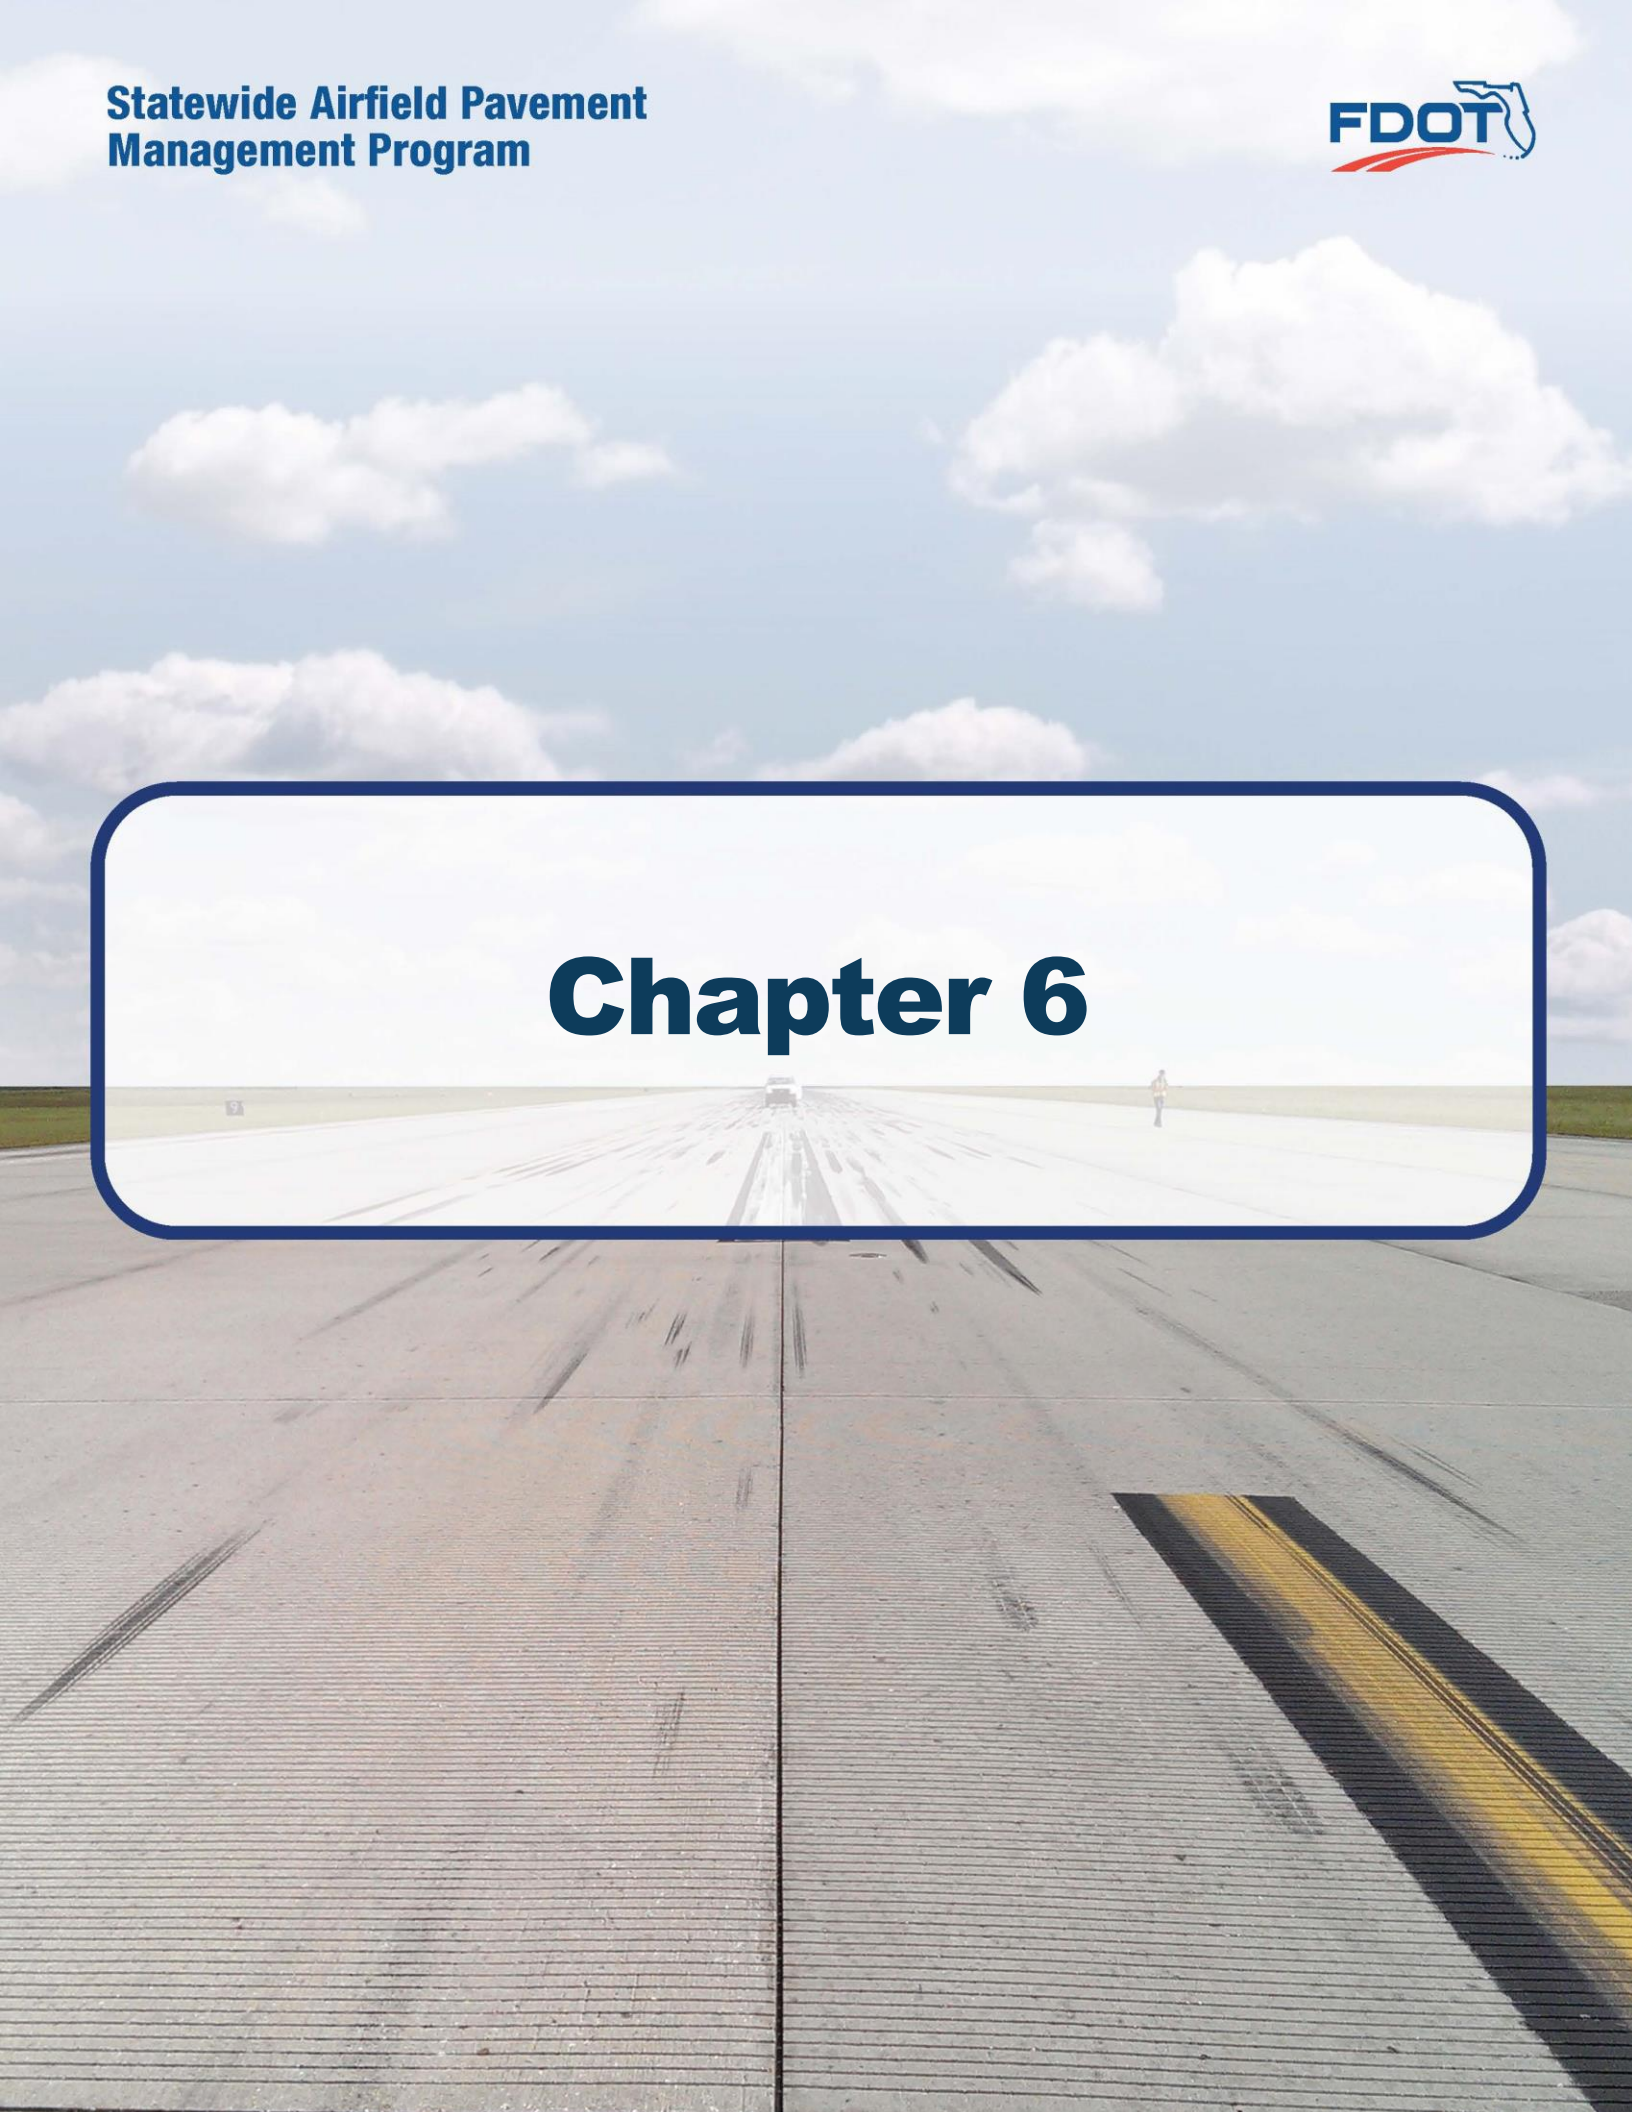Chapter 6






Chapter 6 – Major Rehabilitation Planning

6.1 Major Rehabilitation


Major rehabilitation is recommended to correct or improve structural deficiencies and/or functional deterioration for pavement sections within a network. Often, when pavements are subject to significant changes in the aircraft fleet mix (frequency and type), major rehabilitation is required to provide a pavement section to meet the traffic demand. Major rehabilitation is recommended when a pavement section falls below the Critical PCI value that is defined during the system customization or if a pavement section has a significant observation of load-related distress. Observation of any load-related distress potentially indicates that the section may be structurally deficient or that the aircraft loads being applied to the pavement section are different than what the section was designed for. **Figures 6.1 (a) and 6.1 (b)** depict the decision process for major rehabilitation project identification with the assumption of available funds. Should funding be unavailable for pavement sections in need of major rehabilitation, the airport may elect to apply the appropriate localized stopgap repair.

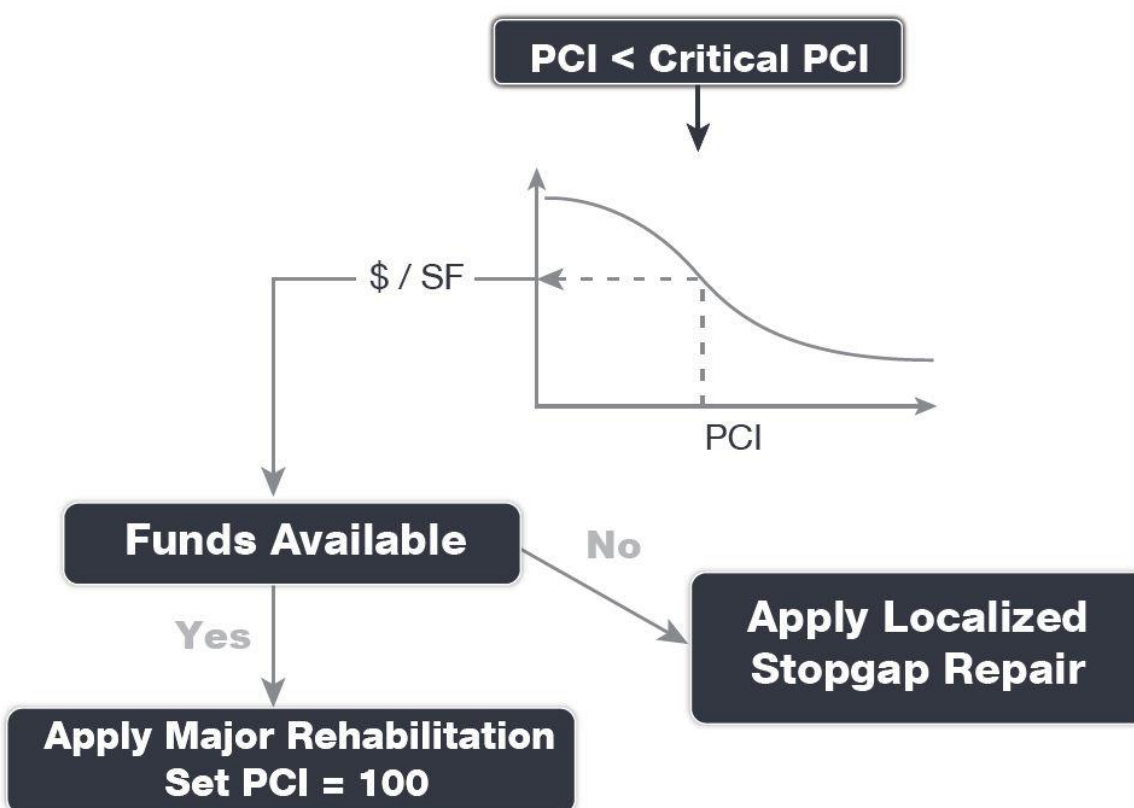Figures 6.1 (a) Major Rehabilitation Planning Decision Diagram, $PCI \leq \text{Critical PCI}$





Figures 6.1 (b) Major Rehabilitation Planning Decision Diagram, $PCI > \text{Critical } PCI$

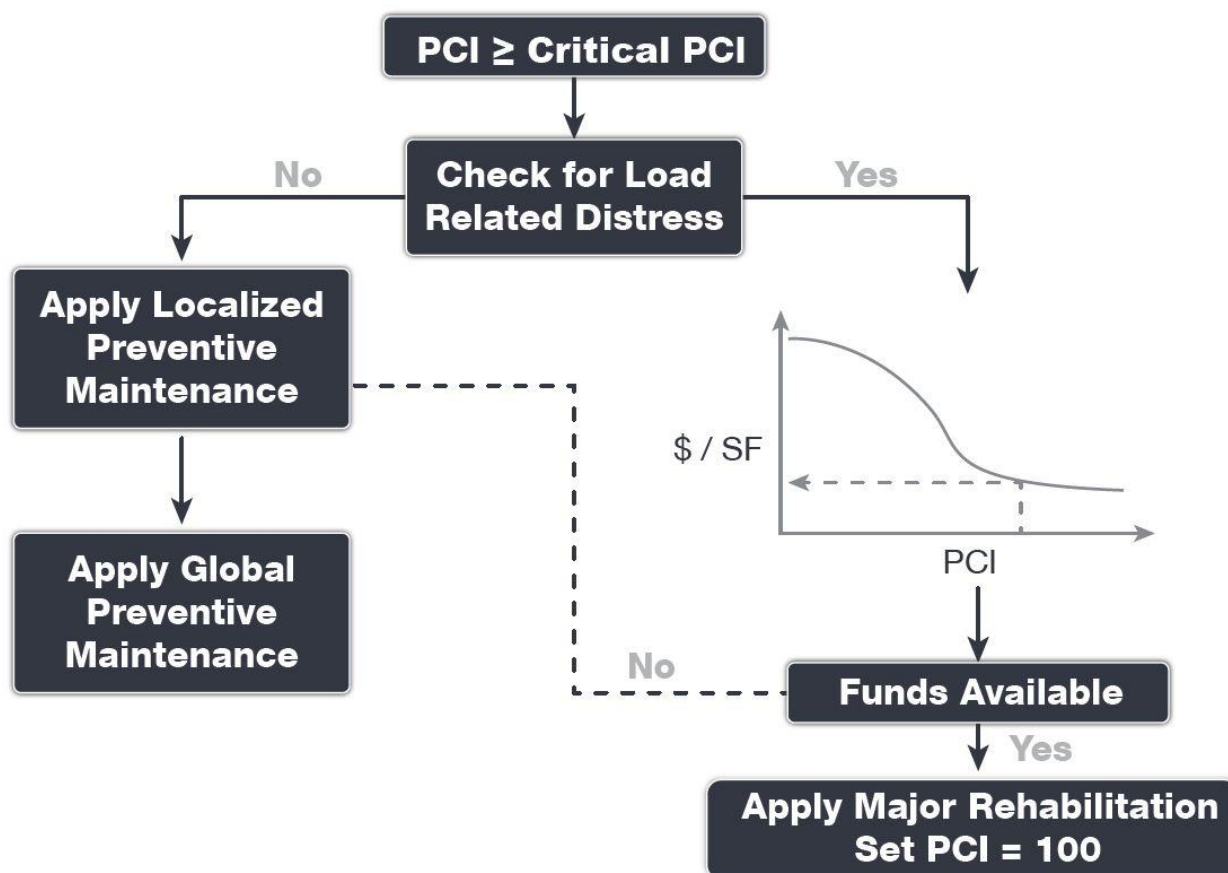



6.1.1 Critical PCI

For the FDOT SAPMP the development of a major rehabilitation program is based on the Critical PCI concept. The **Critical PCI** concept assumes that it is more cost-effective to maintain pavements above, rather than below their critical PCI. It is assumed that once a pavement section deteriorates to the Critical PCI value that it is more cost-effective to complete a major rehabilitation project rather than continuing to apply preventive maintenance. This method includes defining the Critical PCI and introducing major rehabilitation work types.

Identification of annual and long-range Major Rehabilitation work plans are typically based on the Critical PCI concept. The Critical PCI is defined as the PCI value at which the rate of loss (deterioration) increases with time, or the cost of applying localized maintenance and repair increases or is not effective. A Critical PCI is usually within a range of 55 and 70; the following procedure is standard approach in developing a specific Critical PCI:

1. Develop a pavement performance model and refine a prediction model for the pavements considered.
2. Select a localized maintenance and repair policy to be used in developing a work plan.
3. Apply the selected localized policy to the pavement sections for a range of PCI.
4. Compute the unit cost per area for each PCI range.
5. Plot the cost versus the PCI.
6. Determine the Critical PCI based on the point where the cost is insignificant.

The FDOT SAPMP defines the Critical PCI at 65 – this is based on the historic trends in pavement performance and Statewide planning efforts.

6.1.2 FDOT Recommended Minimum Service-Level PCI

The FDOT has recommended **Minimum Service-Level PCI** for airports' airfield pavements based on the following characteristics; airport type within FDOT SAPMP, branch use, and expected aircraft operations. For the purposes of Major Rehabilitation, the Critical PCI is typically the threshold condition that triggers major construction, however it is recommended that the airports maintain the Minimum Service-Level PCI with a combination of Localized Maintenance and Repair and timely Major Rehabilitation. **Table 6.1.2** summarizes the FDOT Recommended Minimum Service-Level PCI.

Table 6.1.2 FDOT Recommended Minimum Service-Level PCI

Branch Use	FDOT Recommended PCI	Additional Consideration
Runway	75	Aircraft Fleet Mix Changes Primary Runway
Taxiway / Taxilane	65	Aircraft Fleet Mix Changes Expected Operations
Aprons / Run-Ups / Ramps	65	Ground Service Equipment Non-Aircraft Operations (e.g. fueling)



6.2 Major Rehabilitation Policy

6.2.1 Major Rehabilitation Pavement Section Development

The review of the existing as-built record documentation within the participating airports' archives was used as the basis of the conceptual pavement design sections. Refinement of the pavement section layers was performed in consideration of the FAA **AC 150/5320-6F "Airport Pavement Design and Evaluation."** It should be noted that no subsurface geotechnical investigation, ALTA/ACSM Survey, topographic survey, utilities survey, environmental, or site specific air traffic study(s) have been utilized in the development of the design criteria. No warranty or assurance is implied in this document for final design nor construction for any airfield pavements discussed within this report. The following **Tables 6.2.1 (a) and (b)** provide details on the conceptual pavement sections developed for this study.

Major rehabilitation is divided into two policy categories as part of this program: Full-Depth Reconstruction (Reconstruction) and Intermediate-Level Major Rehabilitation (Restoration). Based on the pavement type, the general categories are defined as AC Reconstruction and AC Restoration for AC, AAC, and APC flexible pavement types and PCC Reconstruction and PCC Restoration for PCC rigid pavement types. The pavement sections have been based on the average RL Airport Type requirements; no pavement design has been performed in accordance with AC 150/5320-6F for the determined conceptual sections.

Table 6.2.1 (a) Conceptual Pavement Section for Major Rehabilitation – Flexible Asphalt Concrete

Rehabilitation Type	Reliever (RL) Airport
AC Restoration <i>Combination of asphalt pavement milling and overlay with 25% of the areas subject to full-depth reconstruction.</i> PCI = 41 to 65	75% Mill and Overlay P-101 AC Milling (3") P-603 Bituminous Tack P-401 (HMA) (3") 25% AC Reconstruction P-101 Pavement Removal P-152 Subgrade (12") P-211 Base (8") P-602 Bituminous Prime P-603 Bituminous Tack P-401 HMA (4") <i>Excludes any paved shoulder features.</i>
AC Reconstruction <i>Full-depth asphalt pavement section reconstruction.</i> PCI = 40 or less	P-101 Pavement Removal P-152 Subgrade (12") P-211 Base (8") P-602 Bituminous Prime P-603 Bituminous Tack P-401 HMA (4") <i>Excludes any paved shoulder features.</i>



Table 6.2.1 (b) Conceptual Pavement Section for Major Rehabilitation – Rigid Portland Cement Concrete

Rehabilitation Type	Reliever (RL) Airport
PCC Restoration <i>Restoration of PCC pavement with a combination of crack sealing, joint seal replacement, and replacement of 25% of slab panels.</i> PCI = 41 to 65	P-101 Pavement Removal P-605 Joint Seal Repair P-152 Subgrade (12") P-211 Base (if needed, typical) (6") P-501 Rigid PCC (15") *Select Slabs (25%) **Crack Seal and Limited Patching
PCC Reconstruction <i>Full-depth rigid pavement section reconstruction.</i> PCI = 40 or less	P-101 Pavement Removal P-605 Joint Seal Repair P-152 Subgrade (12") P-211 Base (6") P-501 Rigid PCC (14")

The identification of rehabilitation needs and conceptual pavement sections have been determined at the planning level. Design-level investigation is recommended prior to developing construction-level design documents and budgets.

In compliance with FAA Grant Assurances 11 and 19, the FDOT SAPMP provides airports with airfield pavement evaluation reports in accordance with **FAA AC 150/5380-7B Airport Pavement Management Program (PMP)** and **AC 150/5380-6C Guidelines and Procedures for Maintenance of Airport Pavements**. The application of the results of a PCI survey are for planning purposes and are limited to the visual observation of deteriorated pavements in limited sampling; design-level investigation is recommended in accordance with the FAA procedures defined in **AC 5320-6F Airport Pavement Design and Evaluation** and **AC 150/5370-11B Use of Nondestructive Testing in the Evaluation of Airport Pavements**. The aforementioned ACs provide the design-level material properties of in-situ pavement and subgrade layers for the determination of appropriate rehabilitation actions. The FDOT SAPMP is organized to provide airports with planning-level data and does not intend to preclude the responsible engineer in performing the appropriate level of investigation and analysis in determining the appropriate design details of a pavement rehabilitation. It would not be advisable to solely base design-level rehabilitation without the appropriate level of investigation and determination of pavement deterioration beyond that of a visual functional condition assessment.

The recommendations identified in the Major Rehabilitation Needs consider the **FAA AC 150/5370-10H Standard Specifications for Construction of Airports** when determining the appropriate materials and methods implemented for construction projects, such as pavement rehabilitation, on airports. It should be noted that the **AC 150/5370-10H Standard Specifications for Construction of Airports** was updated in December of 2018. Design-level determination of project specific specifications based on the AC should be developed by the Airport when performing applicable construction projects.



6.2.2 Major Rehabilitation Planning-Level Unit Costs

Planning-level opinion of probable construction unit costs developed for this System Update was based on archived bid tabulations and records from airfield pavement projects provided by participating airports. A review of cost trends and cost factors have been incorporated to assist airports in planning for project budgets. Neither FDOT nor the Consultant Team has control over the cost of labor, materials, equipment, or over the Contractor's methods of determining prices or over competitive bidding or market conditions. Opinions of probable construction costs provided herein are based on the information known to FDOT at this time and represent only the Consultant Team's judgment as a design professional familiar with the construction industry. This report cannot and does not guarantee that proposals, bids, or actual construction costs will not vary from its opinions of probable construction costs.

Table 6.2.2 Reliever (RL) Major Rehabilitation Planning-Level Unit Cost by Pavement Type

Rehabilitation Type	PCI Range	Flexible Asphalt Concrete Cost Per SF	Rigid Portland Cement Concrete Cost per SF
Restoration	41 to 65	\$ 9.50	\$ 13.50
Reconstruction	0 to 40	\$ 12.50	\$ 20.00

Planning-level opinion of probable construction unit costs consider factors for non-pavement improvements, QA/QC testing, and administrative costs.

6.3 Major Rehabilitation Needs

The objective of the major pavement rehabilitation needs analysis is to provide planning-level projects within an airport's airfield pavement network. Major rehabilitation activities are recommended when a pavement section has deteriorated below the Critical PCI value, a point at which localized maintenance and repair activities may not be the most cost-effective solution. In addition, major rehabilitation is also recommended when the Section PCI is at or above the Critical PCI but the section has significant load-related PCI distresses. Identification of rehabilitation needs is done at the Airfield Pavement Network Definition's section level. This however does not limit the airport from further refining limits of project planning areas.

Major rehabilitation is identified within the FDOT SAPMP as major construction activity that would result in an improvement or resetting of the pavement section's PCI to a value of 100. Major rehabilitation recommendations (AC Restoration, AC Reconstruction, PCC Restoration, and PCC Reconstruction) should be considered as planning-level only. Additional design-level investigation in accordance to the FAA Advisory Circulars will be required. Recommendations identified within this planning document do not imply final design.

6.3.1 10-Year Unconstrained Budget Major Rehabilitation Needs

An unconstrained budget (unlimited budget) is performed for a 10-year duration to identify pavement rehabilitation needs based on current or forecasted PCI values deteriorating below the Critical PCI. FDOT recognizes airports are constrained by budgets and does not intend to convey an unrealistic approach of addressing pavement rehabilitation. The intent of the 10-Year Major Rehabilitation Needs analysis is to identify pavements that will warrant rehabilitation. It is highly recommended that airport staff utilize this information in support of the development of a practical Capital Improvement Program based on priorities, further design/project-level



investigation, and budgetary constraints. The following **Table 6.3.1** summarizes all identified section-level major rehabilitation needs forecasted for the next 10-year period. It should be noted that the following table depicts planning-level costs and have been rounded for planning purposes.

Table 6.3.1 10-Year Major Rehabilitation Needs

Program Year	Network ID	Branch ID	Section ID	Surface	Area (SF)	PCI Before	Rehabilitation Type	Planning Cost
2020	VNC	AP	4105	PCC	112,872	19	PCC Reconstruction	\$ 2,258,000.00
2020	VNC	AP	4115	PCC	35,804	2	PCC Reconstruction	\$ 717,000.00
2020	VNC	RW 13-31	6120	APC	20,000	60	AC Restoration	\$ 191,000.00
2020	VNC	RW 13-31	6130	APC	20,000	62	AC Restoration	\$ 191,000.00
2020	VNC	T-HANG	610	AC	42,593	64	AC Restoration	\$ 405,000.00
2020	VNC	T-HANG	620	AC	103,188	52	AC Restoration	\$ 981,000.00
2020	VNC	T-HANG	710	AC	42,414	48	AC Restoration	\$ 429,000.00
2020	VNC	T-HANG	730	AAC	18,001	58	AC Restoration	\$ 172,000.00
2020	VNC	TW A	125	AAC	5,738	64	AC Restoration	\$ 55,000.00
2022	VNC	RW 13-31	6115	APC	30,000	64	AC Restoration	\$ 286,000.00
2022	VNC	T-HANG	708	AC	11,509	64	AC Restoration	\$ 110,000.00
2023	VNC	RW 13-31	6125	APC	30,000	64	AC Restoration	\$ 286,000.00
2023	VNC	T-HANG	605	AC	17,687	63	AC Restoration	\$ 169,000.00
2028	VNC	RW 13-31	6110	AAC	196,950	64	AC Restoration	\$ 1,872,000.00

**All values have been rounded to the nearest thousand-dollar.*

The following **Figure 6.3.1 (a)** summarizes the section-level major rehabilitation needs for a 10-year period between 2020 and 2029. **Figure 6.3.1 (b)** provides an inset view of Airfield Pavement Major Rehabilitation Exhibit, a large format exhibit is located in **Appendix C Technical Exhibits**. The exhibit graphically depicts the Major Rehabilitation Needs with rounded costs.



Figure 6.3.1 (a) 10-Year Major Rehabilitation Needs by Program Year



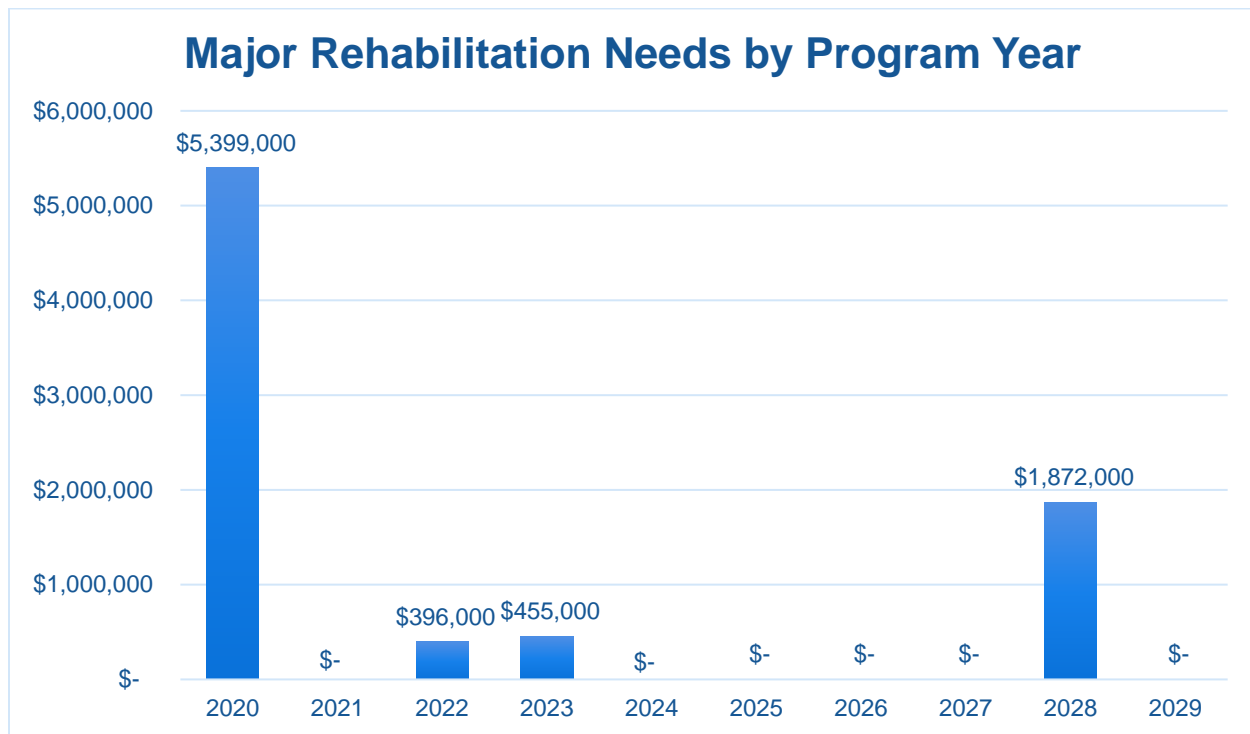


Figure 6.3.1 (b) 10-Year Major Rehabilitation Needs by Program Year Exhibit

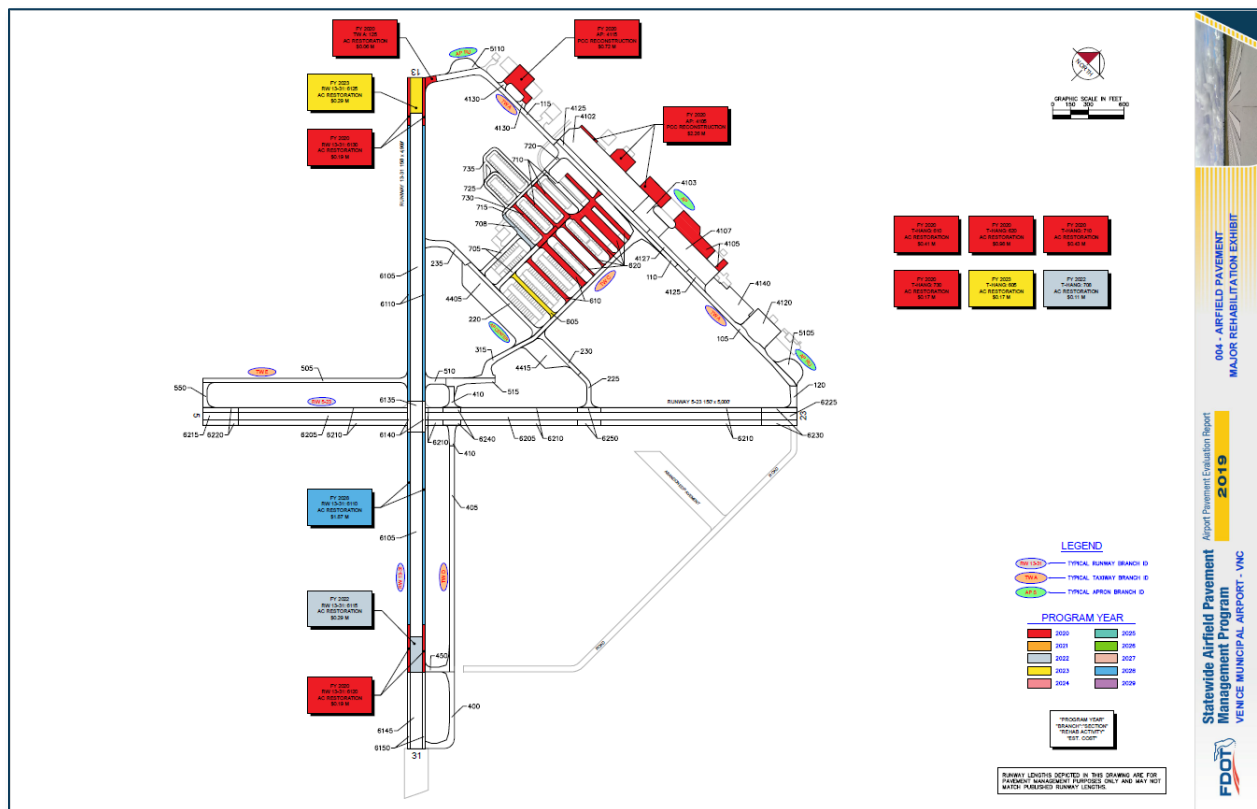

Chapter 7

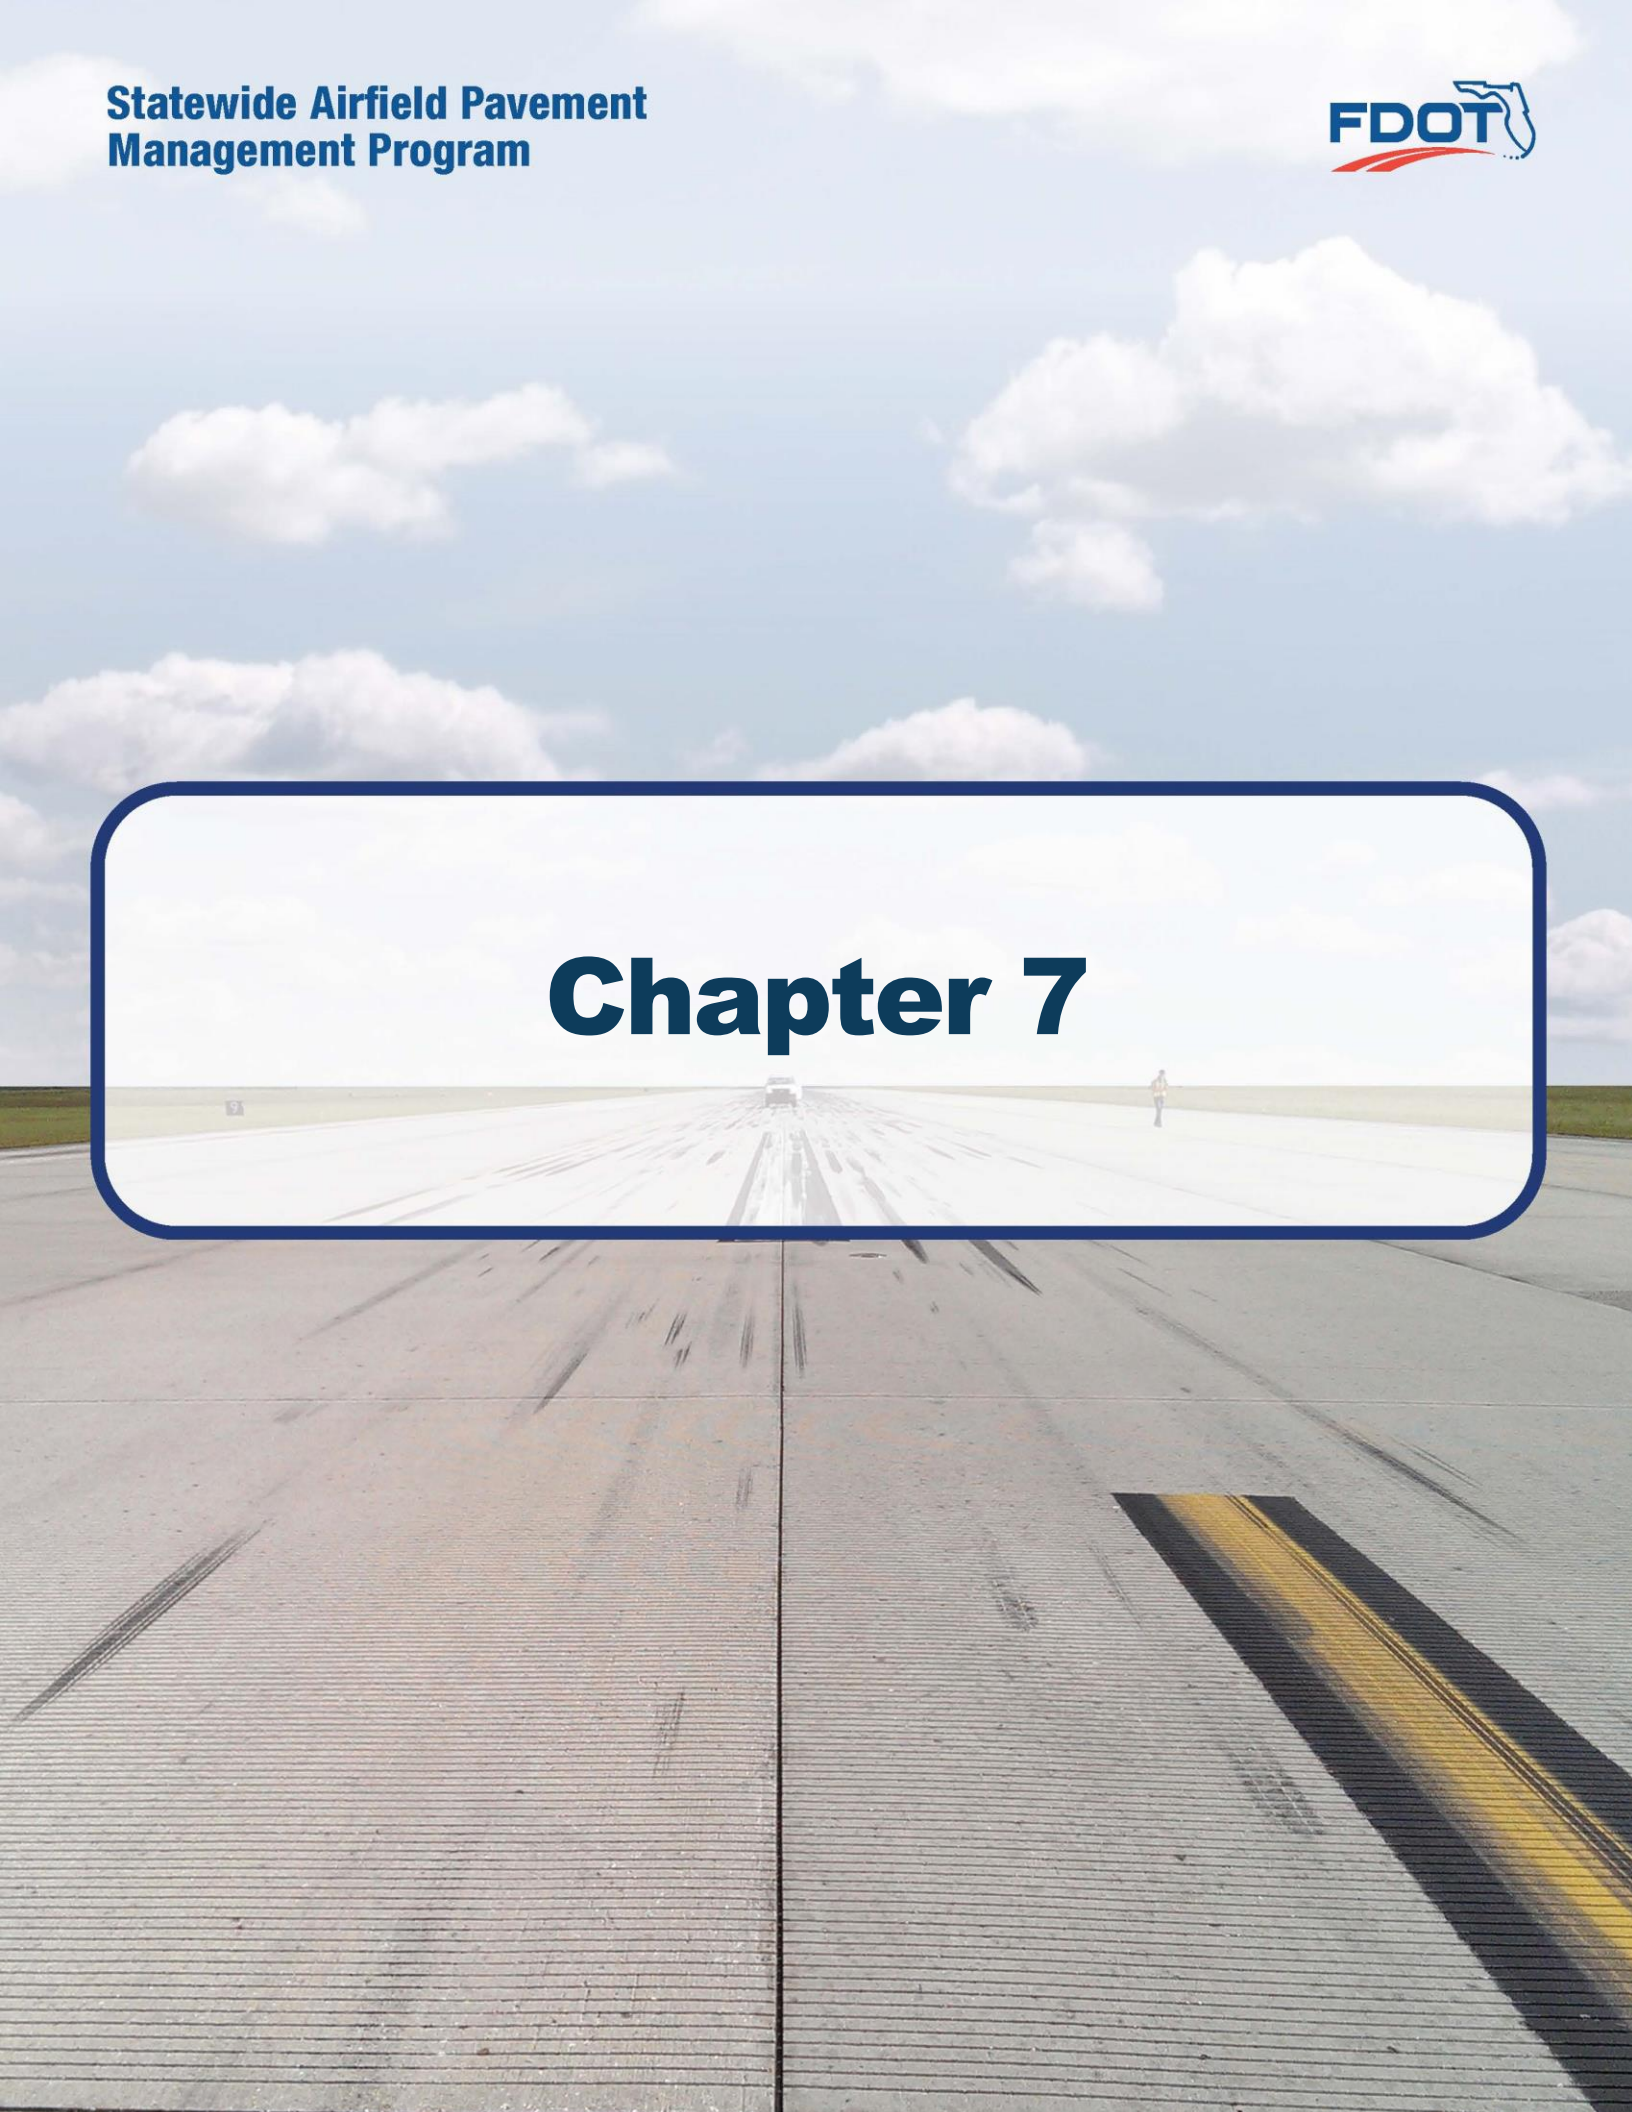



Chapter 7 – Conclusion

7.1 Recommendations

7.1.1 Continued PCI Survey Inspections

It is recommended that the airport continue to perform regularly scheduled PCI Survey inspections in accordance with the ASTM D5340-12 (or latest edition) to monitor the condition of the airfield pavement facilities.

A high priority should be considered for continuous maintenance record keeping and re-inspection of all the airport's maintained pavement facilities to ensure continued safe aircraft operations. A series of scheduled periodic inspections must be carried out for an effective maintenance program. Re-inspection of pavements should be scheduled in a timely manner to ensure that all areas, particularly those that may not come under day-to-day observation, are thoroughly evaluated and reported.

7.1.2 Localized Maintenance and Repair

While deterioration of the pavements due to usage and exposure to the environment cannot be completely prevented, applying timely and effective maintenance efforts can slow the anticipated rate of deterioration. Lack of adequate and timely maintenance is the significant factor in pavement deterioration.

It is recommended that airport sponsors coordinate with their respective Airport Maintenance staff and Airport Engineer when developing project-level maintenance and repair efforts.

7.1.3 Major Rehabilitation

Chapter 6 – Major Rehabilitation Planning identified major pavement rehabilitation project needs from 2020-2029. The identification of the rehabilitation needs was performed at the section level for manageable project areas with the assumption of an unconstrained budget scenario. Given the uncertainty in the airport-specific budget information and prioritization goals, the unconstrained budget scenario was performed to evaluate the worst-case scenario and identify all the inspected pavements' needs in a 10-year period. Certainly, it is understood that most airports are faced with constrained budgets; further evaluation of projects based on prioritization, operational criticality, funding availability, and practicality is recommended.

7.1.4 Pavement Management System

The following recommendations are made to fully implement an effective pavement management program for the airport:

- ▶ Develop a detailed preventive maintenance program for the airport.
- ▶ Further refine and implement the identified 10-year major rehabilitation needs.
- ▶ Maintain detailed records on pavement maintenance, construction, and inspection.
- ▶ Maintain records on major pavement construction projects (year, scope, cost, and construction documents).



7.2 Supporting Documents

001 – Airfield Pavement Network Definition Exhibit

The Airfield Pavement Network Definition Exhibit is located in **Appendix C Technical Exhibits**. The exhibit depicts the airfield layout in a manner that defines the airfield pavement infrastructure as branches, sections, and sample units in accordance with the ASTM D5340-12. The exhibit is intended for planning purposes only – further detail on facilities can be found on the Airport's adopted Airport Layout Plan. Detailed characteristics are tabulated in **Appendix A Pavement Analysis Tables**.

002 – Airfield Pavement System Inventory Exhibit

The Airfield Pavement System Inventory Exhibit is located in **Appendix C Technical Exhibits**. The exhibit depicts any recent and/or anticipated construction activity within the airfield pavement facilities reported by airport staff. The exhibit is intended to schematically identify the pavement limits of works and general work description. The information reported on the **Airport Response Form** provided by each participating airport was used as the basis of the changes; furthermore, changes are confirmed at the airport with airport staff during the in-brief and debrief meeting.

003 – Airfield Pavement Condition Index Exhibit

The Airfield Pavement Condition Index Exhibit is located in **Appendix C Technical Exhibits**. The exhibit is a visual summary of the latest conditions calculated from the results of the PCI Survey performed at the airport. The analysis of the distresses surveyed in accordance with the ASTM D5340-12 (referenced in **Appendix E Inspection Distress Details**) were analyzed using PAVER™ software to determine PCI values. The PCI values are identified in the exhibit and graphically represented using the standard ASTM D5340-12 colors for condition rating categories.

004 – Airfield Pavement Major Rehabilitation Exhibit

The Airfield Pavement Major Rehabilitation Exhibit is located in **Appendix C Technical Exhibits**. The exhibit has been prepared based on the section condition analysis, pavement condition forecasts, and major rehabilitation needs analysis. The exhibit graphically depicts the inventory with the associated rehabilitation type activity, program year, and the planning-level costs. The area limits, rehabilitation type, and planning-level costs should not be considered a design-level recommendation. A tabulation of the 10-Year Major Rehabilitation is located in **Appendix B Airfield Pavement Localized Maintenance and Repair and Major Rehabilitation**.

Inspection Photograph Documentation

Representative field conditions from the PCI Survey are documented with digital photographs located in **Appendix D Inspection Photograph Documentation**. Select photographs are provided with limited caption on the distresses observed – the Appendix does not contain photographs for every sample unit.



7.3 Conclusion

The FDOT SAPMP Update Phase 2 2018-2019 was completed for the airport on behalf of the FDOT ASO in accordance with the Advisory Circulars **150/5380-7B “Airport Pavement Management Program (PMP)”** and **150/5380-6C “Guidelines and Procedures for Maintenance of Airport Pavements.”** FDOT’s implementation of the SAPMP has assisted public airports with this requirement in performing PCI survey inspections and analysis in accordance with the ASTM **D5340-12 “Standard Test Method for Airport Pavement Condition Index Surveys.”**

Appendix A

Airfield Pavement Analysis Tables



Table A-1 Pavement System Inventory Details

Network ID	Branch Name	Branch ID	Branch Use	Section ID	Length (FT)	Width (FT)	Area (SF)	Surface Type	Est. Last Construction Date
VNC	APRON	AP	APRON	4102	870	193	164,918	AC	1/1/2018
VNC	APRON	AP	APRON	4103	900	500	45,587	AC	1/1/2017
VNC	APRON	AP	APRON	4105	920	120	112,872	PCC	1/1/1942
VNC	APRON	AP	APRON	4107	565	160	90,832	AC	1/1/2017
VNC	APRON	AP	APRON	4115	275	150	35,804	PCC	12/25/1999
VNC	APRON	AP	APRON	4120	275	203	57,693	AC	1/1/2018
VNC	APRON	AP	APRON	4125	1,275	42	53,301	AC	1/1/2015
VNC	APRON	AP	APRON	4127	470	42	19,505	AAC	1/1/2017
VNC	APRON	AP	APRON	4130	200	50	5,580	AC	1/1/2015
VNC	APRON	AP	APRON	4140	450	180	73,011	AC	1/1/2015
VNC	CENTER APRON (OLD RW9-27)	AP CENTER	APRON	4405	1,200	100	120,111	AC	1/1/2017
VNC	CENTER APRON (OLD RW9-27)	AP CENTER	APRON	4415	300	150	46,412	AC	1/1/2017
VNC	RUN-UP APRON AT ENDS OF TW A	AP RU	APRON	5105	198	100	26,551	AC	1/1/2015
VNC	RUN-UP APRON AT ENDS OF TW A	AP RU	APRON	5110	100	200	19,846	AC	1/1/2015
VNC	RUNWAY 13-31	RW 13-31	RUNWAY	6105	4,139	100	413,900	AAC	12/1/2006
VNC	RUNWAY 13-31	RW 13-31	RUNWAY	6110	8,400	25	196,950	AAC	12/1/2006
VNC	RUNWAY 13-31	RW 13-31	RUNWAY	6115	300	100	30,000	APC	12/1/2006
VNC	RUNWAY 13-31	RW 13-31	RUNWAY	6120	800	25	20,000	APC	12/1/2006
VNC	RUNWAY 13-31	RW 13-31	RUNWAY	6125	300	100	30,000	APC	12/1/2006
VNC	RUNWAY 13-31	RW 13-31	RUNWAY	6130	800	25	20,000	APC	12/1/2006
VNC	RUNWAY 13-31	RW 13-31	RUNWAY	6135	1,000	100	26,100	AAC	1/1/2013
VNC	RUNWAY 13-31	RW 13-31	RUNWAY	6140	500	25	13,050	AAC	1/1/2013
VNC	RUNWAY 13-31	RW 13-31	RUNWAY	6145	645	100	64,500	AC	5/9/2017
VNC	RUNWAY 13-31	RW 13-31	RUNWAY	6150	1,290	25	32,250	AC	5/9/2017
VNC	RUNWAY 5-23	RW 5-23	RUNWAY	6205	4,149	100	255,000	AC	1/1/2013
VNC	RUNWAY 5-23	RW 5-23	RUNWAY	6210	8,100	25	350,820	AAC	1/1/2013
VNC	RUNWAY 5-23	RW 5-23	RUNWAY	6215	300	100	18,000	AC	1/1/2013
VNC	RUNWAY 5-23	RW 5-23	RUNWAY	6220	800	25	27,000	AC	1/1/2013
VNC	RUNWAY 5-23	RW 5-23	RUNWAY	6225	300	100	18,000	AC	1/1/2013
VNC	RUNWAY 5-23	RW 5-23	RUNWAY	6230	800	25	27,000	AC	1/1/2013
VNC	RUNWAY 5-23	RW 5-23	RUNWAY	6240	400	45	13,680	AC	1/1/2013
VNC	RUNWAY 5-23	RW 5-23	RUNWAY	6250	400	45	18,000	AC	1/1/2013
VNC	GA T-HANGARS	T-HANG	TAXIWAY	605	500	35	17,687	AC	1/1/2003
VNC	GA T-HANGARS	T-HANG	TAXIWAY	610	500	35	42,593	AC	1/1/2003
VNC	GA T-HANGARS	T-HANG	TAXIWAY	620	1,600	75	103,188	AC	12/25/1994



Network ID	Branch Name	Branch ID	Branch Use	Section ID	Length (FT)	Width (FT)	Area (SF)	Surface Type	Est. Last Construction Date
VNC	GA T-HANGARS	T-HANG	TAXIWAY	705	943	40	36,074	AC	1/1/2003
VNC	GA T-HANGARS	T-HANG	TAXIWAY	708	390	30	11,509	AC	12/25/1997
VNC	GA T-HANGARS	T-HANG	TAXIWAY	710	1,000	50	42,414	AC	12/25/1994
VNC	GA T-HANGARS	T-HANG	TAXIWAY	715	700	50	12,818	AC	1/1/2012
VNC	GA T-HANGARS	T-HANG	TAXIWAY	720	250	50	5,418	AC	1/1/2012
VNC	GA T-HANGARS	T-HANG	TAXIWAY	725	600	35	17,455	AC	1/1/2012
VNC	GA T-HANGARS	T-HANG	TAXIWAY	730	1,000	50	18,001	AAC	11/1/2013
VNC	GA T-HANGARS	T-HANG	TAXIWAY	735	870	25	21,879	AC	1/1/2018
VNC	TAXIWAY A	TW A	TAXIWAY	105	1,395	35	55,145	AC	1/1/2015
VNC	TAXIWAY A	TW A	TAXIWAY	110	1,450	35	53,584	AC	1/1/2015
VNC	TAXIWAY A	TW A	TAXIWAY	115	1,333	50	52,281	AC	1/1/2015
VNC	TAXIWAY A	TW A	TAXIWAY	120	200	50	9,988	AC	1/1/2013
VNC	TAXIWAY A	TW A	TAXIWAY	125	125	50	5,738	AAC	12/1/2006
VNC	TAXIWAY B	TW B	TAXIWAY	220	800	35	30,324	AC	1/1/2017
VNC	TAXIWAY B	TW B	TAXIWAY	225	350	35	12,448	AC	1/1/2013
VNC	TAXIWAY B	TW B	TAXIWAY	230	460	35	17,274	AC	1/1/2017
VNC	TAXIWAY B	TW B	TAXIWAY	235	230	50	23,085	AC	5/9/2017
VNC	TAXIWAY C	TW C	TAXIWAY	315	2,103	40	84,284	AC	1/1/2015
VNC	TAXIWAY D	TW D	TAXIWAY	400	645	50	39,559	AC	5/9/2017
VNC	TAXIWAY D	TW D	TAXIWAY	405	1,902	40	76,074	AC	5/9/2017
VNC	TAXIWAY D	TW D	TAXIWAY	410	200	35	18,193	AC	1/1/2013
VNC	TAXIWAY E	TW E	TAXIWAY	505	1,722	35	62,102	AC	1/1/2013
VNC	TAXIWAY E	TW E	TAXIWAY	510	175	50	10,168	AC	1/1/2013
VNC	TAXIWAY E	TW E	TAXIWAY	515	330	50	22,576	AC	1/1/2015
VNC	TAXIWAY E	TW E	TAXIWAY	550	208	37	9,260	AC	1/1/2013
VNC	TAXIWAY F	TW F	TAXIWAY	450	205	40	11,590	AC	5/9/2017



Table A-2 Pavement Condition Index Summary (Last Inspection) – Section Level

Network ID	Branch Name	Branch Use	Section ID	Area (SF)	PCI	Condition Rating
VNC	RUNWAY 13-31	RUNWAY	6105	413,900	76	Satisfactory
VNC	RUNWAY 13-31	RUNWAY	6110	196,950	74	Satisfactory
VNC	RUNWAY 13-31	RUNWAY	6115	30,000	67	Fair
VNC	RUNWAY 13-31	RUNWAY	6120	20,000	61	Fair
VNC	RUNWAY 13-31	RUNWAY	6125	30,000	68	Fair
VNC	RUNWAY 13-31	RUNWAY	6130	20,000	63	Fair
VNC	RUNWAY 13-31	RUNWAY	6135	26,100	93	Good
VNC	RUNWAY 13-31	RUNWAY	6140	13,050	90	Good
VNC	RUNWAY 13-31	RUNWAY	6145	64,500	100	Good
VNC	RUNWAY 13-31	RUNWAY	6150	32,250	100	Good
VNC	RUNWAY 5-23	RUNWAY	6205	255,000	90	Good
VNC	RUNWAY 5-23	RUNWAY	6210	350,820	94	Good
VNC	RUNWAY 5-23	RUNWAY	6215	18,000	94	Good
VNC	RUNWAY 5-23	RUNWAY	6220	27,000	92	Good
VNC	RUNWAY 5-23	RUNWAY	6225	18,000	94	Good
VNC	RUNWAY 5-23	RUNWAY	6230	27,000	94	Good
VNC	RUNWAY 5-23	RUNWAY	6240	13,680	86	Good
VNC	RUNWAY 5-23	RUNWAY	6250	18,000	94	Good
VNC	GA T-HANGARS	TAXIWAY	605	17,687	69	Fair
VNC	GA T-HANGARS	TAXIWAY	610	42,593	66	Fair
VNC	GA T-HANGARS	TAXIWAY	620	103,188	54	Poor
VNC	GA T-HANGARS	TAXIWAY	705	36,074	79	Satisfactory
VNC	GA T-HANGARS	TAXIWAY	708	11,509	68	Fair
VNC	GA T-HANGARS	TAXIWAY	710	42,414	49	Poor
VNC	GA T-HANGARS	TAXIWAY	715	12,818	92	Good
VNC	GA T-HANGARS	TAXIWAY	720	5,418	92	Good
VNC	GA T-HANGARS	TAXIWAY	725	17,455	94	Good
VNC	GA T-HANGARS	TAXIWAY	730	18,001	59	Fair
VNC	GA T-HANGARS	TAXIWAY	735	21,879	100	Good
VNC	TAXIWAY A	TAXIWAY	105	55,145	94	Good
VNC	TAXIWAY A	TAXIWAY	110	53,584	89	Good
VNC	TAXIWAY A	TAXIWAY	115	52,281	92	Good
VNC	TAXIWAY A	TAXIWAY	120	9,988	90	Good
VNC	TAXIWAY A	TAXIWAY	125	5,738	66	Fair
VNC	TAXIWAY B	TAXIWAY	220	30,324	100	Good
VNC	TAXIWAY B	TAXIWAY	225	12,448	91	Good
VNC	TAXIWAY B	TAXIWAY	230	17,274	100	Good



Network ID	Branch Name	Branch Use	Section ID	Area (SF)	PCI	Condition Rating
VNC	TAXIWAY B	TAXIWAY	235	23,085	100	Good
VNC	TAXIWAY C	TAXIWAY	315	84,284	94	Good
VNC	TAXIWAY D	TAXIWAY	400	39,559	100	Good
VNC	TAXIWAY D	TAXIWAY	405	76,074	100	Good
VNC	TAXIWAY D	TAXIWAY	410	18,193	94	Good
VNC	TAXIWAY E	TAXIWAY	505	62,102	94	Good
VNC	TAXIWAY E	TAXIWAY	510	10,168	92	Good
VNC	TAXIWAY E	TAXIWAY	515	22,576	94	Good
VNC	TAXIWAY E	TAXIWAY	550	9,260	94	Good
VNC	TAXIWAY F	TAXIWAY	450	11,590	100	Good
VNC	APRON	APRON	4102	164,918	100	Good
VNC	APRON	APRON	4103	45,587	100	Good
VNC	APRON	APRON	4105	112,872	21	Serious
VNC	APRON	APRON	4107	90,832	100	Good
VNC	APRON	APRON	4115	35,804	4	Failed
VNC	APRON	APRON	4120	57,693	100	Good
VNC	APRON	APRON	4125	53,301	91	Good
VNC	APRON	APRON	4127	19,505	100	Good
VNC	APRON	APRON	4130	5,580	94	Good
VNC	APRON	APRON	4140	73,011	93	Good
VNC	CENTER APRON (OLD RW9-27)	APRON	4405	120,111	100	Good
VNC	CENTER APRON (OLD RW9-27)	APRON	4415	46,412	100	Good
VNC	RUN-UP APRON AT ENDS OF TW A	APRON	5105	26,551	94	Good
VNC	RUN-UP APRON AT ENDS OF TW A	APRON	5110	19,846	94	Good



Table A-3 Forecasted PCI 2020-2029

Network ID	Branch ID	Section ID	Last PCI	Forecasted PCI									
				2020	2021	2022	2023	2024	2025	2026	2027	2028	2029
VNC	AP	4102	100	95	93	90	88	86	84	81	79	77	75
VNC	AP	4103	100	93	90	88	86	84	81	79	77	75	74
VNC	AP	4105	21	19	18	16	15	14	13	11	10	9	8
VNC	AP	4107	100	93	90	88	86	84	81	79	77	75	74
VNC	AP	4115	4	2	1	0	0	0	0	0	0	0	0
VNC	AP	4120	100	95	93	90	88	86	84	81	79	77	75
VNC	AP	4125	91	88	86	83	81	79	77	75	73	72	70
VNC	AP	4127	100	93	91	89	86	84	82	80	78	76	73
VNC	AP	4130	94	91	88	86	84	82	80	78	76	74	72
VNC	AP	4140	93	90	87	85	83	81	79	77	75	73	71
VNC	AP CENTER	4405	100	93	90	88	86	84	81	79	77	75	74
VNC	AP CENTER	4415	100	93	90	88	86	84	81	79	77	75	74
VNC	AP RU	5105	94	91	88	86	84	82	80	78	76	74	72
VNC	AP RU	5110	94	91	88	86	84	82	80	78	76	74	72
VNC	RW 13-31	6105	76	74	73	71	70	69	68	67	66	65	65
VNC	RW 13-31	6110	74	72	71	70	69	68	67	66	65	64	63
VNC	RW 13-31	6115	67	65	65	64	63	62	62	61	60	60	59
VNC	RW 13-31	6120	61	60	59	58	58	57	56	56	55	54	53
VNC	RW 13-31	6125	68	66	66	65	64	63	62	62	61	60	60
VNC	RW 13-31	6130	63	62	61	60	60	59	58	58	57	56	56
VNC	RW 13-31	6135	93	90	87	85	83	82	80	78	77	75	74
VNC	RW 13-31	6140	90	87	85	83	81	79	78	76	75	73	72
VNC	RW 13-31	6145	100	94	92	90	87	85	83	81	79	78	76
VNC	RW 13-31	6150	100	94	92	90	87	85	83	81	79	78	76
VNC	RW 5-23	6205	90	87	85	83	81	79	77	76	74	73	72
VNC	RW 5-23	6210	94	91	88	86	84	82	81	79	77	76	74
VNC	RW 5-23	6215	94	91	89	86	84	82	80	78	77	75	74
VNC	RW 5-23	6220	92	89	87	84	82	80	79	77	75	74	73
VNC	RW 5-23	6225	94	91	89	86	84	82	80	78	77	75	74
VNC	RW 5-23	6230	94	91	89	86	84	82	80	78	77	75	74
VNC	RW 5-23	6240	86	83	81	79	77	76	74	73	72	71	70
VNC	RW 5-23	6250	94	91	89	86	84	82	80	78	77	75	74
VNC	T-HANG	605	69	67	66	65	63	62	61	60	59	58	57
VNC	T-HANG	610	66	64	63	62	61	60	58	57	56	55	54
VNC	T-HANG	620	54	52	51	51	50	49	48	47	46	46	45
VNC	T-HANG	705	79	77	75	74	73	71	70	69	67	66	65
VNC	T-HANG	708	68	66	65	64	62	61	60	59	58	57	56



Network ID	Branch ID	Section ID	Last PCI	Forecasted PCI									
				2020	2021	2022	2023	2024	2025	2026	2027	2028	2029
VNC	T-HANG	710	49	48	47	46	45	44	44	43	42	42	41
VNC	T-HANG	715	92	90	88	86	85	83	82	80	79	77	76
VNC	T-HANG	720	92	90	88	86	85	83	82	80	79	77	76
VNC	T-HANG	725	94	92	90	88	87	85	84	82	81	79	78
VNC	T-HANG	730	59	58	57	56	55	54	53	52	51	50	49
VNC	T-HANG	735	100	96	94	93	91	89	88	86	85	83	82
VNC	TW A	105	94	92	90	88	87	85	84	82	81	79	78
VNC	TW A	110	89	87	85	84	82	81	79	78	76	75	73
VNC	TW A	115	92	90	88	86	85	83	82	80	79	77	76
VNC	TW A	120	90	88	86	85	83	81	80	79	77	76	74
VNC	TW A	125	66	64	64	63	62	61	60	59	59	58	57
VNC	TW B	220	100	94	93	91	89	88	86	85	83	82	80
VNC	TW B	225	91	89	87	85	84	82	81	79	78	77	75
VNC	TW B	230	100	94	93	91	89	88	86	85	83	82	80
VNC	TW B	235	100	95	93	92	90	88	87	85	84	82	81
VNC	TW C	315	94	92	90	88	87	85	84	82	81	79	78
VNC	TW D	400	100	95	93	92	90	88	87	85	84	82	81
VNC	TW D	405	100	95	93	92	90	88	87	85	84	82	81
VNC	TW D	410	94	92	90	88	87	85	84	82	81	79	78
VNC	TW E	505	94	92	90	88	87	85	84	82	81	79	78
VNC	TW E	510	92	90	88	86	85	83	82	80	79	77	76
VNC	TW E	515	94	92	90	88	87	85	84	82	81	79	78
VNC	TW E	550	94	92	90	88	87	85	84	82	81	79	78
VNC	TW F	450	100	95	93	92	90	88	87	85	84	82	81

2/20/2019

Work History Report

Page 1 of 13

Pavement Database: FDOT

Network: VENICE MUNICIPA		Branch: AP CENTER CENTER APRON		Section: 4405		Surface: AC
L.C.D. 1/1/2017		Use: APRON	Rank: S	Length: 1,200.00 (Ft)	Width: 100.00 (Ft)	True Area: 120111.0000 (SqFt)
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2017	CR-AC	Complete Reconstruction - AC	979,185.00	0.00	<input checked="" type="checkbox"/>	4" P-401, 6" MIN P-220
1/1/1942	NU-IN	New Construction - Initial	0.00	0.00	<input checked="" type="checkbox"/>	

Network: VENICE MUNICIPA		Branch: AP CENTER CENTER APRON		Section: 4415		Surface: AC
L.C.D. 1/1/2017		Use: APRON	Rank: S	Length: 300.00 (Ft)	Width: 150.00 (Ft)	True Area: 46412.00001 (SqFt)
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2017	CR-AC	Complete Reconstruction - AC	186,535.00	0.00	<input checked="" type="checkbox"/>	4" P-401, 6" MIN P-220
1/1/1942	NU-IN	New Construction - Initial	0.00	0.00	<input checked="" type="checkbox"/>	

Network: VENICE MUNICIPA		Branch: AP RU RUN-UP APRON		Section: 5105		Surface: AC
L.C.D. 1/1/2015		Use: APRON	Rank: P	Length: 198.00 (Ft)	Width: 100.00 (Ft)	True Area: 26551.00000 (SqFt)
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2015	CR-AC	Complete Reconstruction - AC	0.00	0.00	<input checked="" type="checkbox"/>	4" P-401, 8" P-211
1/1/1991	IMPORT ED	BUILT	0.00	1.50	<input checked="" type="checkbox"/>	1991: 1.5" P-401 ON 6" P-211 ON 8" P-154 SHELL SUBBASE
1/1/1991	IMPORT ED	OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	SOIL: SP

Network: VENICE MUNICIPA		Branch: AP RU RUN-UP APRON		Section: 5110		Surface: AC
L.C.D. 1/1/2015		Use: APRON	Rank: P	Length: 100.00 (Ft)	Width: 200.00 (Ft)	True Area: 19846 (SqFt)
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2015	CR-AC	Complete Reconstruction - AC	0.00	0.00	<input checked="" type="checkbox"/>	4" P-401, 8" P-211
1/1/1991	IMPORT ED	BUILT	0.00	1.50	<input checked="" type="checkbox"/>	1991: 1.5" P-401 ON 6" P-211 ON 8: P-154 SHELL SUBBASE
1/1/1991	IMPORT ED	OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	SOIL: SP

Network: VENICE MUNICIPA		Branch: AP APRON		Section: 4102		Surface: AC
L.C.D. 1/1/2018		Use: APRON	Rank: P	Length: 870.00 (Ft)	Width: 193.00 (Ft)	True Area: 164918.0000 (SqFt)
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2018	CR-AC	Complete Reconstruction - AC	824,590.00	0.00	<input checked="" type="checkbox"/>	4" P-401, 6" MIN P-219
1/1/1986	IMPORT ED	REPAIR	0.00	0.00	<input type="checkbox"/>	JOINT SEALING PROJECT CONDUCTED IN 1986
1/1/1942	IMPORT ED	BUILT	0.00	6.00	<input checked="" type="checkbox"/>	1942: 6" PCC PAVEMENT
1/1/1942	IMPORT ED	OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	SOIL: SP

2/20/2019

Work History Report

Page 2 of 13

Pavement Database: FDOT

Network: VENICE MUNICIPA		Branch: AP		APRON		Section: 4103		Surface:AC	
L.C.D. 1/1/2017		Use: APRON		Rank: P		Length: 900.00 (Ft)		Width: 500.00 (Ft) True Area: 45587.00001 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments			
1/1/2017	CR-AC	Complete Reconstruction - AC	227,935.00	0.00	<input checked="" type="checkbox"/>	4" P-401, 6" MIN P-219 JOINT SEALING PROJECT CONDUCTED IN 1986 1942: 6" PCC PAVEMENT SOIL: SP			
1/1/1986	IMPORT ED	REPAIR	0.00	0.00	<input type="checkbox"/>				
1/1/1942	IMPORT ED	BUILT	0.00	6.00	<input checked="" type="checkbox"/>				
1/1/1942	IMPORT ED	OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>				

Network: VENICE MUNICIPA		Branch: AP		APRON		Section: 4105		Surface:PCC	
L.C.D. 1/1/1942		Use: APRON		Rank: P		Length: 920.00 (Ft)		Width: 120.00 (Ft) True Area: 112872.0000 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments			
1/1/1986	IMPORT ED	REPAIR	0.00	0.00	<input type="checkbox"/>	JOINT SEALING PROJECT CONDUCTED IN 1986 1942: 6" PCC PAVEMENT SOIL: SP			
1/1/1942	IMPORT ED	BUILT	0.00	6.00	<input checked="" type="checkbox"/>				
1/1/1942	IMPORT ED	OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>				

Network: VENICE MUNICIPA		Branch: AP		APRON		Section: 4107		Surface:AC	
L.C.D. 1/1/2017		Use: APRON		Rank: P		Length: 565.00 (Ft)		Width: 160.00 (Ft) True Area: 90832.00002 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments			
1/1/2017	CR-AC	Complete Reconstruction - AC	1,919,285.00	0.00	<input checked="" type="checkbox"/>	4" P-401, 6" MIN P-219			
1/1/1986	IMPORT ED	REPAIR	0.00	0.00	<input type="checkbox"/>	JOINT SEALING PROJECT CONDUCTED IN 1986			
1/1/1942	IMPORT ED	BUILT	0.00	6.00	<input checked="" type="checkbox"/>	1942: 6" PCC PAVEMENT			
1/1/1942	IMPORT ED	OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	SOIL: SP			

Network: VENICE MUNICIPA		Branch: AP		APRON		Section: 4115		Surface:PCC	
L.C.D. 12/25/199		Use: APRON		Rank: P		Length: 275.00 (Ft)		Width: 150.00 (Ft) True Area: 35804 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments			
12/25/1999	NU-IN	New Construction - Initial	0.00	0.00	<input checked="" type="checkbox"/>				

Network: VENICE MUNICIPA		Branch: AP		APRON		Section: 4120		Surface:AC	
L.C.D. 1/1/2018		Use: APRON		Rank: P		Length: 275.00 (Ft)		Width: 203.00 (Ft) True Area: 57693.00001 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments			
1/1/2018	CR-AC	Complete Reconstruction - AC	204,280.00	0.00	<input checked="" type="checkbox"/>	4" P-401, 6" MIN P-219			
12/15/1999	NU-IN	New Construction - Initial	0.00	0.00	<input checked="" type="checkbox"/>				

2/20/2019

Work History Report

Page 3 of 13

Pavement Database: FDOT

Network: VENICE MUNICIPA		Branch: AP	APRON		Section: 4125	Surface: AC
L.C.D. 1/1/2015	Use: APRON	Rank: P	Length: 1,275.00 (Ft)	Width: 42.00 (Ft)	True Area: 53301.00001 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2015	NU-IN	New Construction - Initial	0.00	0.00	<input checked="" type="checkbox"/>	4" P-401SP, 8" P211

Network: VENICE MUNICIPA		Branch: AP	APRON		Section: 4127	Surface: AAC
L.C.D. 1/1/2017	Use: APRON	Rank: P	Length: 470.00 (Ft)	Width: 42.00 (Ft)	True Area: 19505.00000 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2017	ML-OV	MILL and OVERLAY	97,525.00	0.00	<input checked="" type="checkbox"/>	VAR MILL AND OVERLAY UNKN
1/1/2015	NU-IN	New Construction - Initial	0.00	0.00	<input checked="" type="checkbox"/>	4" P-401SP, 8" P211

Network: VENICE MUNICIPA		Branch: AP	APRON		Section: 4130	Surface: AC
L.C.D. 1/1/2015	Use: APRON	Rank: P	Length: 200.00 (Ft)	Width: 50.00 (Ft)	True Area: 5580.000001 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2015	NU-IN	New Construction - Initial	0.00	0.00	<input checked="" type="checkbox"/>	4" P-401SP, 8" P211

Network: VENICE MUNICIPA		Branch: AP	APRON		Section: 4140	Surface: AC
L.C.D. 1/1/2015	Use: APRON	Rank: P	Length: 450.00 (Ft)	Width: 180.00 (Ft)	True Area: 73011.00002 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2015	NU-IN	New Construction - Initial	0.00	0.00	<input checked="" type="checkbox"/>	4" P-401, 8" P-211

Network: VENICE MUNICIPA		Branch: RW 13-31	RUNWAY 13-31		Section: 6105	Surface: AAC
L.C.D. 12/1/2006	Use: RUNWAY	Rank: P	Length: 4,139.00 (Ft)	Width: 100.00 (Ft)	True Area: 413900.0001 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
5/9/2017	ST-SC	Surface Treatment - Seal Coat	0.00	0.00	<input type="checkbox"/>	EMULSIFIED SLURRY SEAL COA
12/1/2006	ML-OL	Mill and Overlay	0.00	0.00	<input checked="" type="checkbox"/>	
1/1/1982	IMPORT ED	OVERLAY	0.00	1.50	<input checked="" type="checkbox"/>	1982: 1.5" P-401 OVERLAY
1/1/1982	IMPORT ED	OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	SOIL: SP
1/1/1942	IMPORT ED	BUILT	0.00	1.50	<input checked="" type="checkbox"/>	1942: 1.5" AC ON 6" LIME ROCK BASE

Network: VENICE MUNICIPA		Branch: RW 13-31	RUNWAY 13-31		Section: 6110	Surface: AAC
L.C.D. 12/1/2006	Use: RUNWAY	Rank: P	Length: 8,400.00 (Ft)	Width: 25.00 (Ft)	True Area: 196950 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
5/9/2017	ST-SC	Surface Treatment - Seal Coat	0.00	0.00	<input type="checkbox"/>	EMULSIFIED SLURRY SEAL COA
12/1/2006	ML-OL	Mill and Overlay	0.00	0.00	<input checked="" type="checkbox"/>	
1/1/1982	IMPORT ED	OVERLAY	0.00	1.50	<input checked="" type="checkbox"/>	1982: 1.5" P-401 OVERLAY
1/1/1982	IMPORT ED	OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	SOIL: SP
1/1/1942	IMPORT ED	BUILT	0.00	1.50	<input checked="" type="checkbox"/>	1942: 1.5" AC ON 6" LIME ROCK BASE

2/20/2019

Work History Report

Page 4 of 13

Pavement Database: FDOT

Network: VENICE MUNICIPA Branch: RW 13-31 RUNWAY 13-31 Section: 6115 Surface: APC
 L.C.D. 12/1/2006 Use: RUNWAY Rank: P Length: 300.00 (Ft) Width: 100.00 (Ft) True Area: 30000.00000 (SqFt)

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
5/9/2017	ST-SC	Surface Treatment - Seal Coat	0.00	0.00	<input type="checkbox"/>	EMULSIFIED SLURRY SEAL COA
12/1/2006	ML-OV	MILL and OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	
1/1/1982	IMPORT ED	OVERLAY	0.00	1.50	<input checked="" type="checkbox"/>	1982 1.5" AC OVERLAY
1/1/1982	IMPORT ED	OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	SOIL: SP
1/1/1942	IMPORT ED	BUILT	0.00	8.00	<input checked="" type="checkbox"/>	1942: 8" PCC PAVEMENT

Network: VENICE MUNICIPA Branch: RW 13-31 RUNWAY 13-31 Section: 6120 Surface: APC
 L.C.D. 12/1/2006 Use: RUNWAY Rank: P Length: 800.00 (Ft) Width: 25.00 (Ft) True Area: 20000.00000 (SqFt)

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
5/9/2017	ST-SC	Surface Treatment - Seal Coat	0.00	0.00	<input type="checkbox"/>	EMULSIFIED SLURRY SEAL COA
12/1/2006	ML-OV	MILL and OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	
1/1/1982	IMPORT ED	OVERLAY	0.00	1.50	<input checked="" type="checkbox"/>	1982: 1.5" AC OVERLAY
1/1/1942	IMPORT ED	BUILT	0.00	8.00	<input checked="" type="checkbox"/>	1942: 8" PCC PAVEMENT

Network: VENICE MUNICIPA Branch: RW 13-31 RUNWAY 13-31 Section: 6125 Surface: APC
 L.C.D. 12/1/2006 Use: RUNWAY Rank: P Length: 300.00 (Ft) Width: 100.00 (Ft) True Area: 30000.00000 (SqFt)

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
5/9/2017	ST-SC	Surface Treatment - Seal Coat	0.00	0.00	<input type="checkbox"/>	EMULSIFIED SLURRY SEAL COA
12/1/2006	ML-OV	MILL and OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	
1/1/1982	IMPORT ED	OVERLAY	0.00	1.50	<input checked="" type="checkbox"/>	1982: 1.5" AC OVERLAY
1/1/1982	IMPORT ED	OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	SOIL: SP
1/1/1942	IMPORT ED	BUILT	0.00	8.00	<input checked="" type="checkbox"/>	1942: 8" PCC

Network: VENICE MUNICIPA Branch: RW 13-31 RUNWAY 13-31 Section: 6130 Surface: APC
 L.C.D. 12/1/2006 Use: RUNWAY Rank: P Length: 800.00 (Ft) Width: 25.00 (Ft) True Area: 20000.00000 (SqFt)

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
5/9/2017	ST-SC	Surface Treatment - Seal Coat	0.00	0.00	<input type="checkbox"/>	
12/1/2006	ML-OV	MILL and OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	
1/1/1982	IMPORT ED	OVERLAY	0.00	1.50	<input checked="" type="checkbox"/>	1982: 1.5" AC OVERLAY
1/1/1982	IMPORT ED	OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	SOIL: SP
1/1/1942	IMPORT ED	BUILT	0.00	8.00	<input checked="" type="checkbox"/>	1942: 8" PCC PAVEMENT

2/20/2019

Work History Report

Page 5 of 13

Pavement Database: FDOT

Network: VENICE MUNICIPA		Branch: RW 13-31		Section: 6135		Surface: AAC
L.C.D. 1/1/2013	Use: RUNWAY	Rank: P	Length: 1,000.00 (Ft)	Width: 100.00 (Ft)	True Area: 26100 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
5/9/2017	ST-SC	Surface Treatment - Seal Coat	0.00	0.00	<input type="checkbox"/>	EMULSIFIED SLURRY SEAL COA
1/1/2013	ML-OV	MILL and OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	1" ML & 1.5"-4" OL P401
12/1/2006	ML-OL	Mill and Overlay	0.00	0.00	<input checked="" type="checkbox"/>	
1/1/1982	IMPORT ED	OVERLAY	0.00	1.50	<input checked="" type="checkbox"/>	1982: 1.5" P-401 OVERLAY
1/1/1982	IMPORT ED	OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	SOIL: SP
1/1/1942	IMPORT ED	BUILT	0.00	1.50	<input checked="" type="checkbox"/>	1942: 1.5" AC ON 6" LIME ROCK BASE

Network: VENICE MUNICIPA		Branch: RW 13-31		Section: 6140		Surface: AAC
L.C.D. 1/1/2013	Use: RUNWAY	Rank: P	Length: 500.00 (Ft)	Width: 25.00 (Ft)	True Area: 13050 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
5/9/2017	ST-SC	Surface Treatment - Seal Coat	0.00	0.00	<input type="checkbox"/>	EMULSIFIED SLURRY SEAL COA
1/1/2013	ML-OV	MILL and OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	1" ML & 1.5"-4" OL P401
12/1/2006	ML-OL	Mill and Overlay	0.00	0.00	<input checked="" type="checkbox"/>	
1/1/1982	IMPORT ED	OVERLAY	0.00	1.50	<input checked="" type="checkbox"/>	1982: 1.5" P-401 OVERLAY
1/1/1982	IMPORT ED	OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	SOIL: SP
1/1/1942	IMPORT ED	BUILT	0.00	1.50	<input checked="" type="checkbox"/>	1942: 1.5" AC ON 6" LIME ROCK BASE

Network: VENICE MUNICIPA		Branch: RW 13-31		Section: 6145		Surface: AC
L.C.D. 5/9/2017	Use: RUNWAY	Rank: P	Length: 645.00 (Ft)	Width: 100.00 (Ft)	True Area: 64500.00001 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
5/9/2017	NC-AC	New Construction - AC	0.00	0.00	<input checked="" type="checkbox"/>	4" P-401, 8" P-211

Network: VENICE MUNICIPA		Branch: RW 13-31		Section: 6150		Surface: AC
L.C.D. 5/9/2017	Use: RUNWAY	Rank: P	Length: 1,290.00 (Ft)	Width: 25.00 (Ft)	True Area: 32250.00000 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
5/9/2017	NC-AC	New Construction - AC	0.00	0.00	<input checked="" type="checkbox"/>	4" P-401, 8" P-211

Network: VENICE MUNICIPA		Branch: RW 5-23		Section: 6205		Surface: AC
L.C.D. 1/1/2013	Use: RUNWAY	Rank: P	Length: 4,148.50 (Ft)	Width: 100.00 (Ft)	True Area: 255000 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2013	CR-AC	Complete Reconstruction - AC	0.00	0.00	<input checked="" type="checkbox"/>	PARTIAL RECON: 4" P-401, 5" P-21
1/1/1942	IMPORT ED	BUILT	0.00	1.50	<input checked="" type="checkbox"/>	1942: 1.5" AC ON 6" LIME ROCK BASE
1/1/1942	IMPORT ED	OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	SOIL: SP

2/20/2019

Work History Report

Page 6 of 13

Pavement Database: FDOT

Network: VENICE MUNICIPA Branch: RW 5-23 RUNWAY 5-23 Section: 6210 Surface: AAC
 L.C.D. 1/1/2013 Use: RUNWAY Rank: P Length: 8,100.00 (Ft) Width: 25.00 (Ft) True Area: 350820 (SqFt)

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2013	ML-OV	MILL and OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	1" ML & VAR 1.5" TO 4" OL
1/1/1942	IMPORT ED	BUILT	0.00	1.50	<input checked="" type="checkbox"/>	1942: 1.5" AC ON 6" LIME ROCK BASE
1/1/1942	IMPORT ED	OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	SOIL: SP

Network: VENICE MUNICIPA Branch: RW 5-23 RUNWAY 5-23 Section: 6215 Surface: AC
 L.C.D. 1/1/2013 Use: RUNWAY Rank: P Length: 300.00 (Ft) Width: 100.00 (Ft) True Area: 18000 (SqFt)

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2013	CR-AC	Complete Reconstruction - AC	0.00	4.00	<input checked="" type="checkbox"/>	4" P-401, 8" P-210
1/1/1986	IMPORT ED	REPAIR	0.00	0.00	<input type="checkbox"/>	1986: JOINT SEAL PROJECT
1/1/1942	IMPORT ED	BUILT	0.00	8.00	<input checked="" type="checkbox"/>	1942: 8" PCC PAVEMENT
1/1/1942	IMPORT ED	OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	SOIL: SP

Network: VENICE MUNICIPA Branch: RW 5-23 RUNWAY 5-23 Section: 6220 Surface: AC
 L.C.D. 1/1/2013 Use: RUNWAY Rank: P Length: 800.00 (Ft) Width: 25.00 (Ft) True Area: 27000 (SqFt)

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2013	CR-AC	Complete Reconstruction - AC	0.00	4.00	<input checked="" type="checkbox"/>	4" P-401, 8" P-210
1/1/1986	IMPORT ED	REPAIR	0.00	0.00	<input type="checkbox"/>	1986: JOINT SEAL PROJECT
1/1/1942	IMPORT ED	BUILT	0.00	8.00	<input checked="" type="checkbox"/>	1942: 8" PCC PAVEMENT
1/1/1942	IMPORT ED	OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	SOIL: SP

Network: VENICE MUNICIPA Branch: RW 5-23 RUNWAY 5-23 Section: 6225 Surface: AC
 L.C.D. 1/1/2013 Use: RUNWAY Rank: P Length: 300.00 (Ft) Width: 100.00 (Ft) True Area: 18000 (SqFt)

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2013	CR-AC	Complete Reconstruction - AC	0.00	4.00	<input checked="" type="checkbox"/>	4" P-401, 8" P-210
1/1/1986	IMPORT ED	REPAIR	0.00	0.00	<input type="checkbox"/>	1986: JOINT SEAL PROJECT
1/1/1942	IMPORT ED	BUILT	0.00	8.00	<input checked="" type="checkbox"/>	1942: 8" PCC PAVEMENT
1/1/1942	IMPORT ED	OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	SOIL: SP

2/20/2019

Work History Report

Page 7 of 13

Pavement Database: FDOT

Network: VENICE MUNICIPA		Branch: RW 5-23		RUNWAY 5-23		Section: 6230	Surface: AC
L.C.D. 1/1/2013		Use: RUNWAY	Rank: P	Length: 800.00 (Ft)	Width: 25.00 (Ft)	True Area: 27000 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments	
1/1/2013	CR-AC	Complete Reconstruction - AC	0.00	4.00	<input checked="" type="checkbox"/>	4" P-401, 8" P-210	
1/1/1986	IMPORT ED	REPAIR	0.00	0.00	<input type="checkbox"/>	1986: JOINT SEAL PROJECT	
1/1/1942	IMPORT ED	BUILT	0.00	8.00	<input checked="" type="checkbox"/>	1942: 8" PCC PAVEMENT	
1/1/1942	IMPORT ED	OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	SOIL: SP	

Network: VENICE MUNICIPA		Branch: RW 5-23		RUNWAY 5-23		Section: 6240	Surface: AC
L.C.D. 1/1/2013		Use: RUNWAY	Rank: P	Length: 400.00 (Ft)	Width: 45.00 (Ft)	True Area: 13680 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments	
1/1/2013	NU-IN	New Construction - Initial	0.00	0.00	<input checked="" type="checkbox"/>	4" P-401, 5" P-210, ON EXISTING 4"	

Network: VENICE MUNICIPA		Branch: RW 5-23		RUNWAY 5-23		Section: 6250	Surface: AC
L.C.D. 1/1/2013		Use: RUNWAY	Rank: P	Length: 400.00 (Ft)	Width: 45.00 (Ft)	True Area: 18000.00000 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments	
1/1/2013	NU-IN	New Construction - Initial	0.00	0.00	<input checked="" type="checkbox"/>	4" P-401, 5" P-210, EXISTING +/- 4"	

Network: VENICE MUNICIPA		Branch: T-HANG		GA T-HANGARS		Section: 605	Surface: AC
L.C.D. 1/1/2003		Use: TAXIWAY	Rank: P	Length: 500.00 (Ft)	Width: 35.00 (Ft)	True Area: 17687 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments	
1/1/2003	NU-IN	New Construction - Initial	0.00	0.00	<input checked="" type="checkbox"/>		

Network: VENICE MUNICIPA		Branch: T-HANG		GA T-HANGARS		Section: 610	Surface: AC
L.C.D. 1/1/2003		Use: TAXIWAY	Rank: P	Length: 500.00 (Ft)	Width: 35.00 (Ft)	True Area: 42593 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments	
1/1/2003	NU-IN	New Construction - Initial	0.00	0.00	<input checked="" type="checkbox"/>		
1/1/1942	NU-IN	New Construction - Initial	0.00	0.00	<input checked="" type="checkbox"/>		

Network: VENICE MUNICIPA		Branch: T-HANG		GA T-HANGARS		Section: 620	Surface: AC
L.C.D. 12/25/199		Use: TAXIWAY	Rank: P	Length: 1,600.00 (Ft)	Width: 75.00 (Ft)	True Area: 103188.0000 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments	
12/25/1994	NU-IN	New Construction - Initial	0.00	0.00	<input checked="" type="checkbox"/>		

Network: VENICE MUNICIPA		Branch: T-HANG		GA T-HANGARS		Section: 705	Surface: AC
L.C.D. 1/1/2003		Use: TAXIWAY	Rank: P	Length: 943.00 (Ft)	Width: 40.00 (Ft)	True Area: 36074.00001 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments	
1/1/2003	NU-IN	New Construction - Initial	0.00	0.00	<input checked="" type="checkbox"/>		
1/1/1942	NU-IN	New Construction - Initial	0.00	0.00	<input checked="" type="checkbox"/>		

2/20/2019

Work History Report

Page 8 of 13

Pavement Database: FDOT

Network: VENICE MUNICIPA		Branch: T-HANG	GA T-HANGARS		Section: 708	Surface: AC
L.C.D. 12/25/199	Use: TAXIWAY	Rank: P	Length: 390.00 (Ft)	Width: 30.00 (Ft)	True Area: 11509 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
12/25/1997	NU-IN	New Construction - Initial	0.00	0.00	<input checked="" type="checkbox"/>	

Network: VENICE MUNICIPA		Branch: T-HANG	GA T-HANGARS		Section: 710	Surface: AC
L.C.D. 12/25/199	Use: TAXIWAY	Rank: P	Length: 1,000.00 (Ft)	Width: 50.00 (Ft)	True Area: 42414 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
12/25/1994	NU-IN	New Construction - Initial	0.00	0.00	<input checked="" type="checkbox"/>	

Network: VENICE MUNICIPA		Branch: T-HANG	GA T-HANGARS		Section: 715	Surface: AC
L.C.D. 1/1/2012	Use: TAXIWAY	Rank: P	Length: 700.00 (Ft)	Width: 50.00 (Ft)	True Area: 12818 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2012	NU-IN	New Construction - Initial	0.00	0.00	<input checked="" type="checkbox"/>	2" P-401SP, 6" LIMEROCK BASE, O

Network: VENICE MUNICIPA		Branch: T-HANG	GA T-HANGARS		Section: 720	Surface: AC
L.C.D. 1/1/2012	Use: TAXIWAY	Rank: P	Length: 250.00 (Ft)	Width: 50.00 (Ft)	True Area: 5418.000001 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2012	NU-IN	New Construction - Initial	0.00	0.00	<input checked="" type="checkbox"/>	2" P-401SP, 6" LIMEROCK BASE, O

Network: VENICE MUNICIPA		Branch: T-HANG	GA T-HANGARS		Section: 725	Surface: AC
L.C.D. 1/1/2012	Use: TAXIWAY	Rank: P	Length: 600.00 (Ft)	Width: 35.00 (Ft)	True Area: 17455 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2012	NU-IN	New Construction - Initial	0.00	0.00	<input checked="" type="checkbox"/>	2" P-401SP, 6" LIMEROCK BASE, O

Network: VENICE MUNICIPA		Branch: T-HANG	GA T-HANGARS		Section: 730	Surface: AAC
L.C.D. 11/1/2013	Use: TAXIWAY	Rank: P	Length: 1,000.00 (Ft)	Width: 50.00 (Ft)	True Area: 18001.000000 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
11/1/2013	ML-OV	MILL and OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	1"-2" MILL AND OVERLAY
12/25/1994	NU-IN	New Construction - Initial	0.00	0.00	<input checked="" type="checkbox"/>	

Network: VENICE MUNICIPA		Branch: T-HANG	GA T-HANGARS		Section: 735	Surface: AC
L.C.D. 1/1/2018	Use: TAXIWAY	Rank: P	Length: 870.00 (Ft)	Width: 25.00 (Ft)	True Area: 21879.000000 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2018	NC-AC	New Construction - AC	0.00	0.00	<input checked="" type="checkbox"/>	2" F-334 SURFACE COURSE, OVE

2/20/2019

Work History Report

Page 9 of 13

Pavement Database: FDOT

Network: VENICE MUNICIPA		Branch: TW A		TAXIWAY A		Section: 105	Surface: AC
L.C.D. 1/1/2015		Use: TAXIWAY		Rank: P	Length: 1,395.00 (Ft)	Width: 35.00 (Ft)	True Area: 55145.00001 (SqFt)
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments	
1/1/2015	CR-AC	Complete Reconstruction - AC	0.00	4.00	<input checked="" type="checkbox"/>	TW REALIGN 4" P-401SP, 8" P210, 1986: 2" AC OVERLAY	
1/1/1986	IMPORT ED	OVERLAY	0.00	2.00	<input checked="" type="checkbox"/>		
1/1/1986	IMPORT ED	OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	SIOL: SP	
1/1/1942	IMPORT ED	BUILT	0.00	1.50	<input checked="" type="checkbox"/>	1942: 1.5" AC ON 6" LIME ROCK BASE	

Network: VENICE MUNICIPA		Branch: TW A		TAXIWAY A		Section: 110	Surface: AC
L.C.D. 1/1/2015		Use: TAXIWAY		Rank: P	Length: 1,450.00 (Ft)	Width: 35.00 (Ft)	True Area: 53584.00001 (SqFt)
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments	
1/1/2015	CR-AC	Complete Reconstruction - AC	0.00	0.00	<input checked="" type="checkbox"/>	TW REALIGN 4" P-401SP, 8" P211 1986: 2" AC OVERLAY	
1/1/1986	IMPORT ED	OVERLAY	0.00	2.00	<input checked="" type="checkbox"/>		
1/1/1986	IMPORT ED	OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	SOIL: SP	
1/1/1942	IMPORT ED	BUILT	0.00	6.00	<input checked="" type="checkbox"/>	1942: 6" PCC PAVEMENT	

Network: VENICE MUNICIPA		Branch: TW A		TAXIWAY A		Section: 115	Surface: AC
L.C.D. 1/1/2015		Use: TAXIWAY		Rank: P	Length: 1,333.00 (Ft)	Width: 50.00 (Ft)	True Area: 52281.00001 (SqFt)
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments	
1/1/2015	CR-AC	Complete Reconstruction - AC	0.00	0.00	<input checked="" type="checkbox"/>	TW REALIGN 4" P-401SP, 8" P210, 1986: 2" AC OVERLAY	
1/1/1986	IMPORT ED	OVERLAY	0.00	2.00	<input checked="" type="checkbox"/>		
1/1/1986	IMPORT ED	OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	SOIL: SP	
1/1/1942	IMPORT ED	BUILT	0.00	1.50	<input checked="" type="checkbox"/>	1942: 1.5" AC ON 6" LIME ROCK BASE	

Network: VENICE MUNICIPA		Branch: TW A		TAXIWAY A		Section: 120	Surface: AC
L.C.D. 1/1/2013		Use: TAXIWAY		Rank: P	Length: 200.00 (Ft)	Width: 50.00 (Ft)	True Area: 9988 (SqFt)
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments	
1/1/2013	NU-IN	New Construction - Initial	0.00	0.00	<input checked="" type="checkbox"/>	4" P-401, 5" BASE P-210, 4" EXISTI	

Network: VENICE MUNICIPA		Branch: TW A		TAXIWAY A		Section: 125	Surface: AAC
L.C.D. 12/1/2006		Use: TAXIWAY		Rank: P	Length: 125.00 (Ft)	Width: 50.00 (Ft)	True Area: 5738.000000 (SqFt)
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments	
12/1/2006	ML-OV	MILL and OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	RW ML & OL 1986: 2" AC OVERLAY	
1/1/1986	IMPORT ED	OVERLAY	0.00	2.00	<input checked="" type="checkbox"/>		
1/1/1986	IMPORT ED	OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	SOIL: SP	
1/1/1942	IMPORT ED	BUILT	0.00	1.50	<input checked="" type="checkbox"/>	1942: 1.5" AC ON 6" LIME ROCK BASE	

2/20/2019

Work History Report

Page 10 of 13

Pavement Database: FDOT

Network: VENICE MUNICIPA		Branch: TW B		TAXIWAY B		Section: 220	Surface: AC
L.C.D. 1/1/2017		Use: TAXIWAY	Rank: P	Length: 800.00 (Ft)	Width: 35.00 (Ft)	True Area: 30324.00000 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments	
1/1/2017	CR-AC	Complete Reconstruction - AC	151,620.00	0.00	<input checked="" type="checkbox"/>	4" P-401, 6" MIN P-220	
1/1/1942	NU-IN	New Construction - Initial	0.00	0.00	<input checked="" type="checkbox"/>		

Network: VENICE MUNICIPA		Branch: TW B		TAXIWAY B		Section: 225	Surface: AC
L.C.D. 1/1/2013		Use: TAXIWAY	Rank: P	Length: 350.00 (Ft)	Width: 35.00 (Ft)	True Area: 12448.00000 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments	
1/1/2013	NU-IN	New Construction - Initial	0.00	0.00	<input checked="" type="checkbox"/>	4" P-401, 5" BASE P-210, 4" EXISTI	

Network: VENICE MUNICIPA		Branch: TW B		TAXIWAY B		Section: 230	Surface: AC
L.C.D. 1/1/2017		Use: TAXIWAY	Rank: P	Length: 460.00 (Ft)	Width: 35.00 (Ft)	True Area: 17274.00000 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments	
1/1/2017	CR-AC	Complete Reconstruction - AC	86,370.00	0.00	<input checked="" type="checkbox"/>	4" P-401, 6" MIN P-220	
1/1/1942	NU-IN	New Construction - Initial	0.00	0.00	<input checked="" type="checkbox"/>		

Network: VENICE MUNICIPA		Branch: TW B		TAXIWAY B		Section: 235	Surface: AC
L.C.D. 5/9/2017		Use: TAXIWAY	Rank: P	Length: 230.00 (Ft)	Width: 50.00 (Ft)	True Area: 23085.00000 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments	
5/9/2017	CR-AC	Complete Reconstruction - AC	115,425.00	0.00	<input checked="" type="checkbox"/>	4" P-401, 8" P-211	
1/1/1942	NU-IN	New Construction - Initial	0.00	0.00	<input checked="" type="checkbox"/>		

Network: VENICE MUNICIPA		Branch: TW C		TAXIWAY C		Section: 315	Surface: AC
L.C.D. 1/1/2015		Use: TAXIWAY	Rank: P	Length: 2,103.00 (Ft)	Width: 40.00 (Ft)	True Area: 84284.00002 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments	
1/1/2015	CR-AC	Complete Reconstruction - AC	0.00	0.00	<input checked="" type="checkbox"/>	4" P-401, 8" P-210	
1/1/1970	IMPORT ED	BUILT	0.00	1.50	<input checked="" type="checkbox"/>	1970: 1.5" AC - SRD TYPE I ON 6" P-211 ON 8" P-154 SHELL SUBBASE	
1/1/1970	IMPORT ED	OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	SOIL: SP	

Network: VENICE MUNICIPA		Branch: TW D		TAXIWAY D		Section: 400	Surface: AC
L.C.D. 5/9/2017		Use: TAXIWAY	Rank: P	Length: 645.00 (Ft)	Width: 50.00 (Ft)	True Area: 39559.00001 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments	
5/9/2017	NC-AC	New Construction - AC	0.00	0.00	<input checked="" type="checkbox"/>	4" P-401, 8" P-211	

2/20/2019

Work History Report

Page 11 of 13

Pavement Database: FDOT

Network: VENICE MUNICIPA		Branch: TW D	TAXIWAY D		Section: 405	Surface: AC
L.C.D. 5/9/2017	Use: TAXIWAY	Rank: P	Length: 1,902.00 (Ft)	Width: 40.00 (Ft)	True Area: 76074.00002 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
5/9/2017	CR-AC	Complete Reconstruction - AC	373,055.00	0.00	<input checked="" type="checkbox"/>	4" P-401, 8" P-210
1/1/1970	IMPORT ED	BUILT	0.00	1.50	<input checked="" type="checkbox"/>	1970: 1.5" AC - SRD TYPE I ON 6" P-211 ON 8" P-154 SHELL SUBBASE
1/1/1970	IMPORT ED	OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	SOIL: SP

Network: VENICE MUNICIPA		Branch: TW D	TAXIWAY D		Section: 410	Surface: AC
L.C.D. 1/1/2013	Use: TAXIWAY	Rank: P	Length: 200.00 (Ft)	Width: 35.00 (Ft)	True Area: 18193.00000 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2013	NU-IN	New Construction - Initial	0.00	0.00	<input checked="" type="checkbox"/>	4" P-401, 5" BASE P-210, 4" EXISTI

Network: VENICE MUNICIPA		Branch: TW E	TAXIWAY E		Section: 505	Surface: AC
L.C.D. 1/1/2013	Use: TAXIWAY	Rank: P	Length: 1,722.00 (Ft)	Width: 35.00 (Ft)	True Area: 62102.00001 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2013	CR-AC	Complete Reconstruction - AC	0.00	0.00	<input checked="" type="checkbox"/>	4" P-401, 8" P-210
1/1/1970	IMPORT ED	BUILT	0.00	1.50	<input checked="" type="checkbox"/>	1970: 1.5" AC - SRD TYPE-I ON 6" P-211 ON 8" P-154 SHELL SUBBASE
1/1/1970	IMPORT ED	OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	SOIL: SP

Network: VENICE MUNICIPA		Branch: TW E	TAXIWAY E		Section: 510	Surface: AC
L.C.D. 1/1/2013	Use: TAXIWAY	Rank: P	Length: 175.00 (Ft)	Width: 50.00 (Ft)	True Area: 10168.00000 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
5/9/2017	ST-SC	Surface Treatment - Seal Coat	0.00	0.00	<input type="checkbox"/>	EMULSIFIED PLUS SEAL COAT
1/1/2013	NU-IN	New Construction - Initial	0.00	0.00	<input checked="" type="checkbox"/>	4" P-401, 5" BASE P-210, EXISTING

Network: VENICE MUNICIPA		Branch: TW E	TAXIWAY E		Section: 515	Surface: AC
L.C.D. 1/1/2015	Use: TAXIWAY	Rank: P	Length: 330.00 (Ft)	Width: 50.00 (Ft)	True Area: 22576.00000 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2015	NU-IN	New Construction - Initial	0.00	0.00	<input checked="" type="checkbox"/>	

Network: VENICE MUNICIPA		Branch: TW E	TAXIWAY E		Section: 550	Surface: AC
L.C.D. 1/1/2013	Use: TAXIWAY	Rank: P	Length: 208.00 (Ft)	Width: 37.00 (Ft)	True Area: 9260.000002 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2013	CR-AC	Complete Reconstruction - AC	0.00	0.00	<input checked="" type="checkbox"/>	4" P-401, 8" BASE P-210
1/1/1942	IMPORT ED	BUILT	0.00	1.50	<input checked="" type="checkbox"/>	1942: 1.5" AC ON 6" LIME ROCK BASE
1/1/1942	IMPORT ED	OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	SOIL: SP

2/20/2019

Work History Report

Page 12 of 13

Pavement Database: FDOT

Network: VENICE MUNICIPA **Branch:** TW F TAXIWAY F **Section:** 450 **Surface:** AC
L.C.D. 5/9/2017 **Use:** TAXIWAY **Rank:** P **Length:** 205.00 (Ft) **Width:** 40.00 (Ft) **True Area:** 11590.00000 (SqFt)

Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
5/9/2017	CR-AC	Complete Reconstruction - AC	63,935.00	0.00	<input checked="" type="checkbox"/>	4" P-401, 8" P-210
1/1/1942	IMPORT ED	BUILT	0.00	1.50	<input checked="" type="checkbox"/>	1942: 1.5" AC ON 6" LIME ROCK BASE
1/1/1942	IMPORT ED	OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	SOIL: SP

Summary:

Work Description	Section Count	Area Total (SqFt)	Thickness Avg (in)	Thickness STD (in)
BUILT	29	2,316,484.00	4.07	2.92
Complete Reconstruction - AC	24	1,391,953.00	0.83	1.62
MILL and OVERLAY	14	1,183,214.00	0.00	0.00
New Construction - AC	4	158,188.00	0.00	0.00
New Construction - Initial	30	972,977.00	0.00	0.00
OVERLAY	40	3,213,232.00	0.50	0.77
REPAIR	8	504,209.00	0.00	0.00
Surface Treatment - Seal Coat	9	760,168.00	0.00	0.00

2/20/2019

Branch Condition Report

Page 1 of 2

Pavement Database: FDOT

Branch ID	Number of Sections	Sum Section Length (Ft)	Avg Section Width (Ft)	True Area (SqFt)	Use	Average PCI	Standard Deviation PCI	Weighted Average PCI
AP	10	6,200.00	164.00	659,103.00	APRON	80.30	34.27	79.70
AP CENTE	2	1,500.00	125.00	166,523.00	APRON	100.00	0.00	100.00
AP RU	2	298.00	150.00	46,397.00	APRON	94.00	0.00	94.00
RW 13-31	10	18,174.00	62.50	846,750.00	RUNWAY	79.20	14.41	77.75
RW 5-23	8	15,248.50	58.13	727,500.00	RUNWAY	92.25	2.73	92.37
T-HANG	11	8,353.00	43.18	329,036.00	TAXIWAY	74.73	16.84	66.51
TW A	5	4,503.00	44.00	176,736.00	TAXIWAY	86.20	10.24	90.76
TW B	4	1,840.00	38.75	83,131.00	TAXIWAY	97.75	3.90	98.65
TW C	1	2,103.00	40.00	84,284.00	TAXIWAY	94.00	0.00	94.00
TW D	3	2,747.00	41.67	133,826.00	TAXIWAY	98.00	2.83	99.18
TW E	4	2,435.00	43.00	104,106.00	TAXIWAY	93.50	0.87	93.80
TW F	1	205.00	40.00	11,590.00	TAXIWAY	100.00	0.00	100.00

2/20/2019**Branch Condition Report****Page 2 of 2***Pavement Database: FDOT*

Use Category	Number of Sections	Total Area (SqFt)	Arithmetic Average PCI	Average STD PCI	Weighted Average PCI
APRON	14	872,023.00	85.07	29.97	84.34
RUNWAY	18	1,574,250.00	85.00	12.68	84.51
TAXIWAY	29	922,709.00	86.41	15.08	84.80
ALL	61	3,368,982.00	85.69	19.03	84.54

Pavement Database: FDOT

NetworkId: VNC

Branch ID	Section ID	Last Const. Date	Surface	Use	Rank	Lanes	True Area (SqFt)	Last Inspection Date	Age At Inspection	PCI
AP	4102	1/1/2018	AC	APRON	P	0	164,918.00	1/1/2018	0	100
AP	4103	1/1/2017	AC	APRON	P	0	45,587.00	1/1/2017	0	100
AP	4105	1/1/1942	PCC	APRON	P	0	112,872.00	10/25/2018	76	21
AP	4107	1/1/2017	AC	APRON	P	0	90,832.00	1/1/2017	0	100
AP	4115	12/25/1999	PCC	APRON	P	0	35,804.00	10/25/2018	19	4
AP	4120	1/1/2018	AC	APRON	P	0	57,693.00	1/1/2018	0	100
AP	4125	1/1/2015	AC	APRON	P	0	53,301.00	10/25/2018	3	91
AP	4127	1/1/2017	AAC	APRON	P	0	19,505.00	1/1/2017	0	100
AP	4130	1/1/2015	AC	APRON	P	0	5,580.00	10/25/2018	3	94
AP	4140	1/1/2015	AC	APRON	P	0	73,011.00	10/25/2018	3	93
AP CENTER	4405	1/1/2017	AC	APRON	S	0	120,111.00	1/1/2017	0	100
AP CENTER	4415	1/1/2017	AC	APRON	S	0	46,412.00	1/1/2017	0	100
AP RU	5105	1/1/2015	AC	APRON	P	0	26,551.00	10/25/2018	3	94
AP RU	5110	1/1/2015	AC	APRON	P	0	19,846.00	10/25/2018	3	94
RW 13-31	6105	12/1/2006	AAC	RUNWAY	P	0	413,900.00	10/25/2018	12	76
RW 13-31	6110	12/1/2006	AAC	RUNWAY	P	0	196,950.00	10/25/2018	12	74
RW 13-31	6115	12/1/2006	APC	RUNWAY	P	0	30,000.00	10/25/2018	12	67
RW 13-31	6120	12/1/2006	APC	RUNWAY	P	0	20,000.00	10/25/2018	12	61
RW 13-31	6125	12/1/2006	APC	RUNWAY	P	0	30,000.00	10/25/2018	12	68
RW 13-31	6130	12/1/2006	APC	RUNWAY	P	0	20,000.00	10/25/2018	12	63
RW 13-31	6135	1/1/2013	AAC	RUNWAY	P	0	26,100.00	10/25/2018	5	93
RW 13-31	6140	1/1/2013	AAC	RUNWAY	P	0	13,050.00	10/25/2018	5	90
RW 13-31	6145	5/9/2017	AC	RUNWAY	P	0	64,500.00	5/9/2017	0	100
RW 13-31	6150	5/9/2017	AC	RUNWAY	P	0	32,250.00	5/9/2017	0	100
RW 5-23	6205	1/1/2013	AC	RUNWAY	P	0	255,000.00	10/25/2018	5	90
RW 5-23	6210	1/1/2013	AAC	RUNWAY	P	0	350,820.00	10/25/2018	5	94
RW 5-23	6215	1/1/2013	AC	RUNWAY	P	0	18,000.00	10/25/2018	5	94
RW 5-23	6220	1/1/2013	AC	RUNWAY	P	0	27,000.00	10/25/2018	5	92
RW 5-23	6225	1/1/2013	AC	RUNWAY	P	0	18,000.00	10/25/2018	5	94
RW 5-23	6230	1/1/2013	AC	RUNWAY	P	0	27,000.00	10/25/2018	5	94
RW 5-23	6240	1/1/2013	AC	RUNWAY	P	0	13,680.00	10/25/2018	5	86

RW 5-23	6250	1/1/2013	AC	RUNWAY	P	0	18,000.00	10/25/2018	5	94
T-HANG	605	1/1/2003	AC	TAXIWAY	P	0	17,687.00	10/25/2018	15	69
T-HANG	610	1/1/2003	AC	TAXIWAY	P	0	42,593.00	10/25/2018	15	66
T-HANG	620	12/25/1994	AC	TAXIWAY	P	0	103,188.00	10/25/2018	24	54
T-HANG	705	1/1/2003	AC	TAXIWAY	P	0	36,074.00	10/25/2018	15	79
T-HANG	708	12/25/1997	AC	TAXIWAY	P	0	11,509.00	10/25/2018	21	68
T-HANG	710	12/25/1994	AC	TAXIWAY	P	0	42,414.00	10/25/2018	24	49
T-HANG	715	1/1/2012	AC	TAXIWAY	P	0	12,818.00	10/25/2018	6	92
T-HANG	720	1/1/2012	AC	TAXIWAY	P	0	5,418.00	10/25/2018	6	92
T-HANG	725	1/1/2012	AC	TAXIWAY	P	0	17,455.00	10/25/2018	6	94
T-HANG	730	11/1/2013	AAC	TAXIWAY	P	0	18,001.00	10/25/2018	5	59
T-HANG	735	1/1/2018	AC	TAXIWAY	P	0	21,879.00	1/1/2018	0	100
TW A	105	1/1/2015	AC	TAXIWAY	P	0	55,145.00	10/25/2018	3	94
TW A	110	1/1/2015	AC	TAXIWAY	P	0	53,584.00	10/25/2018	3	89
TW A	115	1/1/2015	AC	TAXIWAY	P	0	52,281.00	10/25/2018	3	92
TW A	120	1/1/2013	AC	TAXIWAY	P	0	9,988.00	10/25/2018	5	90
TW A	125	12/1/2006	AAC	TAXIWAY	P	0	5,738.00	10/25/2018	12	66
TW B	220	1/1/2017	AC	TAXIWAY	P	0	30,324.00	1/1/2017	0	100
TW B	225	1/1/2013	AC	TAXIWAY	P	0	12,448.00	10/25/2018	5	91
TW B	230	1/1/2017	AC	TAXIWAY	P	0	17,274.00	1/1/2017	0	100
TW B	235	5/9/2017	AC	TAXIWAY	P	0	23,085.00	5/9/2017	0	100
TW C	315	1/1/2015	AC	TAXIWAY	P	0	84,284.00	10/25/2018	3	94
TW D	400	5/9/2017	AC	TAXIWAY	P	0	39,559.00	5/9/2017	0	100
TW D	405	5/9/2017	AC	TAXIWAY	P	0	76,074.00	5/9/2017	0	100
TW D	410	1/1/2013	AC	TAXIWAY	P	0	18,193.00	10/25/2018	5	94
TW E	505	1/1/2013	AC	TAXIWAY	P	0	62,102.00	10/25/2018	5	94
TW E	510	1/1/2013	AC	TAXIWAY	P	0	10,168.00	10/25/2018	5	92
TW E	515	1/1/2015	AC	TAXIWAY	P	0	22,576.00	10/25/2018	3	94
TW E	550	1/1/2013	AC	TAXIWAY	P	0	9,260.00	10/25/2018	5	94
TW F	450	5/9/2017	AC	TAXIWAY	P	0	11,590.00	5/9/2017	0	100

Pavement Database: FDOT

Age Category	Average Age at Inspection	Total Area (SqFt)	Number of Sections	Arithmetic Average PCI	Standard Deviation PCI	Weighted Average PCI
00-02		861,593.00	16	100.00	0.00	100.00
03-05	4	1,352,969.00	27	91.26	6.64	92.08
06-10	6	35,691.00	3	92.67	0.94	92.98
11-15	13	812,942.00	10	68.90	5.45	73.59
16-20	19	35,804.00	1	4.00	0.00	4.00
21-25	23	157,111.00	3	57.00	8.04	53.68
50+	76	112,872.00	1	21.00	0.00	21.00
ALL	7	3,368,982.00	61	85.69	19.03	84.54

Appendix B

Airfield Pavement Localized Maintenance and Repair and
Major Rehabilitation



Table B-1 Localized Maintenance and Repair Needs based on Current Condition

Network ID	Branch ID	Section ID	Distress Code	Description	Severity	Distress Qty	Distress Unit	Percent Distress	Work Description	Work Qty	Work Unit	Unit Cost	Work Cost
VNC	AP	4105	63	LINEAR CR	Medium	242.85	Slabs	67.3%	FDOT - CRACK SEALING - PCC	4553.5	Ft	\$ 4.25	\$ 19,360.00
VNC	AP	4105	63	LINEAR CR	High	13.13	Slabs	3.6%	FDOT - PATCHING - PCC PARTIAL DEPTH	807.3	SqFt	\$ 72.00	\$ 58,150.00
VNC	AP	4105	65	JT SEAL DMG	Medium	157.53	Slabs	43.6%	FDOT - JOINT SEAL - PCC	5327.1	Ft	\$ 2.75	\$ 14,650.00
VNC	AP	4105	65	JT SEAL DMG	High	203.47	Slabs	56.4%	FDOT - JOINT SEAL - PCC	6880.9	Ft	\$ 2.75	\$ 18,930.00
VNC	AP	4105	66	SMALL PATCH	Medium	26.25	Slabs	7.3%	FDOT - PATCHING - PCC PARTIAL DEPTH	71	SqFt	\$ 72.00	\$ 5,090.00
VNC	AP	4105	67	LARGE PATCH	High	6.56	Slabs	1.8%	FDOT - PATCHING - PCC FULL DEPTH	807.3	SqFt	\$ 150.00	\$ 121,140.00
VNC	AP	4105	72	SHAT. SLAB	Low	13.13	Slabs	3.6%	FDOT - CRACK SEALING - PCC	492.1	Ft	\$ 4.25	\$ 2,100.00
VNC	AP	4105	72	SHAT. SLAB	Medium	6.56	Slabs	1.8%	FDOT - SLAB REPLACEMENT - PCC	2051.6	SqFt	\$ 30.00	\$ 61,540.00
VNC	AP	4105	74	JOINT SPALL	Low	19.69	Slabs	5.5%	FDOT - CRACK SEALING - PCC	32.2	Ft	\$ 4.25	\$ 140.00
VNC	AP	4105	74	JOINT SPALL	Medium	32.82	Slabs	9.1%	FDOT - PATCHING - PCC PARTIAL DEPTH	212.1	SqFt	\$ 72.00	\$ 15,270.00
VNC	AP	4105	75	CORNER SPALL	Low	13.13	Slabs	3.6%	FDOT - CRACK SEALING - PCC	21.7	Ft	\$ 4.25	\$ 100.00
VNC	AP	4115	62	CORNER BREAK	High	8.2	Slabs	6.7%	FDOT - PATCHING - PCC FULL DEPTH	264.8	SqFt	\$ 150.00	\$ 39,720.00
VNC	AP	4115	63	LINEAR CR	Medium	49.2	Slabs	40.0%	FDOT - CRACK SEALING - PCC	922.6	Ft	\$ 4.25	\$ 3,930.00
VNC	AP	4115	65	JT SEAL DMG	High	123	Slabs	100.0%	FDOT - JOINT SEAL - PCC	4524.9	Ft	\$ 2.75	\$ 12,450.00
VNC	AP	4115	67	LARGE PATCH	Medium	24.6	Slabs	20.0%	FDOT - PATCHING - PCC FULL DEPTH	3026.8	SqFt	\$ 150.00	\$ 453,990.00
VNC	AP	4115	72	SHAT. SLAB	Low	8.2	Slabs	6.7%	FDOT - CRACK SEALING - PCC	307.4	Ft	\$ 4.25	\$ 1,310.00
VNC	AP	4115	72	SHAT. SLAB	Medium	49.2	Slabs	40.0%	FDOT - SLAB REPLACEMENT - PCC	15375.2	SqFt	\$ 30.00	\$ 461,250.00
VNC	AP	4115	74	JOINT SPALL	Low	8.2	Slabs	6.7%	FDOT - CRACK SEALING - PCC	13.5	Ft	\$ 4.25	\$ 60.00
VNC	AP	4115	74	JOINT SPALL	Medium	24.6	Slabs	20.0%	FDOT - PATCHING - PCC PARTIAL DEPTH	159.3	SqFt	\$ 72.00	\$ 11,440.00
VNC	AP	4115	74	JOINT SPALL	High	8.2	Slabs	6.7%	FDOT - PATCHING - PCC PARTIAL DEPTH	65.7	SqFt	\$ 72.00	\$ 4,770.00
VNC	AP	4115	75	CORNER SPALL	Low	16.4	Slabs	13.3%	FDOT - CRACK SEALING - PCC	26.9	Ft	\$ 4.25	\$ 120.00
VNC	AP	4115	75	CORNER SPALL	Medium	8.2	Slabs	6.7%	FDOT - PATCHING - PCC PARTIAL DEPTH	21.5	SqFt	\$ 72.00	\$ 1,590.00
VNC	RW 13-31	6105	45	DEPRESSION	Low	136.38	SqFt	0.0%	FDOT - PATCHING - AC FULL DEPTH	187.3	SqFt	\$ 9.00	\$ 1,690.00
VNC	RW 13-31	6105	52	RAVELING	Low	70363.04	SqFt	17.0%	FDOT - SURFACE SEAL	70362.6	SqFt	\$ 0.55	\$ 38,700.00
VNC	RW 13-31	6105	57	WEATHERING	Medium	38468.39	SqFt	9.3%	FDOT - SURFACE SEAL	38468.1	SqFt	\$ 0.55	\$ 21,160.00
VNC	RW 13-31	6110	52	RAVELING	Low	25898.72	SqFt	13.2%	FDOT - SURFACE SEAL	25899	SqFt	\$ 0.55	\$ 14,250.00
VNC	RW 13-31	6115	47	JT REF. CR	Medium	24.02	Ft	0.1%	FDOT - CRACK SEALING - AC	24	Ft	\$ 3.00	\$ 80.00
VNC	RW 13-31	6115	52	RAVELING	Low	3000.01	SqFt	10.0%	FDOT - SURFACE SEAL	2999.9	SqFt	\$ 0.55	\$ 1,660.00
VNC	RW 13-31	6115	57	WEATHERING	Medium	26999.98	SqFt	90.0%	FDOT - SURFACE SEAL	27000.2	SqFt	\$ 0.55	\$ 14,860.00
VNC	RW 13-31	6120	47	JT REF. CR	Medium	120.01	Ft	0.6%	FDOT - CRACK SEALING - AC	120.1	Ft	\$ 3.00	\$ 360.00
VNC	RW 13-31	6120	52	RAVELING	Low	3999.98	SqFt	20.0%	FDOT - SURFACE SEAL	3999.9	SqFt	\$ 0.55	\$ 2,210.00
VNC	RW 13-31	6120	57	WEATHERING	Medium	16000.01	SqFt	80.0%	FDOT - SURFACE SEAL	15999.5	SqFt	\$ 0.55	\$ 8,810.00
VNC	RW 13-31	6125	47	JT REF. CR	Medium	29.99	Ft	0.1%	FDOT - CRACK SEALING - AC	29.9	Ft	\$ 3.00	\$ 90.00
VNC	RW 13-31	6125	52	RAVELING	Low	14850	SqFt	49.5%	FDOT - SURFACE SEAL	14849.9	SqFt	\$ 0.55	\$ 8,170.00
VNC	RW 13-31	6130	47	JT REF. CR	Medium	60.01	Ft	0.3%	FDOT - CRACK SEALING - AC	60	Ft	\$ 3.00	\$ 180.00
VNC	RW 13-31	6130	52	RAVELING	Low	10199.99	SqFt	51.0%	FDOT - SURFACE SEAL	10199.9	SqFt	\$ 0.55	\$ 5,620.00
VNC	RW 5-23	6205	52	RAVELING	Low	1195.33	SqFt	0.5%	FDOT - SURFACE SEAL	1194.8	SqFt	\$ 0.55	\$ 660.00



Network ID	Branch ID	Section ID	Distress Code	Description	Severity	Distress Qty	Distress Unit	Percent Distress	Work Description	Work Qty	Work Unit	Unit Cost	Work Cost
VNC	RW 5-23	6210	52	RAVELING	Low	433.25	SqFt	0.1%	FDOT - SURFACE SEAL	433.8	SqFt	\$ 0.55	\$ 240.00
VNC	T-HANG	605	52	RAVELING	Low	17687.04	SqFt	100.0%	FDOT - SURFACE SEAL	17687.3	SqFt	\$ 0.55	\$ 9,730.00
VNC	T-HANG	610	49	OIL SPILLAGE	N/A	221.52	SqFt	0.5%	FDOT - PATCHING - AC PARTIAL DEPTH	285.2	SqFt	\$ 4.00	\$ 1,150.00
VNC	T-HANG	610	52	RAVELING	Low	42593.01	SqFt	100.0%	FDOT - SURFACE SEAL	42592.8	SqFt	\$ 0.55	\$ 23,430.00
VNC	T-HANG	620	45	DEPRESSION	Low	928.93	SqFt	0.9%	FDOT - PATCHING - AC FULL DEPTH	1055.9	SqFt	\$ 9.00	\$ 9,510.00
VNC	T-HANG	620	52	RAVELING	Low	87367.86	SqFt	84.7%	FDOT - SURFACE SEAL	87367.4	SqFt	\$ 0.55	\$ 48,060.00
VNC	T-HANG	620	52	RAVELING	Medium	14291.03	SqFt	13.9%	FDOT - PATCHING - AC PARTIAL DEPTH	14291.2	SqFt	\$ 4.00	\$ 57,170.00
VNC	T-HANG	620	52	RAVELING	High	428.73	SqFt	0.4%	FDOT - PATCHING - AC PARTIAL DEPTH	428.4	SqFt	\$ 4.00	\$ 1,720.00
VNC	T-HANG	705	52	RAVELING	Low	4439.9	SqFt	12.3%	FDOT - SURFACE SEAL	4440.1	SqFt	\$ 0.55	\$ 2,450.00
VNC	T-HANG	708	48	L & T CR	Medium	260.4	Ft	2.3%	FDOT - CRACK SEALING - AC	260.5	Ft	\$ 3.00	\$ 790.00
VNC	T-HANG	708	52	RAVELING	Low	1301.89	SqFt	11.3%	FDOT - SURFACE SEAL	1302.4	SqFt	\$ 0.55	\$ 720.00
VNC	T-HANG	710	45	DEPRESSION	Low	65.55	SqFt	0.2%	FDOT - PATCHING - AC FULL DEPTH	102.3	SqFt	\$ 9.00	\$ 920.00
VNC	T-HANG	710	52	RAVELING	Low	14183.82	SqFt	33.4%	FDOT - SURFACE SEAL	14183.6	SqFt	\$ 0.55	\$ 7,810.00
VNC	T-HANG	710	52	RAVELING	Medium	11792.62	SqFt	27.8%	FDOT - PATCHING - AC PARTIAL DEPTH	11792.9	SqFt	\$ 4.00	\$ 47,180.00
VNC	T-HANG	730	57	WEATHERING	Medium	1839.44	SqFt	10.2%	FDOT - SURFACE SEAL	1839.6	SqFt	\$ 0.55	\$ 1,020.00
VNC	TW A	120	52	RAVELING	Low	198.7	SqFt	2.0%	FDOT - SURFACE SEAL	199.1	SqFt	\$ 0.55	\$ 110.00
VNC	TW A	125	52	RAVELING	Low	1199.96	SqFt	20.9%	FDOT - SURFACE SEAL	1200.2	SqFt	\$ 0.55	\$ 670.00
VNC	TW A	125	57	WEATHERING	Medium	4537.96	SqFt	79.1%	FDOT - SURFACE SEAL	4538.1	SqFt	\$ 0.55	\$ 2,500.00
VNC	TW B	225	52	RAVELING	Low	125.08	SqFt	1.0%	FDOT - SURFACE SEAL	124.9	SqFt	\$ 0.55	\$ 70.00




Table B-2 10-Year Major Rehabilitation Planning Needs at Section Level

Program Year	Network ID	Branch ID	Section ID	Surface	Area (SF)	PCI Before	Rehabilitation Type	Planning Cost
2020	VNC	AP	4105	PCC	112,872	19	PCC Reconstruction	\$ 2,258,000.00
2020	VNC	AP	4115	PCC	35,804	2	PCC Reconstruction	\$ 717,000.00
2020	VNC	RW 13-31	6120	APC	20,000	60	AC Restoration	\$ 191,000.00
2020	VNC	RW 13-31	6130	APC	20,000	62	AC Restoration	\$ 191,000.00
2020	VNC	T-HANG	610	AC	42,593	64	AC Restoration	\$ 405,000.00
2020	VNC	T-HANG	620	AC	103,188	52	AC Restoration	\$ 981,000.00
2020	VNC	T-HANG	710	AC	42,414	48	AC Restoration	\$ 429,000.00
2020	VNC	T-HANG	730	AAC	18,001	58	AC Restoration	\$ 172,000.00
2020	VNC	TW A	125	AAC	5,738	64	AC Restoration	\$ 55,000.00
2022	VNC	RW 13-31	6115	APC	30,000	64	AC Restoration	\$ 286,000.00
2022	VNC	T-HANG	708	AC	11,509	64	AC Restoration	\$ 110,000.00
2023	VNC	RW 13-31	6125	APC	30,000	64	AC Restoration	\$ 286,000.00
2023	VNC	T-HANG	605	AC	17,687	63	AC Restoration	\$ 169,000.00
2028	VNC	RW 13-31	6110	AAC	196,950	64	AC Restoration	\$ 1,872,000.00



Appendix C

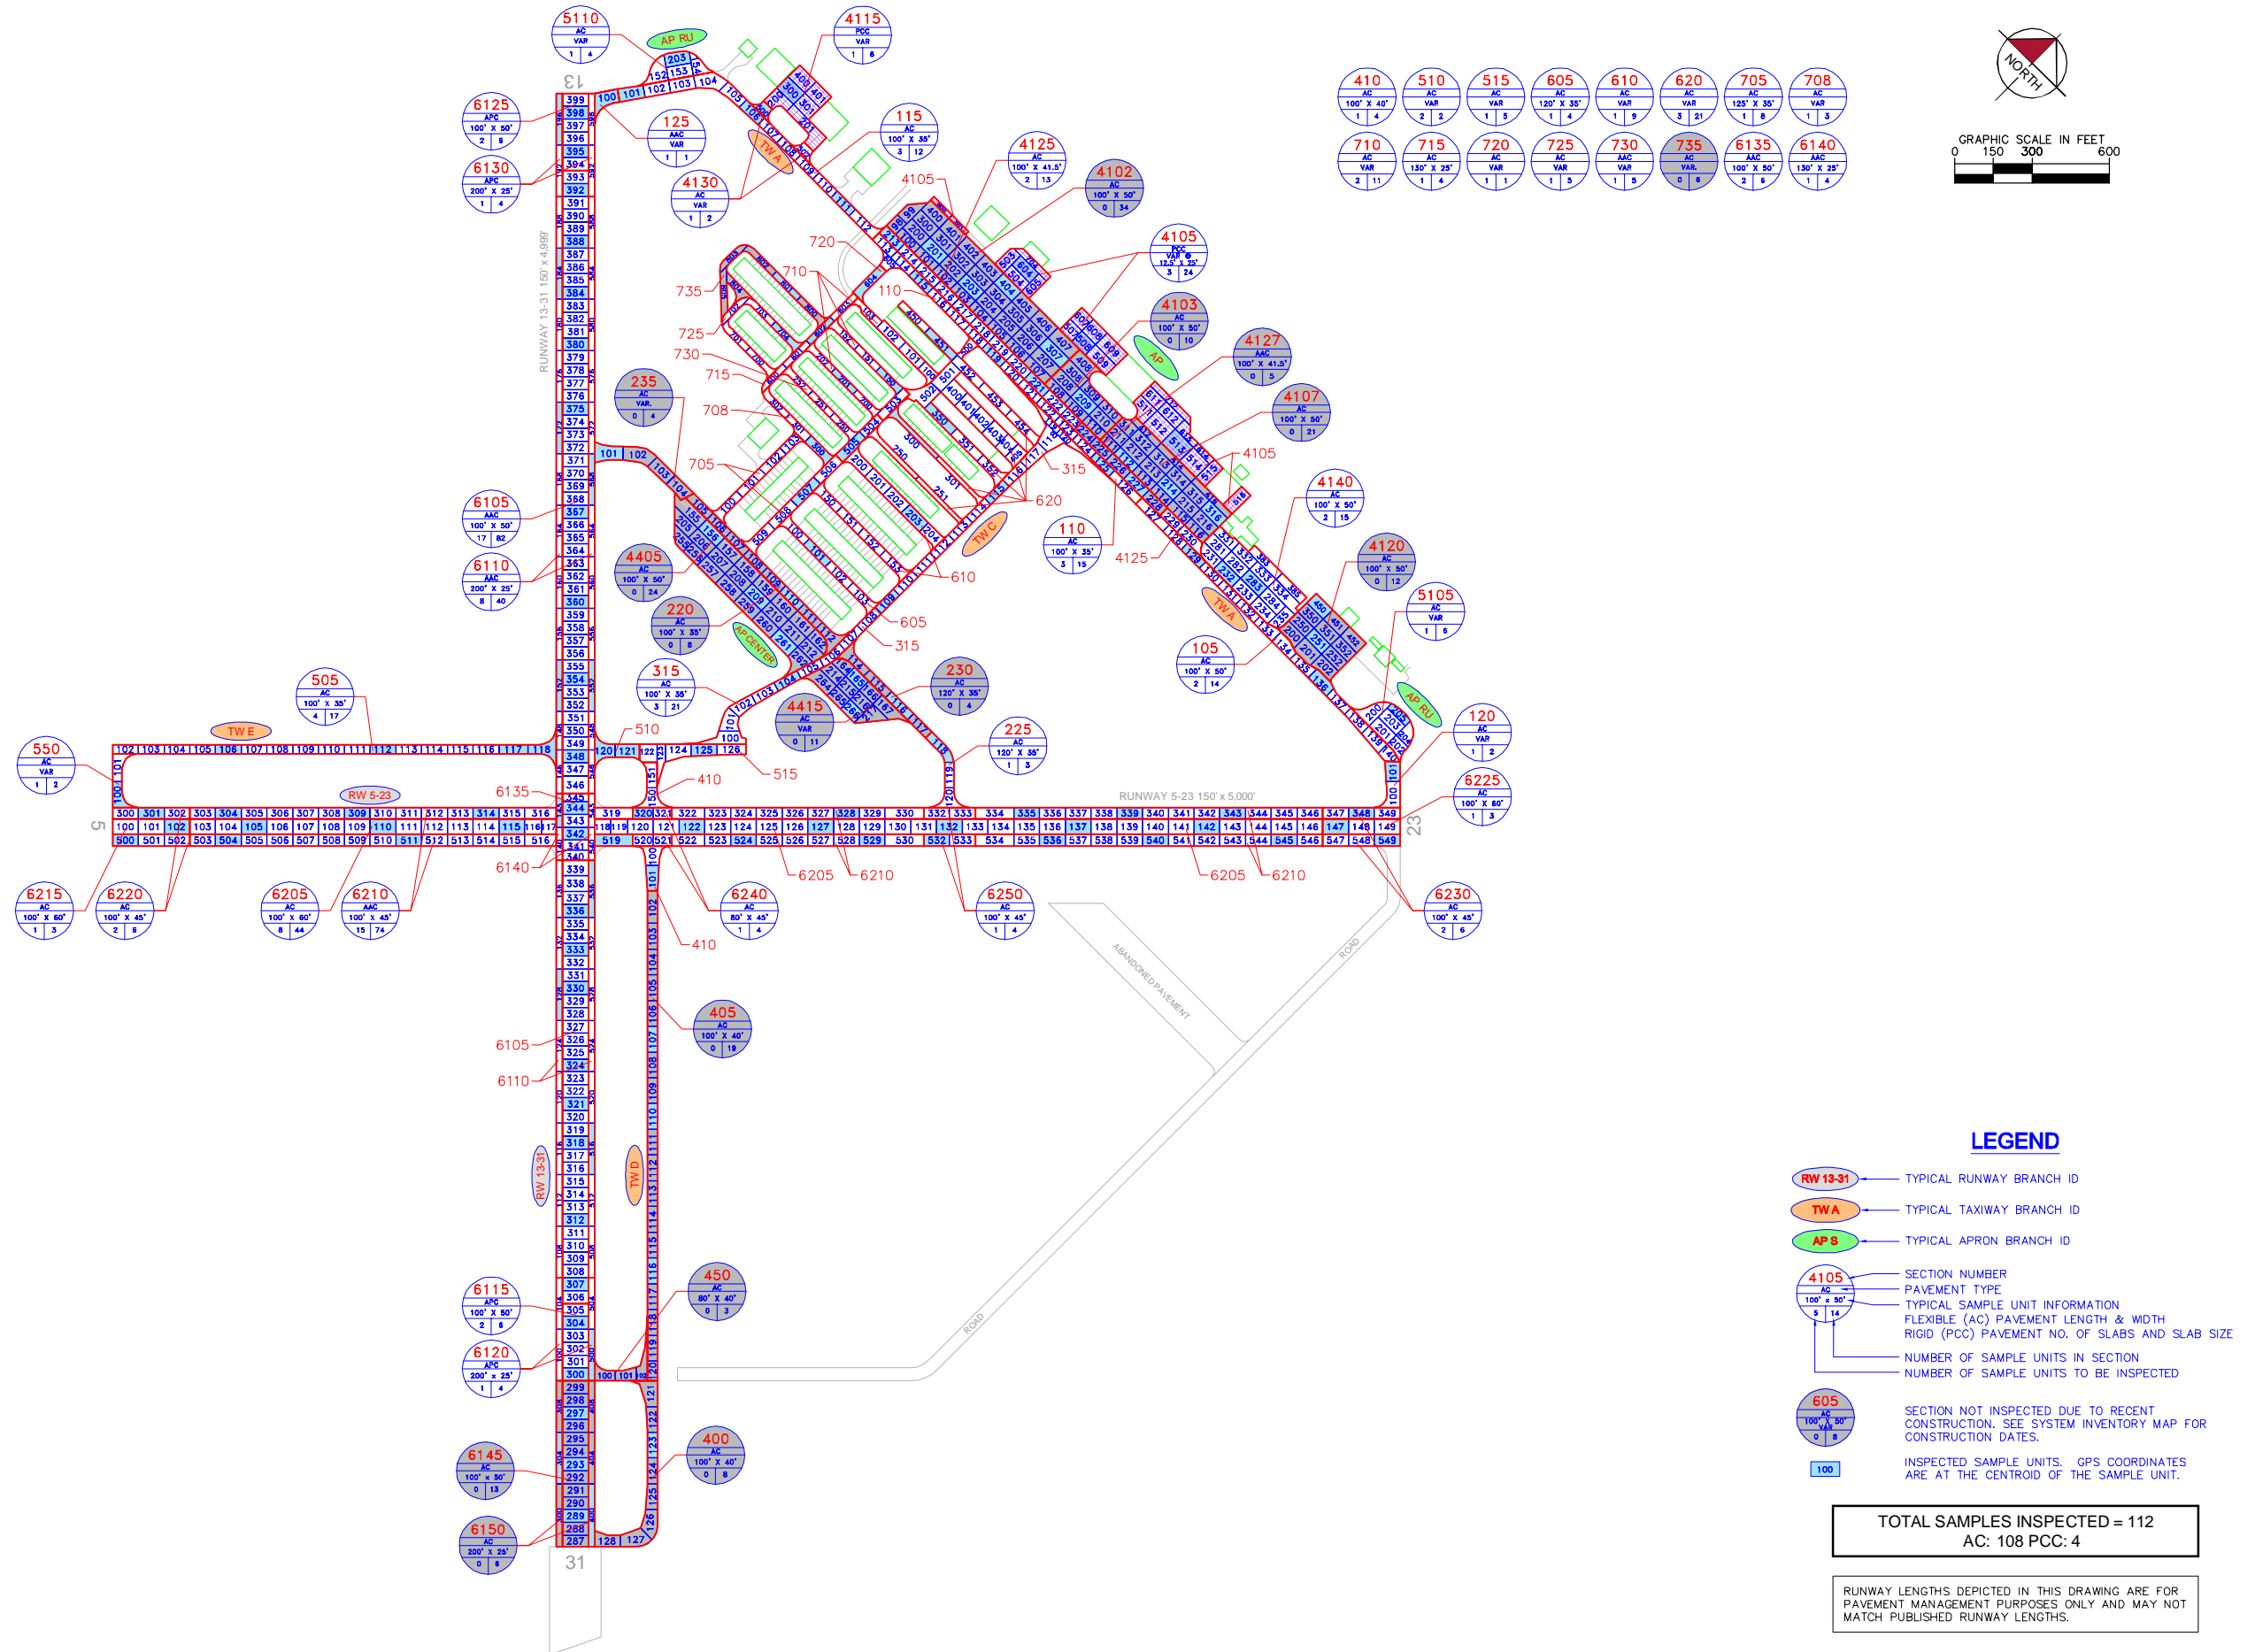Technical Exhibits





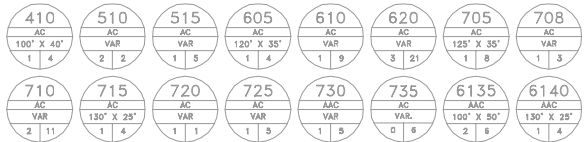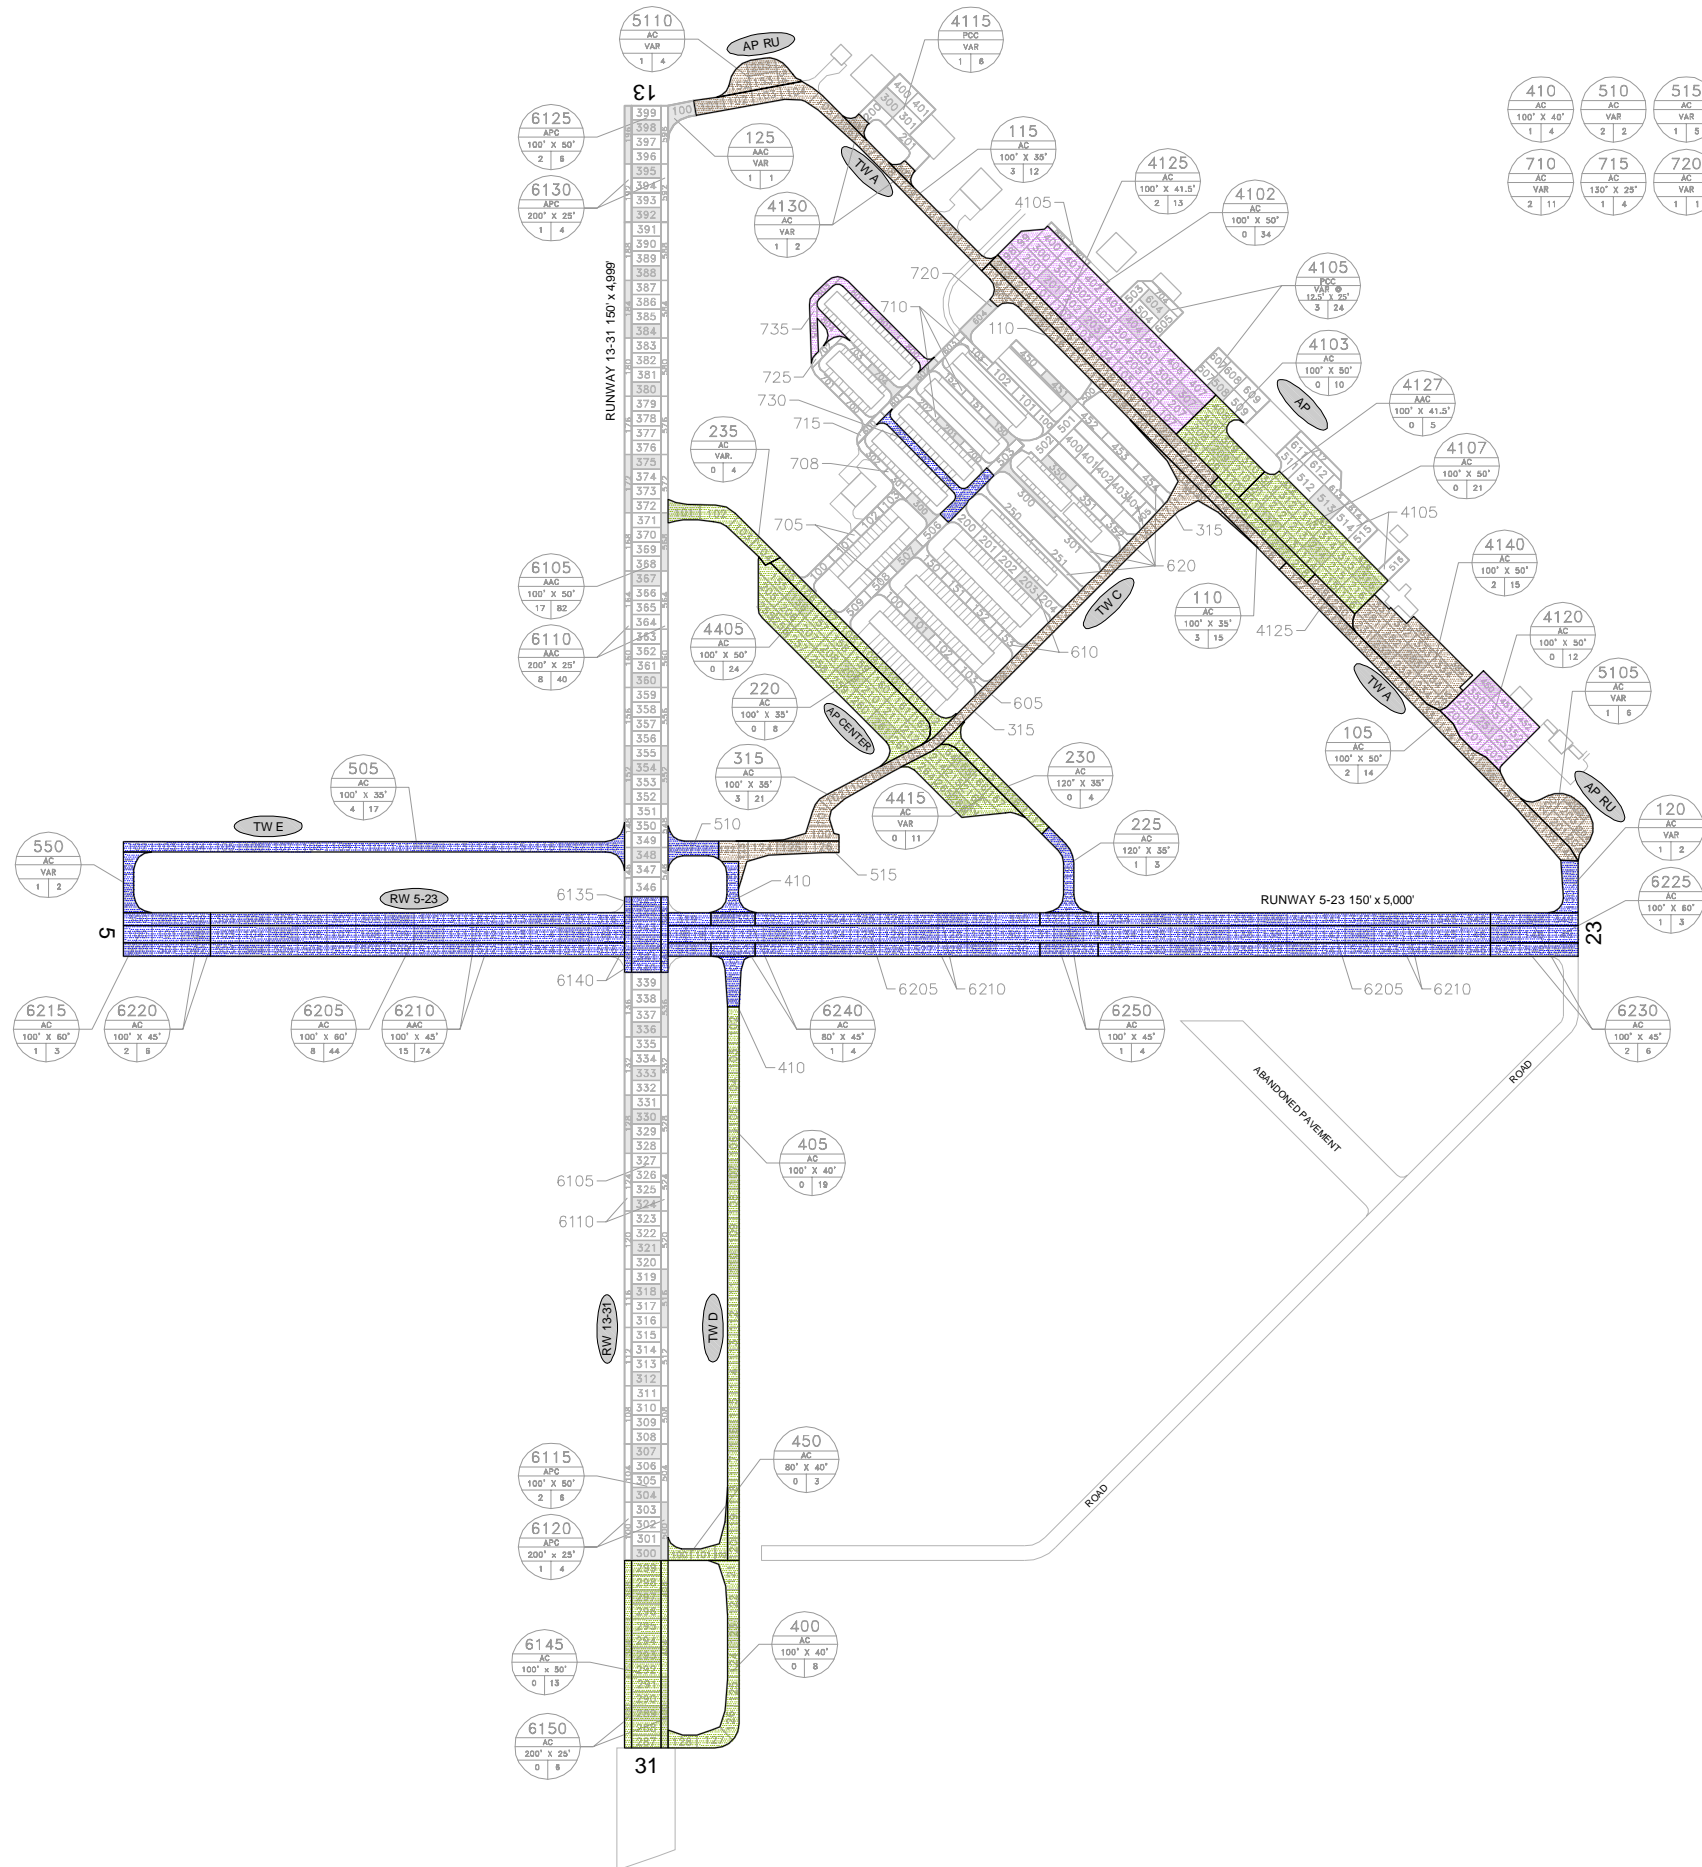001 - AIRFIELD PAVEMENT
NETWORK DEFINITION EXHIBIT



CONSTRUCTION SINCE LAST INSPECTION & ANTICIPATED CONSTRUCTION ACTIVITY		
CONSTRUCTION YEAR	LOCATION	WORK TYPE / PAVEMENT SECTION
2013	RW 5-23, TW A, TW B, TW D, TW E	COMPLETE RECONSTRUCTION - AC / 4" P-401, 5" P-210
2013	RW 5-23, RW 13-31	MILL AND OVERLAY / 1" MILL AND VAR 1.5"-4" OVERLAY
2013	RW 5-23, TW E	COMPLETE RECONSTRUCTION - AC / 4" P-401, 8" P-210
2013	T-HANG	MILL AND OVERLAY / 1"-2" MILL AND OVERLAY
2015	AP RU, AP	COMPLETE RECONSTRUCTION - AC / 4" P-401, 8" P-211
2015	TW A, TW C	COMPLETE RECONSTRUCTION - AC / 4" P-401, 8" P-210
2015	TW E	NEW CONSTRUCTION - AC
2017	AP CENTER, TW B	COMPLETE RECONSTRUCTION - AC / 4" P-401, 6" P-220
2017	AP	COMPLETE RECONSTRUCTION - AC / 4" P-401, 6" P-219
2017	AP	MILL AND OVERLAY
2017	TW B	COMPLETE RECONSTRUCTION - AC / 4" P-401, 8" P-211
2017	RW 13-31, TW D	NEW CONSTRUCTION - AC / 4" P-401, 8" P-211
2017	TW D, TW F	COMPLETE RECONSTRUCTION - AC / 4" P-401, 8" P-210
2018	AP	COMPLETE RECONSTRUCTION - AC / 4" P-401, 6" P-219
2018	T-HANG	NEW CONSTRUCTION - AC / 2" F-334, 6" P-211

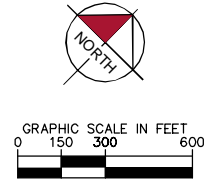
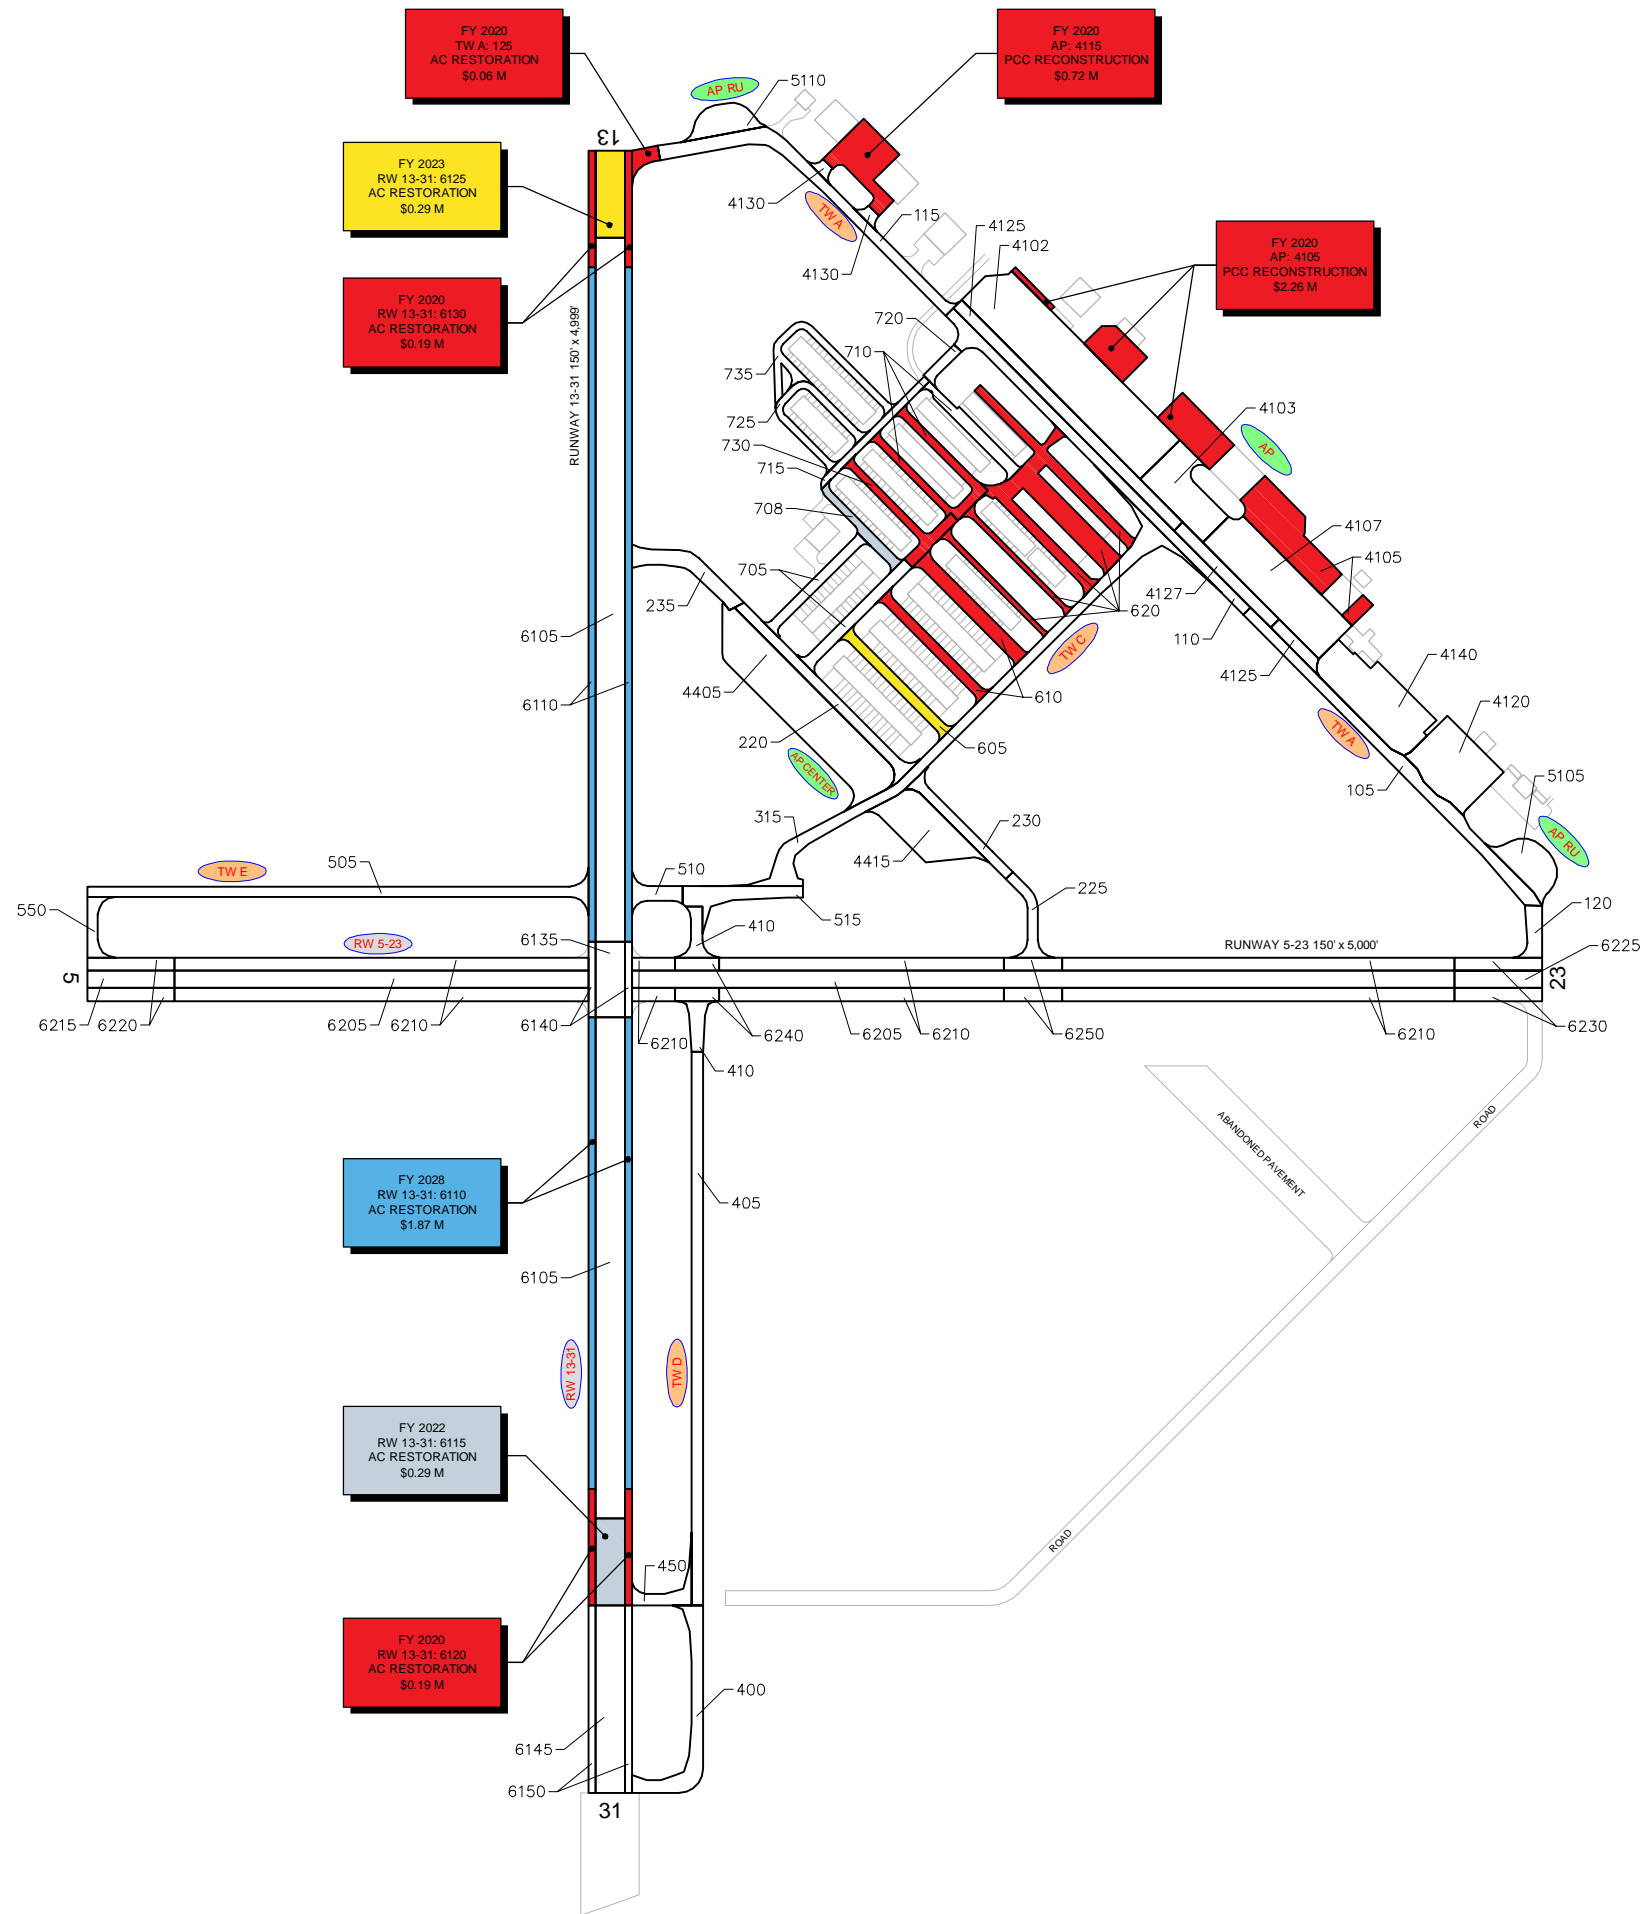
LEGEND

- PROJECTS YEAR 2013
- PROJECTS YEAR 2014
- PROJECTS YEAR 2015
- PROJECTS YEAR 2016
- PROJECTS YEAR 2017
- PROJECTS YEAR 2018
- PROJECTS YEAR 2019
- PROJECTS YEAR 2020
- PROJECTS YEAR 2021
- PROJECTS YEAR 2022

RUNWAY LENGTHS DEPICTED IN THIS DRAWING ARE FOR PAVEMENT MANAGEMENT PURPOSES ONLY AND MAY NOT MATCH PUBLISHED RUNWAY LENGTHS.



003 - AIRFIELD PAVEMENT
CONDITION INDEX EXHIBIT



FY 2020 T-HANG: 610 AC RESTORATION \$0.41 M	FY 2020 T-HANG: 620 AC RESTORATION \$0.98 M	FY 2020 T-HANG: 710 AC RESTORATION \$0.43 M
FY 2020 T-HANG: 730 AC RESTORATION \$0.17 M	FY 2023 T-HANG: 605 AC RESTORATION \$0.17 M	FY 2022 T-HANG: 708 AC RESTORATION \$0.11 M

LEGEND

- RW 13-31 — TYPICAL RUNWAY BRANCH ID
- TW A — TYPICAL TAXIWAY BRANCH ID
- AP S — TYPICAL APRON BRANCH ID

PROGRAM YEAR

2020	2025
2021	2026
2022	2027
2023	2028
2024	2029

"PROGRAM YEAR"
"BRANCH," "SECTION"
"REHAB ACTIVITY"
"EST. COST"

RUNWAY LENGTHS DEPICTED IN THIS DRAWING ARE FOR PAVEMENT MANAGEMENT PURPOSES ONLY AND MAY NOT MATCH PUBLISHED RUNWAY LENGTHS.

Appendix D

Inspection Photograph Documentation



RW 5-23, Section 6205, Sample Unit 115 - Low Severity (50) Patching, Low Severity (52) Raveling, and Low Severity (57) Weathering



RW 5-23, Section 6240, Sample Unit 320 - Low Severity (50) Patching and Low Severity (57) Weathering



RW 13-31, Section 6110, Sample Unit 128 - Low Severity (48) Longitudinal & Transverse Cracking, Low Severity (56) Swelling, and Low Severity (57) Weathering



RW 13-31, Section 6125, Sample Unit 395 - Low and Medium Severity (47) Joint Reflection Cracking, Low Severity (48) Longitudinal & Transverse Cracking, Low Severity (52) Raveling, and Low Severity (57) Weathering



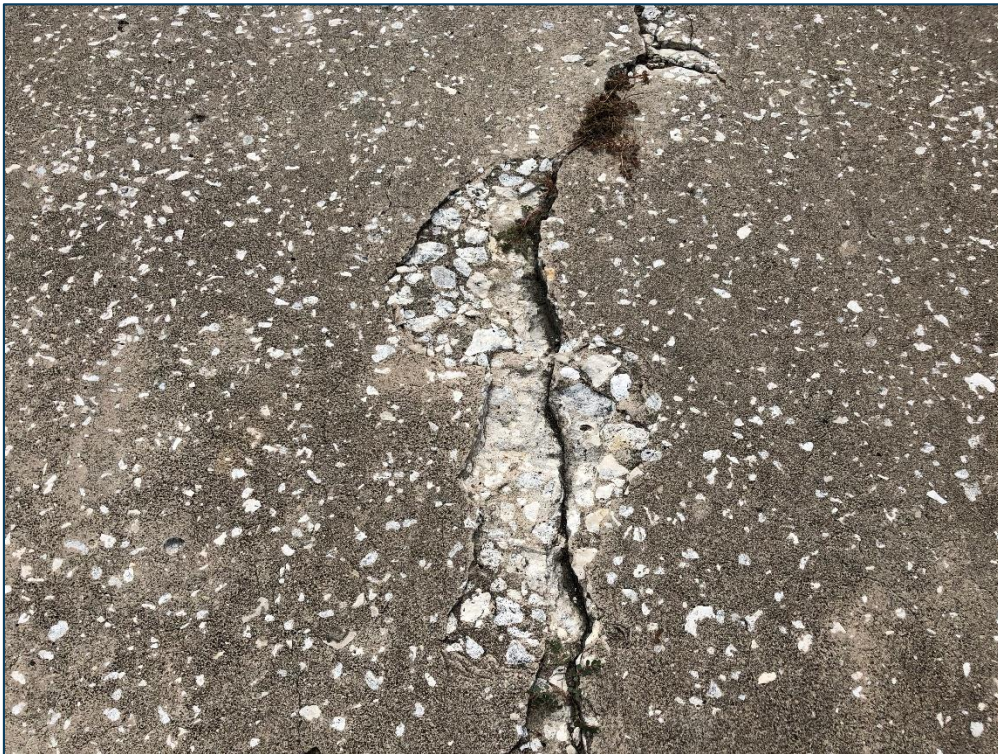
TW A, Section 125, Sample Unit 100 - Low Severity (48) Longitudinal & Transverse Cracking, Low Severity (52) Raveling, and Medium Severity (57) Weathering



TW D, Section 410, Sample Unit 101 - Low Severity (57) Weathering



TWE, Section 515, Sample Unit 125 - (42) Bleeding and Low Severity (57) Weathering



AP, Section 4105, Sample Unit 513 - Medium Severity (63) Linear Cracking



AP, Section 4115, Sample Unit300 - High Severity (65) Joint Seal Damage and Medium Severity (72) Shattered Slab

Appendix E

Inspection Distress Details

Re-Inspection Report

FDOT

Generated Date

2/20/2019

Page 1 of 62

Network:	VNC	Name:	VENICE MUNICIPAL AIRPORT		
Branch:	AP	Name:	APRON	Use:	APRON
Area:	659,103 SqFt				
Section:	4102	of	10	From:	-
To:				-	Last Const.: 1/1/2018
Surface:	AC	Family:	FDOT-SAPMP-RL-AP-PCC	Zone:	
Category:	Rank: P				
Area:	164,918 SqFt	Length:	870 Ft	Width:	193 Ft
Slabs:	528	Slab Length:	13 Ft	Slab Width:	25 Ft
Joint Length:	19,086 Ft				
Shoulder:		Street Type:		Grade:	0
Lanes:	0				
Section Comments:					
Work Date:	1/1/1942	Work Type:	BUILT	Code:	IMPORTED
Is Major M&R:	True				
Work Date:	1/1/1942	Work Type:	OVERLAY	Code:	IMPORTED
Is Major M&R:	True				
Work Date:	1/1/1986	Work Type:	REPAIR	Code:	IMPORTED
Is Major M&R:	False				
Work Date:	1/1/2018	Work Type:	Complete Reconstruction - AC	Code:	CR-AC
Is Major M&R:	True				
Last Insp. Date:	3/11/2015	Total Samples:	87	Surveyed:	9
Conditions:	PCI: 33	NOTE: *** Pre-Construction PCI ***			
Inspection Comments:					
Sample Number:	201	Type:	R	Area:	16.00 Slabs
PCI:	37				
Sample Comments:					
74	JOINT SPALLING	L	4.00	Slabs	
70	SCALING	L	15.00	Slabs	
63	LINEAR CRACKING	M	3.00	Slabs	
75	CORNER SPALLING	M	1.00	Slabs	
65	JOINT SEAL DAMAGE	L	16.00	Slabs	
63	LINEAR CRACKING	L	7.00	Slabs	
74	JOINT SPALLING	M	1.00	Slabs	
66	SMALL PATCH	M	1.00	Slabs	
73	SHRINKAGE CRACKING	N	7.00	Slabs	
Sample Number:	203	Type:	R	Area:	16.00 Slabs
PCI:	41				
Sample Comments:					
74	JOINT SPALLING	L	1.00	Slabs	
63	LINEAR CRACKING	M	7.00	Slabs	
65	JOINT SEAL DAMAGE	L	16.00	Slabs	
63	LINEAR CRACKING	L	4.00	Slabs	
73	SHRINKAGE CRACKING	N	3.00	Slabs	
70	SCALING	L	16.00	Slabs	
Sample Number:	206	Type:	R	Area:	16.00 Slabs
PCI:	38				
Sample Comments:					
63	LINEAR CRACKING	L	7.00	Slabs	
65	JOINT SEAL DAMAGE	L	16.00	Slabs	
74	JOINT SPALLING	L	1.00	Slabs	
75	CORNER SPALLING	L	2.00	Slabs	
63	LINEAR CRACKING	M	4.00	Slabs	
70	SCALING	L	16.00	Slabs	
73	SHRINKAGE CRACKING	N	4.00	Slabs	
67	LARGE PATCH/UTILITY	L	1.00	Slabs	
Sample Number:	210	Type:	R	Area:	16.00 Slabs
PCI:	25				
Sample Comments:					
75	CORNER SPALLING	L	3.00	Slabs	
74	JOINT SPALLING	L	3.00	Slabs	
63	LINEAR CRACKING	M	8.00	Slabs	
74	JOINT SPALLING	M	2.00	Slabs	
70	SCALING	L	16.00	Slabs	

65	JOINT SEAL DAMAGE	L	16.00	Slabs
63	LINEAR CRACKING	L	2.00	Slabs
67	LARGE PATCH/UTILITY	M	1.00	Slabs
73	SHRINKAGE CRACKING	N	4.00	Slabs
63	LINEAR CRACKING	H	1.00	Slabs

Sample Number: 214 **Type:** R **Area:** 16.00 Slabs **PCI:** 16

Sample Comments:

70	SCALING	L	16.00	Slabs
74	JOINT SPALLING	M	2.00	Slabs
66	SMALL PATCH	M	1.00	Slabs
66	SMALL PATCH	M	4.00	Slabs
75	CORNER SPALLING	M	2.00	Slabs
74	JOINT SPALLING	L	5.00	Slabs
65	JOINT SEAL DAMAGE	L	16.00	Slabs
75	CORNER SPALLING	L	2.00	Slabs
63	LINEAR CRACKING	L	1.00	Slabs
73	SHRINKAGE CRACKING	N	4.00	Slabs
63	LINEAR CRACKING	H	3.00	Slabs
63	LINEAR CRACKING	M	4.00	Slabs

Sample Number: 216 **Type:** R **Area:** 20.00 Slabs **PCI:** 47

Sample Comments:

65	JOINT SEAL DAMAGE	L	16.00	Slabs
63	LINEAR CRACKING	L	3.00	Slabs
70	SCALING	L	20.00	Slabs
63	LINEAR CRACKING	M	3.00	Slabs
66	SMALL PATCH	L	1.00	Slabs
74	JOINT SPALLING	M	1.00	Slabs
66	SMALL PATCH	M	3.00	Slabs
75	CORNER SPALLING	L	5.00	Slabs
73	SHRINKAGE CRACKING	N	2.00	Slabs
74	JOINT SPALLING	L	2.00	Slabs

Sample Number: 404 **Type:** R **Area:** 16.00 Slabs **PCI:** 42

Sample Comments:

74	JOINT SPALLING	L	2.00	Slabs
63	LINEAR CRACKING	L	7.00	Slabs
73	SHRINKAGE CRACKING	N	2.00	Slabs
70	SCALING	L	16.00	Slabs
63	LINEAR CRACKING	M	5.00	Slabs
65	JOINT SEAL DAMAGE	L	16.00	Slabs

Sample Number: 513 **Type:** R **Area:** 16.00 Slabs **PCI:** 14

Sample Comments:

63	LINEAR CRACKING	M	11.00	Slabs
65	JOINT SEAL DAMAGE	L	16.00	Slabs
73	SHRINKAGE CRACKING	N	5.00	Slabs
63	LINEAR CRACKING	H	2.00	Slabs
66	SMALL PATCH	H	1.00	Slabs
74	JOINT SPALLING	M	2.00	Slabs
66	SMALL PATCH	M	5.00	Slabs
75	CORNER SPALLING	L	2.00	Slabs
70	SCALING	L	16.00	Slabs
74	JOINT SPALLING	L	3.00	Slabs
63	LINEAR CRACKING	L	4.00	Slabs
71	FAULTING	L	2.00	Slabs

Sample Number: 604 **Type:** R **Area:** 16.00 Slabs **PCI:** 31

Sample Comments:

65	JOINT SEAL DAMAGE	L	16.00	Slabs
63	LINEAR CRACKING	M	10.00	Slabs
74	JOINT SPALLING	L	3.00	Slabs
72	SHATTERED SLAB	L	1.00	Slabs
63	LINEAR CRACKING	L	4.00	Slabs
71	FAULTING	L	2.00	Slabs

Network:	VNC		Name:	VENICE MUNICIPAL AIRPORT								
Branch:	AP	Name:	APRON		Use:	APRON	Area:	659,103 SqFt				
Section:	4103	of 10	From:	-		To:	-		Last Const.:	1/1/2017		
Surface:	AC	Family:	FDOT-SAPMP-RL-AP-PCC		Zone:	Category:		Rank:		P		
Area:	45,587 SqFt		Length:	900 Ft		Width:	500 Ft					
Slabs:	1,228	Slab Length:	13 Ft		Slab Width:	25 Ft		Joint Length:	52,600 Ft			
Shoulder:	Street Type:		Grade:		0		Lanes:	0				
Section Comments:												
Work Date:	1/1/1942		Work Type:				BUILT	Code:	IMPORTED		Is Major M&R:	True
Work Date:	1/1/1942		Work Type:				OVERLAY	Code:	IMPORTED		Is Major M&R:	True
Work Date:	1/1/1986		Work Type:				REPAIR	Code:	IMPORTED		Is Major M&R:	False
Work Date:	1/1/2017		Work Type:				Complete Reconstruction - AC	Code:	CR-AC		Is Major M&R:	True
Last Insp. Date:	3/11/2015		TotalSamples:	87		Surveyed:					9	
Conditions:	PCI:	33	NOTE: *** Pre-Construction PCI ***									
Inspection Comments:												
Sample Number:	201		Type:	R		Area:	16.00 Slabs		PCI:	37		
Sample Comments:												
66	SMALL PATCH		M	1.00 Slabs								
74	JOINT SPALLING		L	4.00 Slabs								
75	CORNER SPALLING		M	1.00 Slabs								
70	SCALING		L	15.00 Slabs								
74	JOINT SPALLING		M	1.00 Slabs								
63	LINEAR CRACKING		M	3.00 Slabs								
63	LINEAR CRACKING		L	7.00 Slabs								
65	JOINT SEAL DAMAGE		L	16.00 Slabs								
73	SHRINKAGE CRACKING		N	7.00 Slabs								
Sample Number:	203		Type:	R		Area:	16.00 Slabs		PCI:	41		
Sample Comments:												
74	JOINT SPALLING		L	1.00 Slabs								
73	SHRINKAGE CRACKING		N	3.00 Slabs								
70	SCALING		L	16.00 Slabs								
63	LINEAR CRACKING		M	7.00 Slabs								
63	LINEAR CRACKING		L	4.00 Slabs								
65	JOINT SEAL DAMAGE		L	16.00 Slabs								
Sample Number:	206		Type:	R		Area:	16.00 Slabs		PCI:	38		
Sample Comments:												
74	JOINT SPALLING		L	1.00 Slabs								
70	SCALING		L	16.00 Slabs								
63	LINEAR CRACKING		L	7.00 Slabs								
67	LARGE PATCH/UTILITY		L	1.00 Slabs								
63	LINEAR CRACKING		M	4.00 Slabs								
73	SHRINKAGE CRACKING		N	4.00 Slabs								
75	CORNER SPALLING		L	2.00 Slabs								
65	JOINT SEAL DAMAGE		L	16.00 Slabs								
Sample Number:	210		Type:	R		Area:	16.00 Slabs		PCI:	25		
Sample Comments:												
70	SCALING		L	16.00 Slabs								
74	JOINT SPALLING		M	2.00 Slabs								
75	CORNER SPALLING		L	3.00 Slabs								
63	LINEAR CRACKING		M	8.00 Slabs								
65	JOINT SEAL DAMAGE		L	16.00 Slabs								
63	LINEAR CRACKING		L	2.00 Slabs								
67	LARGE PATCH/UTILITY		M	1.00 Slabs								
74	JOINT SPALLING		L	3.00 Slabs								
73	SHRINKAGE CRACKING		N	4.00 Slabs								
63	LINEAR CRACKING		H	1.00 Slabs								

Sample Number: 214		Type:	R	Area:		16.00 Slabs	PCI: 16
Sample Comments:							
74	JOINT SPALLING	M		2.00	Slabs		
65	JOINT SEAL DAMAGE	L		16.00	Slabs		
75	CORNER SPALLING	L		2.00	Slabs		
63	LINEAR CRACKING	L		1.00	Slabs		
75	CORNER SPALLING	M		2.00	Slabs		
66	SMALL PATCH	M		1.00	Slabs		
66	SMALL PATCH	M		4.00	Slabs		
63	LINEAR CRACKING	H		3.00	Slabs		
70	SCALING	L		16.00	Slabs		
73	SHRINKAGE CRACKING	N		4.00	Slabs		
74	JOINT SPALLING	L		5.00	Slabs		
63	LINEAR CRACKING	M		4.00	Slabs		
Sample Number: 216		Type:	R	Area:		20.00 Slabs	PCI: 47
Sample Comments:							
70	SCALING	L		20.00	Slabs		
73	SHRINKAGE CRACKING	N		2.00	Slabs		
75	CORNER SPALLING	L		5.00	Slabs		
74	JOINT SPALLING	M		1.00	Slabs		
74	JOINT SPALLING	L		2.00	Slabs		
63	LINEAR CRACKING	L		3.00	Slabs		
66	SMALL PATCH	L		1.00	Slabs		
66	SMALL PATCH	M		3.00	Slabs		
63	LINEAR CRACKING	M		3.00	Slabs		
65	JOINT SEAL DAMAGE	L		16.00	Slabs		
Sample Number: 404		Type:	R	Area:		16.00 Slabs	PCI: 42
Sample Comments:							
65	JOINT SEAL DAMAGE	L		16.00	Slabs		
63	LINEAR CRACKING	L		7.00	Slabs		
73	SHRINKAGE CRACKING	N		2.00	Slabs		
70	SCALING	L		16.00	Slabs		
74	JOINT SPALLING	L		2.00	Slabs		
63	LINEAR CRACKING	M		5.00	Slabs		
Sample Number: 513		Type:	R	Area:		16.00 Slabs	PCI: 14
Sample Comments:							
74	JOINT SPALLING	L		3.00	Slabs		
66	SMALL PATCH	H		1.00	Slabs		
63	LINEAR CRACKING	L		4.00	Slabs		
70	SCALING	L		16.00	Slabs		
73	SHRINKAGE CRACKING	N		5.00	Slabs		
74	JOINT SPALLING	M		2.00	Slabs		
75	CORNER SPALLING	L		2.00	Slabs		
63	LINEAR CRACKING	M		11.00	Slabs		
65	JOINT SEAL DAMAGE	L		16.00	Slabs		
66	SMALL PATCH	M		5.00	Slabs		
71	FAULTING	L		2.00	Slabs		
63	LINEAR CRACKING	H		2.00	Slabs		
Sample Number: 604		Type:	R	Area:		16.00 Slabs	PCI: 31
Sample Comments:							
74	JOINT SPALLING	L		3.00	Slabs		
72	SHATTERED SLAB	L		1.00	Slabs		
63	LINEAR CRACKING	L		4.00	Slabs		
71	FAULTING	L		2.00	Slabs		
65	JOINT SEAL DAMAGE	L		16.00	Slabs		
63	LINEAR CRACKING	M		10.00	Slabs		

Network:	VNC			Name:	VENICE MUNICIPAL AIRPORT				
Branch:	AP	Name:	APRON		Use:	APRON	Area:	659,103 SqFt	
Section:	4105	of 10	From:	-	To:	-	Last Const.:	1/1/1942	
Surface:	PCC	Family:	FDOT-SAPMP-RL-AP-PCC	Zone:		Category:	Rank:	P	
Area:	112,872 SqFt	Length:	920 Ft	Width:	120 Ft				
Slabs:	361	Slab Length:	13 Ft	Slab Width:	25 Ft	Joint Length:	12,208 Ft		
Shoulder:		Street Type:		Grade:	0	Lanes:	0		
Section Comments:									
Work Date:	1/1/1942	Work Type:	BUILT			Code:	IMPORTED	Is Major M&R:	True
Work Date:	1/1/1942	Work Type:	OVERLAY			Code:	IMPORTED	Is Major M&R:	True
Work Date:	1/1/1986	Work Type:	REPAIR			Code:	IMPORTED	Is Major M&R:	False
Last Insp. Date:	10/25/2018	TotalSamples:	24	Surveyed:	3				
Conditions:	PCI: 21								
Inspection Comments:									
Sample Number:	508	Type:	R	Area:	15.00 Slabs	PCI:	24		
Sample Comments:									
63	LINEAR CR	M	4.00	Slabs					
73	SHRINKAGE CR	N	6.00	Slabs					
66	SMALL PATCH	M	4.00	Slabs					
67	LARGE PATCH	H	1.00	Slabs					
65	JT SEAL DMG	H	15.00	Slabs					
66	SMALL PATCH	L	1.00	Slabs					
74	JOINT SPALL	M	1.00	Slabs					
63	LINEAR CR	L	5.00	Slabs					
72	SHAT. SLAB	L	2.00	Slabs					
Sample Number:	513	Type:	R	Area:	24.00 Slabs	PCI:	19		
Sample Comments:									
75	CORNER SPALL	L	2.00	Slabs					
73	SHRINKAGE CR	N	13.00	Slabs					
74	JOINT SPALL	M	4.00	Slabs					
66	SMALL PATCH	L	1.00	Slabs					
63	LINEAR CR	M	20.00	Slabs					
71	FAULTING	L	4.00	Slabs					
63	LINEAR CR	H	2.00	Slabs					
65	JT SEAL DMG	M	24.00	Slabs					
74	JOINT SPALL	L	2.00	Slabs					
63	LINEAR CR	L	2.00	Slabs					
Sample Number:	604	Type:	R	Area:	16.00 Slabs	PCI:	21		
Sample Comments:									
71	FAULTING	L	2.00	Slabs					
63	LINEAR CR	L	2.00	Slabs					
63	LINEAR CR	M	13.00	Slabs					
67	LARGE PATCH	L	1.00	Slabs					
73	SHRINKAGE CR	N	3.00	Slabs					
65	JT SEAL DMG	H	16.00	Slabs					
74	JOINT SPALL	L	1.00	Slabs					
72	SHAT. SLAB	M	1.00	Slabs					

Network:		VNC		Name:		VENICE MUNICIPAL AIRPORT						
Branch:	AP		Name:	APRON		Use:	APRON	Area:	659,103 SqFt			
Section:	4107		of	10	From:	-		To:	-		Last Const.:	1/1/2017
Surface:	AC		Family:	FDOT-SAPMP-RL-AP-PCC		Zone:			Category:	Rank: P		
Area:	90,832 SqFt		Length:	565 Ft		Width:	160 Ft					
Slabs:	1,302		Slab Length:	13 Ft		Slab Width:	25 Ft		Joint Length:	41,200 Ft		
Shoulder:			Street Type:			Grade:	0		Lanes:	0		
Section Comments:												
Work Date:	1/1/1942		Work Type:	OVERLAY				Code:	IMPORTED		Is Major M&R:	True
Work Date:	1/1/1942		Work Type:	BUILT				Code:	IMPORTED		Is Major M&R:	True
Work Date:	1/1/1986		Work Type:	REPAIR				Code:	IMPORTED		Is Major M&R:	False
Work Date:	1/1/2017		Work Type:	Complete Reconstruction - AC				Code:	CR-AC		Is Major M&R:	True
Last Insp. Date:	3/11/2015		TotalSamples:	87		Surveyed:	9					
Conditions:	PCI: 33		NOTE:	*** Pre-Construction PCI ***								
Inspection Comments:												
Sample Number:	201		Type:	R		Area:	16.00 Slabs		PCI:	37		
Sample Comments:												
70	SCALING		L	15.00		Slabs						
66	SMALL PATCH		M	1.00		Slabs						
65	JOINT SEAL DAMAGE		L	16.00		Slabs						
63	LINEAR CRACKING		L	7.00		Slabs						
74	JOINT SPALLING		M	1.00		Slabs						
63	LINEAR CRACKING		M	3.00		Slabs						
73	SHRINKAGE CRACKING		N	7.00		Slabs						
75	CORNER SPALLING		M	1.00		Slabs						
74	JOINT SPALLING		L	4.00		Slabs						
Sample Number:	203		Type:	R		Area:	16.00 Slabs		PCI:	41		
Sample Comments:												
73	SHRINKAGE CRACKING		N	3.00		Slabs						
63	LINEAR CRACKING		M	7.00		Slabs						
70	SCALING		L	16.00		Slabs						
63	LINEAR CRACKING		L	4.00		Slabs						
65	JOINT SEAL DAMAGE		L	16.00		Slabs						
74	JOINT SPALLING		L	1.00		Slabs						
Sample Number:	206		Type:	R		Area:	16.00 Slabs		PCI:	38		
Sample Comments:												
65	JOINT SEAL DAMAGE		L	16.00		Slabs						
63	LINEAR CRACKING		M	4.00		Slabs						
63	LINEAR CRACKING		L	7.00		Slabs						
70	SCALING		L	16.00		Slabs						
74	JOINT SPALLING		L	1.00		Slabs						
73	SHRINKAGE CRACKING		N	4.00		Slabs						
67	LARGE PATCH/UTILITY		L	1.00		Slabs						
75	CORNER SPALLING		L	2.00		Slabs						
Sample Number:	210		Type:	R		Area:	16.00 Slabs		PCI:	25		
Sample Comments:												
63	LINEAR CRACKING		L	2.00		Slabs						
63	LINEAR CRACKING		M	8.00		Slabs						
67	LARGE PATCH/UTILITY		M	1.00		Slabs						
74	JOINT SPALLING		M	2.00		Slabs						
70	SCALING		L	16.00		Slabs						
75	CORNER SPALLING		L	3.00		Slabs						
65	JOINT SEAL DAMAGE		L	16.00		Slabs						
63	LINEAR CRACKING		H	1.00		Slabs						
74	JOINT SPALLING		L	3.00		Slabs						
73	SHRINKAGE CRACKING		N	4.00		Slabs						

Sample Number: 214		Type:	R	Area:		16.00 Slabs	PCI: 16
Sample Comments:							
74	JOINT SPALLING	M		2.00	Slabs		
73	SHRINKAGE CRACKING	N		4.00	Slabs		
75	CORNER SPALLING	M		2.00	Slabs		
65	JOINT SEAL DAMAGE	L		16.00	Slabs		
63	LINEAR CRACKING	M		4.00	Slabs		
63	LINEAR CRACKING	L		1.00	Slabs		
75	CORNER SPALLING	L		2.00	Slabs		
66	SMALL PATCH	M		1.00	Slabs		
63	LINEAR CRACKING	H		3.00	Slabs		
70	SCALING	L		16.00	Slabs		
74	JOINT SPALLING	L		5.00	Slabs		
66	SMALL PATCH	M		4.00	Slabs		
Sample Number: 216		Type:	R	Area:		20.00 Slabs	PCI: 47
Sample Comments:							
63	LINEAR CRACKING	M		3.00	Slabs		
63	LINEAR CRACKING	L		3.00	Slabs		
74	JOINT SPALLING	L		2.00	Slabs		
70	SCALING	L		20.00	Slabs		
73	SHRINKAGE CRACKING	N		2.00	Slabs		
66	SMALL PATCH	M		3.00	Slabs		
75	CORNER SPALLING	L		5.00	Slabs		
74	JOINT SPALLING	M		1.00	Slabs		
65	JOINT SEAL DAMAGE	L		16.00	Slabs		
66	SMALL PATCH	L		1.00	Slabs		
Sample Number: 404		Type:	R	Area:		16.00 Slabs	PCI: 42
Sample Comments:							
65	JOINT SEAL DAMAGE	L		16.00	Slabs		
63	LINEAR CRACKING	M		5.00	Slabs		
63	LINEAR CRACKING	L		7.00	Slabs		
73	SHRINKAGE CRACKING	N		2.00	Slabs		
70	SCALING	L		16.00	Slabs		
74	JOINT SPALLING	L		2.00	Slabs		
Sample Number: 513		Type:	R	Area:		16.00 Slabs	PCI: 14
Sample Comments:							
74	JOINT SPALLING	L		3.00	Slabs		
63	LINEAR CRACKING	M		11.00	Slabs		
63	LINEAR CRACKING	L		4.00	Slabs		
66	SMALL PATCH	M		5.00	Slabs		
70	SCALING	L		16.00	Slabs		
66	SMALL PATCH	H		1.00	Slabs		
65	JOINT SEAL DAMAGE	L		16.00	Slabs		
75	CORNER SPALLING	L		2.00	Slabs		
74	JOINT SPALLING	M		2.00	Slabs		
71	FAULTING	L		2.00	Slabs		
73	SHRINKAGE CRACKING	N		5.00	Slabs		
63	LINEAR CRACKING	H		2.00	Slabs		
Sample Number: 604		Type:	R	Area:		16.00 Slabs	PCI: 31
Sample Comments:							
63	LINEAR CRACKING	L		4.00	Slabs		
63	LINEAR CRACKING	M		10.00	Slabs		
71	FAULTING	L		2.00	Slabs		
65	JOINT SEAL DAMAGE	L		16.00	Slabs		
74	JOINT SPALLING	L		3.00	Slabs		
72	SHATTERED SLAB	L		1.00	Slabs		

Network:	VNC			Name:	VENICE MUNICIPAL AIRPORT								
Branch:	AP		Name:	APRON		Use:	APRON	Area:	659,103 SqFt				
Section:	4115		of	10	From:	-		To:	-		Last Const.:	12/25/1999	
Surface:	PCC		Family:	FDOT-SAPMP-RL-AP-PCC		Zone:			Category:			Rank:	P
Area:	35,804 SqFt		Length:	275 Ft		Width:	150 Ft						
Slabs:	123		Slab Length:	13 Ft		Slab Width:	25 Ft		Joint Length:	4,525 Ft			
Shoulder:			Street Type:			Grade:	0		Lanes:	0			
Section Comments:													
Work Date:	12/25/1999			Work Type:	New Construction - Initial			Code:	NU-IN		Is Major M&R:	True	
Last Insp. Date:	10/25/2018			TotalSamples:	6		Surveyed:	1					
Conditions:	PCI: 4												
Inspection Comments:													
Sample Number:	300		Type:	R		Area:	15.00 Slabs		PCI:	4			
Sample Comments:													
74	JOINT SPALL		L	1.00		Slabs							
62	CORNER BREAK		H	1.00		Slabs							
72	SHAT. SLAB		M	6.00		Slabs							
63	LINEAR CR		L	1.00		Slabs							
73	SHRINKAGE CR		N	3.00		Slabs							
74	JOINT SPALL		H	1.00		Slabs							
63	LINEAR CR		M	6.00		Slabs							
72	SHAT. SLAB		L	1.00		Slabs							
75	CORNER SPALL		L	2.00		Slabs							
75	CORNER SPALL		M	1.00		Slabs							
74	JOINT SPALL		M	3.00		Slabs							
67	LARGE PATCH		M	3.00		Slabs							
65	JT SEAL DMG		H	15.00		Slabs							

Network:	VNC			Name:	VENICE MUNICIPAL AIRPORT								
Branch:	AP		Name:	APRON		Use:	APRON	Area:	659,103 SqFt				
Section:	4120		of	10	From:	-		To:	-		Last Const.:	1/1/2018	
Surface:	AC		Family:	FDOT-SAPMP-RL-AP-PCC		Zone:			Category:	Rank: P			
Area:	57,693 SqFt		Length:	275 Ft		Width:	203 Ft						
Slabs:	142		Slab Length:	13 Ft		Slab Width:	25 Ft		Joint Length:	4,525 Ft			
Shoulder:			Street Type:			Grade:	0		Lanes:	0			
Section Comments:													
Work Date:	12/15/1999			Work Type:	New Construction - Initial				Code:	NU-IN		Is Major M&R:	True
Work Date:	1/1/2018			Work Type:	Complete Reconstruction - AC				Code:	CR-AC		Is Major M&R:	True
Last Insp. Date:	3/11/2015			TotalSamples:	9		Surveyed:	2					
Conditions:	PCI: 2			NOTE: *** Pre-Construction PCI ***									
Inspection Comments:													
Sample Number:	351		Type:	R		Area:	12.00 Slabs		PCI:	3			
Sample Comments:													
63	LINEAR CRACKING		M	9.00		Slabs							
74	JOINT SPALLING		L	3.00		Slabs							
63	LINEAR CRACKING		L	1.00		Slabs							
74	JOINT SPALLING		H	4.00		Slabs							
65	JOINT SEAL DAMAGE		M	12.00		Slabs							
62	CORNER BREAK		M	3.00		Slabs							
66	SMALL PATCH		H	1.00		Slabs							
66	SMALL PATCH		M	1.00		Slabs							
75	CORNER SPALLING		L	1.00		Slabs							
75	CORNER SPALLING		H	1.00		Slabs							
72	SHATTERED SLAB		M	2.00		Slabs							
70	SCALING		L	3.00		Slabs							
73	SHRINKAGE CRACKING		N	2.00		Slabs							
Sample Number:	450		Type:	R		Area:	19.00 Slabs		PCI:	1			
Sample Comments:													
74	JOINT SPALLING		L	1.00		Slabs							
72	SHATTERED SLAB		L	1.00		Slabs							
70	SCALING		L	1.00		Slabs							
70	SCALING		M	1.00		Slabs							
72	SHATTERED SLAB		H	10.00		Slabs							
74	JOINT SPALLING		M	3.00		Slabs							
63	LINEAR CRACKING		M	3.00		Slabs							
75	CORNER SPALLING		L	1.00		Slabs							
65	JOINT SEAL DAMAGE		L	19.00		Slabs							
72	SHATTERED SLAB		M	5.00		Slabs							

Network:	VNC			Name:	VENICE MUNICIPAL AIRPORT				
Branch:	AP	Name:	APRON	Use:	APRON	Area:	659,103 SqFt		
Section:	4125	of	10	From:	-	To:	-	Last Const.:	1/1/2015
Surface:	AC	Family:	FDOT-SAPMP-RL-AP-AC	Zone:		Category:		Rank:	P
Area:	53,301 SqFt	Length:	1,275 Ft	Width:	42 Ft				
Slabs:		Slab Length:	Ft	Slab Width:	Ft	Joint Length:	Ft		
Shoulder:		Street Type:		Grade:	0	Lanes:	0		
Section Comments:									
Work Date:	1/1/2015	Work Type:	New Construction - Initial			Code:	NU-IN	Is Major M&R:	True
Last Insp. Date:	10/25/2018	TotalSamples:	13	Surveyed:	2				
Conditions:	PCI:	91							
Inspection Comments:									
Sample Number:	213	Type:	R	Area:	4150.00 SqFt	PCI:	90		
Sample Comments:									
48	L & T CR	L	15.00 Ft						
57	WEATHERING	L	4150.00 SqFt						
Sample Number:	221	Type:	R	Area:	4150.00 SqFt	PCI:	92		
Sample Comments:									
48	L & T CR	L	2.00 Ft						
57	WEATHERING	L	4150.00 SqFt						

Network:	VNC			Name:	VENICE MUNICIPAL AIRPORT								
Branch:	AP		Name:	APRON		Use:	APRON		Area:	659,103 SqFt			
Section:	4130		of	10	From:	-		To:	-		Last Const.:	1/1/2015	
Surface:	AC		Family:	FDOT-SAPMP-RL-AP-AC		Zone:			Category:			Rank:	P
Area:	5,580 SqFt		Length:	200 Ft		Width:	50 Ft						
Slabs:			Slab Length:	Ft		Slab Width:	Ft		Joint Length:	Ft			
Shoulder:			Street Type:			Grade:	0		Lanes:	0			
Section Comments:													
Work Date:	1/1/2015		Work Type:	New Construction - Initial				Code:	NU-IN		Is Major M&R:	True	
Last Insp. Date:	10/25/2018		TotalSamples:	2		Surveyed:	1						
Conditions:	PCI: 94												
Inspection Comments:													
Sample Number:	500		Type:	R		Area:	2751.00 SqFt		PCI:	94			
Sample Comments:													
57	WEATHERING		L	2751.00		SqFt							

Network:	VNC			Name:	VENICE MUNICIPAL AIRPORT				
Branch:	AP	Name:	APRON	Use:	APRON	Area:	659,103 SqFt		
Section:	4140	of	10	From:	-	To:	-	Last Const.:	1/1/2015
Surface:	AC	Family:	FDOT-SAPMP-RL-AP-AC	Zone:		Category:		Rank:	P
Area:	73,011 SqFt	Length:	450 Ft	Width:	180 Ft				
Slabs:		Slab Length:	Ft	Slab Width:	Ft	Joint Length:	Ft		
Shoulder:		Street Type:		Grade:	0	Lanes:	0		
Section Comments:									
Work Date:	1/1/2015	Work Type:	New Construction - Initial			Code:	NU-IN	Is Major M&R:	True
Last Insp. Date:	10/25/2018	TotalSamples:	15	Surveyed:	2				
Conditions:	PCI:	93							
Inspection Comments:									
Sample Number:	232	Type:	R	Area:	5000.00 SqFt	PCI:	92		
Sample Comments:									
57	WEATHERING	L	5000.00 SqFt						
48	L & T CR	L	2.00 Ft						
Sample Number:	283	Type:	R	Area:	5000.00 SqFt	PCI:	94		
Sample Comments:									
57	WEATHERING	L	5000.00 SqFt						

Network:	VNC		Name:	VENICE MUNICIPAL AIRPORT							
Branch:	AP CENTER		Name:	CENTER APRON (OLD RW9-27)		Use:	APRON	Area:	166,523 SqFt		
Section:	4405 of 2		From:	-		To:	-		Last Const.:	1/1/2017	
Surface:	AC	Family:	C9N59-GA-AP-AAC-APC		Zone:			Category:	Rank: S		
Area:	120,111 SqFt		Length:	1,200 Ft		Width:	100 Ft				
Slabs:	Slab Length:		Ft		Slab Width:	Ft		Joint Length:	Ft		
Shoulder:	Street Type:		Grade:		0		Lanes:	0			
Section Comments:											
Work Date:	1/1/1942		Work Type: New Construction - Initial				Code:	NU-IN		Is Major M&R:	True
Work Date:	1/1/2017		Work Type: Complete Reconstruction - AC				Code:	CR-AC		Is Major M&R:	True
Last Insp. Date:	3/11/2015		TotalSamples:	39		Surveyed:	4				
Conditions:	PCI: 22		NOTE: *** Pre-Construction PCI ***								
Inspection Comments:											
Sample Number:	102		Type:	R		Area:	5000.00 SqFt		PCI:	25	
Sample Comments:											
52	RAVELING		M	5000.00 SqFt							
43	BLOCK CRACKING		M	5000.00 SqFt							
Sample Number:	155		Type:	R		Area:	5000.00 SqFt		PCI:	23	
Sample Comments:											
52	RAVELING		M	5000.00 SqFt							
45	DEPRESSION		L	32.00 SqFt							
43	BLOCK CRACKING		M	5000.00 SqFt							
Sample Number:	159		Type:	R		Area:	5000.00 SqFt		PCI:	22	
Sample Comments:											
43	BLOCK CRACKING		M	5000.00 SqFt							
52	RAVELING		M	5000.00 SqFt							
45	DEPRESSION		L	45.00 SqFt							
45	DEPRESSION		L	48.00 SqFt							
Sample Number:	207		Type:	R		Area:	5000.00 SqFt		PCI:	17	
Sample Comments:											
52	RAVELING		M	4994.00 SqFt							
45	DEPRESSION		L	30.00 SqFt							
53	RUTTING		L	52.00 SqFt							
52	RAVELING		H	6.00 SqFt							
43	BLOCK CRACKING		M	5000.00 SqFt							
42	BLEEDING		N	10.00 SqFt							

Network:		VNC		Name:		VENICE MUNICIPAL AIRPORT											
Branch:		AP CENTER		Name:		CENTER APRON (OLD RW9-27)		Use:		APRON		Area:		166,523 SqFt			
Section:		4415		of 2		From:		-		To:		-		Last Const.:		1/1/2017	
Surface:		AC		Family:		C9N59-GA-AP-AAC-APC		Zone:		Category:		Rank:		S			
Area:		46,412 SqFt		Length:		300 Ft		Width:		150 Ft							
Slabs:		Slab Length:		Ft		Slab Width:		Ft		Joint Length:		Ft					
Shoulder:		Street Type:		Grade:		0		Lanes:		0							
Section Comments:																	
Work Date:		1/1/1942		Work Type:		New Construction - Initial		Code:		NU-IN		Is Major M&R:		True			
Work Date:		1/1/2017		Work Type:		Complete Reconstruction - AC		Code:		CR-AC		Is Major M&R:		True			
Last Insp. Date:		3/11/2015		TotalSamples:		8		Surveyed:		1							
Conditions:		PCI: 32		NOTE:		*** Pre-Construction PCI ***											
Inspection Comments:																	
Sample Number:		215		Type:		R		Area:		4800.00 SqFt		PCI:		32			
Sample Comments:																	
43		BLOCK CRACKING		L		4800.00 SqFt											
52		RAVELING		M		4800.00 SqFt											
45		DEPRESSION		L		200.00 SqFt											

Network:	VNC		Name:	VENICE MUNICIPAL AIRPORT				
Branch:	AP RU	Name:	RUN-UP APRON AT ENDS OF TW A		Use:	APRON	Area:	46,397 SqFt
Section:	5105	of 2	From:	-	To:	-	Last Const.:	1/1/2015
Surface:	AC	Family:	FDOT-SAPMP-RL-AP-AC	Zone:		Category:	Rank:	P
Area:	26,551 SqFt	Length:	198 Ft	Width:	100 Ft			
Slabs:		Slab Length:	Ft	Slab Width:	Ft	Joint Length:	Ft	
Shoulder:		Street Type:		Grade:	0	Lanes:	0	
Section Comments:								
Work Date:	1/1/1991	Work Type: BUILT			Code:	IMPORTED	Is Major M&R:	True
Work Date:	1/1/1991	Work Type: OVERLAY			Code:	IMPORTED	Is Major M&R:	True
Work Date:	1/1/2015	Work Type: Complete Reconstruction - AC			Code:	CR-AC	Is Major M&R:	True
Last Insp. Date:	10/25/2018	TotalSamples:	6	Surveyed:	1			
Conditions:	PCI: 94							
Inspection Comments:								
Sample Number:	205	Type:	R	Area:	3095.00 SqFt	PCI:	94	
Sample Comments:								
57	WEATHERING	L	3095.00	SqFt				

Network:	VNC		Name:	VENICE MUNICIPAL AIRPORT					
Branch:	AP RU	Name:	RUN-UP APRON AT ENDS OF TW A	Use:	APRON	Area:	46,397 SqFt		
Section:	5110	of 2	From:	-	To:	-	Last Const.:	1/1/2015	
Surface:	AC	Family:	FDOT-SAPMP-RL-AP-AC	Zone:		Category:	Rank:	P	
Area:	19,846 SqFt	Length:	100 Ft	Width:	200 Ft				
Slabs:		Slab Length:	Ft	Slab Width:	Ft	Joint Length:		Ft	
Shoulder:		Street Type:		Grade:	0	Lanes:	0		
Section Comments:									
Work Date:	1/1/1991	Work Type:			BUILT	Code:	IMPORTED	Is Major M&R:	True
Work Date:	1/1/1991	Work Type:			OVERLAY	Code:	IMPORTED	Is Major M&R:	True
Work Date:	1/1/2015	Work Type:			Complete Reconstruction - AC	Code:	CR-AC	Is Major M&R:	True
Last Insp. Date:	10/25/2018	TotalSamples:	4	Surveyed:	1				
Conditions:	PCI:	94							
Inspection Comments:									
Sample Number:	203	Type:	R	Area:	5053.00 SqFt	PCI:	94		
Sample Comments:									
57	WEATHERING	L	5053.00	SqFt					

Network:		VNC		Name:		VENICE MUNICIPAL AIRPORT						
Branch:	RW 13-31		Name:	RUNWAY 13-31		Use:	RUNWAY	Area:	846,750 SqFt			
Section:	6105		of	10	From:	-		To:	-		Last Const.:	12/1/2006
Surface:	AAC		Family:	FDOT-SAPMP-RL-RW-AAC		Zone:			Category:	Rank: P		
Area:	413,900 SqFt		Length:	4,139 Ft		Width:	100 Ft					
Slabs:			Slab Length:	Ft		Slab Width:	Ft		Joint Length:	Ft		
Shoulder:			Street Type:			Grade:	0		Lanes:	0		
Section Comments:												
Work Date:	1/1/1942		Work Type:	BUILT				Code:	IMPORTED		Is Major M&R:	True
Work Date:	1/1/1982		Work Type:	OVERLAY				Code:	IMPORTED		Is Major M&R:	True
Work Date:	1/1/1982		Work Type:	OVERLAY				Code:	IMPORTED		Is Major M&R:	True
Work Date:	12/1/2006		Work Type:	Mill and Overlay				Code:	ML-OL		Is Major M&R:	True
Work Date:	5/9/2017		Work Type:	Surface Treatment - Seal Coat				Code:	ST-SC		Is Major M&R:	False
Last Insp. Date:	10/25/2018		TotalSamples:	82		Surveyed:	17					
Conditions:	PCI: 76											
Inspection Comments:												
Sample Number:	307		Type:	R		Area:	5000.00 SqFt		PCI:	71		
Sample Comments:												
57	WEATHERING		M	4000.00 SqFt								
52	RAVELING		L	1000.00 SqFt								
48	L & T CR		L	70.00 Ft								
Sample Number:	312		Type:	R		Area:	5000.00 SqFt		PCI:	77		
Sample Comments:												
52	RAVELING		L	1000.00 SqFt								
57	WEATHERING		L	4000.00 SqFt								
48	L & T CR		L	26.00 Ft								
Sample Number:	318		Type:	R		Area:	5000.00 SqFt		PCI:	73		
Sample Comments:												
57	WEATHERING		M	950.00 SqFt								
48	L & T CR		L	73.00 Ft								
57	WEATHERING		L	3300.00 SqFt								
52	RAVELING		L	750.00 SqFt								
Sample Number:	321		Type:	R		Area:	5000.00 SqFt		PCI:	73		
Sample Comments:												
57	WEATHERING		M	950.00 SqFt								
48	L & T CR		L	79.00 Ft								
52	RAVELING		L	750.00 SqFt								
57	WEATHERING		L	3300.00 SqFt								
Sample Number:	324		Type:	R		Area:	5000.00 SqFt		PCI:	74		
Sample Comments:												
57	WEATHERING		L	3750.00 SqFt								
48	L & T CR		L	28.00 Ft								
52	RAVELING		L	750.00 SqFt								
57	WEATHERING		M	500.00 SqFt								
Sample Number:	330		Type:	R		Area:	5000.00 SqFt		PCI:	76		
Sample Comments:												
48	L & T CR		L	65.00 Ft								
52	RAVELING		L	1000.00 SqFt								
57	WEATHERING		L	4000.00 SqFt								
Sample Number:	333		Type:	R		Area:	5000.00 SqFt		PCI:	73		
Sample Comments:												

48	L & T CR	L	124.00	Ft
57	WEATHERING	M	550.00	SqFt
57	WEATHERING	L	3700.00	SqFt
52	RAVELING	L	750.00	SqFt
Sample Number: 336 Type: R Area: 5000.00 SqFt PCI: 73				
Sample Comments:				
52	RAVELING	L	750.00	SqFt
48	L & T CR	L	85.00	Ft
57	WEATHERING	L	3300.00	SqFt
57	WEATHERING	M	950.00	SqFt
Sample Number: 348 Type: R Area: 5000.00 SqFt PCI: 73				
Sample Comments:				
48	L & T CR	L	146.00	Ft
57	WEATHERING	L	4000.00	SqFt
52	RAVELING	L	1000.00	SqFt
45	DEPRESSION	L	28.00	SqFt
Sample Number: 354 Type: R Area: 5000.00 SqFt PCI: 78				
Sample Comments:				
57	WEATHERING	L	4250.00	SqFt
48	L & T CR	L	40.00	Ft
52	RAVELING	L	750.00	SqFt
Sample Number: 360 Type: R Area: 5000.00 SqFt PCI: 78				
Sample Comments:				
52	RAVELING	L	750.00	SqFt
57	WEATHERING	L	4250.00	SqFt
48	L & T CR	L	95.00	Ft
Sample Number: 367 Type: R Area: 5000.00 SqFt PCI: 78				
Sample Comments:				
48	L & T CR	L	176.00	Ft
52	RAVELING	L	750.00	SqFt
57	WEATHERING	L	4250.00	SqFt
Sample Number: 375 Type: R Area: 5000.00 SqFt PCI: 76				
Sample Comments:				
57	WEATHERING	L	4000.00	SqFt
48	L & T CR	L	80.00	Ft
52	RAVELING	L	1000.00	SqFt
Sample Number: 380 Type: R Area: 5000.00 SqFt PCI: 77				
Sample Comments:				
52	RAVELING	L	850.00	SqFt
48	L & T CR	L	102.00	Ft
57	WEATHERING	L	4150.00	SqFt
Sample Number: 384 Type: R Area: 5000.00 SqFt PCI: 79				
Sample Comments:				
52	RAVELING	L	750.00	SqFt
48	L & T CR	L	17.00	Ft
57	WEATHERING	L	4250.00	SqFt
Sample Number: 388 Type: R Area: 5000.00 SqFt PCI: 76				
Sample Comments:				
57	WEATHERING	L	3900.00	SqFt
52	RAVELING	L	1100.00	SqFt
48	L & T CR	L	54.00	Ft
Sample Number: 392 Type: R Area: 5000.00 SqFt PCI: 78				
Sample Comments:				
57	WEATHERING	L	4250.00	SqFt
52	RAVELING	L	750.00	SqFt
48	L & T CR	L	61.00	Ft

Network:		VNC		Name:		VENICE MUNICIPAL AIRPORT						
Branch:	RW 13-31		Name:	RUNWAY 13-31		Use:	RUNWAY	Area:	846,750 SqFt			
Section:	6110		of	10	From:	-		To:	-		Last Const.:	12/1/2006
Surface:	AAC		Family:	FDOT-SAPMP-RL-RW-AAC		Zone:			Category:	Rank: P		
Area:	196,950 SqFt		Length:	8,400 Ft		Width:	25 Ft					
Slabs:			Slab Length:	Ft		Slab Width:	Ft		Joint Length:	Ft		
Shoulder:			Street Type:			Grade:	0		Lanes:	0		
Section Comments:												
Work Date:	1/1/1942		Work Type:	BUILT				Code:	IMPORTED		Is Major M&R:	True
Work Date:	1/1/1982		Work Type:	OVERLAY				Code:	IMPORTED		Is Major M&R:	True
Work Date:	1/1/1982		Work Type:	OVERLAY				Code:	IMPORTED		Is Major M&R:	True
Work Date:	12/1/2006		Work Type:	Mill and Overlay				Code:	ML-OL		Is Major M&R:	True
Work Date:	5/9/2017		Work Type:	Surface Treatment - Seal Coat				Code:	ST-SC		Is Major M&R:	False
Last Insp. Date:	10/25/2018		TotalSamples:	40		Surveyed:	8					
Conditions:	PCI: 74											
Inspection Comments:												
Sample Number:	128		Type:	R		Area:	5000.00 SqFt		PCI:	57		
Sample Comments:												
57	WEATHERING		L	4500.00 SqFt								
56	SWELLING		L	650.00 SqFt								
48	L & T CR		L	726.00 Ft								
52	RAVELING		L	500.00 SqFt								
Sample Number:	152		Type:	R		Area:	5000.00 SqFt		PCI:	78		
Sample Comments:												
52	RAVELING		L	750.00 SqFt								
57	WEATHERING		L	4250.00 SqFt								
48	L & T CR		L	84.00 Ft								
Sample Number:	172		Type:	R		Area:	5000.00 SqFt		PCI:	78		
Sample Comments:												
48	L & T CR		L	26.00 Ft								
56	SWELLING		L	4.00 SqFt								
57	WEATHERING		L	4250.00 SqFt								
52	RAVELING		L	750.00 SqFt								
Sample Number:	184		Type:	R		Area:	5000.00 SqFt		PCI:	81		
Sample Comments:												
48	L & T CR		L	28.00 Ft								
57	WEATHERING		L	4500.00 SqFt								
52	RAVELING		L	500.00 SqFt								
Sample Number:	516		Type:	R		Area:	5000.00 SqFt		PCI:	75		
Sample Comments:												
48	L & T CR		L	139.00 Ft								
52	RAVELING		L	500.00 SqFt								
57	WEATHERING		L	4500.00 SqFt								
56	SWELLING		L	200.00 SqFt								
Sample Number:	536		Type:	R		Area:	5525.00 SqFt		PCI:	70		
Sample Comments:												
57	WEATHERING		L	4696.00 SqFt								
48	L & T CR		L	290.00 Ft								
56	SWELLING		L	112.00 SqFt								
52	RAVELING		L	829.00 SqFt								

Sample Number: 552		Type: R	Area: 5000.00 SqFt		PCI: 74
Sample Comments:					
48	L & T CR	L	175.00	Ft	
57	WEATHERING	L	4250.00	SqFt	
52	RAVELING	L	750.00	SqFt	
56	SWELLING	L	75.00	SqFt	

Sample Number: 568		Type: R	Area: 5000.00 SqFt	PCI: 78
Sample Comments:				
57	WEATHERING	L	4250.00 SqFt	
48	L & T CR	L	57.00 Ft	
52	RAVELING	L	750.00 SqFt	

Network:	VNC		Name:	VENICE MUNICIPAL AIRPORT										
Branch:	RW 13-31		Name:	RUNWAY 13-31		Use:	RUNWAY	Area:	846,750 SqFt					
Section:	6115		of	10		From:	-		To:	-		Last Const.:	12/1/2006	
Surface:	APC		Family:	FDOT-SAPMP-RL-RW-AAC		Zone:			Category:			Rank:	P	
Area:	30,000 SqFt		Length:	300 Ft		Width:	100 Ft							
Slabs:			Slab Length:	Ft		Slab Width:	Ft		Joint Length:			Ft		
Shoulder:			Street Type:			Grade:	0		Lanes:	0				
Section Comments:														
Work Date:	1/1/1942		Work Type:	BUILT				Code:	IMPORTED		Is Major M&R:	True		
Work Date:	1/1/1982		Work Type:	OVERLAY				Code:	IMPORTED		Is Major M&R:	True		
Work Date:	1/1/1982		Work Type:	OVERLAY				Code:	IMPORTED		Is Major M&R:	True		
Work Date:	12/1/2006		Work Type:	MILL and OVERLAY				Code:	ML-OV		Is Major M&R:	True		
Work Date:	5/9/2017		Work Type:	Surface Treatment - Seal Coat				Code:	ST-SC		Is Major M&R:	False		
Last Insp. Date:	10/25/2018		TotalSamples:	6		Surveyed:	2							
Conditions:	PCI: 67													
Inspection Comments:														
Sample Number:	300		Type:	R		Area:	5000.00 SqFt		PCI:	70				
Sample Comments:														
52	RAVELING		L	500.00		SqFt								
57	WEATHERING		M	4500.00		SqFt								
48	L & T CR		L	170.00		Ft								
47	JT REF. CR		L	6.00		Ft								
Sample Number:	304		Type:	R		Area:	5000.00 SqFt		PCI:	64				
Sample Comments:														
52	RAVELING		L	500.00		SqFt								
47	JT REF. CR		L	180.00		Ft								
47	JT REF. CR		M	8.00		Ft								
48	L & T CR		L	59.00		Ft								
57	WEATHERING		M	4500.00		SqFt								

Network:	VNC		Name:	VENICE MUNICIPAL AIRPORT								
Branch:	RW 13-31		Name:	RUNWAY 13-31		Use:	RUNWAY	Area:	846,750 SqFt			
Section:	6120		of	10		From:	-		To:	-	Last Const.:	12/1/2006
Surface:	APC		Family:	FDOT-SAPMP-RL-RW-AAC		Zone:			Category:	Rank: P		
Area:	20,000 SqFt		Length:	800 Ft		Width:	25 Ft					
Slabs:	Slab Length:		Ft		Slab Width:	Ft		Joint Length:	Ft			
Shoulder:	Street Type:				Grade:	0		Lanes:	0			
Section Comments:												
Work Date:	1/1/1942		Work Type: BUILT				Code:	IMPORTED		Is Major M&R: True		
Work Date:	1/1/1982		Work Type: OVERLAY				Code:	IMPORTED		Is Major M&R: True		
Work Date:	12/1/2006		Work Type: MILL and OVERLAY				Code:	ML-OV		Is Major M&R: True		
Work Date:	5/9/2017		Work Type: Surface Treatment - Seal Coat				Code:	ST-SC		Is Major M&R: False		
Last Insp. Date:	10/25/2018		TotalSamples:	4		Surveyed: 1						
Conditions:	PCI: 61											
Inspection Comments:												
Sample Number:	500		Type:	R		Area:	5000.00 SqFt		PCI:	61		
Sample Comments:												
48	L & T CR		L	125.00 Ft								
57	WEATHERING		M	4000.00 SqFt								
47	JT REF. CR		L	132.00 Ft								
52	RAVELING		L	1000.00 SqFt								
47	JT REF. CR		M	30.00 Ft								

Network:		VNC		Name:		VENICE MUNICIPAL AIRPORT						
Branch:	RW 13-31		Name:	RUNWAY 13-31		Use:	RUNWAY	Area:	846,750 SqFt			
Section:	6125		of	10	From:	-		To:	-		Last Const.:	12/1/2006
Surface:	APC		Family:	FDOT-SAPMP-RL-RW-AAC		Zone:			Category:	Rank: P		
Area:	30,000 SqFt		Length:	300 Ft		Width:	100 Ft					
Slabs:			Slab Length:	Ft		Slab Width:	Ft		Joint Length:	Ft		
Shoulder:			Street Type:			Grade:	0		Lanes:	0		
Section Comments:												
Work Date:	1/1/1942		Work Type: BUILT					Code:	IMPORTED		Is Major M&R:	True
Work Date:	1/1/1982		Work Type: OVERLAY					Code:	IMPORTED		Is Major M&R:	True
Work Date:	1/1/1982		Work Type: OVERLAY					Code:	IMPORTED		Is Major M&R:	True
Work Date:	12/1/2006		Work Type: MILL and OVERLAY					Code:	ML-OV		Is Major M&R:	True
Work Date:	5/9/2017		Work Type: Surface Treatment - Seal Coat					Code:	ST-SC		Is Major M&R:	False
Last Insp. Date:	10/25/2018		TotalSamples:	6		Surveyed: 2						
Conditions:	PCI: 68											
Inspection Comments:												
Sample Number:	395		Type:	R		Area:	5000.00 SqFt		PCI:	67		
Sample Comments:												
48	L & T CR		L	43.00 Ft								
47	JT REF. CR		L	60.00 Ft								
47	JT REF. CR		M	10.00 Ft								
52	RAVELING		L	2000.00 SqFt								
57	WEATHERING		L	3000.00 SqFt								
Sample Number:	398		Type:	R		Area:	5000.00 SqFt		PCI:	69		
Sample Comments:												
52	RAVELING		L	2950.00 SqFt								
57	WEATHERING		L	2050.00 SqFt								
48	L & T CR		L	61.00 Ft								
47	JT REF. CR		L	7.00 Ft								

Network:	VNC		Name:	VENICE MUNICIPAL AIRPORT								
Branch:	RW 13-31		Name:	RUNWAY 13-31		Use:	RUNWAY	Area:	846,750 SqFt			
Section:	6130		of	10		From:	-		To:	-	Last Const.:	12/1/2006
Surface:	APC		Family:	FDOT-SAPMP-RL-RW-AAC		Zone:			Category:	Rank: P		
Area:	20,000 SqFt		Length:	800 Ft		Width:	25 Ft					
Slabs:	Slab Length:		Ft		Slab Width:	Ft		Joint Length:	Ft			
Shoulder:	Street Type:				Grade:	0		Lanes:	0			
Section Comments:												
Work Date:	1/1/1942		Work Type: BUILT				Code:	IMPORTED		Is Major M&R:	True	
Work Date:	1/1/1982		Work Type: OVERLAY				Code:	IMPORTED		Is Major M&R:	True	
Work Date:	1/1/1982		Work Type: OVERLAY				Code:	IMPORTED		Is Major M&R:	True	
Work Date:	12/1/2006		Work Type: MILL and OVERLAY				Code:	ML-OV		Is Major M&R:	True	
Work Date:	5/9/2017		Work Type: Surface Treatment - Seal Coat				Code:	ST-SC		Is Major M&R:	False	
Last Insp. Date:	10/25/2018		TotalSamples:	4		Surveyed:	1					
Conditions:	PCI: 63											
Inspection Comments:												
Sample Number:	196		Type:	R		Area:	5000.00 SqFt		PCI:	63		
Sample Comments:												
48	L & T CR		L	54.00 Ft								
47	JT REF. CR		M	15.00 Ft								
57	WEATHERING		L	2450.00 SqFt								
52	RAVELING		L	2550.00 SqFt								
47	JT REF. CR		L	170.00 Ft								

Network:	VNC		Name:	VENICE MUNICIPAL AIRPORT								
Branch:	RW 13-31		Name:	RUNWAY 13-31		Use:	RUNWAY	Area:	846,750 SqFt			
Section:	6135		of	10		From:	-		To:	-	Last Const.:	1/1/2013
Surface:	AAC		Family:	FDOT-SAPMP-RL-RW-AAC		Zone:			Category:	Rank: P		
Area:	26,100 SqFt		Length:	1,000 Ft		Width:	100 Ft					
Slabs:			Slab Length:	Ft		Slab Width:	Ft		Joint Length:	Ft		
Shoulder:			Street Type:			Grade:	0		Lanes:	0		
Section Comments:												
Work Date:	1/1/1942		Work Type: BUILT				Code:	IMPORTED		Is Major M&R: True		
Work Date:	1/1/1982		Work Type: OVERLAY				Code:	IMPORTED		Is Major M&R: True		
Work Date:	1/1/1982		Work Type: OVERLAY				Code:	IMPORTED		Is Major M&R: True		
Work Date:	12/1/2006		Work Type: Mill and Overlay				Code:	ML-OL		Is Major M&R: True		
Work Date:	1/1/2013		Work Type: MILL and OVERLAY				Code:	ML-OV		Is Major M&R: True		
Work Date:	5/9/2017		Work Type: Surface Treatment - Seal Coat				Code:	ST-SC		Is Major M&R: False		
Last Insp. Date:	10/25/2018		TotalSamples:	6		Surveyed:		2				
Conditions:	PCI: 93											
Inspection Comments:												
Sample Number:	342		Type:	R		Area:	5000.00 SqFt		PCI:	94		
Sample Comments:												
57	WEATHERING		L	5000.00 SqFt								
Sample Number:	344		Type:	R		Area:	5000.00 SqFt		PCI:	92		
Sample Comments:												
48	L & T CR		L	6.00 Ft								
57	WEATHERING		L	5000.00 SqFt								

Network:	VNC		Name:	VENICE MUNICIPAL AIRPORT										
Branch:	RW 13-31		Name:	RUNWAY 13-31		Use:	RUNWAY	Area:	846,750 SqFt					
Section:	6140		of	10		From:	-		To:	-		Last Const.:	1/1/2013	
Surface:	AAC		Family:	FDOT-SAPMP-RL-RW-AAC		Zone:			Category:			Rank:	P	
Area:	13,050 SqFt		Length:	500 Ft		Width:	25 Ft							
Slabs:			Slab Length:	Ft		Slab Width:	Ft		Joint Length:			Ft		
Shoulder:			Street Type:			Grade:	0		Lanes:	0				
Section Comments:														
Work Date:	1/1/1942		Work Type:	BUILT				Code:	IMPORTED		Is Major M&R:	True		
Work Date:	1/1/1982		Work Type:	OVERLAY				Code:	IMPORTED		Is Major M&R:	True		
Work Date:	1/1/1982		Work Type:	OVERLAY				Code:	IMPORTED		Is Major M&R:	True		
Work Date:	12/1/2006		Work Type:	Mill and Overlay				Code:	ML-OL		Is Major M&R:	True		
Work Date:	1/1/2013		Work Type:	MILL and OVERLAY				Code:	ML-OV		Is Major M&R:	True		
Work Date:	5/9/2017		Work Type:	Surface Treatment - Seal Coat				Code:	ST-SC		Is Major M&R:	False		
Last Insp. Date:	10/25/2018		TotalSamples:	4		Surveyed:	1							
Conditions:	PCI: 90													
Inspection Comments:														
Sample Number:	143		Type:	R		Area:	3300.00 SqFt		PCI:	90				
Sample Comments:														
57	WEATHERING		L	3300.00 SqFt										
48	L & T CR		L	14.00 Ft										

Network:		VNC		Name:		VENICE MUNICIPAL AIRPORT																									
Branch:		RW 5-23		Name:		RUNWAY 5-23		Use:		RUNWAY		Area:		727,500 SqFt																	
Section:		6205		of 8		From:		-		To:		-		Last Const.: 1/1/2013																	
Surface:		AC		Family:		FDOT-SAPMP-RL-RW-AC		Zone:		Category:		Rank:		P																	
Area:		255,000 SqFt		Length:		4,149 Ft		Width:		100 Ft																					
Slabs:		Slab Length:		Ft		Slab Width:		Ft		Joint Length:		Ft																			
Shoulder:		Street Type:		Grade:		0		Lanes:		0																					
Section Comments:																															
Work Date:				1/1/1942				Work Type:				BUILT				Code:				IMPORTED				Is Major M&R:				True			
Work Date:				1/1/1942				Work Type:				OVERLAY				Code:				IMPORTED				Is Major M&R:				True			
Work Date:				1/1/2013				Work Type:				Complete Reconstruction - AC				Code:				CR-AC				Is Major M&R:				True			
Last Insp. Date:				10/25/2018				TotalSamples:				44				Surveyed:				8											
Conditions:				PCI:				90				Inspection Comments:																			
Sample Number:				105				Type:		R		Area:				6000.00 SqFt				PCI:				90							
Sample Comments:																															
48		L & T CR		L		5.00		Ft																							
52		RAVELING		L		10.00		SqFt																							
57		WEATHERING		L		5990.00		SqFt																							
Sample Number:				110				Type:		R		Area:				6000.00 SqFt				PCI:				89							
Sample Comments:																															
48		L & T CR		L		3.00		Ft																							
57		WEATHERING		L		5940.00		SqFt																							
52		RAVELING		L		60.00		SqFt																							
Sample Number:				115				Type:		R		Area:				6000.00 SqFt				PCI:				86							
Sample Comments:																															
52		RAVELING		L		5.00		SqFt																							
50		PATCHING		L		114.00		SqFt																							
57		WEATHERING		L		5881.00		SqFt																							
48		L & T CR		L		1.00		Ft																							
Sample Number:				122				Type:		R		Area:				6000.00 SqFt				PCI:				90							
Sample Comments:																															
48		L & T CR		L		3.00		Ft																							
52		RAVELING		L		30.00		SqFt																							
57		WEATHERING		L		5970.00		SqFt																							
Sample Number:				127				Type:		R		Area:				6000.00 SqFt				PCI:				91							
Sample Comments:																															
57		WEATHERING		L		5940.00		SqFt																							
52		RAVELING		L		60.00		SqFt																							
Sample Number:				132				Type:		R		Area:				6000.00 SqFt				PCI:				91							
Sample Comments:																															
57		WEATHERING		L		5940.00		SqFt																							
52		RAVELING		L		60.00		SqFt																							
Sample Number:				137				Type:		R		Area:				6000.00 SqFt				PCI:				94							
Sample Comments:																															
57		WEATHERING		L		6000.00		SqFt																							
Sample Number:				142				Type:		R		Area:				6000.00 SqFt				PCI:				92							
Sample Comments:																															
57		WEATHERING		L		6000.00		SqFt																							
48		L & T CR		L		6.00		Ft																							

Network:		VNC		Name:		VENICE MUNICIPAL AIRPORT						
Branch:	RW 5-23		Name:	RUNWAY 5-23		Use:	RUNWAY	Area:	727,500 SqFt			
Section:	6210		of	8	From:	-		To:	-		Last Const.:	1/1/2013
Surface:	AAC		Family:	FDOT-SAPMP-RL-RW-AAC		Zone:			Category:	Rank: P		
Area:	350,820 SqFt		Length:	8,100 Ft		Width:	25 Ft					
Slabs:			Slab Length:	Ft		Slab Width:	Ft		Joint Length:	Ft		
Shoulder:			Street Type:			Grade:	0		Lanes:	0		
Section Comments:												
Work Date:	1/1/1942		Work Type: BUILT				Code:	IMPORTED		Is Major M&R: True		
Work Date:	1/1/1942		Work Type: OVERLAY				Code:	IMPORTED		Is Major M&R: True		
Work Date:	1/1/2013		Work Type: MILL and OVERLAY				Code:	ML-OV		Is Major M&R: True		
Last Insp. Date:	10/25/2018		TotalSamples:	74		Surveyed:	15					
Conditions:	PCI: 94											
Inspection Comments:												
Sample Number:	304		Type:	R		Area:	4500.00 SqFt		PCI:	92		
Sample Comments:												
52	RAVELING		L	25.00 SqFt								
57	WEATHERING		L	4475.00 SqFt								
Sample Number:	309		Type:	R		Area:	4500.00 SqFt		PCI:	94		
Sample Comments:												
57	WEATHERING		L	4500.00 SqFt								
Sample Number:	314		Type:	R		Area:	4500.00 SqFt		PCI:	93		
Sample Comments:												
57	WEATHERING		L	4494.00 SqFt								
52	RAVELING		L	6.00 SqFt								
Sample Number:	328		Type:	R		Area:	4500.00 SqFt		PCI:	94		
Sample Comments:												
57	WEATHERING		L	4500.00 SqFt								
Sample Number:	335		Type:	R		Area:	4500.00 SqFt		PCI:	94		
Sample Comments:												
57	WEATHERING		L	4500.00 SqFt								
Sample Number:	339		Type:	R		Area:	4500.00 SqFt		PCI:	91		
Sample Comments:												
57	WEATHERING		L	4455.00 SqFt								
52	RAVELING		L	45.00 SqFt								
Sample Number:	343		Type:	R		Area:	4500.00 SqFt		PCI:	94		
Sample Comments:												
57	WEATHERING		L	4500.00 SqFt								
Sample Number:	504		Type:	R		Area:	4500.00 SqFt		PCI:	93		
Sample Comments:												
52	RAVELING		L	10.00 SqFt								
57	WEATHERING		L	4490.00 SqFt								
Sample Number:	511		Type:	R		Area:	4500.00 SqFt		PCI:	94		
Sample Comments:												
57	WEATHERING		L	4500.00 SqFt								
Sample Number:	519		Type:	R		Area:	6637.00 SqFt		PCI:	94		
Sample Comments:												
57	WEATHERING		L	6637.00 SqFt								

Sample Number: 524		Type: R	Area: 4500.00 SqFt	PCI: 94
Sample Comments:				
57	WEATHERING	L	4500.00 SqFt	
Sample Number: 529		Type: R	Area: 4500.00 SqFt	PCI: 94
Sample Comments:				
57	WEATHERING	L	4500.00 SqFt	
Sample Number: 536		Type: R	Area: 4500.00 SqFt	PCI: 94
Sample Comments:				
57	WEATHERING	L	4500.00 SqFt	
Sample Number: 540		Type: R	Area: 4500.00 SqFt	PCI: 94
Sample Comments:				
57	WEATHERING	L	4500.00 SqFt	
Sample Number: 545		Type: R	Area: 4500.00 SqFt	PCI: 94
Sample Comments:				
57	WEATHERING	L	4500.00 SqFt	

Network:	VNC		Name:	VENICE MUNICIPAL AIRPORT										
Branch:	RW 5-23		Name:	RUNWAY 5-23		Use:	RUNWAY	Area:	727,500 SqFt					
Section:	6215		of	8		From:	-		To:	-		Last Const.:	1/1/2013	
Surface:	AC		Family:	FDOT-SAPMP-RL-RW-AC		Zone:			Category:			Rank:	P	
Area:	18,000 SqFt		Length:	300 Ft		Width:	100 Ft							
Slabs:	96		Slab Length:	13 Ft		Slab Width:	25 Ft		Joint Length:	3,200 Ft				
Shoulder:			Street Type:			Grade:	0		Lanes:	0				
Section Comments:														
Work Date:	1/1/1942		Work Type: BUILT					Code:	IMPORTED		Is Major M&R:	True		
Work Date:	1/1/1942		Work Type: OVERLAY					Code:	IMPORTED		Is Major M&R:	True		
Work Date:	1/1/1986		Work Type: REPAIR					Code:	IMPORTED		Is Major M&R:	False		
Work Date:	1/1/2013		Work Type: Complete Reconstruction - AC					Code:	CR-AC		Is Major M&R:	True		
Last Insp. Date:	10/25/2018		TotalSamples:	3		Surveyed:	1							
Conditions:	PCI: 94													
Inspection Comments:														
Sample Number:	102		Type:	R		Area:	6000.00 SqFt		PCI:	94				
Sample Comments:														
57	WEATHERING		L	6000.00 SqFt										

Network:	VNC		Name:	VENICE MUNICIPAL AIRPORT								
Branch:	RW 5-23		Name:	RUNWAY 5-23		Use:	RUNWAY	Area:	727,500 SqFt			
Section:	6220		of	8	From:	-		To:	-		Last Const.:	1/1/2013
Surface:	AC		Family:	FDOT-SAPMP-RL-RW-AC		Zone:			Category:	Rank: P		
Area:	27,000 SqFt		Length:	800 Ft		Width:	25 Ft					
Slabs:	64		Slab Length:	13 Ft		Slab Width:	25 Ft		Joint Length:	1,575 Ft		
Shoulder:			Street Type:			Grade:	0		Lanes:	0		
Section Comments:												
Work Date:	1/1/1942		Work Type:	BUILT				Code:	IMPORTED		Is Major M&R:	True
Work Date:	1/1/1942		Work Type:	OVERLAY				Code:	IMPORTED		Is Major M&R:	True
Work Date:	1/1/1986		Work Type:	REPAIR				Code:	IMPORTED		Is Major M&R:	False
Work Date:	1/1/2013		Work Type:	Complete Reconstruction - AC				Code:	CR-AC		Is Major M&R:	True
Last Insp. Date:	10/25/2018		TotalSamples:	6		Surveyed:	2					
Conditions:	PCI: 92											
Inspection Comments:												
Sample Number:	301		Type:	R		Area:	4500.00 SqFt		PCI:	91		
Sample Comments:												
57	WEATHERING		L	4500.00 SqFt								
48	L & T CR		L	10.00 Ft								
Sample Number:	500		Type:	R		Area:	4500.00 SqFt		PCI:	94		
Sample Comments:												
57	WEATHERING		L	4500.00 SqFt								

Network: VNC		Name: VENICE MUNICIPAL AIRPORT		
Branch: RW 5-23	Name: RUNWAY 5-23	Use: RUNWAY	Area: 727,500 SqFt	
Section: 6225	of 8	From: -	To: -	Last Const.: 1/1/2013
Surface: AC	Family: FDOT-SAPMP-RL-RW-AC	Zone:	Category:	Rank: P
Area: 18,000 SqFt	Length: 300 Ft	Width: 100 Ft		
Slabs: 96	Slab Length: 13 Ft	Slab Width: 25 Ft	Joint Length: 3,200 Ft	
Shoulder:	Street Type:	Grade: 0	Lanes: 0	
Section Comments:				
Work Date: 1/1/1942	Work Type: BUILT		Code: IMPORTED	Is Major M&R: True
Work Date: 1/1/1942	Work Type: OVERLAY		Code: IMPORTED	Is Major M&R: True
Work Date: 1/1/1986	Work Type: REPAIR		Code: IMPORTED	Is Major M&R: False
Work Date: 1/1/2013	Work Type: Complete Reconstruction - AC		Code: CR-AC	Is Major M&R: True
Last Insp. Date: 10/25/2018	TotalSamples: 3	Surveyed: 1		
Conditions: PCI: 94				
Inspection Comments:				
Sample Number: 147	Type: R	Area: 6000.00 SqFt	PCI: 94	
Sample Comments:				
57 WEATHERING	L	6000.00 SqFt		

Network:	VNC		Name:	VENICE MUNICIPAL AIRPORT							
Branch:	RW 5-23		Name:	RUNWAY 5-23		Use:	RUNWAY	Area:	727,500 SqFt		
Section:	6230	of 8	From:	-		To:	-		Last Const.:	1/1/2013	
Surface:	AC	Family:	FDOT-SAPMP-RL-RW-AC		Zone:	Category:		Rank: P			
Area:	27,000 SqFt		Length:	800 Ft		Width:	25 Ft				
Slabs:	64	Slab Length:	13 Ft		Slab Width:	25 Ft		Joint Length:	1,575 Ft		
Shoulder:	Street Type:		Grade:		0		Lanes:	0			
Section Comments:											
Work Date:	1/1/1942		Work Type: BUILT				Code:	IMPORTED		Is Major M&R:	True
Work Date:	1/1/1942		Work Type: OVERLAY				Code:	IMPORTED		Is Major M&R:	True
Work Date:	1/1/1986		Work Type: REPAIR				Code:	IMPORTED		Is Major M&R:	False
Work Date:	1/1/2013		Work Type: Complete Reconstruction - AC				Code:	CR-AC		Is Major M&R:	True
Last Insp. Date:	10/25/2018		TotalSamples:	6		Surveyed: 2					
Conditions:	PCI:	94									
Inspection Comments:											
Sample Number:	348	Type:	R	Area:	4500.00 SqFt		PCI:	94			
Sample Comments:											
57	WEATHERING		L	4500.00 SqFt							
Sample Number:	549	Type:	R	Area:	4500.00 SqFt		PCI:	94			
Sample Comments:											
57	WEATHERING		L	4500.00 SqFt							

Network:		VNC		Name:		VENICE MUNICIPAL AIRPORT													
Branch:		RW 5-23		Name:		RUNWAY 5-23		Use:		RUNWAY		Area:		727,500 SqFt					
Section:		6240		of		8		From:		-		To:		-		Last Const.:		1/1/2013	
Surface:		AC		Family:		FDOT-SAPMP-RL-RW-AC		Zone:				Category:				Rank:		P	
Area:		13,680 SqFt		Length:		400 Ft		Width:		45 Ft									
Slabs:				Slab Length:		Ft		Slab Width:		Ft		Joint Length:		Ft					
Shoulder:				Street Type:				Grade:		0		Lanes:		0					
Section Comments:																			
Work Date:		1/1/2013		Work Type:		New Construction - Initial		Code:		NU-IN		Is Major M&R:		True					
Last Insp. Date:		10/25/2018		TotalSamples:		4		Surveyed:		1									
Conditions:		PCI:		86															
Inspection Comments:																			
Sample Number:		320		Type:		R		Area:		3600.00 SqFt		PCI:		86					
Sample Comments:																			
57		WEATHERING		L		3435.00 SqFt													
50		PATCHING		L		165.00 SqFt													

Network:	VNC		Name:	VENICE MUNICIPAL AIRPORT										
Branch:	RW 5-23		Name:	RUNWAY 5-23		Use:	RUNWAY	Area:	727,500 SqFt					
Section:	6250		of	8		From:	-		To:	-		Last Const.:	1/1/2013	
Surface:	AC		Family:	FDOT-SAPMP-RL-RW-AC		Zone:			Category:			Rank:	P	
Area:	18,000 SqFt		Length:	400 Ft		Width:	45 Ft							
Slabs:			Slab Length:	Ft		Slab Width:	Ft		Joint Length:			Ft		
Shoulder:			Street Type:			Grade:	0		Lanes:	0				
Section Comments:														
Work Date:	1/1/2013		Work Type:	New Construction - Initial				Code:	NU-IN		Is Major M&R:	True		
Last Insp. Date:	10/25/2018		TotalSamples:	4		Surveyed:	1							
Conditions:	PCI: 94													
Inspection Comments:														
Sample Number:	532		Type:	R		Area:	4500.00 SqFt		PCI:	94				
Sample Comments:														
57	WEATHERING		L	4500.00		SqFt								

Network:	VNC		Name:	VENICE MUNICIPAL AIRPORT										
Branch:	T-HANG		Name:	GA T-HANGARS		Use:	TAXIWAY	Area:	329,036 SqFt					
Section:	605		of	11		From:	-		To:	-		Last Const.:	1/1/2003	
Surface:	AC		Family:	DEFAULT		Zone:			Category:			Rank:	P	
Area:	17,687 SqFt		Length:	500 Ft		Width:	35 Ft							
Slabs:			Slab Length:	Ft		Slab Width:	Ft		Joint Length:	Ft				
Shoulder:			Street Type:			Grade:	0		Lanes:	0				
Section Comments:														
Work Date:	1/1/2003		Work Type:	New Construction - Initial				Code:	NU-IN		Is Major M&R:	True		
Last Insp. Date:	10/25/2018		TotalSamples:	4		Surveyed:	1							
Conditions:	PCI:	69												
Inspection Comments:														
Sample Number:	101		Type:	R		Area:	4200.00 SqFt		PCI:	69				
Sample Comments:														
48	L & T CR		L	282.00 Ft										
52	RAVELING		L	4200.00 SqFt										

Network:	VNC	Name:	VENICE MUNICIPAL AIRPORT						
Branch:	T-HANG	Name:	GA T-HANGARS	Use:	TAXIWAY	Area:	329,036 SqFt		
Section:	610	of	11	From:	-	To:	-	Last Const.:	1/1/2003
Surface:	AC	Family:	DEFAULT	Zone:		Category:		Rank:	P
Area:	42,593 SqFt	Length:	500 Ft	Width:	35 Ft				
Slabs:		Slab Length:	Ft	Slab Width:	Ft	Joint Length:	Ft		
Shoulder:		Street Type:		Grade:	0	Lanes:	0		
Section Comments:									
Work Date:	1/1/1942	Work Type:	New Construction - Initial		Code:	NU-IN	Is Major M&R:	True	
Work Date:	1/1/2003	Work Type:	New Construction - Initial		Code:	NU-IN	Is Major M&R:	True	
Last Insp. Date: 10/25/2018									
TotalSamples: 9									
Surveyed: 1									
Conditions: PCI: 66									
Inspection Comments:									
Sample Number:	203	Type:	R	Area:	5000.00 SqFt	PCI:	66		
Sample Comments:									
48	L & T CR	L	28.00	Ft					
52	RAVELING	L	5000.00	SqFt					
49	OIL SPILLAGE	N	26.00	SqFt					

Network:	VNC		Name:	VENICE MUNICIPAL AIRPORT						
Branch:	T-HANG		Name:	GA T-HANGARS		Use:	TAXIWAY	Area:	329,036 SqFt	
Section:	620 of 11		From:	-		To:	-		Last Const.:	12/25/1994
Surface:	AC		Family:	FDOT-SAPMP-RL-TW-AC		Zone:			Rank:	P
Area:	103,188 SqFt		Length:	1,600 Ft		Width:	75 Ft			
Slabs:			Slab Length:	Ft		Slab Width:	Ft		Joint Length:	Ft
Shoulder:			Street Type:			Grade:	0		Lanes:	0
Section Comments:										
Work Date:	12/25/1994		Work Type:	New Construction - Initial				Code:	NU-IN	
Last Insp. Date:	10/25/2018		TotalSamples:	21		Surveyed:	3			
Conditions:	PCI: 54									
Inspection Comments:										
Sample Number:	300		Type:	R		Area:	4856.00 SqFt		PCI:	69
Sample Comments:										
48	L & T CR		L	390.00 Ft						
52	RAVELING		L	4856.00 SqFt						
Sample Number:	350		Type:	R		Area:	5075.00 SqFt		PCI:	48
Sample Comments:										
45	DEPRESSION		L	10.00 SqFt						
52	RAVELING		M	1000.00 SqFt						
43	BLOCK CR		L	1208.00 SqFt						
52	RAVELING		L	4075.00 SqFt						
48	L & T CR		L	485.00 Ft						
Sample Number:	451		Type:	R		Area:	4510.00 SqFt		PCI:	44
Sample Comments:										
45	DEPRESSION		L	120.00 SqFt						
52	RAVELING		M	1000.00 SqFt						
48	L & T CR		L	123.00 Ft						
52	RAVELING		L	3296.00 SqFt						
52	RAVELING		H	60.00 SqFt						
50	PATCHING		L	154.00 SqFt						

Network:	VNC			Name:	VENICE MUNICIPAL AIRPORT						
Branch:	T-HANG		Name:	GA T-HANGARS		Use:	TAXIWAY	Area:	329,036 SqFt		
Section:	705 of 11		From:	-		To:	-		Last Const.:	1/1/2003	
Surface:	AC		Family:	DEFAULT		Zone:			Rank:	P	
Area:	36,074 SqFt		Length:	943 Ft		Width:	40 Ft				
Slabs:			Slab Length:	Ft		Slab Width:	Ft		Joint Length:	Ft	
Shoulder:			Street Type:			Grade:	0		Lanes:	0	
Section Comments:											
Work Date:	1/1/1942		Work Type: New Construction - Initial				Code:	NU-IN		Is Major M&R:	True
Work Date:	1/1/2003		Work Type: New Construction - Initial				Code:	NU-IN		Is Major M&R:	True
Last Insp. Date:	10/25/2018		TotalSamples:	8		Surveyed:					1
Conditions:	PCI: 79										
Inspection Comments:											
Sample Number:	507		Type:	R		Area:	4875.00 SqFt		PCI:	79	
Sample Comments:											
48	L & T CR		L	137.00 Ft							
52	RAVELING		L	600.00 SqFt							
57	WEATHERING		L	4275.00 SqFt							

Network:		VNC		Name:		VENICE MUNICIPAL AIRPORT													
Branch:		T-HANG		Name:		GA T-HANGARS		Use:		TAXIWAY		Area:		329,036 SqFt					
Section:		708		of		11		From:		-		To:		-		Last Const.:		12/25/1997	
Surface:		AC		Family:		FDOT-SAPMP-RL-TW-AC		Zone:				Category:				Rank:		P	
Area:		11,509 SqFt		Length:		390 Ft		Width:		30 Ft									
Slabs:				Slab Length:		Ft		Slab Width:		Ft		Joint Length:		Ft					
Shoulder:				Street Type:				Grade:		0		Lanes:		0					
Section Comments:																			
Work Date:		12/25/1997		Work Type:		New Construction - Initial		Code:		NU-IN		Is Major M&R:		True					
Last Insp. Date:		10/25/2018		TotalSamples:		3		Surveyed:		1									
Conditions:		PCI:		68															
Inspection Comments:																			
Sample Number:		300		Type:		R		Area:		4420.00 SqFt		PCI:		68					
Sample Comments:																			
52	RAVELING			L		500.00 SqFt													
57	WEATHERING			L		3920.00 SqFt													
48	L & T CR			L		99.00 Ft													
48	L & T CR			M		100.00 Ft													

Network:		VNC		Name:		VENICE MUNICIPAL AIRPORT						
Branch:	T-HANG		Name:	GA T-HANGARS		Use:	TAXIWAY	Area:	329,036 SqFt			
Section:	710		of 11	From:	-		To:	-		Last Const.:	12/25/1994	
Surface:	AC		Family:	FDOT-SAPMP-RL-TW-AC		Zone:			Category:	Rank: P		
Area:	42,414 SqFt		Length:	1,000 Ft		Width:	50 Ft					
Slabs:			Slab Length:	Ft		Slab Width:	Ft		Joint Length:	Ft		
Shoulder:			Street Type:			Grade:	0		Lanes:	0		
Section Comments:												
Work Date:	12/25/1994		Work Type:	New Construction - Initial				Code:	NU-IN		Is Major M&R:	True
Last Insp. Date:	10/25/2018		TotalSamples:	11		Surveyed:	2					
Conditions:	PCI: 49											
Inspection Comments:												
Sample Number:	150		Type:	R		Area:	3474.00 SqFt		PCI:	41		
Sample Comments:												
50	PATCHING		L	109.00 SqFt								
52	RAVELING		M	1800.00 SqFt								
52	RAVELING		L	1565.00 SqFt								
45	DEPRESSION		L	10.00 SqFt								
48	L & T CR		L	352.00 Ft								
Sample Number:	201		Type:	R		Area:	3000.00 SqFt		PCI:	58		
Sample Comments:												
43	BLOCK CR		L	1320.00 SqFt								
52	RAVELING		L	600.00 SqFt								
57	WEATHERING		L	2400.00 SqFt								
48	L & T CR		L	280.00 Ft								

Network:	VNC			Name:	VENICE MUNICIPAL AIRPORT						
Branch:	T-HANG		Name:	GA T-HANGARS		Use:	TAXIWAY	Area:	329,036 SqFt		
Section:	715 of 11		From:	-		To:	-		Last Const.:	1/1/2012	
Surface:	AC		Family:	FDOT-SAPMP-RL-TW-AC		Zone:			Rank:	P	
Area:	12,818 SqFt		Length:	700 Ft		Width:	50 Ft				
Slabs:			Slab Length:	Ft		Slab Width:	Ft		Joint Length:	Ft	
Shoulder:			Street Type:			Grade:	0		Lanes:	0	
Section Comments:											
Work Date:	1/1/2012		Work Type: New Construction - Initial				Code:	NU-IN		Is Major M&R:	True
Last Insp. Date:	10/25/2018		TotalSamples:	4		Surveyed:	1				
Conditions:	PCI: 92										
Inspection Comments:											
Sample Number:	602		Type:	R		Area:	3250.00 SqFt		PCI:	92	
Sample Comments:											
57	WEATHERING		L	3248.00 SqFt							
50	PATCHING		L	2.00 SqFt							

Network:	VNC		Name:	VENICE MUNICIPAL AIRPORT								
Branch:	T-HANG		Name:	GA T-HANGARS		Use:	TAXIWAY	Area:	329,036 SqFt			
Section:	720	of	11	From:	-			To:	-		Last Const.:	1/1/2012
Surface:	AC	Family:	FDOT-SAPMP-RL-TW-AC		Zone:				Category:	Rank: P		
Area:	5,418 SqFt		Length:	250 Ft		Width:	50 Ft					
Slabs:			Slab Length:	Ft		Slab Width:	Ft		Joint Length:	Ft		
Shoulder:			Street Type:			Grade:	0		Lanes:	0		
Section Comments:												
Work Date:	1/1/2012		Work Type:	New Construction - Initial			Code:	NU-IN		Is Major M&R:	True	
Last Insp. Date:	10/25/2018		TotalSamples:	1		Surveyed:	1					
Conditions:	PCI: 92											
Inspection Comments:												
Sample Number:	604	Type:	R	Area:	5422.00 SqFt		PCI:	92				
Sample Comments:												
48	L & T CR		L	5.00 Ft								
57	WEATHERING		L	5422.00 SqFt								

Network:	VNC	Name:	VENICE MUNICIPAL AIRPORT						
Branch:	T-HANG	Name:	GA T-HANGARS	Use:	TAXIWAY	Area:	329,036 SqFt		
Section:	725	of	11	From:	-	To:	-	Last Const.:	1/1/2012
Surface:	AC	Family:	FDOT-SAPMP-RL-TW-AC	Zone:		Category:		Rank:	P
Area:	17,455 SqFt	Length:	600 Ft	Width:	35 Ft				
Slabs:		Slab Length:	Ft	Slab Width:	Ft	Joint Length:	Ft		
Shoulder:		Street Type:		Grade:	0	Lanes:	0		
Section Comments:									
Work Date:	1/1/2012	Work Type:	New Construction - Initial		Code:	NU-IN	Is Major M&R:	True	
Last Insp. Date:	10/25/2018	TotalSamples:	5	Surveyed:	1				
Conditions:	PCI:	94							
Inspection Comments:									
Sample Number:	704	Type:	R	Area:	3702.00 SqFt	PCI:	94		
Sample Comments:									
57	WEATHERING	L	3702.00	SqFt					

Network:		VNC		Name:		VENICE MUNICIPAL AIRPORT								
Branch:	T-HANG		Name:	GA T-HANGARS		Use:	TAXIWAY	Area:	329,036 SqFt					
Section:	730		of	11		From:	-		To:	-		Last Const.:	11/1/2013	
Surface:	AAC		Family:	FDOT-SAPMP-RL-TW-AAC		Zone:			Category:			Rank:	P	
Area:	18,001 SqFt		Length:	1,000 Ft		Width:	50 Ft							
Slabs:			Slab Length:	Ft		Slab Width:	Ft		Joint Length:			Ft		
Shoulder:			Street Type:			Grade:	0		Lanes:	0				
Section Comments:														
Work Date:	12/25/1994		Work Type:	New Construction - Initial				Code:	NU-IN		Is Major M&R:	True		
Work Date:	11/1/2013		Work Type:	MILL and OVERLAY				Code:	ML-OV		Is Major M&R:	True		
Last Insp. Date:	10/25/2018		TotalSamples:	5		Surveyed:	1							
Conditions:	PCI: 59													
Inspection Comments:														
Sample Number:	505		Type:	R		Area:	4893.00 SqFt		PCI:	59				
Sample Comments:														
43	BLOCK CR		L	3220.00 SqFt										
57	WEATHERING		M	500.00 SqFt										
57	WEATHERING		L	4393.00 SqFt										

Network:	VNC	Name:	VENICE MUNICIPAL AIRPORT							
Branch:	TW A	Name:	TAXIWAY A		Use:	TAXIWAY	Area:	176,736 SqFt		
Section:	105	of	5	From:	-	To:	-	Last Const.:	1/1/2015	
Surface:	AC	Family:	FDOT-SAPMP-RL-TW-AC	Zone:		Category:		Rank:	P	
Area:	55,145 SqFt		Length:	1,395 Ft		Width:	35 Ft			
Slabs:	Slab Length:		Ft	Slab Width:		Ft	Joint Length:		Ft	
Shoulder:	Street Type:			Grade:		0	Lanes:		0	
Section Comments:										
Work Date:	1/1/1942		Work Type:			BUILT	Code:	IMPORTED	Is Major M&R:	True
Work Date:	1/1/1986		Work Type:			OVERLAY	Code:	IMPORTED	Is Major M&R:	True
Work Date:	1/1/1986		Work Type:			OVERLAY	Code:	IMPORTED	Is Major M&R:	True
Work Date:	1/1/2015		Work Type:			Complete Reconstruction - AC	Code:	CR-AC	Is Major M&R:	True
Last Insp. Date:	10/25/2018		TotalSamples:	14		Surveyed:				2
Conditions:	PCI:		94							
Inspection Comments:										
Sample Number:	129		Type:	R	Area:	3500.00 SqFt		PCI:	94	
Sample Comments:										
57	WEATHERING		L	3500.00 SqFt						
Sample Number:	136		Type:	R	Area:	4881.00 SqFt		PCI:	94	
Sample Comments:										
57	WEATHERING		L	4881.00 SqFt						

Network:	VNC		Name:	VENICE MUNICIPAL AIRPORT										
Branch:	TW A		Name:	TAXIWAY A		Use:	TAXIWAY	Area:	176,736 SqFt					
Section:	110		of	5		From:	-		To:	-		Last Const.:	1/1/2015	
Surface:	AC		Family:	FDOT-SAPMP-RL-TW-AC		Zone:			Category:			Rank:	P	
Area:	53,584 SqFt		Length:	1,450 Ft		Width:	35 Ft							
Slabs:	Slab Length:		Ft		Slab Width:	Ft		Joint Length:	Ft					
Shoulder:	Street Type:				Grade:	0		Lanes:	0					
Section Comments:														
Work Date:	1/1/1942		Work Type:				BUILT		Code:	IMPORTED		Is Major M&R:	True	
Work Date:	1/1/1986		Work Type:				OVERLAY		Code:	IMPORTED		Is Major M&R:	True	
Work Date:	1/1/1986		Work Type:				OVERLAY		Code:	IMPORTED		Is Major M&R:	True	
Work Date:	1/1/2015		Work Type:				Complete Reconstruction - AC		Code:	CR-AC		Is Major M&R:	True	
Last Insp. Date:	10/25/2018		TotalSamples:	15		Surveyed:	3							
Conditions:	PCI: 89													
Inspection Comments:														
Sample Number:	115		Type:	R		Area:	3500.00 SqFt		PCI:	89				
Sample Comments:														
48	L & T CR		L	33.00 Ft										
57	WEATHERING		L	3500.00 SqFt										
Sample Number:	119		Type:	R		Area:	3500.00 SqFt		PCI:	89				
Sample Comments:														
48	L & T CR		L	33.00 Ft										
57	WEATHERING		L	3500.00 SqFt										
Sample Number:	125		Type:	R		Area:	3500.00 SqFt		PCI:	90				
Sample Comments:														
57	WEATHERING		L	3500.00 SqFt										
48	L & T CR		L	23.00 Ft										

Network:	VNC		Name:	VENICE MUNICIPAL AIRPORT							
Branch:	TW A		Name:	TAXIWAY A		Use:	TAXIWAY	Area:	176,736 SqFt		
Section:	115 of 5		From:	-		To:	-		Last Const.:	1/1/2015	
Surface:	AC		Family:	FDOT-SAPMP-RL-TW-AC		Zone:			Category:	Rank: P	
Area:	52,281 SqFt		Length:	1,333 Ft		Width:	50 Ft				
Slabs:	Slab Length:		Ft		Slab Width:	Ft		Joint Length:	Ft		
Shoulder:	Street Type:				Grade:	0		Lanes:	0		
Section Comments:											
Work Date:	1/1/1942		Work Type: BUILT				Code:	IMPORTED		Is Major M&R:	True
Work Date:	1/1/1986		Work Type: OVERLAY				Code:	IMPORTED		Is Major M&R:	True
Work Date:	1/1/1986		Work Type: OVERLAY				Code:	IMPORTED		Is Major M&R:	True
Work Date:	1/1/2015		Work Type: Complete Reconstruction - AC				Code:	CR-AC		Is Major M&R:	True
Last Insp. Date:	10/25/2018		TotalSamples:	12		Surveyed:	3				
Conditions:	PCI: 92										
Inspection Comments:											
Sample Number:	101		Type:	R		Area:	4913.00 SqFt		PCI:	92	
Sample Comments:											
48	L & T CR		L	6.00 Ft							
57	WEATHERING		L	4913.00 SqFt							
Sample Number:	106		Type:	R		Area:	3867.00 SqFt		PCI:	94	
Sample Comments:											
57	WEATHERING		L	3867.00 SqFt							
Sample Number:	111		Type:	R		Area:	3500.00 SqFt		PCI:	92	
Sample Comments:											
57	WEATHERING		L	3500.00 SqFt							
48	L & T CR		L	4.00 Ft							

Network:	VNC		Name:	VENICE MUNICIPAL AIRPORT								
Branch:	TW A		Name:	TAXIWAY A		Use:	TAXIWAY	Area:	176,736 SqFt			
Section:	120	of	5	From:	-			To:	-		Last Const.:	1/1/2013
Surface:	AC	Family:	FDOT-SAPMP-RL-TW-AC		Zone:				Category:	Rank: P		
Area:	9,988 SqFt		Length:	200 Ft		Width:	50 Ft					
Slabs:	Slab Length:		Ft		Slab Width:	Ft		Joint Length:	Ft			
Shoulder:	Street Type:		Grade:		0		Lanes:	0				
Section Comments:												
Work Date:	1/1/2013		Work Type:	New Construction - Initial			Code:	NU-IN		Is Major M&R:	True	
Last Insp. Date:	10/25/2018		TotalSamples:	2		Surveyed:	1					
Conditions:	PCI:		90									
Inspection Comments:												
Sample Number:	101	Type:	R	Area:	4372.00 SqFt		PCI:	90				
Sample Comments:												
57	WEATHERING		L	4285.00 SqFt								
52	RAVELING		L	87.00 SqFt								

Network:	VNC		Name:	VENICE MUNICIPAL AIRPORT							
Branch:	TW A		Name:	TAXIWAY A		Use:	TAXIWAY	Area:	176,736 SqFt		
Section:	125	of 5	From:	-		To:	-		Last Const.:	12/1/2006	
Surface:	AAC	Family:	FDOT-SAPMP-RL-TW-AAC		Zone:	Category:		Rank: P			
Area:	5,738 SqFt		Length:	125 Ft		Width:	50 Ft				
Slabs:	Slab Length:		Ft		Slab Width:	Ft		Joint Length:	Ft		
Shoulder:	Street Type:		Grade:		0		Lanes:	0			
Section Comments:											
Work Date:	1/1/1942		Work Type: BUILT				Code:	IMPORTED		Is Major M&R:	True
Work Date:	1/1/1986		Work Type: OVERLAY				Code:	IMPORTED		Is Major M&R:	True
Work Date:	1/1/1986		Work Type: OVERLAY				Code:	IMPORTED		Is Major M&R:	True
Work Date:	12/1/2006		Work Type: MILL and OVERLAY				Code:	ML-OV		Is Major M&R:	True
Last Insp. Date:	10/25/2018		TotalSamples:	1		Surveyed:	1				
Conditions:	PCI: 66										
Inspection Comments:											
Sample Number:	100	Type:	R	Area:	5738.00 SqFt		PCI:	66			
Sample Comments:											
56	SWELLING		L	130.00	SqFt						
57	WEATHERING		M	4538.00	SqFt						
52	RAVELING		L	1200.00	SqFt						
48	L & T CR		L	214.00	Ft						

Network:	VNC			Name:	VENICE MUNICIPAL AIRPORT				
Branch:	TW B		Name:	TAXIWAY B		Use:	TAXIWAY	Area:	83,131 SqFt
Section:	220	of	4	From:	-	To:	-	Last Const.:	1/1/2017
Surface:	AC	Family:	C9N59-GA-AP-AAC-APC	Zone:		Category:		Rank:	P
Area:	30,324 SqFt	Length:	800 Ft	Width:	35 Ft				
Slabs:		Slab Length:	Ft	Slab Width:	Ft	Joint Length:	Ft		
Shoulder:		Street Type:		Grade:	0	Lanes:	0		
Section Comments:									
Work Date:	1/1/1942	Work Type:	New Construction - Initial			Code:	NU-IN	Is Major M&R:	True
Work Date:	1/1/2017	Work Type:	Complete Reconstruction - AC			Code:	CR-AC	Is Major M&R:	True
Last Insp. Date:	3/11/2015	TotalSamples:	39	Surveyed:	4				
Conditions:	PCI: 22	NOTE: *** Pre-Construction PCI ***							
Inspection Comments:									
Sample Number:	102	Type:	R	Area:	5000.00 SqFt	PCI:	25		
Sample Comments:									
43	BLOCK CRACKING	M	5000.00 SqFt						
52	RAVELING	M	5000.00 SqFt						
Sample Number:	155	Type:	R	Area:	5000.00 SqFt	PCI:	23		
Sample Comments:									
45	DEPRESSION	L	32.00 SqFt						
52	RAVELING	M	5000.00 SqFt						
43	BLOCK CRACKING	M	5000.00 SqFt						
Sample Number:	159	Type:	R	Area:	5000.00 SqFt	PCI:	22		
Sample Comments:									
45	DEPRESSION	L	45.00 SqFt						
45	DEPRESSION	L	48.00 SqFt						
43	BLOCK CRACKING	M	5000.00 SqFt						
52	RAVELING	M	5000.00 SqFt						
Sample Number:	207	Type:	R	Area:	5000.00 SqFt	PCI:	17		
Sample Comments:									
52	RAVELING	H	6.00 SqFt						
53	RUTTING	L	52.00 SqFt						
43	BLOCK CRACKING	M	5000.00 SqFt						
42	BLEEDING	N	10.00 SqFt						
45	DEPRESSION	L	30.00 SqFt						
52	RAVELING	M	4994.00 SqFt						

Network:	VNC		Name:	VENICE MUNICIPAL AIRPORT							
Branch:	TW B		Name:	TAXIWAY B		Use:	TAXIWAY	Area:	83,131 SqFt		
Section:	225	of 4	From:	-			To:	-		Last Const.:	1/1/2013
Surface:	AC	Family:	FDOT-SAPMP-RL-AP-AC		Zone:		Category:		Rank:	P	
Area:	12,448 SqFt		Length:	350 Ft		Width:	35 Ft				
Slabs:		Slab Length:	Ft		Slab Width:	Ft		Joint Length:	Ft		
Shoulder:		Street Type:		Grade:	0		Lanes:	0			
Section Comments:											
Work Date:	1/1/2013		Work Type:	New Construction - Initial			Code:	NU-IN		Is Major M&R:	True
Last Insp. Date:	10/25/2018		TotalSamples:	3		Surveyed:	1				
Conditions:	PCI: 91										
Inspection Comments:											
Sample Number:	118	Type:	R	Area:	4778.00 SqFt		PCI:	91			
Sample Comments:											
52	RAVELING		L	48.00	SqFt						
57	WEATHERING		L	4730.00	SqFt						

Network:	VNC			Name:	VENICE MUNICIPAL AIRPORT						
Branch:	TW B		Name:	TAXIWAY B		Use:	TAXIWAY	Area:	83,131 SqFt		
Section:	230	of 4	From:	-			To:	-	Last Const.:	1/1/2017	
Surface:	AC	Family:	DEFAULT	Zone:				Category:	Rank: P		
Area:	17,274 SqFt	Length:	460 Ft	Width:	35 Ft						
Slabs:	Slab Length:		Ft	Slab Width:		Ft	Joint Length:		Ft		
Shoulder:	Street Type:		Grade:	0			Lanes:	0			
Section Comments:											
Work Date:	1/1/1942		Work Type:			New Construction - Initial		Code:	NU-IN	Is Major M&R:	True
Work Date:	1/1/2017		Work Type:			Complete Reconstruction - AC		Code:	CR-AC	Is Major M&R:	True
Last Insp. Date: 3/11/2015											
TotalSamples:		3		Surveyed: 1							
Conditions:	PCI:	22	NOTE: *** Pre-Construction PCI ***								
Inspection Comments:											
Sample Number:	116	Type:	R	Area:	4200.00 SqFt			PCI:	22		
Sample Comments:											
52	RAVELING		M	2708.00	SqFt						
52	RAVELING		L	1482.00	SqFt						
52	RAVELING		H	10.00	SqFt						
45	DEPRESSION		L	68.00	SqFt						
43	BLOCK CRACKING		M	4200.00	SqFt						

Network:		VNC		Name:		VENICE MUNICIPAL AIRPORT																	
Branch:		TW B		Name:		TAXIWAY B		Use:		TAXIWAY		Area:		83,131 SqFt									
Section:		235		of 4		From:		-		To:		-		Last Const.: 5/9/2017									
Surface:		AC		Family:		C9N59-GA-AP-AAC-APC		Zone:		Category:		Rank:		P									
Area:		23,085 SqFt		Length:		230 Ft		Width:		50 Ft													
Slabs:		Slab Length:		Ft		Slab Width:		Ft		Joint Length:		Ft											
Shoulder:		Street Type:		Grade:		0		Lanes:		0													
Section Comments:																							
Work Date:				1/1/1942				Work Type:				New Construction - Initial				Code:		NU-IN		Is Major M&R:		True	
Work Date:				5/9/2017				Work Type:				Complete Reconstruction - AC				Code:		CR-AC		Is Major M&R:		True	
Last Insp. Date:				3/11/2015				TotalSamples:				39				Surveyed:				4			
Conditions:				PCI: 22				NOTE:				*** Pre-Construction PCI ***											
Inspection Comments:																							
Sample Number:				102				Type:		R		Area:				5000.00 SqFt				PCI:		25	
Sample Comments:																							
43		BLOCK CRACKING				M		5000.00 SqFt															
52		RAVELING				M		5000.00 SqFt															
Sample Number:				155				Type:		R		Area:				5000.00 SqFt				PCI:		23	
Sample Comments:																							
52		RAVELING				M		5000.00 SqFt															
45		DEPRESSION				L		32.00 SqFt															
43		BLOCK CRACKING				M		5000.00 SqFt															
Sample Number:				159				Type:		R		Area:				5000.00 SqFt				PCI:		22	
Sample Comments:																							
45		DEPRESSION				L		48.00 SqFt															
43		BLOCK CRACKING				M		5000.00 SqFt															
45		DEPRESSION				L		45.00 SqFt															
52		RAVELING				M		5000.00 SqFt															
Sample Number:				207				Type:		R		Area:				5000.00 SqFt				PCI:		17	
Sample Comments:																							
53		RUTTING				L		52.00 SqFt															
52		RAVELING				M		4994.00 SqFt															
42		BLEEDING				N		10.00 SqFt															
43		BLOCK CRACKING				M		5000.00 SqFt															
52		RAVELING				H		6.00 SqFt															
45		DEPRESSION				L		30.00 SqFt															

Network:		VNC		Name:		VENICE MUNICIPAL AIRPORT									
Branch:		TW C		Name:		TAXIWAY C		Use:		TAXIWAY		Area:		84,284 SqFt	
Section:		315		of 1		From:		-		To:		-		Last Const.: 1/1/2015	
Surface:		AC		Family:		DEFAULT		Zone:		Category:		Rank:		P	
Area:		84,284 SqFt		Length:		2,103 Ft		Width:		40 Ft					
Slabs:		Slab Length:		Ft		Slab Width:		Ft		Joint Length:		Ft			
Shoulder:		Street Type:		Grade:		0		Lanes:		0					
Section Comments:															
Work Date:		1/1/1970		Work Type:		BUILT		Code:		IMPORTED		Is Major M&R:		True	
Work Date:		1/1/1970		Work Type:		OVERLAY		Code:		IMPORTED		Is Major M&R:		True	
Work Date:		1/1/2015		Work Type:		Complete Reconstruction - AC		Code:		CR-AC		Is Major M&R:		True	
Last Insp. Date:		10/25/2018		TotalSamples:		21		Surveyed:		3					
Conditions:		PCI: 94													
Inspection Comments:															
Sample Number:		104		Type:		R		Area:		3594.00 SqFt		PCI:		94	
Sample Comments:															
42 BLEEDING		N		1.00 SqFt											
57 WEATHERING		L		3594.00 SqFt											
Sample Number:		109		Type:		R		Area:		3504.00 SqFt		PCI:		94	
Sample Comments:															
57 WEATHERING		L		3504.00 SqFt											
Sample Number:		115		Type:		R		Area:		3548.00 SqFt		PCI:		94	
Sample Comments:															
57 WEATHERING		L		3548.00 SqFt											

Network:	VNC			Name:	VENICE MUNICIPAL AIRPORT							
Branch:	TW D		Name:	TAXIWAY D		Use:	TAXIWAY		Area:	133,826 SqFt		
Section:	405 of 3		From:	-		To:	-		Last Const.:	5/9/2017		
Surface:	AC		Family:	FDOT-SAPMP-RL-TW-AC		Zone:			Category:	Rank: P		
Area:	76,074 SqFt		Length:	1,902 Ft		Width:	40 Ft					
Slabs:			Slab Length:	Ft		Slab Width:	Ft		Joint Length:	Ft		
Shoulder:			Street Type:			Grade:	0		Lanes:	0		
Section Comments:												
Work Date:	1/1/1970		Work Type:	BUILT				Code:	IMPORTED		Is Major M&R:	True
Work Date:	1/1/1970		Work Type:	OVERLAY				Code:	IMPORTED		Is Major M&R:	True
Work Date:	5/9/2017		Work Type:	Complete Reconstruction - AC				Code:	CR-AC		Is Major M&R:	True
Last Insp. Date:	3/11/2015		TotalSamples:	18		Surveyed:	3					
Conditions:	PCI: 68		NOTE:	*** Pre-Construction PCI ***								
Inspection Comments:												
Sample Number:	107		Type:	R		Area:	4000.00 SqFt		PCI:	68		
Sample Comments:												
48	LONGITUDINAL/TRANSVERSE CRACKING		L	372.00 Ft								
52	RAVELING		L	4000.00 SqFt								
42	BLEEDING		N	5.00 SqFt								
Sample Number:	110		Type:	R		Area:	4000.00 SqFt		PCI:	69		
Sample Comments:												
52	RAVELING		L	4000.00 SqFt								
42	BLEEDING		N	2.00 SqFt								
48	LONGITUDINAL/TRANSVERSE CRACKING		L	291.00 Ft								
Sample Number:	116		Type:	R		Area:	4000.00 SqFt		PCI:	69		
Sample Comments:												
48	LONGITUDINAL/TRANSVERSE CRACKING		L	354.00 Ft								
52	RAVELING		L	4000.00 SqFt								
42	BLEEDING		N	4.00 SqFt								

Network:	VNC		Name:	VENICE MUNICIPAL AIRPORT							
Branch:	TW D		Name:	TAXIWAY D		Use:	TAXIWAY	Area:	133,826 SqFt		
Section:	410	of 3	From:	-			To:	-		Last Const.:	1/1/2013
Surface:	AC	Family:	FDOT-SAPMP-RL-TW-AC		Zone:				Category:	Rank: P	
Area:	18,193 SqFt		Length:	200 Ft		Width:	35 Ft				
Slabs:			Slab Length:	Ft		Slab Width:	Ft		Joint Length:	Ft	
Shoulder:			Street Type:			Grade:	0		Lanes:	0	
Section Comments:											
Work Date:	1/1/2013		Work Type:	New Construction - Initial			Code:	NU-IN		Is Major M&R:	True
Last Insp. Date:	10/25/2018		TotalSamples:	4		Surveyed:	1				
Conditions:	PCI: 94										
Inspection Comments:											
Sample Number:	101	Type:	R	Area:	4533.00 SqFt		PCI:	94			
Sample Comments:											
57	WEATHERING		L	4533.00 SqFt							

Network:	VNC		Name:	VENICE MUNICIPAL AIRPORT					
Branch:	TW E		Name:	TAXIWAY E		Use:	TAXIWAY	Area:	104,106 SqFt
Section:	505	of 4	From:	-			To:	-	Last Const.: 1/1/2013
Surface:	AC	Family:	FDOT-SAPMP-RL-TW-AC		Zone:	Category:		Rank:	P
Area:	62,102 SqFt		Length:	1,722 Ft		Width:	35 Ft		
Slabs:	Slab Length:		Ft		Slab Width:	Ft		Joint Length:	Ft
Shoulder:	Street Type:		Grade:		0		Lanes:	0	
Section Comments:									
Work Date:	1/1/1970		Work Type: BUILT				Code:	IMPORTED	
Work Date:	1/1/1970		Work Type: OVERLAY				Code:	IMPORTED	
Work Date:	1/1/2013		Work Type: Complete Reconstruction - AC				Code:	CR-AC	
Last Insp. Date:	10/25/2018		TotalSamples:	17		Surveyed:	4		
Conditions:	PCI: 94		Inspection Comments:						
Sample Number:	106	Type:	R	Area:	3500.00 SqFt		PCI:	94	
Sample Comments:									
57	WEATHERING		L	3500.00 SqFt					
Sample Number:	112	Type:	R	Area:	3500.00 SqFt		PCI:	94	
Sample Comments:									
57	WEATHERING		L	3500.00 SqFt					
Sample Number:	117	Type:	R	Area:	3938.00 SqFt		PCI:	94	
Sample Comments:									
57	WEATHERING		L	3938.00 SqFt					
Sample Number:	118	Type:	R	Area:	5664.00 SqFt		PCI:	94	
Sample Comments:									
57	WEATHERING		L	5664.00 SqFt					

Network:	VNC		Name:	VENICE MUNICIPAL AIRPORT										
Branch:	TW E		Name:	TAXIWAY E		Use:	TAXIWAY	Area:	104,106 SqFt					
Section:	510		of	4		From:	-		To:	-		Last Const.:	1/1/2013	
Surface:	AC		Family:	FDOT-SAPMP-RL-TW-AC		Zone:			Category:			Rank:	P	
Area:	10,168 SqFt		Length:	175 Ft		Width:	50 Ft							
Slabs:			Slab Length:	Ft		Slab Width:	Ft		Joint Length:			Ft		
Shoulder:			Street Type:			Grade:	0		Lanes:	0				
Section Comments:														
Work Date:	1/1/2013		Work Type:	New Construction - Initial				Code:	NU-IN		Is Major M&R:	True		
Work Date:	5/9/2017		Work Type:	Surface Treatment - Seal Coat				Code:	ST-SC		Is Major M&R:	False		
Last Insp. Date:	10/25/2018		TotalSamples:	2		Surveyed:	2							
Conditions:	PCI: 92													
Inspection Comments:														
Sample Number:	120		Type:	R		Area:	5281.00 SqFt		PCI:	94				
Sample Comments:														
57	WEATHERING		L	5281.00 SqFt										
Sample Number:	121		Type:	R		Area:	4887.00 SqFt		PCI:	89				
Sample Comments:														
48	L & T CR		L	40.00 Ft										
57	WEATHERING		L	4887.00 SqFt										

Network:	VNC		Name:	VENICE MUNICIPAL AIRPORT							
Branch:	TW E		Name:	TAXIWAY E		Use:	TAXIWAY	Area:	104,106 SqFt		
Section:	515	of 4	From:	-			To:	-		Last Const.:	1/1/2015
Surface:	AC	Family:	FDOT-SAPMP-RL-TW-AC		Zone:				Category:	Rank: P	
Area:	22,576 SqFt		Length:	330 Ft		Width:	50 Ft				
Slabs:	Slab Length:		Ft		Slab Width:	Ft		Joint Length:	Ft		
Shoulder:	Street Type:		Grade:		0		Lanes:	0			
Section Comments:											
Work Date:	1/1/2015		Work Type:	New Construction - Initial			Code:	NU-IN		Is Major M&R:	True
Last Insp. Date:	10/25/2018		TotalSamples:	5		Surveyed:	1				
Conditions:	PCI: 94										
Inspection Comments:											
Sample Number:	125	Type:	R	Area:	4394.00 SqFt		PCI:	94			
Sample Comments:											
42	BLEEDING	N	1.00 SqFt								
57	WEATHERING	L	4394.00 SqFt								

Network:	VNC			Name:	VENICE MUNICIPAL AIRPORT									
Branch:	TW E		Name:	TAXIWAY E		Use:	TAXIWAY	Area:	104,106 SqFt					
Section:	550		of	4		From:	-		To:	-		Last Const.:	1/1/2013	
Surface:	AC		Family:	FDOT-SAPMP-RL-TW-AC		Zone:			Category:			Rank:	P	
Area:	9,260 SqFt		Length:	208 Ft		Width:	37 Ft							
Slabs:			Slab Length:	Ft		Slab Width:	Ft		Joint Length:			Ft		
Shoulder:			Street Type:			Grade:	0		Lanes:	0				
Section Comments:														
Work Date:	1/1/1942		Work Type:				BUILT		Code:	IMPORTED		Is Major M&R:	True	
Work Date:	1/1/1942		Work Type:				OVERLAY		Code:	IMPORTED		Is Major M&R:	True	
Work Date:	1/1/2013		Work Type:				Complete Reconstruction - AC		Code:	CR-AC		Is Major M&R:	True	
Last Insp. Date:	10/25/2018		TotalSamples:	2		Surveyed:	1							
Conditions:	PCI: 94													
Inspection Comments:														
Sample Number:	100		Type:	R		Area:	4473.00 SqFt		PCI:	94				
Sample Comments:														
57	WEATHERING		L	4473.00 SqFt										

Network:	VNC		Name:	VENICE MUNICIPAL AIRPORT							
Branch:	TW F		Name:	TAXIWAY F		Use:	TAXIWAY	Area:	11,590 SqFt		
Section:	450 of 1		From:	-		To:	-		Last Const.:	5/9/2017	
Surface:	AC		Family:	FDOT-SAPMP-RL-TW-AC		Zone:			Category:	Rank: P	
Area:	11,590 SqFt		Length:	205 Ft		Width:	40 Ft				
Slabs:			Slab Length:	Ft		Slab Width:	Ft		Joint Length:	Ft	
Shoulder:			Street Type:			Grade:	0		Lanes:	0	
Section Comments:											
Work Date:	1/1/1942		Work Type: BUILT				Code:	IMPORTED		Is Major M&R:	True
Work Date:	1/1/1942		Work Type: OVERLAY				Code:	IMPORTED		Is Major M&R:	True
Work Date:	5/9/2017		Work Type: Complete Reconstruction - AC				Code:	CR-AC		Is Major M&R:	True
Last Insp. Date:	3/11/2015		TotalSamples:	3		Surveyed:	1				
Conditions:	PCI: 30		NOTE: *** Pre-Construction PCI ***								
Inspection Comments:											
Sample Number:	101		Type:	R		Area:	4000.00 SqFt		PCI:	30	
Sample Comments:											
43	BLOCK CRACKING		M	478.00 SqFt							
45	DEPRESSION		L	16.00 SqFt							
41	ALLIGATOR CRACKING		L	82.00 SqFt							
41	ALLIGATOR CRACKING		L	240.00 SqFt							
52	RAVELING		L	4000.00 SqFt							
43	BLOCK CRACKING		M	380.00 SqFt							
43	BLOCK CRACKING		M	800.00 SqFt							
48	LONGITUDINAL/TRANSVERSE CRACKING		L	262.00 Ft							