FLORIDA DEPARTMENT OF TRANSPORTATION AVIATION AND SPACEPORTS OFFICE

Statewide Airfield Pavement Management Program

Airport Pavement Evaluation Report September 2017



Plant City Airport (PCM) General Aviation Airport District 7



FDOT

141

Florida Department of Transportation

Statewide Airfield Pavement Management Program

Prepared by:

FDOT Aviation and Spaceports Office 605 Suwannee Street Tallahassee, Florida 32399-0450

OFFICE OF FREIGHT, LOGISTICS & PASSENGER OPERATIONS



Table of Contents

Executive Summary10	
Program Background10	
Summary of Results11Pavement Condition Index (Latest Inspection)11Forecasted Pavement Condition Index 2018-202712Major Rehabilitation Planning 2018-202713	
Summary of Plant City Airport14	
Chapter 1 – Introduction16	
1.1 Background16	
1.2 Statewide Airfield Pavement Management Program (SAPMP) Update 2016-201716	
1.3 Organization 18 1.3.1 Florida Department of Transportation Aviation and Spaceports Office Program Manager 18 1.3.2 Participating Florida Public-Use and Publicly Owned Airports 18 1.3.3 Florida Department of Transportation District Offices 18 1.3.4 Consultant 18	
1.4 Purpose of Airport Pavement Evaluation Report	
1.5 History of the Program	
1.6 Federal Aviation Administration (FAA)	
1.7 FDOT SAPMP Objectives and Components 22 1.7.1 Program Objectives 22 1.7.2 Program Components 22	
1.8 References	
Chapter 2 – Methodology	
2.1 Airfield Pavement Database	
2.2 Airfield Pavement System Inventory 28 2.2.1 Pavement Management Program Network Definition Terminology 29	
2.3 Airfield Pavement Structure. 31 2.3.1 Pavement Structure Types. 31	
2.4 Airfield Pavement Work History 33 2.4.1 Airfield Pavement Record Keeping 33	
2.5 Airfield Pavement Traffic	
2.6 Airfield Pavement Condition Index (PCI) Survey 33 2.6.1 PCI Survey Methodology 33 2.6.2 Pavement Distress Types 35	



2.6.3 PCI Survey Inspection Procedures	
2.6.4 Updates to the ASTM D5340-12	40
Chapter 3 – Airfield Pavement System Inventory	43
3.1 Airfield Pavement Network Information	43
3.1.1 Previous and/or Anticipated Airfield Pavement Construction	43
3.1.2 Estimated Pavement Age	45
3.1.3 Functional Use Classification	
3.1.4 Pavement Surface Type	
3.1.5 Pavement System Inventory Details	
Chapter 4 – Airfield Pavement Condition	53
4.1 Airfield Pavement Condition Index (Latest Inspection)	53
4.1.1 Network-Level Analysis	
4.1.2 Branch-Level Analysis	
4.1.3 Section-Level Analysis	
4.2 Summary of Pavement Condition Evaluation Results	59
4.2.1 Network-Level Observations	
4.2.2 Branch-Level Observations	59
4.3 Forecasted Pavement Conditions	60
4.3.1 Performance Models and Prediction Curves	
4.3.2 Branch-Level Pavement Condition Forecast	
4.3.3 Section-Level Pavement Condition Forecast	
4.3.4 Forecasted PCI Considerations	64
Chapter 5 – Localized Maintenance and Repair Planning	66
5.1 Localized Maintenance and Repair	
5.2 Localized Maintenance and Repair Policy	
5.3 Localized Maintenance and Repair Analysis and Recommendations	
Chapter 6 – Major Rehabilitation Planning	75
6.1 Major Rehabilitation	75
6.1.1 Critical PCI	
6.1.2 FDOT Recommended Minimum Service-Level PCI	77
6.2 Major Rehabilitation Policy	78
6.2.1 Major Rehabilitation Pavement Section Development	
6.2.2 Major Rehabilitation Planning-Level Unit Costs	
6.3 Major Rehabilitation Needs	80
6.3.1 10-Year Unconstrained Budget Major Rehabilitation Needs	
Chapter 7 – Conclusion	85
7.1 Recommendations	85
7.1.1 Continued PCI Survey Inspections	
7.1.2 Localized Maintenance and Repair	



7.1.3 Major Rehabilitation	
7.1.4 Pavement Management System	
7.2 Supporting Documents	86
001 – Airfield Pavement Network Definition Exhibit	
002 – Airfield Pavement System Inventory Exhibit	
003 – Airfield Pavement Condition Index Exhibit	
004 – Airfield Pavement Major Rehabilitation Exhibit	
Inspection Photograph Documentation	86
7.3 Conclusion	87



- Appendix A Airfield Pavement Analysis Tables
- Appendix B Airfield Pavement Localized Maintenance and Repair and Major Rehabilitation
- Appendix C Technical Exhibits
- Appendix D Inspection Photograph Documentation
- Appendix E Inspection Distress Details



List of Figures

Figure E-4 Major Rehabilitation Planning Annual Budget 2018-202714
Figure 1.2 Florida Aviation System (Facilities with Pavement) and FDOT Districts17
Figure 1.7-1 Typical Pavement Condition Life Cycle
Figure 1.7-2 General Pavement Treatments by Condition Range
Figure 1.7-3 Flexible Asphalt Concrete25
Figure 1.7-4 Rigid Portland Cement Concrete25
Figure 3.1.1-1 2017 Airfield Pavement Network Definition Exhibit
Figure 3.1.1-2 2017 Airfield Pavement System Inventory Exhibit45
Figure 3.1.2 Average Age of Pavements at Inspection
Figure 3.1.3 Airfield Pavement Functional Classification Use by Area47
Figure 3.1.4 (a) Pavement Surface Type by Area (SF)48
Figure 3.1.4 (b) Pavement Surface Type by Area (%)49
Figure 4.1.1 Latest Condition – Overall Network
Figure 4.1.2 (a) Latest Condition – Runway Pavements
Figure 4.1.2 (a) Latest Condition – Runway Pavements
Figure 4.1.2 (a) Latest Condition – Runway Pavements
Figure 4.1.2 (a) Latest Condition – Runway Pavements
Figure 4.1.2 (a) Latest Condition – Runway Pavements54Figure 4.1.2 (b) Latest Condition – Taxiway Pavements.54Figure 4.1.2 (c) Latest Condition – Apron Pavements.55Figure 4.1.2 (d) Latest Condition – Taxilane Pavements.55
Figure 4.1.2 (a) Latest Condition – Runway Pavements54Figure 4.1.2 (b) Latest Condition – Taxiway Pavements.54Figure 4.1.2 (c) Latest Condition – Apron Pavements.55Figure 4.1.2 (d) Latest Condition – Taxilane Pavements.55Figure 4.1.3 2017 Airfield Pavement Condition Index Exhibit.58
Figure 4.1.2 (a) Latest Condition – Runway Pavements
Figure 4.1.2 (a) Latest Condition – Runway Pavements54Figure 4.1.2 (b) Latest Condition – Taxiway Pavements54Figure 4.1.2 (c) Latest Condition – Apron Pavements55Figure 4.1.2 (d) Latest Condition – Taxilane Pavements55Figure 4.1.3 2017 Airfield Pavement Condition Index Exhibit58Figure 4.2.2 Pavement Condition Summary by Facility Use59Figure 4.3.2 (a) Forecasted Runway Pavement Performance60
Figure 4.1.2 (a) Latest Condition – Runway Pavements54Figure 4.1.2 (b) Latest Condition – Taxiway Pavements54Figure 4.1.2 (c) Latest Condition – Apron Pavements55Figure 4.1.2 (d) Latest Condition – Taxilane Pavements55Figure 4.1.3 2017 Airfield Pavement Condition Index Exhibit58Figure 4.2.2 Pavement Condition Summary by Facility Use59Figure 4.3.2 (a) Forecasted Runway Pavement Performance60Figure 4.3.2 (b) Forecasted Taxiway Pavement Performance61
Figure 4.1.2 (a) Latest Condition – Runway Pavements54Figure 4.1.2 (b) Latest Condition – Taxiway Pavements.54Figure 4.1.2 (c) Latest Condition – Apron Pavements.55Figure 4.1.2 (d) Latest Condition – Taxilane Pavements.55Figure 4.1.3 2017 Airfield Pavement Condition Index Exhibit.58Figure 4.2.2 Pavement Condition Summary by Facility Use.59Figure 4.3.2 (a) Forecasted Runway Pavement Performance.60Figure 4.3.2 (b) Forecasted Taxiway Pavement Performance.61Figure 4.3.2 (c) Forecasted Apron Pavement Performance.61
Figure 4.1.2 (a) Latest Condition – Runway Pavements.54Figure 4.1.2 (b) Latest Condition – Taxiway Pavements54Figure 4.1.2 (c) Latest Condition – Apron Pavements55Figure 4.1.2 (d) Latest Condition – Taxilane Pavements55Figure 4.1.3 2017 Airfield Pavement Condition Index Exhibit58Figure 4.2.2 Pavement Condition Summary by Facility Use59Figure 4.3.2 (a) Forecasted Runway Pavement Performance60Figure 4.3.2 (b) Forecasted Taxiway Pavement Performance61Figure 4.3.2 (c) Forecasted Apron Pavement Performance61Figure 6.1-1 Major Rehabilitation Planning Decision Diagram, PCI ≤ Critical PCI75



List of Tables

Table E-1 Pavement Condition Index Summary (Last Inspection) – Section Level11
Table E-2 Pavement Condition Index Forecast 2018-2027 12
Table E-3 Major Rehabilitation Planning 2018-2027 13
Table 2.2.1 Airfield Pavement Database Network Definition Terminology 30
Table 2.6.2-1 (a) Pavement Distress Types – Flexible Asphalt Concrete-Surfaced Airfields35
Table 2.6.2-1 (b) Pavement Distresses Possible Causes – Flexible Asphalt Concrete-Surfaced Airfields
Table 2.6.2-1 (c) Pavement Distresses Possible Effects – Flexible Asphalt Concrete-Surfaced Airfields 36
Table 2.6.2-2 (a) Pavement Distresses – Rigid Portland Cement Concrete-Surfaced Airfields37
Table 2.6.2-2 (b) Pavement Distresses Possible Causes – Rigid Portland Cement Concrete- Surfaced Airfields
Table 2.6.2-2 (c) Pavement Distresses Possible Effects – Rigid Portland Cement Concrete- Surfaced Airfields
Table 2.6.3 (a) Recommended Sample Rate Schedule for Flexible Asphalt Concrete
Table 2.6.3 (b) Recommended Sample Rate Schedule for Rigid Portland Cement Concrete39
Table 2.6.4 Summary of Updates to ASTM D5340-1241
Table 3.1.1 Previous and/or Anticipated Airfield Pavement Construction
Table 3.1.5 Pavement System Inventory Details 50
Table 4.1.3 Latest Pavement Condition Index Summary
Table 4.3.3 Forecasted PCI 2018-2027
Table 5.2-1 Localized Maintenance and Repair – Flexible Asphalt Concrete
Table 5.2-2 Localized Maintenance and Repair – Rigid Portland Cement Concrete
Table 5.2-3 (a) Localized Repair Planning-Level Unit Costs – Flexible Asphalt Concrete70
Table 5.2-3 (b) Localized M&R Planning-Level Unit Costs – Rigid Portland Cement Concrete .70



Table 5.3-1 Summary of Airport Localized M&R Planning Cost and Quantity at Network Level 71
Table 5.3-2 Summary of Airport Localized M&R Planning Cost and Quantity at Section Level72
Table 5.3-3 Summary of Localized Maintenance
Table 6.1.2 FDOT Recommended Minimum Service-Level PCI
Table 6.2.1 (a) Conceptual Pavement Section for Major Rehabilitation – Flexible Asphalt Concrete
Table 6.2.1 (b) Conceptual Pavement Section for Major Rehabilitation – Rigid Portland Cement Concrete
Table 6.2.2 General Aviation Major Rehabilitation Planning-Level Unit Cost by Pavement Type
Table 6.3.1.10-Year Major Rebabilitation Needs 81



Executive Summary



Executive Summary

Program Background

Airport airfield pavement infrastructure facilities represent a large capital investment in the Florida Airport System. Timely and appropriate maintenance and strategic rehabilitation are essential as repair costs increase significantly in proportion to deterioration. Airport pavement distresses can also contribute to the development of loose debris and decreased ride quality, which can be a safety concern for aircraft operations.

In 2016, the Florida Department of Transportation (FDOT) Aviation and Spaceports Office (ASO) selected Kimley-Horn and Associates, Inc. with subconsultants Airfield Pavement Management Systems, LLC and AVCON, Inc. to provide professional services in support of FDOT in the continued efforts of performing a system update to the Statewide Airfield Pavement Management Program (SAPMP). This work is to be completed from fiscal year 2016 through fiscal year 2019. The SAPMP has 95 public use airport facilities throughout the seven FDOT Districts that participate in the system update. The results of this system update for this specific airport are presented in this report and can be utilized by FDOT and the Federal Aviation Administration (FAA) to identify, prioritize, and schedule pavement maintenance, repair, and major rehabilitation projects.

Pavement condition was assessed utilizing the pavement condition index (PCI) methodology as defined in the FAA Advisory Circular 150/5380-7B "Airport Pavement Management Program (PMP)" using the documented procedures set forth by ASTM D5340-12 "Standard Test Method for Airport Pavement Condition Index Surveys."

Pavement deterioration, in accordance with the ASTM D5340-12, was characterized in terms of distinct distress types, severity level of distress, and quantity of distress. This information is utilized to calculate a PCI numeric that represents the overall condition of the pavement in a numeric index that ranges from 0 (a condition category of FAILED) to 100 (GOOD). The PCI methodology analyzes an overall measure of the pavement condition and provides an indication of the degree of maintenance, repair, or rehabilitation efforts that will be required to sustain functional pavement.

The tasks required for the system update at each participating airport consist of the following:

- Obtain recent and anticipated airfield pavement construction work data.
- Update airport airfield pavement system inventory records (construction history, identification, geometry, and facility classification).
- Perform PCI Survey Inspections at each participating airport.
- Update the FDOT SAPMP PAVER[™] database system.
- Update the FDOT SAPMP GIS Airfield Navigation GPS enabled Maps.
- Update airfield pavement performance models and pavement condition forecasting.
- Identification of planning-level maintenance, repair, and major rehabilitation to address pavement needs based on functional PCI analysis.
- Development of planning-level opinion of probable construction costs for pavement rehabilitation.

Summary of Results

Pavement Condition Index (Latest Inspection)

Table E-1 Pavement Condition Index Summary (Last Inspection) – Section Level

Network ID	Branch Name	Branch Use	Section ID	Area (SF)	PCI	Condition Rating	
PCM	RUNWAY 10-28	RUNWAY	6103	15,106	46 Poor		
PCM	RUNWAY 10-28	RUNWAY	6115	228,796	58	Fair	
PCM	RUNWAY 10-28	RUNWAY	6120	52,500	58	Fair	
PCM	TAXIWAY A	TAXIWAY	110	124,860	58	Fair	
PCM	TAXIWAY A	TAXIWAY	115	33,606	55	Poor	
PCM	TAXIWAY A	TAXIWAY	120	6,040	92	Good	
PCM	TAXIWAY A	TAXIWAY	150	4,773	48	Poor	
PCM	TAXIWAY A	TAXIWAY	160	5,383	53	Poor	
PCM	TAXIWAY A	TAXIWAY	165	6,228	92	Good	
PCM	TAXIWAY A	TAXIWAY 170		4,870	90	Good	
PCM	TAXIWAY A	TAXIWAY 174		4,273	94	Good	
PCM	TAXIWAY A	TAXIWAY 175 3,137		3,137	83	Satisfactory	
PCM	T-HANGARS TAXIWAY	TAXILANE 705 13,043		70	Fair		
PCM	T-HANGARS TAXIWAY	TAXILANE 710 5,895		40	Very Poor		
PCM	T-HANGARS TAXIWAY	TAXILANE	720	6,460	45	Poor	
PCM	T-HANGARS TAXIWAY	TAXILANE	725	23,407	60	Fair	
PCM	TAXIWAY TO HANGAR	TAXILANE	750	53,871	90	Good	
PCM	APRON	APRON	4105	112,145	93	Good	
PCM	APRON	APRON 4110 45,437 65		Fair			
PCM	APRON	APRON	4120	46,434	63	Fair	
PCM	APRON	APRON	4130	77,514	59	Fair	
PCM	APRON	APRON	4135	29,575	69	Fair	
PCM	APRON	APRON	4140	2,500	75	Satisfactory	

FDOT

111

Forecasted Pavement Condition Index 2018-2027

Table E-2 Pavement Condition Index Forecast 2018-2027

Network ID	Branch ID	Section ID					l	Forecas	sted PC	I			
Network ID	Branch ID	Section ID	Last PCI	2018	2019	2020	2021	2022	2023	2024	2025	2026	2027
PCM	AP	4105	93	91	90	88	87	85	83	82	80	79	77
PCM	AP	4110	65	63	60	58	56	54	53	53	52	52	52
PCM	AP	4120	63	61	58	56	55	54	53	52	52	52	52
PCM	AP	4130	59	57	56	54	53	51	49	48	46	45	43
PCM	AP	4135	69	67	66	64	63	61	59	58	56	55	53
PCM	AP	4140	75	73	71	69	67	65	63	62	60	59	57
PCM	RW 10-28	6103	46	43	40	36	33	31	29	26	23	20	17
PCM	RW 10-28	6115	58	56	55	53	50	47	44	41	37	34	32
PCM	RW 10-28	6120	58	56	55	53	51	50	48	46	45	43	42
PCM	TW A	110	58	56	54	53	51	50	48	47	46	45	44
PCM	TW A	115	55	53	52	50	49	47	46	44	42	41	39
PCM	TW A	120	92	89	86	84	82	80	78	76	75	74	73
РСМ	TW A	150	48	47	45	45	44	44	43	43	43	43	43
PCM	TW A	160	53	51	50	48	47	46	45	44	44	43	43
РСМ	TW A	165	92	89	86	84	82	80	78	76	75	74	73
PCM	TW A	170	90	87	85	82	80	78	77	75	74	73	72
РСМ	TW A	174	94	91	88	86	83	81	79	77	76	74	73
PCM	TW A	175	83	81	79	77	76	74	73	72	71	71	70
PCM	TW HANG	750	90	88	85	83	80	78	76	75	73	72	70
PCM	TW T-HANG	705	70	69	68	67	66	65	64	63	62	62	61
PCM	TW T-HANG	710	40	38	37	36	34	33	32	31	30	30	29
PCM	TW T-HANG	720	45	43	42	40	39	37	36	35	33	32	31
РСМ	TW T-HANG	725	60	59	58	56	55	54	52	51	49	47	46

141


Major Rehabilitation Planning 2018-2027

Table E-3 Major Rehabilitation Planning 2018-2027

Program Year	Network ID	Branch ID	Section ID	Surface	Area (SF)	PCI Before	Rehabilitation Type	Planning Cost
2018	РСМ	AP	4110	AAC	45,437	63	AC Restoration	\$ 319,000.00
2018	РСМ	AP	4120	AAC	46,434	61	AC Restoration	\$ 326,000.00
2018	РСМ	AP	4130	AC	77,514	57	AC Restoration	\$ 543,000.00
2018	РСМ	AP	4140	PCC	2,500	73	PCC Restoration	\$ 26,000.00
2018	РСМ	RW 10-28	6103	AAC	15,106	43	AC Restoration	\$ 126,000.00
2018	РСМ	RW 10-28	6115	AAC	228,796	56	AC Restoration	\$ 1,602,000.00
2018	РСМ	RW 10-28	6120	AC	52,500	56	AC Restoration	\$ 368,000.00
2018	РСМ	TW A	110	AAC	124,860	56	AC Restoration	\$ 875,000.00
2018	РСМ	TW A	115	AC	33,606	53	AC Restoration	\$ 236,000.00
2018	РСМ	TW A	150	AAC	4,773	47	AC Restoration	\$ 37,000.00
2018	РСМ	TW A	160	AAC	5,383	51	AC Restoration	\$ 38,000.00
2018	РСМ	TW T-HANG	710	AC	5,895	38	AC Reconstruction	\$ 54,000.00
2018	РСМ	TW T-HANG	720	AC	6,460	43	AC Restoration	\$ 54,000.00
2018	РСМ	TW T-HANG	725	AC	23,407	59	AC Restoration	\$ 164,000.00
2020	РСМ	AP	4135	AC	29,575	64	AC Restoration	\$ 208,000.00
2023	РСМ	TW T-HANG	705	AC	13,043	64	AC Restoration	\$ 92,000.00

*All planning cost values have been rounded to the nearest thousand-dollar.



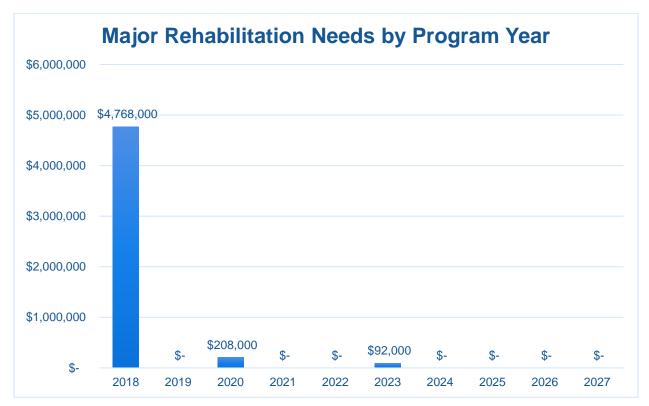

Summary of Plant City Airport

Plant City Airport was inspected in March 2017 – the overall weighted PCI value was 65, a condition rating of Fair. The results of the maintenance, repair, and major rehabilitation analysis identified \$559,980 in localized M&R needs based on current conditions and a 10-Year major rehabilitation need of \$5,068,000 based on forecasted conditions. The current major rehabilitation needs based on the latest inspection consist of \$4,768,000 for pavements below critical condition.

Localized maintenance and repair identified within this report are categorized as preventive or stopgap; the FDOT SAPMP has defined maintenance policies based on FAA recommendations. Major rehabilitation is identified within the FDOT SAPMP as major construction activity that would result in an improvement or resetting of the pavement section's PCI to a value of 100. Such activities could include: mill and hot-mix asphalt overlay, rigid pavement repair and slab replacement, and full-depth reconstruction. It is recommended that the airport use this as a planning tool for future project development and prioritization – all localized maintenance and repair and major rehabilitation recommendations should be considered as planning-level only. All final localized maintenance, repair, and major rehabilitation is subject to change based on airport prioritization and further design-level evaluation.



Chapter 1

FDOT

Chapter 1 – Introduction

1.1 Background

The State of Florida has 128 public airports of which 100 public-use airports are recognized as part of the Federal Aviation Administration's (FAA) National Plan of Integrated Airport Systems (NPIAS) that are vital to the Florida economy as well as the economy of the United States. The Florida Aviation System (FAS) provides opportunities for the State to capitalize on an increasingly global marketplace. Florida's system of commercial service and general aviation (GA) airports are important to businesses throughout the entire State. Air travel is essential to tourism, Florida's number one industry.

There are millions of square feet of pavement infrastructure that consists of runways, taxiways, aprons, ramps, and other areas of airports that are vital to the support and safety of aircraft operations. Timely pavement maintenance, repair and major rehabilitation of these pavements will support the airport in operating safely, efficiently, economically and without excessive down time.

In general, adherence to the FAA Advisory Circulars are mandatory for all projects funded with federal grant monies through the Airport Improvement Program (AIP) and with revenue from the Passenger Facilities Charges (PFC) Program. Further information is detailed in FAA Grant Assurance No. 11 "Pavement Maintenance," No. 34 "Policies, Standards, and Specifications," and PFC Assurance No. 9 "Standards and Specifications." The Florida Department of Transportation (FDOT) performs the Statewide Airfield Pavement Management Program (SAPMP) System Updates for the benefit of participating public-use and publicly owned airports through the Aviation and Spaceports Office (ASO).

The SAPMP addresses the requirements of maintaining an effective pavement management program for the participating airports at the network level. Network-level management of pavement assets provides insight for short-term and long-term budget needs, understanding of the overall condition of the network (current and future), and pavement facilities that are subject for project consideration. A network-level evaluation can be supportive in the identification of maintenance, repair, and major rehabilitation needs and budgetary planning-level opinions of probable construction costs.

1.2 Statewide Airfield Pavement Management Program (SAPMP) Update 2016-2017

In 1992, the FDOT established the Statewide Airfield Pavement Management Program (SAPMP) to provide program managers, District Aviation and Spaceport Offices, and airport operators a system to proactively manage airport airfield pavement infrastructure within the Florida Aviation System. The SAPMP performs network-level Pavement Condition Index (PCI) survey inspections for airport facilities that are categorized as General Aviation (GA), Reliever (RL), and Commercial (PR). Currently, the program consists of 95 actively participating publicuse airports with pavement facilities and provides users with comprehensive data to better manage pavement assets.



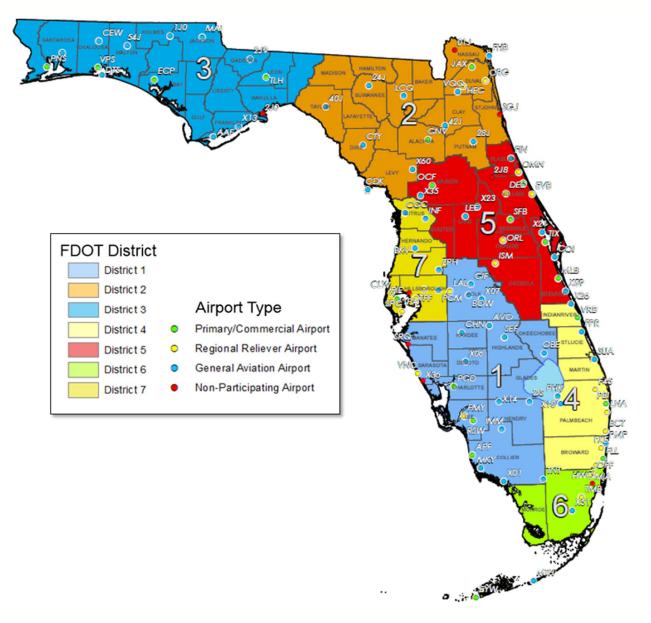


Figure 1.2 Florida Aviation System (Facilities with Pavement) and FDOT Districts

In 2016, the Florida Department of Transportation Aviation and Spaceports Office contracted Kimley-Horn and Associates, Inc. along with subconsultants Airfield Pavement Management Systems, LLC and AVCON, Inc. to provide professional services in support of FDOT in the continued efforts of performing a system update to the SAPMP. This work is to be completed from fiscal year 2016 through fiscal year 2019.

1.3 Organization

1.3.1 Florida Department of Transportation Aviation and Spaceports Office Program Manager

The FDOT Aviation and Spaceports Office (ASO) Aviation Engineering Manager serves as the Program Manager (ASO-PM) for the SAPMP. The ASO-PM monitors the work performed by the designated Consultant for the program. The ASO-PM has review and approval authority for each program task and manages the program's day-to-day details and pertinent updates.

The ASO-PM reports updates and milestones to the FDOT State Aviation and Spaceports Manager and Development Administrator.

1.3.2 Participating Florida Public-Use and Publicly Owned Airports

The airports are the end-user and beneficiary of the SAPMP. The SAPMP provides a specific Airport Pavement Evaluation Report that meets the requirements of the FAA Advisory Circular **150/5380-7B "Airport Pavement Management Program (PMP)."** Individual participating airports will be provided a final Airport Pavement Evaluation Report by the designated Consultant that is specific to each airport's airfield pavement condition index survey. The ASO-PM has full authority and final approval of each report prior to finalization. In advance of each PCI survey and prior to completion of each Airport Pavement Evaluation Report, participating airports are asked to provide the necessary record documentation for the proper analysis efforts. Relevant record documentation artifacts may consist of but are not limited to: Airport Layout Plans (ALP), Construction Bid Tabulations, As-Built Construction Drawings, Engineer's Reports, and/or field pavement inspection reports.

1.3.3 Florida Department of Transportation District Offices

The seven (7) FDOT District Offices, specifically the Aviation representatives (currently the Freight and Logistics personnel), provide essential support to the SAPMP update and the ASO-PM. Each District supports the SAPMP's on-going efforts by providing local construction cost information throughout the State. The construction cost information, typically consisting of plans and bid tabulations, are used as the basis of the development maintenance, repair, and major rehabilitation opinions of probable construction costs for planning purposes. Each District Office receives copies of individual Airport Pavement Evaluation Reports for the participating airport facilities located within their respective Districts.

1.3.4 Consultant

The Consultant, Kimley-Horn and Associates, Inc., provides technical and administrative support to the ASO-PM for the SAPMP update. The support consists of airfield pavement system inventory updates, performance of PCI Surveys in accordance with ASTM *D5340-12* "*Standard Test Method for Airport Pavement Condition Index Surveys,*" evaluation and reporting of the pavement condition in accordance with the FAA Advisory Circular *150/5380-7B* "*Airport Pavement Management Program (PMP).*"

The Consultant Team consists of Kimley-Horn, Airfield Pavement Management Systems, LLC., and AVCON, Inc.

A brief description of the general scope of work undertaken to update the SAPMP includes but is not limited to:

- Research and evaluation of existing record documentation was performed to identify construction projects that have taken place since the most recent major update of the SAPMP. This data is used to update the pavement inventory and network definition.
- An update to the existing Network Definition Map was made to reflect geometric changes, pavement composition updates, and section characterization. Furthermore, an update to the PCI Survey sample units were made to reflect the field investigation efforts.
- A functional pavement evaluation with PCI Survey inspections was completed on all airfield pavements maintained by the Airport. The PCI Survey procedure, as defined by ASTM D5340-12, was used as the basis of the functional pavement evaluation. For this specific evaluation, the sample units defined by prior studies were inspected as to better develop performance models for prediction curves. Pavement subject to construction or anticipated construction during scheduled PCI Survey inspection or within 2 years were omitted from inspection based on confirmation of airport personnel.
- Condition Analysis was performed based on the distress data observed, rated, measured, and recorded in accordance with the ASTM D5340-12 for the calculation of PCI values and ratings. The results of the current condition analysis were used in concert with the historic PCI Survey data and construction work history to develop performance models to forecast future PCI values for each section for a 10-year study duration.
- Maintenance, Repair, and Rehabilitation Planning was performed predicated on the results of the condition analysis with updated policies and planning-level unit costs. The policies, or M&R policies, have been updated to reflect standard practices for maintenance, repair, and major rehabilitation as defined by the FAA AC 150/5380-6C "Guidelines and Procedures for Maintenance of Airport Pavements." Planning-level unit costs were developed based on representative construction bid tabulations provided by participating airports. The bid tabulations consisted of limited airfield pavement construction projects that took place between 2009 and 2015 at participating airports.

1.4 Purpose of Airport Pavement Evaluation Report

The individual airport airfield pavement evaluation report discusses the work performed, a summary of findings, condition analysis results, and recommendations for maintenance, repair, and major rehabilitation (M&R) planning associated with the SAPMP system update. It also briefly describes the procedures used to ensure that the appropriate engineering and scientific standards of care, quality, budget, schedules, and safety requirements were implemented during the performance of this work.

The purpose of this Airfield Pavement Evaluation Report is to achieve the following:

- Describe the goals, procedures, and purpose of the SAPMP
- Provide a brief technical explanation of the pavement management methodology, standard practices, and objectives
- Analyze pavement distresses data for the determination of pavement conditions and for identification of airfield pavement maintenance, repair, and major rehabilitation needs based on functional PCI trends

The identification of rehabilitation needs has been determined at the planning level. Design-level investigation is recommended prior to developing construction-level design documents and budgets.

In compliance with FAA Grant Assurances 11 and 19; the FDOT SAPMP provides airports with airfield pavement evaluation reports in accordance with FAA AC 150/5380-7B Airport Pavement Management Program (PMP) and AC 150/5380-6C Guidelines and Procedures for Maintenance of Airport Pavements. The application of the results of a PCI survey are for planning purposes and are limited to the visual observation of deteriorated pavements in limited sampling; design-level investigation is recommended in accordance with the FAA procedures defined in AC 5320-6F Airport Pavement Design and Evaluation and AC 150/5370-11B Use of Nondestructive Testing in the Evaluation of Airport Pavements. The aforementioned ACs provide the design-level material properties of in-situ pavement and subgrade layers for the determination of appropriate rehabilitation actions. The FDOT Statewide Airfield Pavement Management Program is organized to provide airports with planning-level data and does not intend to preclude the responsible engineer in performing the appropriate level of investigation and analysis in determining the appropriate design details of a pavement rehabilitation. It would not be advisable to solely base design-level rehabilitation without the appropriate level of investigation and determination of pavement deterioration beyond that of a visual functional condition assessment.

1.5 History of the Program

In 1992, the FDOT implemented the SAPMP to understand the pavement conditions at public airports in the FAS, systematically update pavement infrastructure information, and assist airport operators with recommendations of pavement maintenance, repair, and major rehabilitation needs. The 1992 SAPMP implementation provided the FDOT and the participating airports valuable information for establishing and performing timely and appropriate pavement rehabilitation.

Plant City Airport (PCM)

During the 1992-1993 implementation and again during the 1998-1999 updates; the SAPMP performed the development with proprietary software for pavement management system analysis. This development allowed for the creation of pavement management database file system populated with airport attributes and condition data. The pavement management database was used to establish maintenance, repair, and rehabilitation policies; consider planning-level unit costs; and develop recommendations for performing pavement maintenance. This system, known as AIRPAV, was initially developed during the 1992-1993 SAPMP implementation for the analysis of distress data. The AIRPAV system was used again in the 1998-1999 SAPMP update.

In 2004, the SAPMP system update included the review of the AIRPAV software compared to other industry available non-proprietary software packages. As a result of this review, MicroPAVER[™] (currently known as PAVER[™]) was selected for implementation of the system update. MicroPAVER[™] was developed by the U.S. Army Corps of Engineers Construction Engineering Research Laboratory for pavement management. Data from the 1998-1999 FDOT SAPMP update, which was built upon the initial 1992-1993 implementation of AIRPAV, was reviewed and converted to be compatible with the MicroPAVER[™] system. This data conversion included all documented pavement facilities, classifications, types, histories, geometries, PCI condition data and pertinent attributes gathered from airport feedback at the time. This information was used to develop the inventory of each participating airport's pavement facilities in a consistent format. This was the development of Airfield Pavement Network Definition Exhibits. These inventory exhibits visually depicted the branch, section, and sample units that were based upon the pavement construction history and composition information provided by each airport.

In the 2006-2008 system update, the SAPMP was updated again with continued use of the MicroPAVER[™] system. Based on the distress data collected, a maintenance repair and major rehabilitation planning program was developed for each airport. As part of this SAPMP update, the procedures for the inspection and the collection of the pavement distress data were documented, and an interactive website (http://www.dot.state.fl.us/aviation/pavement.shtm) was established for input of data.

In the 2010-2012 system update, the SAPMP was updated using new global positioning system (GPS) integrated technology to digitally collect pavement distress data. Interactive geographic information system (GIS) map files were developed from updated Airfield Pavement Network Definition Exhibits to aid pavement condition inspectors in the collection of sample distress data. The data collected was utilized to develop pavement performance models to predict future pavement PCI values and make recommendations for major rehabilitation.

In the 2013-2015 system update, the SAPMP integrated PAVER[™] and FieldInspector[™] with the use of GPS and GIS capable field tablets. Furthermore, the update included continued adherence to the ASTM D5340-12 "Standard Test Method for Airport Pavement Condition Index Surveys." The ASTM update consisted of refinement of distress definition types and deduction values for select asphalt concrete and Portland Cement Concrete distresses.



1.6 Federal Aviation Administration (FAA)

Currently, airports participating in the Airport Improvement Program (AIP) Grant Program are required by the FAA to develop and implement a pavement maintenance program to be eligible for funding (FAA Advisory Circular 150/5380-6C "Guidelines and Procedures for *Maintenance of Airport Pavements*" and 150/5380-7B "Airport Pavement Management **Program (PMP)**"). This program requires detailed inspection of airfield pavement conditions by trained personnel. The inspections are required to be performed at least once a year using the PASER method or every three years if the pavement is inspected as defined by the PCI survey procedure in accordance with the ASTM *D5340-12* "*Standard Test Method for Airport Pavement Condition Index Surveys.*"

In general, adherence to the Advisory Circulars are mandatory for all projects funded with federal grant monies through the AIP program and with revenue from the Passenger Facilities Charges (PFC) Program. Further information is detailed in FAA Grant Assurance No. 11 "Pavement Maintenance," No. 34 "Policies, Standards, and Specifications," and PFC Assurance No. 9 "Standards and Specifications."

1.7 FDOT SAPMP Objectives and Components

The FDOT SAPMP is a program that provides the FAS support in implementing and/or maintaining a network-level Pavement Management Program in a consistent and regularly scheduled manner.

In accordance with FAA AC150/5380-7B "Airport Pavement Management Program (PMP)" an effective Pavement Management Program consists of a system that achieves specific objectives. The FDOT SAPMP objectives are as follows:

1.7.1 Program Objectives

- 1 A systematic means for collecting and storing information regarding existing pavement structure and condition.
- 2 An objective and repeatable system for evaluating pavement condition.
- 3 Procedures for predicting future pavement condition.
- 4 Procedures for modeling both past and future pavement performance conditions.
- 5 Procedures to determine the budget requirements to meet management objectives, such as the maintenance, repair, and major rehabilitation budget required to keep a pavement at a specified PCI level or the budget required to improve to target PCI level.
- 6 Procedures for formulating and prioritizing maintenance, repair, and major rehabilitation projects.

The objectives are accomplished by the following components:


1.7.2 Program Components

- A. Database
- B. Pavement Inventory
- C. Pavement Structure
- D. Pavement Work History
- E. Pavement Condition Data



- F. Pavement Performance Modeling for the Prediction/Forecast of PCI
- G. Maintenance, Repair, and Major Rehabilitation Policies and Budget Simulation

A well-maintained network-level pavement management program may provide airport staff a better understanding of the airfield pavement performance for developing and planning for specific maintenance, repair, and major rehabilitation projects. The understanding of specific distress types and severities will assist the airport in addressing pavement maintenance and repair with the appropriate treatments as defined by the FAA Advisory Circular 150/5380-6C "Guidelines and Procedures for Maintenance of Airport Pavements." The development of projects with an understanding of system inventory, deterioration details, and pavement condition forecasts may assist airport staff in developing practical rehabilitation actions and budgets. Furthermore, the understanding of pavements' past performance and forecasted condition may assist airport staff in addressing pavement rehabilitation in a timely and costeffective manner. Figure 1.7-1 Typical Pavement Condition Life Cycle, which is based on the FAA Advisory Circular 150/5380-7B "Airport Pavement Management Program (PMP)." Figure 1.7-1 Typical Pavement Condition Life Cycle, depicts a general duration of a pavement section and identifies the ideal condition to perform rehabilitative treatments at an optimal cost rather than allowing significant increase in rate of deterioration that would result in increased costs.

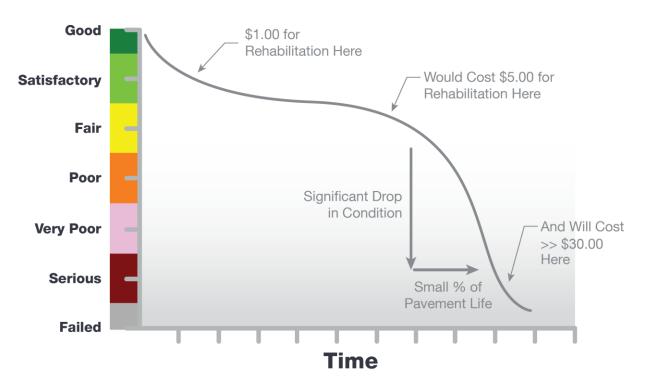

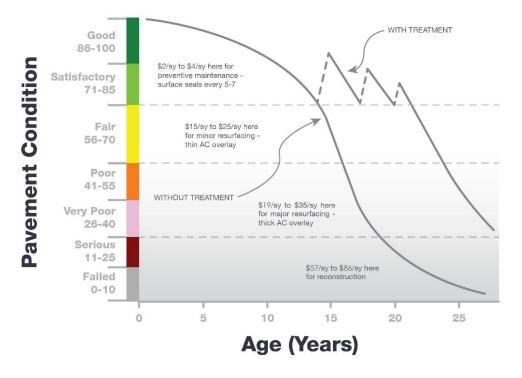


*Figure is for conceptual purposes only – unit costs are not specific to airfield pavements (AC vs PCC).

Figure 1.7-2 General Pavement Treatments by Condition Range depicts generic flexible asphalt concrete (AC) pavement treatments that are effective at specific condition ranges. This graphic is a general concept and will vary based on pavement surface type and overall

composition. The intent is to convey various treatment types that would be effective based on the condition of the pavement along the deterioration model.





Pavement maintenance, repair, and major rehabilitation would be quite anticipatory if all pavements behaved as depicted in **Figures 1.7-1 and 1.7-2**, however pavement condition performance vary significantly based on several factors. Factors that contribute to a pavement section's condition and deterioration performance may include: functional design life, material type, material construction quality, climatic conditions, aircraft loading type and frequency, non-aircraft loading type and frequency, maintenance history, subgrade conditions, and other infrastructure in the vicinity. The list of factors is not all-inclusive of all factors that may contribute to a pavement's life cycle, it is intended to clarify that unique conditions certainly will affect a pavement's deterioration.

Figures 1.7-3 and Figure 1.7-4 depict visual conditions of pavement facilities, for both AC and PCC respectively, with approximated PCI ranges and corresponding repair and rehabilitation measures.

141

Representative **PCI Range Rehabilitation Activities Representative PCI Pavement Surface** Routine Maintenance Pavements with PCI values above 85, or 86-100 90 'Good', may require periodic joint/crack sealing and local patching. Pavement Preservation Pavements with PCI conditions ranging from 'Fair' to 'Satisfactory' may require surface 65-85 70 treatments (seal coat), thin overlays, and/or joint/crack sealing. Major Rehabiliation Pavements that have deteriorated below a PCI 65, or within the range of 'Very Poor' to 40-64 50 rehabilitation such as pavement mill and Major Reconstruction Pavements that have deteriorated below a 15 PCI 40, or within the range of 'Failed' to 0 - 39'Very Poor' conditions, may require major reconstruction.

Figure 1.7-4 Rigid Portland Cement Concrete

	PCI Range	Representative PCI	Representative Pavement Surface	Rehabilitation Activities
Routine Maintenance	86-100	90		Pavements with PCI values above 85, or 'Good', may require periodic joint/crack sealing and local patching.
Pavement Preservation	65-85	70		Pavements with PCI conditions ranging from 'Fair' to 'Satisfactory' may require patches and/or joint/crack sealing.
Major Rehabiliation	40-64	50		Pavements that have deteriorated below a PCI 65, or within the range of 'Very Poor' to 'Fair' conditions may require major rehabilitation such as slab replacement and PCC restoration activity.
Major Reconstruction	0-39	15		Pavements that have deteriorated below a PCI 40, or within the range of 'Failed' to 'Very Poor' conditions, may require major reconstruction.

Figure 1.7-3 Flexible Asphalt Concrete

1.8 References

The following reference documents were referenced as specific guidelines and procedures for maintaining airport pavements; establishing an effective pavement maintenance program; and identifying specific pavement distresses, probable causes of distresses, inspection guidelines, and recommended methods of repair:

- ASTM D5340-12 "Standard Test Method for Airport Pavement Condition Index Surveys."
- FAA Advisory Circular 150/5380-7B 150/5380-7B "Airport Pavement Management Program."
- FAA Advisory Circular 150/5380-6C "Guidelines and Procedures for Maintenance of Airport Pavements."
- FAA Advisory Circular 150/5320-6F "Airport Pavement Design and Evaluation."
- Department of the Air Force, Air Force Civil Engineer Center "Engineering Technical Letter (ETL) 14-3: Preventive Maintenance Plan (PMP) for Airfield Pavements."
- Unified Facilities Criteria (UFC) 3-260-16FA 16 "Airfield Pavement Condition Survey Procedures Pavements."
- Unified Facilities Criteria (UFC) 3-260-03 "Airfield Pavement Evaluation."
- Pavement Management for Airports, Roads, and Parking Lots 2nd Edition, M.Y. Shahin.



Chapter 2

Chapter 2 – Methodology

An effective pavement management program incorporates the regular collection of pavement condition information and communication of information to appropriate sponsors. This chapter of the report defines the specific methods utilized as part of the SAPMP System Update to meet the requirements of an effective pavement management system as defined by the FAA Advisory Circular **150/5380-7B** "Airport Pavement Management Program (PMP)."

2.1 Airfield Pavement Database

The SAPMP program has historically utilized PAVER[™] (formerly MicroPAVER[™]); the current update has maintained the use of the PAVER[™] 7.0 version of the software. The PAVER[™] software application was developed by the U.S. Army Construction Engineering Research Laboratory sponsored by the FAA, Federal Highway Administration, U.S. Army, U.S. Air Force, and the U.S. Navy to meet the objectives of an effective pavement management system. The SAPMP consists of a network-level database of the airport's airfield pavement facilities that are part of the program. PAVER[™] can achieve the following pavement management objectives: a manageable inventory system, the analysis of the current condition of pavements in accordance with the ASTM D5340, the development of pavement performance models to forecast conditions, and the development of maintenance, repair, and major rehabilitation recommendations based on budgetary scenarios.

PAVER[™] inventory management is based on a tiered organizational structure that consists of networks, branches, and sections, with the section being the smallest unit of management. Critical elements of an effective pavement management program are maintained within the network-level PAVER[™] database. These elements typically consist of pavement inventory characteristics, pavement structure, work history, historic condition records, and analytical customization.

The SAPMP System Update consisted of the conversion of the previous database from a PAVER[™] version 6.5 to a version 7.0.

2.2 Airfield Pavement System Inventory

An airfield pavement system inventory typically maintains the location of all runways, taxiways, and aprons; geometric characteristics; type of pavement structure, year of construction and/or last major rehabilitation; and general composition details of the pavement.

The pavement inventory for an airport's airfield is an assembly of pavement infrastructure information that builds an inventory of branches and sections that codifies the airport's airfield pavement network. General geometry characteristics, estimated length, width, functional classification, pavement surface type, and operational function are among the characteristics identified at this initial phase in the pavement management process. The development of a pavement inventory that reasonably reflects the airport's airfield pavement facilities that are maintained by the airport provides a defined scope of the inspection and analysis efforts. As in the past, the SAPMP scope of work is specific to the airport-maintained airfield pavements as defined in the field network definition exhibits presented to current airport personnel.

A critical input to the pavement system inventory and network definition in the development of the SAPMP update is the date of last major rehabilitation/construction performed on the pavement assets that would set the asset at a PCI of 100 and a condition rating of Good. The airport provided a limited combination of record drawings, reports, and staff input that was pertinent information in developing the construction history of the airport's pavements from inception. Major rehabilitation/construction activities performed in the last 24-months or anticipated in the next 24-months are assumed to restore the PCI to 100. These activities include; pavement overlay, mill and replace, mill and overlay, new construction, and/or complete reconstruction.

Aerial imagery was obtained through the FDOT Surveying & Mapping Office's *Aerial Photo Look Up System (APLUS)*. This spatially projected imagery was utilized with computer-aided drafting software (AutoCAD) in concert with geographical information system software (ArcGIS) to develop a planning-level representative model that reasonably reflects the pavement assets at the airport.

2.2.1 Pavement Management Program Network Definition Terminology

There are several terms that are common in the communication of the results of the SAPMP System Update, these terms are defined as follows:

Pavement Network

A pavement network is a logical unit for organizing pavements into a structure for pavement management. A network will typically consist of one or more pavement *branches*, which are typically comprised of one or many pavement *sections*. The network is the starting point of the hierarchy of pavement management organization. For example, a network can be all the pavements within an airport's airfield or all the pavements in a statewide program. For the FDOT SAPMP, a network represents an individual airport's airfield pavement facilities maintained by the airport.

The SAPMP System Update consists of research and evaluation of existing record documentation for the participating airports' airfield facilities. The pavement network is typically limited to the pavement facilities subject to aircraft use that is also maintained by the airport owner and eligible for public funding.

Pavement Branch

A pavement branch, also known as a facility, is a logical unit of generally identifiable pavement of a network with distinct functional classification. For example, within an airfield each runway, taxiway, or apron is considered a branch. A branch must consist of at least one section.

Pavement Section

A pavement section, also known as a feature, is the most specific management unit when considering the application and selection of maintenance, repair, and/or major rehabilitation treatments on an area of pavement within a branch. Each branch consists of at least one section, but may consist of more if pavement feature characteristics are distinct throughout the branch. Characteristics considered when subdividing branches into sections include, but are not limited to: pavement structure, type, age, condition, and function; traffic composition and frequency (current and future); geometric location; construction history; and other related

infrastructure features (e.g. drainage). A pavement section is defined as a subordinate of a pavement branch, which is a subordinate of a "parent" pavement network.

Pavement Sample Unit

A pavement sample unit is a subdivision of a pavement section that has a standard size range: twenty (20) continuous slabs (± 8 slabs) for Portland Cement Concrete (PCC) pavement and 5,000 contiguous square feet ($\pm 2,000$ ft²) for flexible asphalt concrete (AC) or porous friction course pavements.

PMS Network Level	Common Definition	Airport Example		
Network	Overall pavement assets maintained by the Airport	"Tallahassee International Airport – Airfield Pavements"		
Branch Name	Commonly defined asset name as established by Airport and by use	"Runway 18-36"		
Branch ID	Codified shorthand name for commonly defined asset established for database identification	"RW 18-36" RW, Branch Use, "Runway" 18-36, Runway Facility		
Section ID	Codified identification for pavement asset that is distinct by the following: Pavement Composition Construction Work History Aircraft Traffic Condition Records	"6105"		
Sample Unit	A numeric identification of an area of pavement (5,000±2,000 SF of AC or 20±8 slabs of PCC) that has been inspected in accordance with ASTM D5340-12.	"300"		

Table 2.2.1 Airfield Pavement Database Network Definition Terminology



2.3 Airfield Pavement Structure

2.3.1 Pavement Structure Types

Airport airfield pavements are constructed to provide adequate support for the loads imposed by aircraft and produce a firm, stable, smooth, all-year, all-weather surface free of debris or other particles that may be blown or dislocated by propeller wash or jet blast. Typical pavement planning and design requires coordination of factors that include but are not limited to; subgrade conditions, material layer types, aircraft fleet mix (type, frequency, and traffic growth), and functional use. A pavement structure is composed of constructed layers that consist of subgrade, subbase, base course, structural courses, and surfaces courses. For the FDOT SAPMP, two major pavement structure types are classified for evaluation and analysis: Flexible Asphalt Concrete Surface and Rigid Portland Cement Concrete Surface. Additionally, Composite Structures known as Whitetopping Pavements are also present at limited airports within the Florida Airports System; these unique pavement structures are evaluated separately.

Flexible Asphalt Concrete Surface

A pavement comprised of aggregate mixture with an asphalt cement binder. The FDOT SAPMP consists of three (3) asphalt concrete surface types: Asphalt Concrete (AC), Asphalt Concrete Overlaid on Asphalt Concrete (AAC), and Asphalt Concrete Overlaid on Portland Cement Concrete (APC).

Asphalt Concrete (AC)

A flexible pavement section consisting of aggregate mixture with asphalt cement binder layered on engineered base course material that is layered on subbase and subgrade soil material.

Asphalt Concrete Overlaid on Asphalt Concrete (AAC)

A flexible pavement section consisting of aggregate mixture with asphalt cement binder layered on an existing flexible AC pavement section. Flexible airfield pavement sections are AAC when a pavement rehabilitation consists of a pavement milling operation and a resurfacing of asphalt layers; or a direct overlay of asphalt concrete without surface preparation.

Asphalt Concrete Overlaid on Portland Cement Concrete (APC)

A flexible pavement section consisting of aggregate mixture with asphalt cement binder layered on an existing Rigid PCC pavement section. This unique pavement composition may result in distinct pavement distress manifestations known as reflective joint cracking.



Rigid Portland Cement Concrete Surface

A pavement comprised of aggregate mixture with a Portland Cement binder. The FDOT SAPMP recognizes Portland Cement Concrete (PCC) as the primary rigid pavement section.

Portland Cement Concrete (PCC)

A rigid pavement section composed of Portland cement concrete placed on a granular or treated base course that is supported on a compacted subgrade. The concrete surface must provide a texture of nonskid qualities, prevent the infiltration of surface water into the subgrade, and provide structural support to the airplanes. Rigid pavement construction requires the layout of appropriately designed joint spacing.

Composite Structure – Whitetopping Pavement

A composite pavement comprised of relatively thin Portland Cement Concrete overlaid on an existing flexible asphalt concrete pavement structure. There are three (3) types of Whitetopping Pavements; Conventional (WHT), Thin (TWT), and Ultra-Thin (UTW).

Conventional Whitetopping (WHT)

A composite pavement structure consisting of a modified PCC overlaid on an existing flexible AC pavement section area. The modified PCC layer is typically greater than 6-inches in thickness.

Thin Whitetopping (TWT)

A composite pavement structure consisting of a modified PCC overlaid on an existing flexible asphalt concrete pavement section. The modified PCC layer is typically between 4 and 6 inches in thickness.

Ultra-Thin Whitetopping (UTW)

A composite pavement structure consisting of a modified PCC overlaid on an existing flexible asphalt concrete pavement section. The Portland Cement Concrete layer is typically between 2 and 4 inches in thickness.



2.4 Airfield Pavement Work History

2.4.1 Airfield Pavement Record Keeping

It is strongly recommended that airports maintain records of all airfield construction and maintenance related to the pavement facilities. A history of all maintenance and repair performed and its associated costs (construction and soft costs) can provide valuable information on the effectiveness of various treatments on pavements. An airport should maintain detailed records of maintenance (routine, emergency, and proactive) activities. The records should consist of the following:

- 1. Location and Limits of Work.
- 2. Types and Severity of Distresses Repaired.
- 3. Type of Work.
- 4. Cost of Work.
- 5. Supporting Documents (contract documents, construction drawings, specifications, bid tabulations, repair product, photograph records, etc.).

2.5 Airfield Pavement Traffic

A pavement section is typically designed to meet the needs of the user (airlines, air cargo, general aviation, and/or military) in providing a safe, smooth, operational surface. Pavement deterioration generally occurs gradually through increased roughness and/or fatigue cracking caused by successive and heavy aircraft traffic.

This study does not consist of a study or analysis of each individual airport's airfield aircraft fleet mix or traffic operations. However, it is strongly recommended that airports incorporate the requirements of FAA Advisory Circular **150/5320-6F Airport Pavement Design and Evaluation** when developing design-level rehabilitation activities. The AC provides guidance on incorporation of aircraft traffic fleet mix data.

2.6 Airfield Pavement Condition Index (PCI) Survey

2.6.1 PCI Survey Methodology

In adherence to the FAA Advisory Circular **150/5380-7B** "Airport Pavement Management **Program (PMP)**," the FDOT SAPMP utilizes the PCI Survey Method of inspection to collect pavement distress data and analyze the condition. The PCI Survey Inspection procedure is a visual statistical sampling of pavements for recording primary distress types (e.g. cracking and deformation), associated severities, and quantities as defined by the ASTM D5340-12. This effort is the primary means of obtaining and recording pavement distress data. The survey inspection consists primarily of visual inspection of pavement surfaces for signs of distress and deterioration resulting from loading (aircraft) and environmental influences.

A visual pavement condition survey provides an indication of the cause and rate of deterioration of a pavement section from a functional point of view and can be an indicator of structural distress. The functional condition analysis assesses the rating of the operational surface. A visual PCI Survey Inspection does not predict the remaining structural life of a pavement section, or its ability to support loads. The functional condition determined by the PCI method



can provide a cost-effective means to plan for pavement rehabilitation projects. The timely application of pavement rehabilitation may lead to the extension of functional life of individual pavement sections. This method varies from structural evaluation; functional condition is limited to visually observed distresses and indicative modes of pavement deterioration. A formal structural evaluation analyzes subsurface conditions, material characteristics, and qualitative pavement structure attributes. A structural evaluation may consist of; subsurface geotechnical exploration, falling weight deflectometer testing, petrographic testing, material coring, and/or flexural testing.



2.6.2 Pavement Distress Types

For each section, the severity and quantity of defined distresses are recorded and then analyzed in accordance with the ASTM D5340-12 standard. The standard identifies 17 distinct flexible asphalt concrete distress types and 16 distinct rigid Portland Cement Concrete distress types.

Table 2.6.2-1 (a) Pavement Distress Types – Flexible Asphalt Concrete-Surfaced Airfields

Distress	Common Distress Mechanisms
Alligator Cracking	Load / Fatigue
Bleeding	Construction Quality/ Mix Design
Block Cracking	Climate / Age
Corrugation	Load / Construction Quality
Depression	Load / Subsurface
Jet Blast	Aircraft
Joint Reflection - Cracking	Climate / Subsurface Pavement / Traffic Load
Longitudinal/Transverse Cracking	Climate / Construction Quality
Oil Spillage	Aircraft / Vehicle
Patching	Utility / Pavement Repair / Age
Polished Aggregate	Repeated Traffic Loading
Raveling	Climate / Age
Rutting	Load / Fatigue
Shoving	PCC Pavement Growth / Movement
Slippage Cracking	Load / Pavement Bond / Mix Design
Swelling	Climate / Subsurface
Weathering	Climate / Age

Table 2.6.2-1 (b) Pavement Distresses Possible Causes – Flexible Asphalt Concrete-SurfacedAirfields

Classification by Possible Causes								
Load	Climate / Durability	Moisture / Drainage	Others					
 Alligator Cracking Corrugation Depression Patching of Load-based distress Polished Aggregate Rutting Slippage Cracking 	 Bleeding Block Cracking Joint Reflection Cracking L/T Cracking Patching of climate / durability-caused distresses Shoving from PCC Raveling Weathering Swelling 	 Alligator Cracking Depression Patching of moisture / drainage caused distress Swelling Raveling Weathering 	 Oil Spillage Jet Blast Erosion Polished Aggregate 					

Table 2.6.2-1 (c) Pavement Distresses Possible Effects – Flexible Asphalt Concrete-SurfacedAirfields

	Classification by Possible Effects							
Roughness	Skid / Hydroplaning Potential	FOD Potential	Rate of Deterioration and Maintenance Requirements					
 Corrugation Depression Rutting Shoving of asphalt pavement Swelling Raveling Weathering 	 Bleeding Depression Polished Aggregate Rutting 	 Block Cracking Joint Reflection Cracking L/T Cracking Slippage Cracking 	All Distresses					



Table 2.6.2-2 (a) Pavement Distresses – Rigid Portland Cement Concrete-Surfaced Airfields

Distress	Common Distress Mechanisms			
Blowup	Climate / ASR			
Corner Break	Load Repetition / Curling Stresses			
Linear Cracking	Load Repetition / Curling Stresses / Shrinkage Stresses			
Durability Cracking	Freeze-Thaw Cycling			
Joint Seal Damage	Material Deterioration / Construction Quality / Age			
Small Patch	Pavement Repair			
Large Patch/Utility Cut	Utility / Pavement Repair			
Popout	Freeze-Thaw Cycling / ASR / Material Quality			
Pumping	Load Repetition / Poor Joint Sealant			
Scaling	Construction Quality / Freeze-Thaw Cycling			
Faulting	Subgrade Quality / ASR / Inadequate Load Transfer			
Shattered Slab	Overloading			
Shrinkage Cracking	Construction Quality / Climate			
Joint Spalling	Load Repetition / Infiltration of Incompressible Material / Deterioration of Dowel (Load Transfer) Bars			
Corner Spalling	Load Repetition / Infiltration of Incompressible Material / Deterioration of Dowel (Load Transfer) Bars			
Alkali-Silica Reaction (ASR)	Construction Quality / Climate / Chemical Reaction			

Table 2.6.2-2 (b) Pavement Distresses Possible Causes – Rigid Portland Cement Concrete-
Surfaced Airfields

Classification by Possible Causes								
Load	Climate / Durability	Moisture / Drainage	Others					
 Corner Break Shattered Slab L/T/D Cracking Pumping Patching of Load- associated distress Spalling 	 Blowup "D" Cracking Joint Seal Damage Popouts Scaling Patch of Climate/Durability- associated distress Shrinkage Cracking Spalling L/T/D Cracking 	 Corner Break Shattered Slab Pumping Patching of Moisture/Drainage- associated distress 	Settlement / Faulting					

Table 2.6.2-2 (c) Pavement Distresses Possible Effects – Rigid Portland Cement Concrete-
Surfaced Airfields

	Classification by Possible Effects								
Roughness	Skid / Hydroplaning Potential	FOD Potential	Rate of Deterioration and Maintenance Requirements						
 Blowup Corner Break L/T/D Cracking Shattered Slab Settlement / Faulting Spalling 	 Settlement / Faulting Spalling 	 Corner Break L/T/D Cracking "D" Cracking Joint Seal Damage Shattered Slab Popouts Scaling 	All distresses						



2.6.3 PCI Survey Inspection Procedures

Inspection Sampling Rate

The FDOT SAPMP performs PCI Survey Inspections on sample units defined in the previous update. The sample units are subject to change at the discretion of the inspection personnel and/or to major pavement rehabilitation treatments. Furthermore, access to the sample units based on accessibility or impacts to operations may affect the overall sampling rate effort at each airport. The following **Tables 2.6.3 (a) and (b)** define the sampling criteria used by the FDOT SAPMP. A higher sampling rate may be utilized to achieve a greater statistical confidence should the airport have the available resources to perform PCI Survey Inspections independent of the FDOT SAPMP.

Table 2.6.3 (a) Recommended Sample Rate Schedule for Flexible Asphalt Concrete

Number of Total	Sample Units to Inspect						
Sample Units in Section	Runways	Taxiways, Aprons, and Others					
1 - 4	1	1					
5 - 10	2	1					
11 - 15	3	2					
16 - 30	5	3					
31 - 40	7	4					
41 - 50	8	5					
51 or more	20% but ≤20	10% but ≤10					

Table 2.6.3 (b) Recommended Sample Rate Schedule for Rigid Portland Cement Concrete

Number of Total	Sample Units to Inspect						
Sample Units in Section	Runways	Taxiways, Aprons, and Others					
1 - 3	1	1					
4 - 6	2	1					
7 - 10	3	2					
11 - 15	4	2					
16 - 20	5	3					
21 - 30	7	3					
31 - 40	8	4					
41 - 50	10	5					
51 or more	20% but ≤20	10% but ≤10					

FDOT

2.6.4 Updates to the ASTM D5340-12

Airfield pavement distresses and conditions were surveyed in accordance with the methods outlined in FAA Advisory Circular 150/5380-6C and ASTM D5340-12. These procedures define distress type, severity, and quantity for sampling areas within each defined pavement section area to analyze and determine the PCI value and condition rating. During the 2013-2015 System Update, the incorporation of the significant chances to the ASTM D5340 (version D5340-12) resulted in an adjusted pavement condition indices on pavement sections subject to the distress types updated. Furthermore, the revision of the PCI deduction curves and the separation of distress types from the original, such as Weathering and Raveling, have in select cases increased the PCI value of the section without any rehabilitation performed.

Flexible Asphalt Concrete Pavement Distress Updates

The previous methodology which featured "(52) Weathering and Raveling" distress has been separated into two distresses "(52) Raveling" and "(57) Weathering." Previously, areas that were recorded as "Weathering and Raveling" were considered as one distress with a high deduction. Based on the updated methodology, in certain situations where "Weathering" only exists and does not meet the definition of "Raveling," the PCI deduction is not as high as the former "Weathering and Raveling." Therefore, areas identified only as "(57) Weathering" based on current ASTM standards, which were previously identified as "(52) Weathering and Raveling," may be subject to an improvement in PCI. In instances where pavement PCI has increased due to this update, it is not due to an improvement in actual condition, however indicative of the adjusted distress deterioration effects.

Rigid Portland Cement Concrete Pavement Distress Updates

The previous methodology defined "(70) Scaling" as a distress that consisted of surface deterioration caused by construction defects, material defects, and environmental factors. The distress included Alkali-Silica Reaction, also known as ASR. The current methodology has separated Alkali-Silica Reaction as a distress identified as "(76) Alkali-Silica Reaction / ASR." As a result the previous "(70) Scaling" numerical deduction contribution to the PCI has been reduced. Previous inspections that recorded "(70) Scaling," and currently do not exhibit "(76) Alkali-Silica Reactivity / ASR" may potentially see an increase in PCI. Additionally, "(73) Shrinkage Cracks" has been redefined as "(73) Shrinkage Cracking". Shrinkage Cracking is characterized in two forms; drying shrinkage and plastic shrinkage. Drying shrinkage occurs over time as moisture leaves the pavement, it develops when hardened pavement continues to shrink as excess water not needed for cement hydration evaporates. It forms when subsurface resistance to the shrinkage is present and may extend through the entire depth of the slab. Plastic shrinkage develops when there is rapid loss of water in the surface of recently placed pavement or can form from over finishing/overworking of the pavement during construction. These shrinkage cracks appear as a series of inter-connected hairline cracks, or pattern cracking, and are often observed throughout the majority of the slab surface. This condition is also referred to as map cracking or crazing.



141

Distress	Updates to Reflect AST	M 5340-12				
Use and Surface Type	Updated Distress	Former Distress in Prior to 5340-10	Deduction Curve	Potential Effect		
AC/AAC/ APC Airfield	(52) Raveling - Low	(52) Weathering and Raveling - Low	No Change	N/A		
	(52) Raveling - Medium	(52) Weathering and Raveling - Medium	No Change	N/A		
	(52) Raveling - High	(52) Weathering and Raveling - High	No Change	N/A		
	(57) Weathering - Low	N/A – was part of 'Weathering and Raveling'	New	Increase in PCI with no maintenance		
	(57) Weathering - Medium	N/A – was part of 'Weathering and Raveling'	New	Increase in PCI with no maintenance		
	(57) Weathering - High	N/A – was part of 'Weathering and Raveling'	New	Increase in PCI with no maintenance		
PCC Airfield	(70) Scaling - Low	(70) Scaling, Map Cracking, and Crazing - Low	New	Increase in PCI with no maintenance		
	(70) Scaling - Medium	(70) Scaling, Map Cracking, and Crazing - Medium	New	Increase in PCI with no maintenance		
	(70) Scaling - High	(70) Scaling, Map Cracking, and Crazing - High	New	Increase in PCI with no maintenance		
	(76) Alkali Silica Reaction – Low	N/A – was part of 'Scaling, Map Cracking, and Crazing'	New	Increase in PCI with no maintenance		
	(76) Alkali Silica Reaction – Medium	N/A – was part of 'Scaling, Map Cracking, and Crazing'	New	Increase in PCI with no maintenance		
	(76) Alkali Silica Reaction – High	N/A – was part of 'Scaling, Map Cracking, and Crazing'	New	Increase in PCI with no maintenance		
	(73) Shrinkage Cracking	(73) Shrinkage Cracking	No Change	Prior distress types identified as 'Scaling, Map Cracking, and Crazing' may now be identified as 'Shrinkage Cracking'		

Table 2.6.4 Summary of Updates to ASTM D5340-12

Statewide Airfield Pavement Management Program



Chapter 3

FDOT

Chapter 3 – Airfield Pavement System Inventory

A significant element of an effective airfield pavement management system is the appropriate record keeping of changes due to construction or operational use of the pavement facilities. This chapter discusses the inventory data collected from the airport and summarizes network-level characteristics of the airport's airfield pavements. At the start of each FDOT SAPMP System Update, all airports are asked to review the existing Airfield Pavement Network Definition exhibit for accuracy. Furthermore, participating airports are asked to provide documentation for any recent or anticipated construction related to their airfield pavements.

3.1 Airfield Pavement Network Information

3.1.1 Previous and/or Anticipated Airfield Pavement Construction

Based on information provided by the airport, the following **Table 3.1.1** summarizes the airfield pavement construction projects that have been incorporated into the SAPMP database system since the 2013-2015 System Update. **Figure 3.1.1-1** and **Figure 3.1.1-2** provides an inset view of the 2017 Airfield Pavement Network Definition Exhibit and the 2017 Airfield Pavement System Inventory Exhibits that depict the updated network details for the airport reflected in the PAVER Database. Large format exhibits are referenced in **Appendix C Technical Exhibits**.

Year	General Work Description					
	AP - Reconstruction: 2" FL-334, 6" P-209, 6" P-160, 12" P-152					
2013	TW A - Mill and Overlay: 2" FL-334					
	TW A - Mill and Overlay: 2" AC Type SP-12.5					

Table 3.1.1 Previous and/or Anticipated Airfield Pavement Construction

The airport provided a limited combination of record drawings, reports, and staff input that was pertinent information in developing the construction history of the airport's pavements from inception. Major rehabilitation/construction activities performed in the last 24-months or anticipated in the next 24-months are assumed to restore the PCI to 100. These activities include: pavement overlay, mill and replace, mill and overlay, new construction, and/or complete reconstruction. These pavements were not formally subject to a PCI Survey and actual conditions may vary. Furthermore, any localized maintenance or repair performed that would improve the PCI will be considered in the condition analysis, if performed within inspection areas.


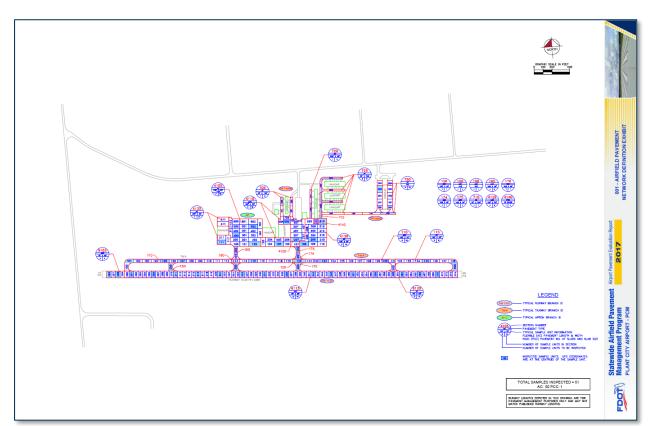


Figure 3.1.1-1 2017 Airfield Pavement Network Definition Exhibit

The Airfield Pavement Network Definition Exhibit provides details to the PCI Survey inspection efforts. The exhibit identifies the pavement facilities, surface type, section definition, and sample unit delineation.




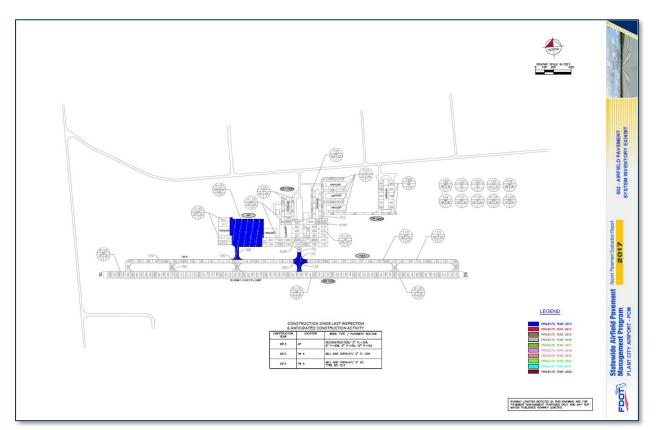


The Airfield Pavement System Inventory Exhibit provides details to the work history updates communicated by the Airport. The Exhibit provides the approximate limits of recent and/or anticipated construction on the airfield pavement facilities. The limits are based on documentation provided by the Airport and, if constructed, observed in the field.

3.1.2 Estimated Pavement Age

Standard pavement design practice considers a design life of a 20-year period. Design inputs typically require subgrade soil conditions, pavement section layer material characteristics, and anticipated loading (aircraft fleet mix) for the design-life period. Based on the review of the historic airfield pavement construction, **Figure 3.1.2** summarizes the average age of the pavement sections since any major construction activity has occurred during the PCI Survey inspection. This is intended to be a rough estimate based on interpretation of the limited data available at the time of report.



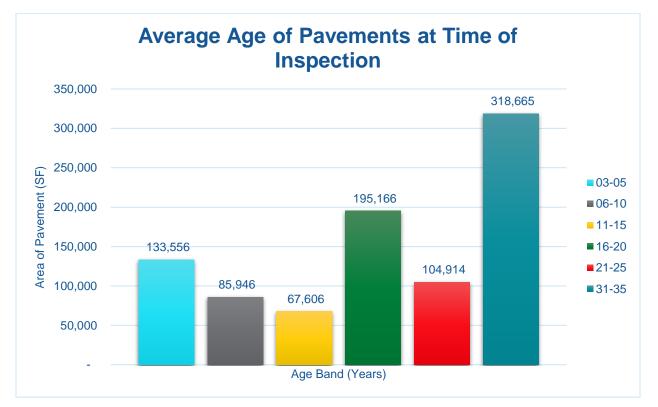

The estimation of the pavement age is based on information requested and provided by participating airports. Additionally, data collected in the prior system updates since 1992 have been relied upon.

FDOT

3.1.3 Functional Use Classification

Pavements are subject to varying aircraft loading patterns based on utilization and overall operations. For this SAPMP Update, the following categories of airfield functional use have been identified and associated with the following possible pavement branch facilities: Apron, Runway, Taxiway, and Taxilane. **Figure 3.1.3** summarizes the identified pavements' functional use by area in square feet. The pavement areas reviewed exclude shoulder pavement facilities.

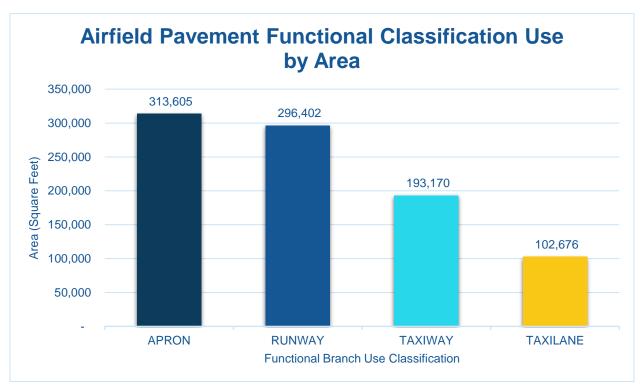


Figure 3.1.3 Airfield Pavement Functional Classification Use by Area

FDOT

3.1.4 Pavement Surface Type

The airfield pavement facility surface types within the SAPMP include four common types of pavement: Portland cement concrete (PCC), asphalt concrete (AC), asphalt concrete overlaid on asphalt concrete (AAC), and asphalt concrete overlaid on Portland cement concrete (APC).

Based on the record documentation incorporated within the SAPMP database throughout the years, the pavement surface types have been assigned to the various pavement sections in accordance to its work history composition. The following **Figures 3.1.4 (a) and (b)** summarize the applicable pavement types observed at this specific airport's airfield.


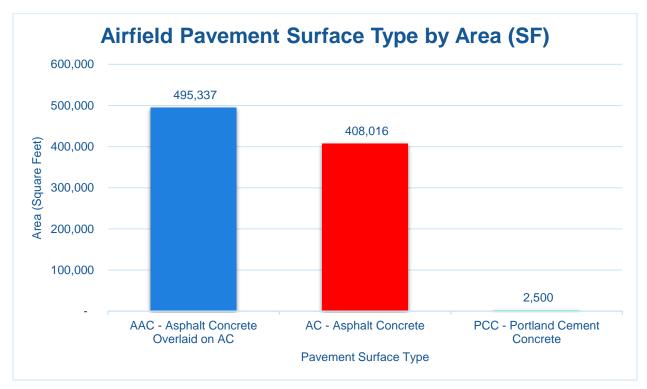


Figure 3.1.4 (a) Pavement Surface Type by Area (SF)



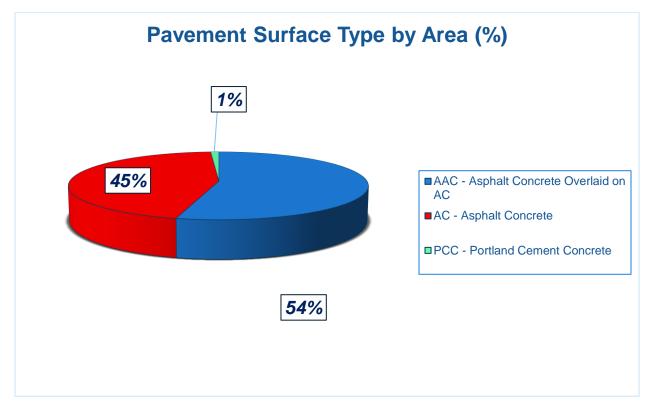

3.1.5 Pavement System Inventory Details

The following **Table 3.1.5** displays the section-level details assembled as part of this update. The section-level details are based on the record documentation provided by the airports to FDOT and from SAPMP System Updates. The details assembled rely on the accuracy and the adequacy of data provided; however, it should be noted that characteristics such as pavement areas may be based on aerial interpretation of spatially projected imagery. The accuracy of data is presented with the intention of a network planning-level document; should the airport elect to perform rehabilitation work, it is recommended that further investigation be performed at the project level for construction purposes.

In summary, the scope of the pavement inventory update resulted in the updating of select existing pavement geometry and the development of an AutoCAD model with spatial projection for use within GIS. **Appendix A** includes the Airfield Pavement Network Definition Exhibit and the Airfield Pavement System Inventory Exhibit which visually summarize the results of the Airfield Pavement System Inventory analysis and reporting.

ment 2017



Table 3.1.5 Pavement System Inventory Details

Network ID	Branch Name	Branch ID	Branch Use	Section ID	Length (FT)	Width (FT)	Area (SF)	Surface Type	Est. Last Construction Date
PCM	APRON	AP	APRON	4105	350	320	112,145	AC	3/1/2013
PCM	APRON	AP	APRON	4110	450	100	45,437	AAC	1/1/1992
PCM	APRON	AP	APRON	4120	325	140	46,434	AAC	1/1/1992
PCM	APRON	AP	APRON	4130	300	250	77,514	AC	1/1/1986
PCM	APRON	AP	APRON	4135	200	132	29,575	AC	1/1/2008
PCM	APRON	AP	APRON	4140	50	50	2,500	PCC	1/1/2010
PCM	RUNWAY 10-28	RW 10-28	RUNWAY	6103	200	75	15,106	AAC	1/1/2002
PCM	RUNWAY 10-28	RW 10-28	RUNWAY	6115	3050	75	228,796	AAC	1/1/1983
PCM	RUNWAY 10-28	RW 10-28	RUNWAY	6120	700	75	52,500	AC	1/1/2002
PCM	TAXIWAY A	TW A	TAXIWAY	110	3000	40	124,860	AAC	1/1/2001
PCM	TAXIWAY A	TW A	TAXIWAY	115	750	40	33,606	AC	1/1/2001
PCM	TAXIWAY A	TW A	TAXIWAY	120	150	40	6,040	AAC	8/1/2013
PCM	TAXIWAY A	TW A	TAXIWAY	150	120	35	4,773	AAC	1/1/2001
PCM	TAXIWAY A	TW A	TAXIWAY	160	125	40	5,383	AAC	1/1/2001
PCM	TAXIWAY A	TW A	TAXIWAY	165	65	35	6,228	AAC	3/1/2013
PCM	TAXIWAY A	TW A	TAXIWAY	170	120	40	4,870	AAC	8/1/2013
PCM	TAXIWAY A	TW A	TAXIWAY	174	100	40	4,273	AAC	8/1/2013
PCM	TAXIWAY A	TW A	TAXIWAY	175	70	40	3,137	AAC	1/1/2001
PCM	TAXIWAY TO HANGAR	TW HANG	TAXILANE	750	850	60	53,871	AC	1/1/2011
PCM	T-HANGARS TAXIWAY	TW T-HANG	TAXILANE	705	430	30	13,043	AC	1/1/1992
PCM	T-HANGARS TAXIWAY	TW T-HANG	TAXILANE	710	280	20	5,895	AC	1/1/1986
PCM	T-HANGARS TAXIWAY	TW T-HANG	TAXILANE	720	323	20	6,460	AC	1/1/1986
PCM	T-HANGARS TAXIWAY	TW T-HANG	TAXILANE	725	1000	20	23,407	AC	1/1/1997

2017



FDOT

141

PAGE INTENTIONALLY LEFT BLANK

Statewide Airfield Pavement Management Program



Chapter 4

FDOT

Chapter 4 – Airfield Pavement Condition

The examination of specific distress types (with causes attributed to load, climate, or other defined distress mechanism), determination of the severity of distress, and determination of the quantity of distress manifestation are required in the computation of a PCI value. The PCI provides valuable information that can be used to determine the existing condition of the pavement, possible cause of the pavement deterioration, and eventually aid in the planning of the rehabilitation of pavements. It should be noted that the PCI method of pavement condition evaluation is strictly a visual and functional evaluation. Further evaluation of the pavement rehabilitation.

4.1 Airfield Pavement Condition Index (Latest Inspection)

4.1.1 Network-Level Analysis

The following **Figure 4.1.1** summarizes the network-level pavement condition analysis based on the most recent PCI Survey inspection results.

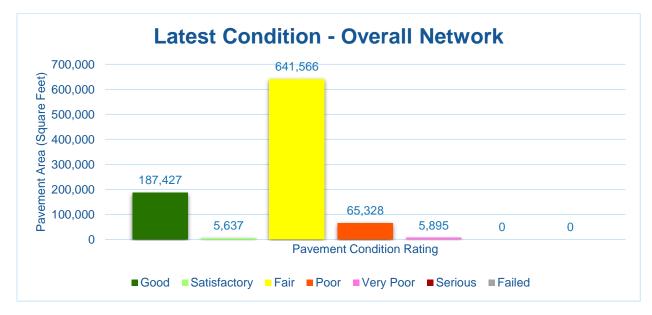


Figure 4.1.1 Latest Condition – Overall Network

4.1.2 Branch-Level Analysis

The following **Figures 4.1.2 (a) through (d)** summarize the branch-level pavement condition analysis based on the most recent PCI Survey inspection results; the following Figures provide overall branch-level conditions by branch use.



111




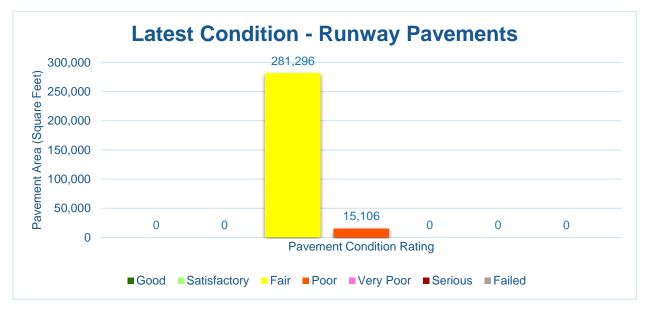


Figure 4.1.2 (b) Latest Condition – Taxiway Pavements

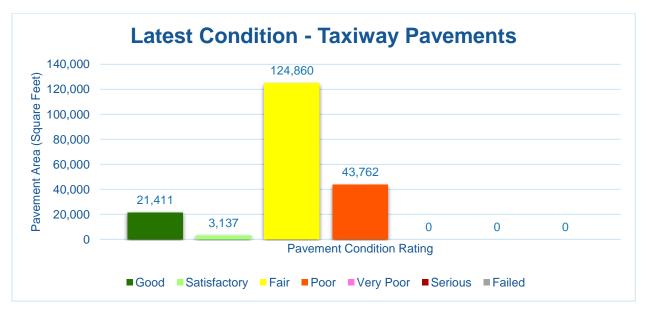


141





Figure 4.1.2 (d) Latest Condition – Taxilane Pavements

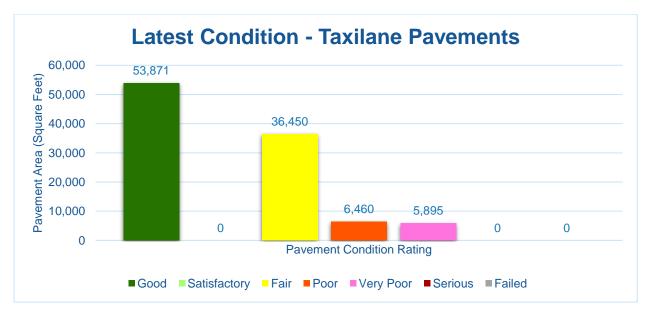



4.1.3 Section-Level Analysis

The following **Table 4.1.3** provides details for each pavement section of its area-weighted average PCI and the percent of distress which is related to load, climate, or other factors. The amount of distress attributed to the various causes provides insight into maintenance, repair, and rehabilitation needs. Load-related distress indicates that pavements are reaching the end of their structural design life, and for those pavements exhibiting a significant amount of these distress types, rehabilitation should be planned to strengthen or reconstruct the pavement. **Appendix C Technical Exhibits** provides a technical exhibit that graphically depicts the PCI values and ratings determined from this SAPMP System Update.

Any pavement facilities subject to pavement construction within the past 2 years or anticipated for construction within the next year may have been omitted from inspection. Pavement subject to major rehabilitation will be set to a PCI of 100.

Network ID	Branch ID	Branch Name	Branch Use	Section ID	Area (SF)	Surface	PCI	PCI Rating	PCI Pct Climate	PCI Pct Load	PCI Pct Other	Sample Units Inspected	Total Sample Units in Section
РСМ	AP	APRON	APRON	4105	112,145	AC	93	Good	100%	0%	0%	3	22
PCM	AP	APRON	APRON	4110	45,437	AAC	65	Fair	83%	0%	17%	2	10
РСМ	AP	APRON	APRON	4120	46,434	AAC	63	Fair	100%	0%	0%	1	9
РСМ	AP	APRON	APRON	4130	77,514	AC	59	Fair	100%	0%	0%	3	15
РСМ	AP	APRON	APRON	4135	29,575	AC	69	Fair	99%	0%	1%	1	5
PCM	AP	APRON	APRON	4140	2,500	PCC	75	Satisfactory	0%	75%	25%	1	1
РСМ	RW 10-28	RUNWAY 10-28	RUNWAY	6103	15,106	AAC	46	Poor	91%	0%	9%	2	4
PCM	RW 10-28	RUNWAY 10-28	RUNWAY	6115	228,796	AAC	58	Fair	97%	0%	3%	13	61
РСМ	RW 10-28	RUNWAY 10-28	RUNWAY	6120	52,500	AC	58	Fair	94%	0%	6%	3	14
РСМ	TW A	TAXIWAY A	TAXIWAY	110	124,860	AAC	58	Fair	100%	0%	0%	6	32
РСМ	TW A	TAXIWAY A	TAXIWAY	115	33,606	AC	55	Poor	92%	0%	8%	2	8
PCM	TW A	TAXIWAY A	TAXIWAY	120	6,040	AAC	92	Good	100%	0%	0%	1	1
PCM	TW A	TAXIWAY A	TAXIWAY	150	4,773	AAC	48	Poor	100%	0%	0%	1	1
РСМ	TW A	TAXIWAY A	TAXIWAY	160	5,383	AAC	53	Poor	100%	0%	0%	1	1
PCM	TW A	TAXIWAY A	TAXIWAY	165	6,228	AAC	92	Good	100%	0%	0%	1	2
РСМ	TW A	TAXIWAY A	TAXIWAY	170	4,870	AAC	90	Good	100%	0%	0%	1	1
PCM	TW A	TAXIWAY A	TAXIWAY	174	4,273	AAC	94	Good	100%	0%	0%	1	1
РСМ	TW A	TAXIWAY A	TAXIWAY	175	3,137	AAC	83	Satisfactory	100%	0%	0%	1	1
PCM	TW HANG	TAXIWAY TO HANGAR	TAXILANE	750	53,871	AC	90	Good	100%	0%	0%	2	13
PCM	TW T-HANG	T-HANGARS TAXIWAY	TAXILANE	705	13,043	AC	70	Fair	100%	0%	0%	1	4
PCM	TW T-HANG	T-HANGARS TAXIWAY	TAXILANE	710	5,895	AC	40	Very Poor	100%	0%	0%	1	1
PCM	TW T-HANG	T-HANGARS TAXIWAY	TAXILANE	720	6,460	AC	45	Poor	100%	0%	0%	1	2
PCM	TW T-HANG	T-HANGARS TAXIWAY	TAXILANE	725	23,407	AC	60	Fair	88%	0%	12%	2	5

Table 4.1.3 Latest Pavement Condition Index Summary

Plant City Airport (PCM)




121

FDO

141

Figure 4.1.3 is an inset view of the 2017 Airfield Pavement Condition Index Exhibit that visually represents the results of the latest PCI Survey inspection. A large format exhibit is located in **Appendix C Technical Exhibits.**

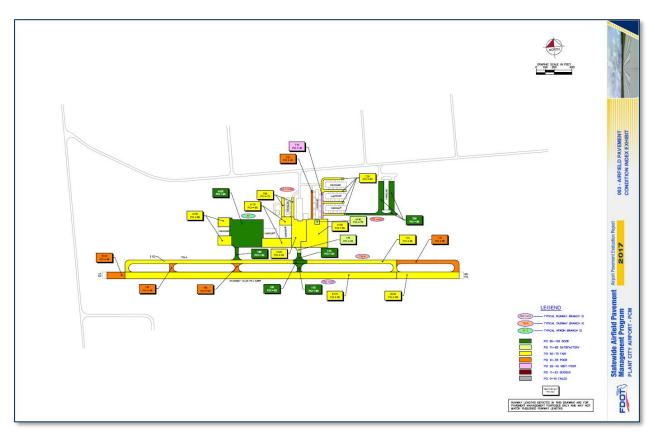





4.2 Summary of Pavement Condition Evaluation Results

4.2.1 Network-Level Observations

The field PCI Survey performed at Plant City Airport (PCM) was started and completed on 03/28/2017. The resulting overall average area-weighted PCI value was 65 representing a condition rating of Fair. Plant City Airport is served solely by Runway 10-28 which is 75-ft wide and 3,950-ft long.

Based on the FAA 5010 Report as of 07/25/2017 the Airport has reported 47,975 operations for 12 months ending 11/03/2015.

4.2.2 Branch-Level Observations

The following branch-level observations are intended to be an overall summary of select pavement facilities identified during the PCI Survey; further detail at the section and sample-level may be referenced for all pavements assessed as part of this System Update. The branch-level observations discussed are limited to select branches based on use and condition.

Runway 10-28

Runway 10-28 consists of 3 sections constructed of AC and AAC. The last construction years range from 1983 to 2002. The average area-weighted PCI for Runway 10-28 is 57 representing a Fair condition rating. The pavement distresses observed were related to Climate and Other distress classifications. Distresses observed in Runway 10-28 consist of Depression, Longitudinal & Transverse Cracking, Raveling, and Swelling.

Taxiway A

Taxiway A consists of 9 sections constructed of AC and AAC. The last construction years range from 2001 to 2013. The average area-weighted PCI for Taxiway A is 61 representing a Fair condition rating. The pavement distresses observed were related to Climate and Other distress classifications. Distresses observed in Taxiway A consist of Longitudinal & Transverse Cracking, Patching, Raveling, Swelling, and Weathering.

Apron

The Apron consists of 6 sections constructed of AC, AAC, and PCC. The last construction years range from 1986 to 2013. The average area-weighted PCI for the Apron is 73 representing a Satisfactory condition rating. The pavement distresses observed were related to Climate, Load, and Other distress classifications. Distresses observed in the Apron consist of Block Cracking, Depression, Longitudinal & Transverse Cracking, Oil Spillage, Patching, Raveling, Weathering, Linear Cracking, Shattered Slab, and Shrinkage Cracking.

Figure 4.2.2 Pavement Condition Summary by Facility Use

Facility Use	Average Area-Weighted PCI	Condition Rating
Runway	57	Fair
Taxiway	61	Fair
Apron	73	Satisfactory
Taxilane	74	Satisfactory



4.3 Forecasted Pavement Conditions

4.3.1 Performance Models and Prediction Curves

Pavement Performance Models are developed from the distress data and historic construction records collected for the SAPMP. This data is consolidated in a database and organized by inspection/construction date, pavement type, age, and pavement use. The pavement Performance Models are used to develop broad Prediction Curves, alternatively known as deterioration curves or family curves. These Prediction Curves are utilized to developed forecasted PCI values based on historic trends and statistical models.

4.3.2 Branch-Level Pavement Condition Forecast

The following **Figures 4.3.2 (a) through (c)** depict the branch-level pavement condition forecast by Branch Use (Runway, Taxiway, and/or Apron). The forecasted conditions are for a 10-year duration starting in January 2018 through January 2027.

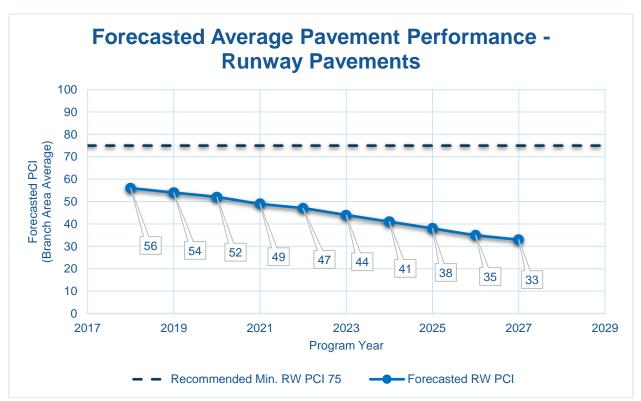



Figure 4.3.2 (a) Forecasted Runway Pavement Performance




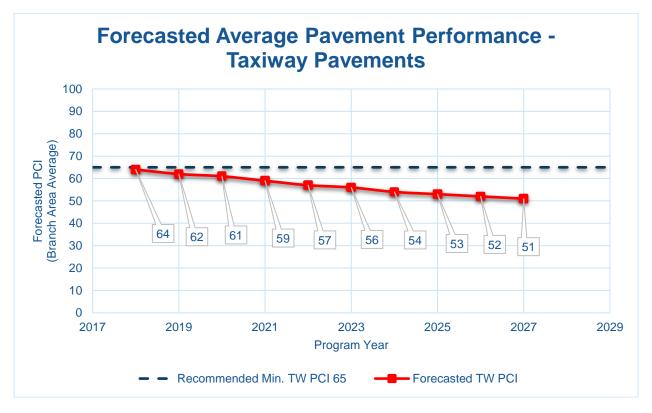


Figure 4.3.2 (c) Forecasted Apron Pavement Performance



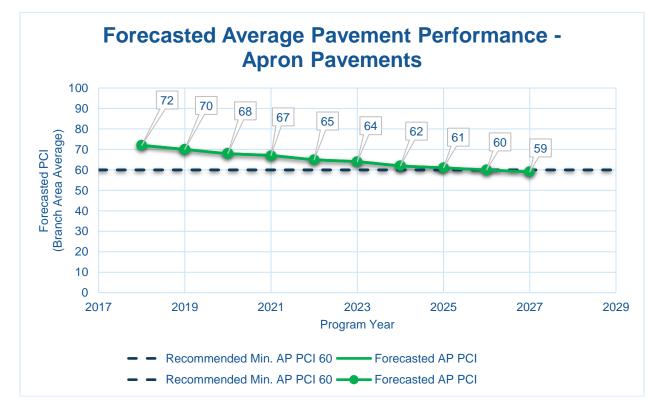

4.3.3 Section-Level Pavement Condition Forecast

The following **Table 4.3.3** provides detail to the forecasted PCI values for each section inspected. Please note the forecasted Branch- and Section-Level PCI's are for planning purposes and are subject to the sensitivities in changes in traffic and maintenance frequency. Airport staff should perform annual visual condition assessments to maintain recent understanding of pavement conditions.

Statewide Airfield Pavement Management Program Airport Pavement Evaluation Report

ement 2017



Table 4.3.3 Forecasted PCI 2018-2027

Network ID	Branch ID	Section ID	Last PCI			Forecasted PCI							
Network ID	Branch ID	Section ID		2018	2019	2020	2021	2022	2023	2024	2025	2026	2027
PCM	AP	4105	93	91	90	88	87	85	83	82	80	79	77
PCM	AP	4110	65	63	60	58	56	54	53	53	52	52	52
PCM	AP	4120	63	61	58	56	55	54	53	52	52	52	52
PCM	AP	4130	59	57	56	54	53	51	49	48	46	45	43
PCM	AP	4135	69	67	66	64	63	61	59	58	56	55	53
PCM	AP	4140	75	73	71	69	67	65	63	62	60	59	57
PCM	RW 10-28	6103	46	43	40	36	33	31	29	26	23	20	17
PCM	RW 10-28	6115	58	56	55	53	50	47	44	41	37	34	32
PCM	RW 10-28	6120	58	56	55	53	51	50	48	46	45	43	42
PCM	TW A	110	58	56	54	53	51	50	48	47	46	45	44
PCM	TW A	115	55	53	52	50	49	47	46	44	42	41	39
PCM	TW A	120	92	89	86	84	82	80	78	76	75	74	73
PCM	TW A	150	48	47	45	45	44	44	43	43	43	43	43
PCM	TW A	160	53	51	50	48	47	46	45	44	44	43	43
PCM	TW A	165	92	89	86	84	82	80	78	76	75	74	73
PCM	TW A	170	90	87	85	82	80	78	77	75	74	73	72
PCM	TW A	174	94	91	88	86	83	81	79	77	76	74	73
PCM	TW A	175	83	81	79	77	76	74	73	72	71	71	70
PCM	TW HANG	750	90	88	85	83	80	78	76	75	73	72	70
PCM	TW T-HANG	705	70	69	68	67	66	65	64	63	62	62	61
PCM	TW T-HANG	710	40	38	37	36	34	33	32	31	30	30	29
PCM	TW T-HANG	720	45	43	42	40	39	37	36	35	33	32	31
PCM	TW T-HANG	725	60	59	58	56	55	54	52	51	49	47	46



4.3.4 Forecasted PCI Considerations

As FDOT continues to update the SAPMP with future PCI Survey inspections and assembly of airfield pavement construction work history, the performance models will be further refined. With the refinement of additional PCI and work history data points, the forecasting of pavement conditions will continue to better reflect the performance trends of airfield pavements in the Florida Airports System. Forecasted or predicted pavement conditions for the airport are intended for planning purposes only. Design-level recommendations for pavement rehabilitation and/or reconstruction will require the appropriate application of the procedures defined in FAA *AC 150/5320-6F Airport Pavement Design and Evaluation* and *AC 150/5370-11B Use of Nondestructive Testing in the Evaluation of Airport Pavements* to determine structural and/or functional conditions at the time of project.

Statewide Airfield Pavement Management Program



Chapter 5



Chapter 5 – Localized Maintenance and Repair Planning

General Maintenance and Rehabilitation (M&R) methods are characterized under three broad categories: localized maintenance and repair, global treatments, and major rehabilitation.

- > Localized Maintenance and Repair includes patching and crack sealing.
- > Global Treatments includes surface seals and rejuvenators (flexible pavements).
- Major Rehabilitation includes overlays, significant slab replacement, and reconstruction.

This chapter discusses the FDOT SAPMP Localized Maintenance and Repair Planning approach. Proactive localized maintenance and repair, specifically preservation, is highly recommended to the airports. However, it is certainly recognized that once pavements have deteriorated below a certain condition, the facility would benefit from a more substantial rehabilitation in lieu of localized efforts. Chapter 6 Major Rehabilitation Planning discusses the addressing of pavements through timely rehabilitation once it has deteriorated below a critical PCI where localized repairs may not be as cost effective.

5.1 Localized Maintenance and Repair

Localized maintenance and repair is best applied as a conservation measure and is oftentimes applied to slow the rate of deterioration of distress pavements; however, may be applied as a temporary corrective measure in isolated areas. Localized maintenance and repair can be applied either as a safety ("stopgap") measure or preventive measure. Example distress types subject to localized preventive maintenance and repair may consist of low-severity longitudinal and transverse cracking and low-severity weathering. In many cases however, localized stopgap repair is applied as a safety measure to address high-severity distress manifestations when major rehabilitation is not funded for a given section with a PCI value below critical PCI. Some agencies may elect to define both types; preventative and stopgap, as localized maintenance.

Localized Stopgap/Safety Maintenance and Repair

Localized Stopgap or Safety Maintenance and Repair is defined as the localized distress repair needed to keep pavements operational in a safe condition. These activities are typically applied to high-severity distresses or distresses affecting operational activities. Typical pavement section PCIs will range from 0 to 65.

Localized Preventive Maintenance and Repair

Localized Preventive Maintenance and Repair is defined as distress maintenance activities performed with the primary objective of slowing the rate of deterioration. These activities typically include crack sealing and patching. Typical pavement section PCIs will be above 65.



5.2 Localized Maintenance and Repair Policy

The resulting Localized Maintenance and Repair recommendations are identified based on the policy defined in **Table 5.2.1** and **Table 5.2.2**, for flexible asphalt concrete and rigid Portland cement concrete pavements, respectively. The activities identified were based on the research of practical pavement treatments in consideration of the FAA *AC 150/5380-6C "Guidelines and Procedures for Maintenance of Airport Pavements"* and the *FDOT Airfield Pavement Distress Repair Manual*. Additionally, the *Engineering Technical Letter (ETL) 14-3: Preventive Maintenance Plan (PMP) for Airfield Pavements* was referenced for conservative application of pavement treatments. The Localized Maintenance and Repair Policy and associated planning-level unit costs were developed in consideration of a network-level analysis – it is strictly intended to provide a glimpse of the condition of the airport pavements with a limited PCI survey effort.

The developed Localized Maintenance and Repair Policy and associated planning-level unit costs were based on a statewide consideration of pavement treatments and review of state construction costs for both Airfield Pavements and from the FDOT Historical Cost Information archives. Furthermore, a consideration of limited repair quantities was factored in the determination of conservative planning-level unit costs. The identified Localized maintenance activities for both preventive and stopgap activities are based on a statewide network approach; project-specific evaluation and maintenance quantities should be developed prior to any construction.

Distress	Severity	Description	Code	Work Type	Work Unit
41	Low	ALLIGATOR CR	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
41	Medium	ALLIGATOR CR	FDOT-PA-AF	DT-PA-AF FDOT - PATCHING - AC FULL DEPTH	
41	High	ALLIGATOR CR	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
42	N/A	BLEEDING	FDOT-MO-PV	FDOT - MONITOR	N/A
43	Low	BLOCK CR	FDOT-MO-PV	FDOT - MONITOR	N/A
43	Medium	BLOCK CR	FDOT-CS-AC	FDOT - CRACK SEALING - AC	Ft
43	High	BLOCK CR	FDOT-PA-AP	FDOT - PATCHING - AC PARTIAL DEPTH	SqFt
44	Low	CORRUGATION	FDOT-ML-AC	FDOT - MILLING - AC	SqFt
44	Medium	CORRUGATION	FDOT-ML-AC	FDOT - MILLING - AC	SqFt
44	High	CORRUGATION	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
45	Low	DEPRESSION	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
45	Medium	DEPRESSION	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
45	High	DEPRESSION	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
46	High	JET BLAST	FDOT-PA-AP	FDOT - PATCHING - AC PARTIAL DEPTH	SqFt
46	N/A	JET BLAST	FDOT-PA-AP	FDOT - PATCHING - AC PARTIAL DEPTH	SqFt
47	Low	JT REF. CR	FDOT-MO-PV	FDOT - MONITOR	N/A
47	Medium	JT REF. CR	FDOT-CS-AC	FDOT - CRACK SEALING - AC	Ft
47	High	JT REF. CR	FDOT-CS-AC	FDOT - CRACK SEALING - AC	Ft

Table 5.2-1 Localized Maintenance and Repair – Flexible Asphalt Concrete

2017

FDOT

111

Distress	Severity	Description	Code	Work Type	Work Unit
48	Low	L&TCR	FDOT-MO-PV	FDOT - MONITOR	N/A
48	Medium	L&TCR	FDOT-CS-AC	FDOT - CRACK SEALING - AC	Ft
48	High	L & T CR	FDOT-CS-AC	FDOT - CRACK SEALING - AC	Ft
49	N/A	OIL SPILLAGE	FDOT-PA-AP	FDOT - PATCHING - AC PARTIAL DEPTH	SqFt
50	Low	PATCHING	FDOT-MO-PV	FDOT - MONITOR	N/A
50	Medium	PATCHING	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
50	High	PATCHING	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
51	N/A	POLISHED AG	FDOT-SS-LO	FDOT - SURFACE SEAL	SqFt
52	Low	RAVELING	FDOT-SS-LO	FDOT - SURFACE SEAL	SqFt
52	Medium	RAVELING	FDOT-PA-AP	FDOT - PATCHING - AC PARTIAL DEPTH	SqFt
52	High	RAVELING	FDOT-PA-AP	FDOT - PATCHING - AC PARTIAL DEPTH	SqFt
53	Low	RUTTING	FDOT-MO-PV	FDOT - MONITOR	N/A
53	Medium	RUTTING	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
53	High	RUTTING	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
54	Low	SHOVING	FDOT-MO-PV	FDOT - MONITOR	N/A
54	Medium	SHOVING	FDOT-ML-AC	FDOT - MILLING - AC	SqFt
54	High	SHOVING	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
55	N/A	SLIPPAGE CR	FDOT-PA-AP	FDOT - PATCHING - AC PARTIAL DEPTH	SqFt
56	Low	SWELLING	FDOT-MO-PV	FDOT - MONITOR	N/A
56	Medium	SWELLING	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
56	High	SWELLING	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
57	Low	WEATHERING	FDOT-MO-PV	FDOT - MONITOR	N/A
57	Medium	WEATHERING	FDOT-SS-LO	FDOT - SURFACE SEAL	SqFt
57	High	WEATHERING	FDOT-PA-AP	FDOT - PATCHING - AC PARTIAL DEPTH	SqFt

Table 5.2-2 Localized Maintenance and Repair – Rigid Portland Cement Concrete

Distress	Severity	Description	Code	Work Type	Work Unit
61	Low	BLOW-UP	FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	SqFt
61	Medium	BLOW-UP	FDOT-PA-PF	FDOT - PATCHING - PCC FULL DEPTH	SqFt
61	High	BLOW-UP	FDOT-SL-PC	FDOT - SLAB REPLACEMENT - PCC	SqFt
62	Low	CORNER BREAK	FDOT-CS-PC	FDOT - CRACK SEALING - PCC	Ft
62	Medium	CORNER BREAK	FDOT-PA-PF	FDOT - PATCHING - PCC FULL DEPTH	SqFt
62	High	CORNER BREAK	FDOT-PA-PF	FDOT - PATCHING - PCC FULL DEPTH	SqFt
63	Low	LINEAR CR	FDOT-MO-PV	FDOT - MONITOR	N/A
63	Medium	LINEAR CR	FDOT-CS-PC	FDOT - CRACK SEALING - PCC	Ft
63	High	LINEAR CR	FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	SqFt

2017

Plant City Airport (PCM)

FDOT

141

Distress	Severity	Description	Code	Work Type	Work Unit
64	Low	DURABIL. CR	FDOT-MO-PV	FDOT - MONITOR	N/A
64	Medium	DURABIL. CR	FDOT-PA-PF	FDOT - PATCHING - PCC FULL DEPTH	SqFt
64	High	DURABIL. CR	FDOT-SL-PC	FDOT - SLAB REPLACEMENT - PCC	SqFt
65	Low	JT SEAL DMG	FDOT-JS-PC	FDOT - JOINT SEAL - PCC	Ft
65	Medium	JT SEAL DMG	FDOT-JS-PC	FDOT - JOINT SEAL - PCC	Ft
65	High	JT SEAL DMG	FDOT-JS-PC	FDOT - JOINT SEAL - PCC	Ft
66	Low	SMALL PATCH	FDOT-MO-PV	FDOT - MONITOR	N/A
66	Medium	SMALL PATCH	FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	SqFt
66	High	SMALL PATCH	FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	SqFt
67	Low	LARGE PATCH	FDOT-MO-PV	FDOT - MONITOR	N/A
67	Medium	LARGE PATCH	FDOT-PA-PF	FDOT - PATCHING - PCC FULL DEPTH	SqFt
67	High	LARGE PATCH	FDOT-PA-PF	FDOT - PATCHING - PCC FULL DEPTH	SqFt
68	N/A	POPOUTS	FDOT-PO-FL	FDOT - POPOUT FILLER	SqFt
69	N/A	PUMPING	FDOT-SB-PC	FDOT – SLAB STABILIZATION - PCC	SqFt
70	Low	SCALING	FDOT-MO-PV	FDOT - MONITOR	N/A
70	Medium	SCALING	FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	SqFt
70	High	SCALING	FDOT-SL-PC	FDOT - SLAB REPLACEMENT - PCC	SqFt
71	Low	FAULTING	FDOT-MO-PV	FDOT - MONITOR	N/A
71	Medium	FAULTING	FDOT-GR-PP	FDOT - GRINDING (LOCALIZED)	Ft
71	High	FAULTING	FDOT-GR-PP	FDOT - GRINDING (LOCALIZED)	Ft
72	Low	SHAT. SLAB	FDOT-CS-PC	FDOT - CRACK SEALING - PCC	Ft
72	Medium	SHAT. SLAB	FDOT-SL-PC	FDOT - SLAB REPLACEMENT - PCC	SqFt
72	High	SHAT. SLAB	FDOT-SL-PC	FDOT - SLAB REPLACEMENT - PCC	SqFt
73	N/A	SHRINKAGE CR	FDOT-MO-PV	FDOT - MONITOR	N/A
74	Low	JOINT SPALL	FDOT-CS-PC	FDOT - CRACK SEALING - PCC	Ft
74	Medium	JOINT SPALL	FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	SqFt
74	High	JOINT SPALL	FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	SqFt
75	Low	CORNER SPALL	FDOT-CS-PC	FDOT - CRACK SEALING - PCC	Ft
75	Medium	CORNER SPALL	FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	SqFt
75	High	CORNER SPALL	FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	SqFt
76	Low	ASR	FDOT-MO-PV	FDOT - MONITOR	N/A
76	Medium	ASR	FDOT-PA-PF	FDOT - PATCHING - PCC FULL DEPTH	SqFt
76	High	ASR	FDOT-SL-PC	FDOT - SLAB REPLACEMENT - PCC	SqFt



Table 5.2-3 (a) Localized Repair Planning-Level Unit Costs – Flexible Asphalt Concrete

Code	Name	Cost	Units
FDOT-SS-LO	FDOT - SURFACE SEAL	\$0.55	SqFt
FDOT-ML-AC	FDOT - MILLING - AC	\$2.00	SqFt
FDOT-GR-PP	FDOT - GRINDING (LOCALIZED)	\$2.00	Ft
FDOT-CS-AC	FDOT - CRACK SEALING - AC	\$3.00	Ft
FDOT-MO-PV	FDOT - MONITOR	\$0.00	SqFt
FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	\$6.00	SqFt
FDOT-PA-AP	FDOT - PATCHING - AC PARTIAL DEPTH	\$3.00	SqFt

Table 5.2-3 (b) Localized M&R Planning-Level Unit Costs – Rigid Portland Cement Concrete

Code	Name	Cost	Units
FDOT-PA-PF	FDOT - PATCHING - PCC FULL DEPTH	\$100.00	SqFt
FDOT-SL-PC	FDOT - SLAB REPLACEMENT - PCC	\$30.00	SqFt
FDOT-SB-PC	FDOT - SLAB STABILIZATION - PCC	\$30.00	SqFt
FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	\$72.00	SqFt
FDOT-PO-FL	FDOT - POPOUT FILLER	\$0.05	SqFt
FDOT-GR-PP	FDOT - GRINDING (LOCALIZED)	\$2.00	Ft
FDOT-CS-PC	FDOT - CRACK SEALING - PCC	\$4.25	Ft
FDOT-MO-PV	FDOT - MONITOR	\$0.00	N/A
FDOT-JS-PC	FDOT - JOINT SEAL - PCC	\$2.75	Ft

*PCC Patching (Full Depth and Partial Depth) consider high-early-strength and high-performing repair material.



5.3 Localized Maintenance and Repair Analysis and Recommendations

The SAPMP provides a planning-level estimation of Localized Maintenance and Repair based on the results of the latest PCI Survey Inspection performed at the airport. Based on the limited sample units inspected, a statistical extrapolation of distresses at the section level is used to estimate the quantities of recommended repair activities based on the policies defined in 5.2 Localized M&R Policy. The PCI Survey Inspections did not consist of 100% inspection of all sample units; therefore, the section-level distress quantities used to estimate the Localized Maintenance and Repair needs are for conceptual planning purposes. The accuracy of the extrapolated distresses, and therefore work quantities, is subject to the amount of sample units inspected and the concentration of distress types observed in sample units. Appendix B provides the estimated Localized Maintenance and Repair based on this SAPMP's PCI Survey Inspection efforts. Localized Preventive Maintenance and Repair is typically applied to pavements that are in a condition at or above the Critical PCI of 65. Localized Stopgap Maintenance and Repair is typically applied to pavements that are below the Critical PCI of 65. It is recommended that airport staff evaluate the application of Localized Maintenance and Repair in concert with the planning of Major Rehabilitation efforts identified in Chapter 6 Major Rehabilitation Planning. Pavements with Stopgap recommendations that are subject to nearterm Major Rehabilitation efforts may remove the need to perform localized maintenance efforts.

The following **Table 5.3-1** summarizes the anticipated Localized Maintenance and Repair efforts based on the PCI Survey Inspection efforts performed at this airport as part of this SAPMP System Update. The following table depicts planning-level costs rounded to the nearest ten dollars.

Work Description	Work Category	Rough Estimate of Work Quantity	Work Units	Plann	ing Material Cost
FDOT - SURFACE SEAL	PREVENTIVE	28,015	SqFt	\$	15,410.00
FDOT - CRACK SEALING - PCC	PREVENTIVE	25	Ft	\$	110.00
FDOT - PATCHING - AC FULL DEPTH	PREVENTIVE	80	SqFt	\$	480.00
FDOT - PATCHING - AC PARTIAL DEPTH	STOPGAP	99,740	SqFt	\$	299,220.00
FDOT - MILLING - AC	STOPGAP	20	SqFt	\$	40.00
FDOT - SURFACE SEAL	STOPGAP	431,740	SqFt	\$	237,460.00
FDOT - CRACK SEALING - AC	STOPGAP	970	Ft	\$	2,900.00
FDOT - PATCHING - AC FULL DEPTH	STOPGAP	730	SqFt	\$	4,360.00

Plant City Airport (PCM)

The following **Table 5.3-2** provides further breakdown of the anticipated planning-level cost at the section level for the pavements exhibiting distresses that would benefit from Localized M&R. The table shows the approximate improved "End Condition" of the section after the application of Localized M&R. The following table depicts planning-level costs rounded to the nearest ten dollars.

Network ID	Branch ID	Section ID	Area (SF)	Start Condition	End Condition	Cost
PCM	AP	4105	112,145	93	94	\$ 140.00
PCM	AP	4110	45,437	65	73	\$ 8,660.00
PCM	AP	4120	46,434	63	68	\$ 5,110.00
PCM	AP	4130	77,514	59	66	\$ 10,240.00
PCM	AP	4135	29,575	69	87	\$ 15,500.00
PCM	AP	4140	2,500	75	75	\$ 110.00
PCM	RW 10-28	6103	15,106	46	65	\$ 23,980.00
PCM	RW 10-28	6115	228,796	58	72	\$ 261,080.00
PCM	RW 10-28	6120	52,500	58	72	\$ 51,180.00
PCM	TW A	110	124,860	58	72	\$ 96,290.00
PCM	TW A	115	33,606	55	73	\$ 32,180.00
PCM	TW A	120	6,040	92	94	\$ 20.00
PCM	TW A	150	4,773	48	69	\$ 5,010.00
PCM	TW A	160	5,383	53	74	\$ 5,040.00
РСМ	TW A	165	6,228	92	92	\$ -
PCM	TW A	170	4,870	90	92	\$ 10.00
PCM	TW A	174	4,273	94	94	\$ -
PCM	TW A	175	3,137	83	87	\$ 90.00
PCM	TW HANG	750	53,871	90	92	\$ 160.00
PCM	TW T-HANG	705	13,043	70	70	\$ -
PCM	TW T-HANG	710	5,895	40	65	\$ 10,760.00
PCM	TW T-HANG	720	6,460	45	66	\$ 10,500.00
PCM	TW T-HANG	725	23,407	60	74	\$ 24,070.00

Table 5.3-2 Summary of Airport Localized M&R Planning Cost and Quantity at Section Level

The following **Table 5.3-3** provides a summary of the anticipated planning-level costs for Localized Preventive Maintenance and Repair and Localized Stopgap Maintenance and Repair. The following table depicts planning-level costs rounded to the nearest ten dollars.

Table 5.3-3 Summary of Localized Maintenance

Work Category	Cost
Preventive	\$ 16,000.00
Stopgap	\$ 543,980.00
Planning-Level Localized M&R Needs =	\$ 559,980.00

Statewide Airfield Pavement Management Program



Chapter 6


FDOT

Chapter 6 – Major Rehabilitation Planning

6.1 Major Rehabilitation

Major rehabilitation is recommended to correct or improve structural deficiencies and/or functional deterioration for pavement sections within a network. Often, when pavements are subject to significant changes in the aircraft fleet mix (frequency and type), major rehabilitation is required to provide a pavement section to meet the traffic demand. Major rehabilitation is recommended when a pavement section falls below the Critical PCI value that is defined during the system customization or if a pavement section has a significant observation of load-related distress. Observation of any load-related distress potentially indicates that the section may be structurally deficient or that the aircraft loads being applied to the pavement section are different than what the section was designed for. **Figures 6.1-1 and 6.1-2** depict the decision process for major rehabilitation project identification with the assumption of available funds. Should funding be unavailable for pavement sections in need of major rehabilitation, the airport may elect to apply the appropriate localized stopgap repair.


Figure 6.1-1 Major Rehabilitation Planning Decision Diagram, PCI ≤ Critical PCI

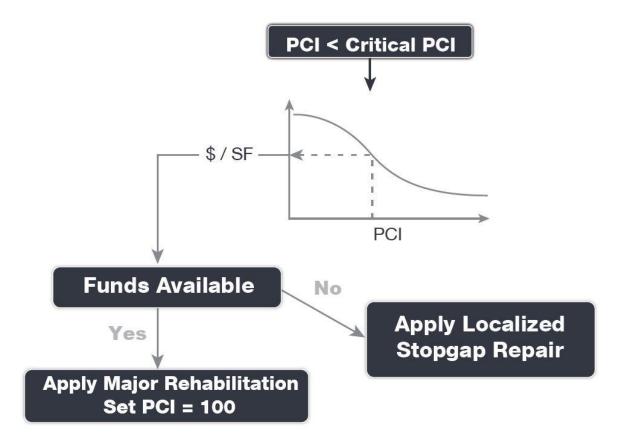

FDOT

141

Figure 6.1-2 Major Rehabilitation Planning Decision Diagram, PCI > Critical PCI

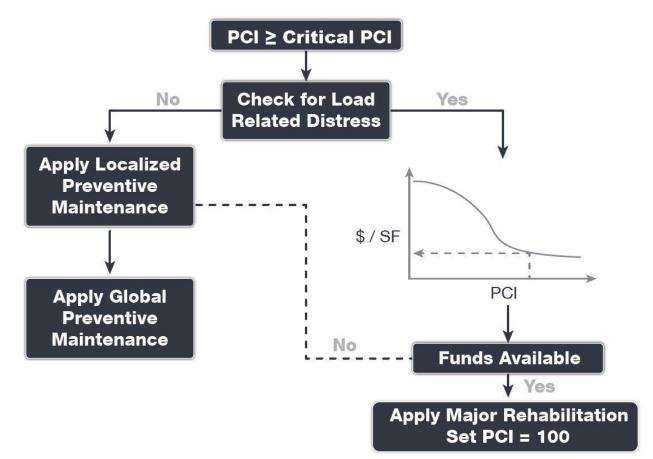

6.1.1 Critical PCI

For the FDOT SAPMP the development of a major rehabilitation program is based on the Critical PCI concept. The *Critical PCI* concept assumes that it is more cost-effective to maintain pavements above, rather than below their critical PCI. It is assumed that once a pavement section deteriorates to the Critical PCI value that it is more cost-effective to complete a major rehabilitation project rather than continuing to apply preventive maintenance. This method includes defining the Critical PCI and introducing major rehabilitation work types.

Identification of annual and long-range Major Rehabilitation work plans are typically based on the Critical PCI concept. The Critical PCI is defined as the PCI value at which the rate of loss (deterioration) increases with time, or the cost of applying localized maintenance and repair increases or is not effective. A Critical PCI is usually within a range of 55 and 70; the following procedure is standard approach in developing a specific Critical PCI:

- 1. Develop a pavement performance model and refine a prediction model for the pavements considered.
- 2. Select a localized maintenance and repair policy to be used in developing a work plan.
- 3. Apply the selected localized policy to the pavement sections for a range of PCI.
- 4. Compute the unit cost per area for each PCI range.
- 5. Plot the cost versus the PCI.
- 6. Determine the Critical PCI based on the point where the cost is insignificant.

The FDOT SAPMP defines the Critical PCI at 65 – this is based on the historic trends in pavement performance and Statewide planning efforts.

6.1.2 FDOT Recommended Minimum Service-Level PCI

The FDOT has recommended *Minimum Service-Level PCI* for airports' airfield pavements based on the following characteristics; airport type within FDOT SAPMP, branch use, and expected aircraft operations. For the purposes of Major Rehabilitation, the Critical PCI is typically the threshold condition that triggers major construction, however it is recommended that the airports maintain the Minimum Service-Level PCI with a combination of Localized Maintenance and Repair and timely Major Rehabilitation. **Table 6.1.2** summarizes the FDOT Recommended Minimum Service-Level PCI.

Branch Use	FDOT Recommended PCI	Additional Consideration				
Runway	75	Aircraft Fleet Mix Changes Primary Runway				
Taxiway / Taxilane	65	Aircraft Fleet Mix Changes Expected Operations				
Aprons / Run-Ups / Ramps	60	Ground Service Equipment Non-Aircraft Operations (e.g. fueling)				

Table 6.1.2 FDOT Recommended Minimum Service-Level PCI

6.2 Major Rehabilitation Policy

6.2.1 Major Rehabilitation Pavement Section Development

The review of the existing as-built record documentation within the participating airports' archives was used as the basis of the conceptual pavement design sections. Refinement of the pavement section layers was performed in consideration of the FAA *AC 150/ 5320-6F "Airport Pavement Design and Evaluation."* It should be noted that no subsurface geotechnical investigation, ALTA/ACSM Survey, topographic survey, utilities survey, environmental, or site specific air traffic study(s) have been utilized in the development of the design criteria. No warranty or assurance is implied in this document for final design nor construction for any airfield pavements discussed within this report. The following **Tables 6.2.1 (a) and (b)** provide details on the conceptual pavement sections developed for this study.

Major rehabilitation is divided into two policy categories as part of this program: Full-Depth Reconstruction (Reconstruction) and Intermediate-Level Major Rehabilitation (Restoration). Based on the pavement type, the general categories are defined as AC Reconstruction and AC Restoration for AC, AAC, and APC flexible pavement types and PCC Reconstruction and PCC Restoration for PCC rigid pavement types. The pavement sections have been based on the average GA Airport Type requirements; no pavement design has been performed in accordance with AC 150/5320-6F for the determined conceptual sections.

Rehabilitation Type	General Aviation (GA) Airport
AC Restoration Combination of asphalt pavement milling and overlay with 25% of the areas subject to full- depth reconstruction.	75% Mill and Overlay P-101 AC Milling (2") P-603 Bituminous Tack P-401 (HMA) (2")
PCI = 41 to 65	25% AC Reconstruction P-101 Pavement Removal P-152 Subgrade (12") P-211 Base (6") P-602 Bituminous Prime P-603 Bituminous Tack P-401 HMA (2") Excludes any paved shoulder features.
AC Reconstruction	P-101 Pavement Removal P-152 Subgrade (12") P-211 Base (6")
Full-depth asphalt pavement section reconstruction.	P-602 Bituminous Prime P-603 Bituminous Tack P-401 HMA (2")
PCI = 40 or less	Excludes any paved shoulder features.

Table 6.2.1 (a) Conceptual Pavement Section for Major Rehabilitation – Flexible AsphaltConcrete

Table 6.2.1 (b) Conceptual Pavement Section for Major Rehabilitation – Rigid Portland CementConcrete

Rehabilitation Type	General Aviation (GA) Airport
PCC Restoration Restoration of PCC pavement with a combination of crack sealing, joint seal replacement, and replacement of 25% of slab panels. PCI = 41 to 65	P-101 Pavement Removal P-605 Joint Seal Repair P-152 Subgrade (6") P-211 Base (if needed, typical) (6") P-501 Rigid PCC (10") *Select Slabs (25%) **Crack Seal and Limited Patching
PCC Reconstruction Full-depth rigid pavement section reconstruction. PCI = 40 or less	P-101 Pavement Removal P-605 Joint Seal Repair P-152 Subgrade (6") P-211 Base (6") P-501 Rigid PCC (10")

The identification of rehabilitation needs and conceptual pavement sections have been determined at the planning level. Design-level investigation is recommended prior to developing construction-level design documents and budgets.

In compliance with FAA Grant Assurances 11 and 19, the FDOT SAPMP provides airports with airfield pavement evaluation reports in accordance with FAA AC 150/5380-7B Airport Pavement Management Program (PMP) and AC 150/5380-6C Guidelines and Procedures for Maintenance of Airport Pavements. The application of the results of a PCI survey are for planning purposes and are limited to the visual observation of deteriorated pavements in limited sampling; design-level investigation is recommended in accordance with the FAA procedures defined in AC 5320-6F Airport Pavement Design and Evaluation and AC 150/5370-11B Use of Nondestructive Testing in the Evaluation of Airport Pavements. The aforementioned ACs provide the design-level material properties of in-situ pavement and subgrade layers for the determination of appropriate rehabilitation actions. The FDOT SAPMP is organized to provide airports with planning-level data and does not intend to preclude the responsible engineer in performing the appropriate level of investigation and analysis in determining the appropriate design-level rehabilitation. It would not be advisable to solely base design-level rehabilitation without the appropriate level of investigation and determination of pavement deterioration beyond that of a visual functional condition assessment.

6.2.2 Major Rehabilitation Planning-Level Unit Costs

Planning-level opinion of probable construction unit costs developed for this System Update was based on archived bid tabulations and records from airfield pavement projects provided by participating airports. A review of cost trends and cost factors have been incorporated to assist airports in planning for project budgets. Neither FDOT nor the Consultant Team has control over the cost of labor, materials, equipment, or over the Contractor's methods of determining prices or over competitive bidding or market conditions. Opinions of probable construction costs

provided herein are based on the information known to FDOT at this time and represent only the Consultant Team's judgment as a design professional familiar with the construction industry. This report cannot and does not guarantee that proposals, bids, or actual construction costs will not vary from its opinions of probable construction costs.

Table 6.2.2 General Aviation	Major Rehabilitation	Planning-Level Unit	Cost by Pavement Type
------------------------------	----------------------	---------------------	-----------------------

Rehabilitation Type	PCI Range	Flexible Asphalt Concrete Cost Per SF		tland Cement Cost per SF
Restoration	41 to 65	\$ 7.00	\$	10.00
Reconstruction	0 to 40	\$ 9.00	\$	15.00

Planning-level opinion of probable construction unit costs consider factors for non-pavement improvements, QA/QC testing, and administrative costs.

6.3 Major Rehabilitation Needs

The objective of the major pavement rehabilitation needs analysis is to provide planning-level projects within an airport's airfield pavement network. Major rehabilitation activities are recommended when a pavement section has deteriorated below the Critical PCI value, a point at which localized maintenance and repair activities may not be the most cost-effective solution. In addition, major rehabilitation is also recommended when the Section PCI is at or above the Critical PCI but the section has significant load-related PCI distresses. Identification of rehabilitation needs is done at the Airfield Pavement Network Definition's section level. This however does not limit the airport from further refining limits of project planning areas.

Major rehabilitation is identified within the FDOT SAPMP as major construction activity that would result in an improvement or resetting of the pavement section's PCI to a value of 100. Major rehabilitation recommendations (AC Restoration, AC Reconstruction, PCC Restoration, and PCC Reconstruction) should be considered as planning-level only. Additional design-level investigation in accordance to the FAA Advisory Circulars will be required. Recommendations identified within this planning document do not imply final design.

6.3.1 10-Year Unconstrained Budget Major Rehabilitation Needs

An unconstrained budget (unlimited budget) is performed for a 10-year duration to identify pavement rehabilitation needs based on current or forecasted PCI values deteriorating below the Critical PCI. FDOT recognizes airports are constrained by budgets and does not intend to convey an unrealistic approach of addressing pavement rehabilitation. The intent of the 10-Year Major Rehabilitation Needs analysis is to identify pavements that will warrant rehabilitation. It is highly recommended that airport staff utilize this information in support of the development of a practical Capital Improvement Program based on priorities, further design/project-level investigation, and budgetary constraints. The following **Table 6.3.1** summarizes all identified section-level major rehabilitation needs forecasted for the next 10-year period. It should be noted that the following table depicts planning-level costs and have been rounded for planning purposes.




Program Year	Network ID	Branch ID	Section ID	Surface	Area (SF)	PCI Before	Rehabilitation Type	Planning Cost
2018	РСМ	AP	4110	AAC	45,437	63	AC Restoration	\$ 319,000.00
2018	РСМ	AP	4120	AAC	46,434	61	AC Restoration	\$ 326,000.00
2018	РСМ	AP	4130	AC	77,514	57	AC Restoration	\$ 543,000.00
2018	РСМ	AP	4140	PCC	2,500	73	PCC Restoration	\$ 26,000.00
2018	РСМ	RW 10-28	6103	AAC	15,106	43	AC Restoration	\$ 126,000.00
2018	PCM	RW 10-28	6115	AAC	228,796	56	AC Restoration	\$ 1,602,000.00
2018	РСМ	RW 10-28	6120	AC	52,500	56	AC Restoration	\$ 368,000.00
2018	PCM	TW A	110	AAC	124,860	56	AC Restoration	\$ 875,000.00
2018	РСМ	TW A	115	AC	33,606	53	AC Restoration	\$ 236,000.00
2018	PCM	TW A	150	AAC	4,773	47	AC Restoration	\$ 37,000.00
2018	РСМ	TW A	160	AAC	5,383	51	AC Restoration	\$ 38,000.00
2018	PCM	TW T-HANG	710	AC	5,895	38	AC Reconstruction	\$ 54,000.00
2018	РСМ	TW T-HANG	720	AC	6,460	43	AC Restoration	\$ 54,000.00
2018	РСМ	TW T-HANG	725	AC	23,407	59	AC Restoration	\$ 164,000.00
2020	РСМ	AP	4135	AC	29,575	64	AC Restoration	\$ 208,000.00
2023	PCM	TW T-HANG	705	AC	13,043	64	AC Restoration	\$ 92,000.00

Table 6.3.1 10-Year Major Rehabilitation Needs


*All values have been rounded to the nearest thousand-dollar.

The following **Figure 6.3.1-1** summarizes the section-level major rehabilitation needs for a 10year period between 2018 and 2027. **Figure 6.3.1-2** provides an inset view of Airfield Pavement Major Rehabilitation Exhibit, a large format exhibit is located in **Appendix C Technical Exhibits**. The exhibit graphically depicts the Major Rehabilitation Needs with rounded costs.

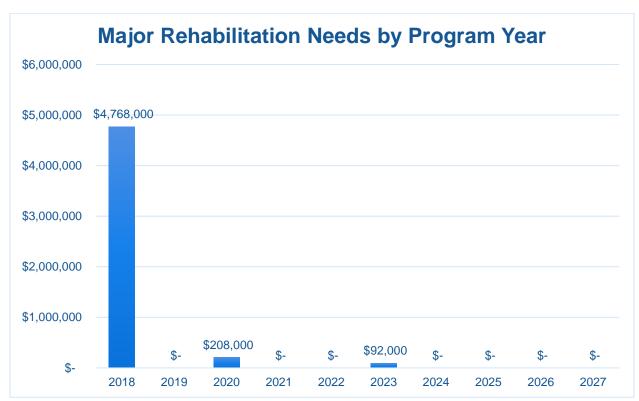





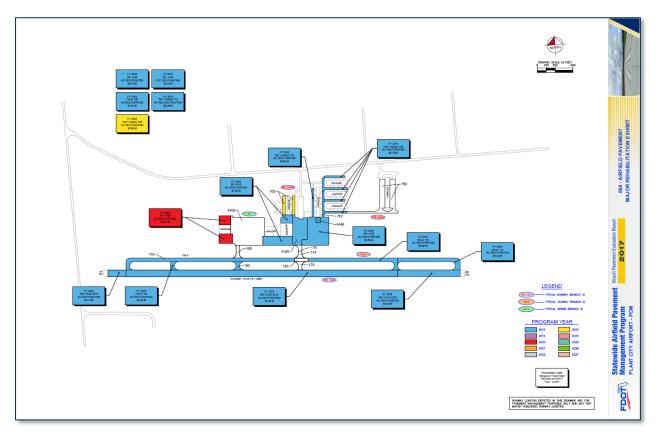



Statewide Airfield Pavement Management Program



Chapter 7

Chapter 7 – Conclusion

7.1 Recommendations

7.1.1 Continued PCI Survey Inspections

It is recommended that the airport continue to perform regularly scheduled PCI Survey inspections in accordance with the ASTM D5340-12 (or latest edition) to monitor the condition of the airfield pavement facilities.

A high priority should be considered for continuous maintenance record keeping and reinspection of all the airport's maintained pavement facilities to ensure continued safe aircraft operations. A series of scheduled periodic inspections must be carried out for an effective maintenance program. Re-inspection of pavements should be scheduled in a timely manner to ensure that all areas, particularly those that may not come under day-to-day observation, are thoroughly evaluated and reported.

7.1.2 Localized Maintenance and Repair

While deterioration of the pavements due to usage and exposure to the environment cannot be completely prevented, applying timely and effective maintenance efforts can slow the anticipated rate of deterioration. Lack of adequate and timely maintenance is the significant factor in pavement deterioration.

It is recommended that airport sponsors coordinate with their respective Airport Maintenance staff and Airport Engineer when developing project-level maintenance and repair efforts.

7.1.3 Major Rehabilitation

Chapter 6 – Major Rehabilitation Planning identified major pavement rehabilitation project needs from 2018-2027. The identification of the rehabilitation needs was performed at the section level for manageable project areas with the assumption of an unconstrained budget scenario. Given the uncertainty in the airport-specific budget information and prioritization goals, the unconstrained budget scenario was performed to evaluate the worst-case scenario and identify all the inspected pavements' needs in a 10-year period. Certainly, it is understood that most airports are faced with constrained budgets; further evaluation of projects based on prioritization, operational criticality, funding availability, and practicality is recommended.

7.1.4 Pavement Management System

The following recommendations are made to fully implement an effective pavement management program for the airport:

- > Develop a detailed preventive maintenance program for the airport.
- Further refine and implement the identified 10-year major rehabilitation needs.
- Maintain detailed records on pavement maintenance, construction, and inspection.
- Maintain records on major pavement construction projects (year, scope, cost, and construction documents).

7.2 Supporting Documents

001 – Airfield Pavement Network Definition Exhibit

The Airfield Pavement Network Definition Exhibit is located in **Appendix C Technical Exhibits**. The exhibit depicts the airfield layout in a manner that defines the airfield pavement infrastructure as branches, sections, and sample units in accordance with the ASTM D5340-12. The exhibit is intended for planning purposes only – further detail on facilities can be found on the Airport's adopted Airport Layout Plan. Detailed characteristics are tabulated in **Appendix A Pavement Analysis Tables.**

002 – Airfield Pavement System Inventory Exhibit

The Airfield Pavement System Inventory Exhibit in is located in **Appendix C Technical Exhibits**. The exhibit depicts any recent and/or anticipated construction activity within the airfield pavement facilities reported by airport staff. The exhibit is intended to schematically identify the pavement limits of works and general work description. The information reported on the *Airport Response Form* provided by each participating airport was used as the basis of the changes; furthermore, changes are confirmed at the airport with airport staff during the in-brief and debrief meeting.

003 – Airfield Pavement Condition Index Exhibit

The Airfield Pavement Condition Index Exhibit is located in **Appendix C Technical Exhibits**. The exhibit is a visual summary of the latest conditions calculated from the results of the PCI Survey performed at the airport. The analysis of the distresses surveyed in accordance with the ASTM D5340-12 (referenced in **Appendix E Inspection Distress Details**) were analyzed using PAVER[™] software to determine PCI values. The PCI values are identified in the exhibit and graphically represented using the standard ASTM D5340-12 colors for condition rating categories.

004 – Airfield Pavement Major Rehabilitation Exhibit

The Airfield Pavement Major Rehabilitation Exhibit is located in **Appendix C Technical Exhibits**. The exhibit has been prepared based on the section condition analysis, pavement condition forecasts, and major rehabilitation needs analysis. The exhibit graphically depicts the inventory with the associated rehabilitation type activity, program year, and the planning-level costs. The area limits, rehabilitation type, and planning-level costs should not be considered a design-level recommendation. A tabulation of the 10-Year Major Rehabilitation is located in **Appendix B Airfield Pavement Localized Maintenance and Repair and Major Rehabilitation**.

Inspection Photograph Documentation

Representative field conditions from the PCI Survey are documented with digital photographs located in **Appendix D Inspection Photograph Documentation.** Select photographs are provided with limited caption on the distresses observed – the Appendix does not contain photographs for every sample unit.



7.3 Conclusion


The FDOT SAPMP Update Phase 1 2016-2017 was completed for the airport on behalf of the FDOT ASO in accordance with the Advisory Circulars 150/5380-7B "Airport Pavement Management Program (PMP)" and 150/5380-6C "Guidelines and Procedures for Maintenance of Airport Pavements." FDOT's implementation of the SAPMP has assisted public airports with this requirement in performing PCI survey inspections and analysis in accordance with the ASTM D5340-12 "Standard Test Method for Airport Pavement Condition Index Surveys."

Statewide Airfield Pavement Management Program



Appendix A

Airfield Pavement Analysis Tables

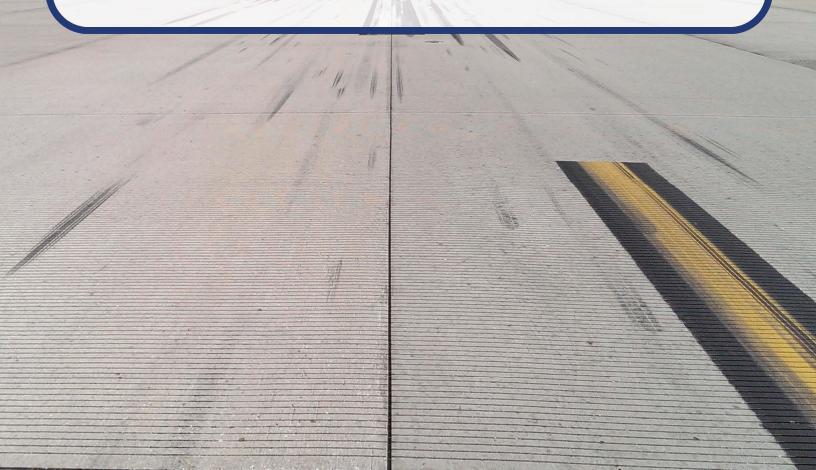



Network ID	Branch Name	Branch ID	Branch Use	Section ID	Length (FT)	Width (FT)	Area (SF)	Surface Type	Est. Last Construction Date
PCM	APRON	AP	APRON	4105	350	320	112,145	AC	3/1/2013
PCM	APRON	AP	APRON	4110	450	100	45,437	AAC	1/1/1992
PCM	APRON	AP	APRON	4120	325	140	46,434	AAC	1/1/1992
РСМ	APRON	AP	APRON	4130	300	250	77,514	AC	1/1/1986
PCM	APRON	AP	APRON	4135	200	132	29,575	AC	1/1/2008
PCM	APRON	AP	APRON	4140	50	50	2,500	PCC	1/1/2010
РСМ	RUNWAY 10-28	RW 10-28	RUNWAY	6103	200	75	15,106	AAC	1/1/2002
PCM	RUNWAY 10-28	RW 10-28	RUNWAY	6115	3050	75	228,796	AAC	1/1/1983
PCM	RUNWAY 10-28	RW 10-28	RUNWAY	6120	700	75	52,500	AC	1/1/2002
РСМ	TAXIWAY A	TW A	TAXIWAY	110	3000	40	124,860	AAC	1/1/2001
РСМ	TAXIWAY A	TW A	TAXIWAY	115	750	40	33,606	AC	1/1/2001
PCM	TAXIWAY A	TW A	TAXIWAY	120	150	40	6,040	AAC	8/1/2013
РСМ	TAXIWAY A	TW A	TAXIWAY	150	120	35	4,773	AAC	1/1/2001
PCM	TAXIWAY A	TW A	TAXIWAY	160	125	40	5,383	AAC	1/1/2001
PCM	TAXIWAY A	TW A	TAXIWAY	165	65	35	6,228	AAC	3/1/2013
РСМ	TAXIWAY A	TW A	TAXIWAY	170	120	40	4,870	AAC	8/1/2013
PCM	ΤΑΧΙΨΑΥ Α	TW A	TAXIWAY	174	100	40	4,273	AAC	8/1/2013
РСМ	TAXIWAY A	TW A	TAXIWAY	175	70	40	3,137	AAC	1/1/2001
РСМ	TAXIWAY TO HANGAR	TW HANG	TAXILANE	750	850	60	53,871	AC	1/1/2011
PCM	T-HANGARS TAXIWAY	TW T-HANG	TAXILANE	705	430	30	13,043	AC	1/1/1992
РСМ	T-HANGARS TAXIWAY	TW T-HANG	TAXILANE	710	280	20	5,895	AC	1/1/1986
PCM	T-HANGARS TAXIWAY	TW T-HANG	TAXILANE	720	323	20	6,460	AC	1/1/1986
РСМ	T-HANGARS TAXIWAY	TW T-HANG	TAXILANE	725	1000	20	23,407	AC	1/1/1997

Table A-1 Pavement System Inventory Details



Table A-2 Pavement Condition Index Summary (Last Inspection) – Section Level

Network ID	Branch Name	Branch Use	Section ID	Area (SF)	PCI	Condition Rating
PCM	RUNWAY 10-28	RUNWAY	6103	15,106	46	Poor
PCM	RUNWAY 10-28	RUNWAY	6115	228,796	58	Fair
PCM	RUNWAY 10-28	RUNWAY	6120	52,500	58	Fair
PCM	TAXIWAY A	TAXIWAY	110	124,860	58	Fair
PCM	TAXIWAY A	TAXIWAY	115	33,606	55	Poor
PCM	TAXIWAY A	TAXIWAY	120	6,040	92	Good
PCM	TAXIWAY A	TAXIWAY	150	4,773	48	Poor
PCM	TAXIWAY A	TAXIWAY	160	5,383	53	Poor
PCM	TAXIWAY A	TAXIWAY	165	6,228	92	Good
PCM	TAXIWAY A	TAXIWAY	170	4,870	90	Good
PCM	TAXIWAY A	TAXIWAY	174	4,273	94	Good
PCM	TAXIWAY A	TAXIWAY	175	3,137	83	Satisfactory
PCM	T-HANGARS TAXIWAY	TAXILANE	705	13,043	70	Fair
PCM	T-HANGARS TAXIWAY	TAXILANE	710	5,895	40	Very Poor
PCM	T-HANGARS TAXIWAY	TAXILANE	720	6,460	45	Poor
PCM	T-HANGARS TAXIWAY	TAXILANE	725	23,407	60	Fair
PCM	TAXIWAY TO HANGAR	TAXILANE	750	53,871	90	Good
PCM	APRON	APRON	4105	112,145	93	Good
PCM	APRON	APRON	4110	45,437	65	Fair
PCM	APRON	APRON	4120	46,434	63	Fair
PCM	APRON	APRON	4130	77,514	59	Fair
PCM	APRON	APRON	4135	29,575	69	Fair
PCM	APRON	APRON	4140	2,500	75	Satisfactory

Airport Pavement 2017 Evaluation Report



141

Table A-3 Forecasted PCI 2018-2027

Network ID	Branch ID	Section ID					l	Forecas	sted PC				
Network ID	Branch ID	Section ID	Last PCI	2018	2019	2020	2021	2022	2023	2024	2025	2026	2027
РСМ	AP	4105	93	91	90	88	87	85	83	82	80	79	77
PCM	AP	4110	65	63	60	58	56	54	53	53	52	52	52
РСМ	AP	4120	63	61	58	56	55	54	53	52	52	52	52
PCM	AP	4130	59	57	56	54	53	51	49	48	46	45	43
РСМ	AP	4135	69	67	66	64	63	61	59	58	56	55	53
PCM	AP	4140	75	73	71	69	67	65	63	62	60	59	57
PCM	RW 10-28	6103	46	43	40	36	33	31	29	26	23	20	17
PCM	RW 10-28	6115	58	56	55	53	50	47	44	41	37	34	32
РСМ	RW 10-28	6120	58	56	55	53	51	50	48	46	45	43	42
PCM	TW A	110	58	56	54	53	51	50	48	47	46	45	44
РСМ	TW A	115	55	53	52	50	49	47	46	44	42	41	39
PCM	TW A	120	92	89	86	84	82	80	78	76	75	74	73
PCM	TW A	150	48	47	45	45	44	44	43	43	43	43	43
PCM	TW A	160	53	51	50	48	47	46	45	44	44	43	43
РСМ	TW A	165	92	89	86	84	82	80	78	76	75	74	73
PCM	TW A	170	90	87	85	82	80	78	77	75	74	73	72
РСМ	TW A	174	94	91	88	86	83	81	79	77	76	74	73
PCM	TW A	175	83	81	79	77	76	74	73	72	71	71	70
PCM	TW HANG	750	90	88	85	83	80	78	76	75	73	72	70
PCM	TW T-HANG	705	70	69	68	67	66	65	64	63	62	62	61
РСМ	TW T-HANG	710	40	38	37	36	34	33	32	31	30	30	29
PCM	TW T-HANG	720	45	43	42	40	39	37	36	35	33	32	31
РСМ	TW T-HANG	725	60	59	58	56	55	54	52	51	49	47	46

7/26/2017	7/26/2017 Work History Report Page 1 of Pavement Database: FDOT								
Network: L.C.D.: 3/1/20		TY AIRPO e: APRON	Branch: AP Rank: P	APRO Length: 350		Section: dth: 320.0	4105 00 (Ft) True Area:	Surface: AC 112,145.00 (SqFt)	
Work Date	Work Code	Work 1	Description	Cost	Thickness (in)	Major M&R	Comm	ients	
3/1/2013 1/1/1986	CR-AC IMPORT ED	1	construction - AC	0.00	0.00 1.50		2" Bitum. Surface, 6" 1986 1.5" SI SURFA 6" STAB BASE		
Network: L.C.D.: 1/1/19		TY AIRPO	Branch: AP Rank: P	APRO Length: 450		Section:	4110 00 (Ft) True Area:	Surface: AAC 45,437.00 (SqFt)	
Work Date	Work Code		Description	Cost	Thickness (in)	Major M&R	Comm		
1/1/2012 1/1/1992	SS-SC	Surface Seal - OVERLAY	Seal Coat	0.00	0.00		Estimated Rehab Date 1992 1" P-401 OL	e	
1/1/1970	IMPORT ED	BUILT		0.00	1.00		1970 1" TYPE 1 BIT	6" LIMEROCK	
Network: L.C.D.: 1/1/19		TY AIRPO e: APRON	Branch: AP Rank: P	APRO Length: 325		Section: dth: 140.0	4120 00 (Ft) True Area:	Surface: AAC 46,434.00 (SqFt)	
Work Date	Work Code	Work l	Description	Cost	Thickness (in)	Major M&R	Comm	nents	
1/1/2012 1/1/1992	SS-SC IMPORT ED	Surface Seal - BUILT	Seal Coat	0.00	0.00 1.00		Estimated Rehab Date 1992 1" P-401 OL	e	
Network: L.C.D.: 1/1/19		TY AIRPO e: APRON	Branch: AP Rank: P	APRO Length: 300		Section: dth: 250.0	4130 00 (Ft) True Area:	Surface: AC 77,514.00 (SqFt)	
Work Date	Work Code	Work l	Description	Cost	Thickness (in)	Major M&R	Comm	nents	
1/1/2012 1/1/1986	SS-SC IMPORT ED	Surface Seal - BUILT	Seal Coat	0.00	0.00		Estimated Rehab Dat 1986 1.5" TYPE S-1 LIMEROCK 6" STA	BIT 9"	
Network: L.C.D.: 1/1/20		TY AIRPO e: APRON	Branch: AP Rank: P	APRO Length: 200		Section: dth: 132.0	4135 00 (Ft) True Area:	Surface: AC 29,575.00 (SqFt)	
Work Date 1/1/2008	Work Code NU-IN	Work I New Construc	Description ction - Initial	Cost 0.00	Thickness (in) 0.00	Major M&R ✔	Comm	nents	
Network: L.C.D.: 1/1/20		TY AIRPO e: APRON	Branch: AP Rank: P	APRO Length: 50		Section: dth: 50.0	4140 00 (Ft) True Area:	Surface: PCC 2,500.00 (SqFt)	
Work Date 1/1/2010	Work Code NU-IN	Work I New Construc	Description ction - Initial	Cost 0.00	Thickness (in) 0.00	Major M&R ✔	Comm	ients	

7/26/2017	1	Wol	rk History	y Report		Page 2 of 5
		Pavement Database:	FDOT			
Notwork	DI ANT CI	TY AIRPO Branch: RW 10	28 DUNW	VAY 10-28	Section:	6103 Surface: AAC
L.C.D.: 1/1/2				.00 (Ft) Wid		00 (Ft) True Area: 15,106.00 (SqFt)
	Work		8	Thickness	Major	
Work Date	Code	Work Description	Cost	(in)	M&R	Comments
1/1/2002		Overlay - AC Thin	0.00	1.50		1.5" AC Ovly
1/1/1976	ED	OVERLAY	0.00	6.00		1976 6" LIMEROCK
1/1/1900	NU-IN	New Construction - Initial	0.00	0.00		
Notwork		TY AIRPO Branch: RW 10	29 DUNI	VAV 10 28	Section:	6115 Surface AAC
L.C.D.: 1/1/1			ength: 3,050	VAY 10-28 .00 (Ft) Wid		6115 Surface: AAC 00 (Ft) True Area: 228,796.00 (SqFt)
	Work		_	Thickness	Major	
Work Date	Code	Work Description	Cost	(in)	M&R	Comments
1/1/1983	IMPORT ED	OVERLAY	0.00	1.50		1983 1.5" BIT OL
1/1/1976	IMPORT	OVERLAY	0.00	6.00		1976 6" LIMEROCK
1/1/1960	ED IMPORT ED	OVERLAY	0.00	0.75		1960 .75" BIT OL
1/1/1948	IMPORT ED	BUILT	0.00	6.00		1948 6" LIMEROCK
		TY AIRPO Branch: RW 10		VAY 10-28	Section:	
L.C.D.: 1/1/2		e: RUNWAY Rank: P L	ength: 700	.00 (Ft) Wid		00 (Ft) True Area: 52,500.00 (SqFt)
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2002	NULL INT			(III)	Mak	
		New Construction - Initial	0.00	3.00		3" AC /6" Limerock / 4" Stab Subbase
1/1/1976		New Construction - Initial OVERLAY	0.00 0.00	× /		3" AC /6" Limerock / 4" Stab Subbase 1976 6" LIMEROCK
	IMPORT ED	OVERLAY	0.00	3.00 6.00		1976 6" LIMEROCK
Network:	IMPORT ED PLANT CI	OVERLAY TY AIRPO Branch: TW A	0.00 TAXI	3.00 6.00	Section:	1976 6" LIMEROCK 110 Surface: AAC
	IMPORT ED PLANT CI	OVERLAY TY AIRPO Branch: TW A e: TAXIWAY Rank: P L	0.00 TAXIV ength: 3,000	3.00 6.00	Section: Ith: 40.0	1976 6" LIMEROCK 110 Surface: AAC 00 (Ft) True Area: 124,860.00 (SqFt)
Network: L.C.D.: 1/1/2	IMPORT ED PLANT CI 001 Us Work	OVERLAY TY AIRPO Branch: TW A æ: TAXIWAY Rank: P L	0.00 TAXI ength: 3,000	3.00 6.00 WAY A .00 (Ft) Wid Thickness	Section: Ith: 40.0 Major	1976 6" LIMEROCK 110 Surface: AAC 00 (Ft) True Area: 124,860.00 (SqFt)
Network: L.C.D.: 1/1/2 Work Date	IMPORT ED PLANT CI 001 Us Work Code CS-AC OL-AT	OVERLAY TY AIRPO Branch: TW A e: TAXIWAY Rank: P L Work Description Crack Sealing - AC Overlay - AC Thin	0.00 TAXIV ength: 3,000 Cost 0.00 0.00	3.00 6.00 WAY A .00 (Ft) Wid Thickness (in)	Section: Ith: 40.0 Major	1976 6" LIMEROCK 110 Surface: AAC 00 (Ft) True Area: 124,860.00 (SqFt) Comments Estimated Rehab date based on Airport 1" AC Ovly
Network: L.C.D.: 1/1/2 Work Date 6/1/2013	IMPORT ED PLANT Cl 001 Us Work Code CS-AC OL-AT IMPORT	OVERLAY TY AIRPO Branch: TW A e: TAXIWAY Rank: P L Work Description Crack Sealing - AC Overlay - AC Thin	0.00 TAXIV ength: 3,000 Cost 0.00	3.00 6.00 WAY A .00 (Ft) Wid Thickness (in) 0.00	Section: Ith: 40.0 Major M&R	1976 6" LIMEROCK 110 Surface: AAC 00 (Ft) True Area: 124,860.00 (SqFt) Comments Estimated Rehab date based on Airport
Network: L.C.D.: 1/1/2 Work Date 6/1/2013 1/1/2001	IMPORT ED PLANT CI 001 Us Work Code CS-AC OL-AT	OVERLAY TY AIRPO Branch: TW A e: TAXIWAY Rank: P L Work Description Crack Sealing - AC Overlay - AC Thin REPAIR	0.00 TAXIV ength: 3,000 Cost 0.00 0.00	3.00 6.00 WAY A .00 (Ft) Wid Thickness (in) 0.00 1.00	Section: Ith: 40.0 Major M&R	1976 6" LIMEROCK 110 Surface: AAC 00 (Ft) True Area: 124,860.00 (SqFt) Comments Estimated Rehab date based on Airport 1" AC Ovly
Network: L.C.D.: 1/1/2 Work Date 6/1/2013 1/1/2001 1/1/1993 1/1/1963	IMPORT ED PLANT CI 001 Us Work Code CS-AC OL-AT IMPORT ED IMPORT ED	OVERLAY TY AIRPO Branch: TW A e: TAXIWAY Rank: P L Work Description Crack Sealing - AC Overlay - AC Thin REPAIR	0.00 TAXIV ength: 3,000 Cost 0.00 0.00 0.00	3.00 6.00 WAY A .00 (Ft) Wid Thickness (in) 0.00 1.00 0.00	Section: Major M&R	1976 6" LIMEROCK 110 Surface: AAC 00 (Ft) True Area: 124,860.00 (SqFt) Comments Estimated Rehab date based on Airport 1" AC Ovly 1993 P-625 SEAL COAT 1963 1" P-401 6" P-211 28" GRANULAR SUB
Network: L.C.D.: 1/1/2 Work Date 6/1/2013 1/1/2001 1/1/1993 1/1/1963	IMPORT ED PLANT CI 001 Us Work Code CS-AC OL-AT IMPORT ED IMPORT ED	OVERLAY TY AIRPO Branch: TW A e: TAXIWAY Rank: P L Work Description Crack Sealing - AC Overlay - AC Thin REPAIR BUILT TY AIRPO Branch: TW A	0.00 TAXIV ength: 3,000 Cost 0.00 0.00 0.00 0.00	3.00 6.00 WAY A .00 (Ft) Wid Thickness (in) 0.00 1.00 0.00 1.00	Section: Major M&R V Section: Section:	1976 6" LIMEROCK 110 Surface: AAC 00 (Ft) True Area: 124,860.00 (SqFt) Comments Estimated Rehab date based on Airport 1" AC Ovly 1993 P-625 SEAL COAT 1963 1" P-401 6" P-211 28" GRANULAR SUB
Network: L.C.D.: 1/1/2 Work Date 6/1/2013 1/1/2001 1/1/1993 1/1/1963 Network:	IMPORT ED PLANT CI 001 Us Work Code CS-AC OL-AT IMPORT ED IMPORT ED PLANT CI 001 Us Work Code	OVERLAY TY AIRPO Branch: TW A ee: TAXIWAY Rank: P L Work Description Crack Sealing - AC Overlay - AC Thin REPAIR BUILT TY AIRPO Branch: TW A ee: TAXIWAY Rank: P L Work Description	0.00 TAXIV ength: 3,000 Cost 0.00 0.00 0.00 0.00	3.00 6.00 WAY A .00 (Ft) Wid Thickness (in) 0.00 1.00 0.00 1.00 0.00	Section: Major M&R V Section: Section:	1976 6" LIMEROCK 110 Surface: AAC 00 (Ft) True Area: 124,860.00 (SqFt) Comments Estimated Rehab date based on Airport 1" AC Ovly 1993 P-625 SEAL COAT 1963 1" P-401 6" P-211 28" GRANULAR SUB 115 Surface: AC
Network: L.C.D.: 1/1/2 Work Date 6/1/2013 1/1/2001 1/1/1993 1/1/1963 Network: L.C.D.: 1/1/2 Work Date 6/1/2013	IMPORT ED PLANT CI 001 Us Work Code CS-AC OL-AT IMPORT ED IMPORT ED IMPORT CO US Work Code CS-AC	OVERLAY TY AIRPO Branch: TW A e: TAXIWAY Rank: P L Work Description Crack Sealing - AC Overlay - AC Thin REPAIR BUILT TY AIRPO Branch: TW A e: TAXIWAY Rank: P L Work Description Crack Sealing - AC	0.00 TAXIV ength: 3,000 Cost 0.00 0.00 0.00 TAXIV ength: 750 Cost 0.00	3.00 6.00 WAY A .00 (Ft) Wid Thickness (in) 0.00 1.00 1.00 1.00 0.00 1.00 0.00 1.00 0.00 1.00 0.00 1.00	Section: Major M&R M&R M&R Section: Ath: 40.0 Major M&R Major M&R	1976 6" LIMEROCK 110 Surface: AAC 20 (Ft) True Area: 124,860.00 (SqFt) Comments Estimated Rehab date based on Airport 1" AC Ovly 1993 P-625 SEAL COAT 1963 1" P-401 6" P-211 28" GRANULAR SUB 115 Surface: AC 20 (Ft) True Area: 33,606.00 (SqFt) Comments Estimated Rehab date based on Airport
Network: L.C.D.: 1/1/2 Work Date 6/1/2013 1/1/2001 1/1/1993 1/1/1963 Network: L.C.D.: 1/1/2 Work Date	IMPORT ED PLANT CI 001 Us Work Code CS-AC OL-AT IMPORT ED IMPORT ED PLANT CI 001 Us Work Code	OVERLAY TY AIRPO Branch: TW A ee: TAXIWAY Rank: P L Work Description Crack Sealing - AC Overlay - AC Thin REPAIR BUILT TY AIRPO Branch: TW A ee: TAXIWAY Rank: P L Work Description	0.00 TAXIV ength: 3,000 Cost 0.00 0.00 0.00 0.00 TAXIV ength: 750 Cost	3.00 6.00 WAY A .00 (Ft) Wid Thickness (in) 0.00 1.00 0.00 1.00 0.00 1.00 0.00 1.00 0.00 1.00 0.00 1.00 0.00 1.00 0.00 1.00 0.00 1.00	Section: Major M&R Section: M&R M&R Major M&R Major M&R Major M&R Major M&R Major M&R Major M&R Major M&R Major M&R Major M&R Major M&R Major M&R Major M&R Major M&R Major MAR Major MAR Major MAR Major MAR Major MAR Major MAR Major MAR Major MAR Major MAR Major MAR Major MAR Major MAR Major MAR Major MAR Major MAR	1976 6" LIMEROCK 110 Surface: AAC 00 (Ft) True Area: 124,860.00 (SqFt) Comments Estimated Rehab date based on Airport 1" AC Ovly 1993 P-625 SEAL COAT 1963 1" P-401 6" P-211 28" GRANULAR SUB 115 Surface: AC 00 (Ft) True Area: 33,606.00 (SqFt) Comments

7/26/2017	7	Wor Pavement Database:	rk History <i>FDOT</i>	y Report		Page 3 of 5
Network:	PLANT CI	TY AIRPO Branch: TW A	TAXIV	WAY A	Section:	120 Surface: AAC
L.C.D.: 8/1/2	013 Us	e: TAXIWAY Rank: P L	ength: 150	.00 (Ft) Wie	dth: 40.	00 (Ft) True Area: 6,040.00 (SqFt)
Work Date	Work	Work Description	Cost	Thickness	Major	Comments
8/1/2013	Code ML-OV	MILL and OVERLAY	0.00	(in) 0.00	M&R	2" MILL and 2" OVERLAY of SP-12.5
1/1/2001		New Construction - Initial	0.00			2 MILL and 2 OVERLAT OF SF-12.5
1/1/2001	10-11	New Construction - Initian	0.00	0.00		
Network:	PLANT CI	TY AIRPO Branch: TW A	TAXIV	WAY A	Section:	150 Surface: AAC
L.C.D.: 1/1/2	001 Us	e: TAXIWAY Rank: P L	ength: 120	.00 (Ft) Wi	dth: 35.	00 (Ft) True Area: 4,773.00 (SqFt)
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
6/1/2013		Crack Sealing - AC	0.00	0.00		Estimated Rehab date based on Airport
1/1/2001	OL-AT	Overlay - AC Thin	0.00	1.00		1" AC Ovly
1/1/1993	IMPORT	REPAIR	0.00	0.00		1993 P-625 SEAL COAT
1/1/1963	ED IMPORT ED	BUILT	0.00	1.00		1963 1" P-401 6" P-211 28" GRANULAR
Network: L.C.D.: 1/1/2		TY AIRPO Branch: TW A e: TAXIWAY Rank: P L		WAY A .00 (Ft) Wi o	Section: dth: 40.	160 Surface: AAC 00 (Ft) True Area: 5,383.00 (SqFt)
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
6/1/2013		Crack Sealing - AC	0.00	(III)		Estimated Rehab date based on Airport
1/1/2001	OL-AT	Overlay - AC Thin	0.00	1.00		1" AC Ovly
1/1/1993	IMPORT ED	REPAIR	0.00	0.00		1993 P-625 SEAL COAT
1/1/1986	IMPORT ED	BUILT	0.00	1.50		1986 1.5" TYPE S1 BIT
1/1/1986		OVERLAY	0.00	6.00		1986 6" TYPE 3 BASE 6" STAB BASE
		TY AIRPO Branch: TW A		WAY A	Section:	
L.C.D.: 3/1/2		e: TAXIWAY Rank: P L	ength: 65	. ,		00 (Ft) True Area: 6,228.00 (SqFt)
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
3/1/2013	ML-OV	MILL and OVERLAY	0.00	0.00		2" Mill 2" Overlay Bitum surface course
1/1/2001	NU-IN	New Construction - Initial	0.00	0.00		
Network:	PLANT CI	TY AIRPO Branch: TW A	TAXIV	WAY A	Section:	170 Surface: AAC
L.C.D.: 8/1/2	013 Us	e: TAXIWAY Rank: P L	ength: 120	.00 (Ft) Wie	dth: 40.	00 (Ft) True Area: 4,870.00 (SqFt)
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
8/1/2013	ML-OV	MILL and OVERLAY	0.00	0.00		2" Mill and 2" Overlay SP-12.5
1/1/2001		Overlay - AC Thin	0.00			1" AC Ovly
1/1/1993	IMPORT ED	REPAIR	0.00	0.00		1993 P-625 SEAL COAT
1/1/1963	IMPORT ED	BUILT	0.00	1.00		1963 1" P-401 6" P-211 28" GRANULAR

7/26/2017	,	Wo Pavement Database:	rk History <i>FDOT</i>	y Report			Page 4 of 5
Network:	PLANT CI	TY AIRPO Branch: TW A	TAXIV	WAY A	Section:	174	Surface: AAC
L.C.D.: 8/1/20	013 Us	e: TAXIWAY Rank: P L	ength: 100	.00 (Ft) Wi	dth: 40.	00 (Ft) True Area:	4,273.00 (SqFt)
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Com	nents
8/1/2013	ML-OV	MILL and OVERLAY	0.00	0.00		2" Mill and 2" Overl	ay of SP-12.5
1/1/2001	NU-IN	New Construction - Initial	0.00	0.00			
Network:	PLANT CI	TY AIRPO Branch: TW A	TAXIV	WAY A	Section:	175	Surface: AAC
L.C.D.: 1/1/20	001 Us	e: TAXIWAY Rank: P L	ength: 70	.00 (Ft) Wi	dth: 40.	00 (Ft) True Area:	3,137.00 (SqFt)
Work Date	Work Code	Work Description	Cost	Thickness	Major M&D	Com	nents
1/1/2001		- Overlay - AC Thin	0.00	(in) 1.00	M&R	1" AC Ovly	
1/1/1992		OVERLAY	0.00			1992 1" P-401 OL	
	ED		1				
1/1/1960	IMPORT ED	OVERLAY	0.00	1.00		1960 1" P-401	
1/1/1948	IMPORT	BUILT	0.00	6.00		1948 6" LIMEROCH	X
	ED						
Network:	PLANT CI	TY AIRPO Branch: TW HA	ANG TAXIV	WAY ТО Н	Section:	750	Surface: AC
L.C.D.: 1/1/20	011 Us	e: TAXILAN Rank: P L	ength: 850	.00 (Ft) Wi	dth: 60.	00 (Ft) True Area:	53,871.00 (SqFt)
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Com	nents
1/1/2011	NU-IN	New Construction - Initial	0.00	0.00			
Network: L.C.D.: 1/1/19		TY AIRPO Branch: TW T- e: TAXILAN Rank: P L			Section:	705 00 (Ft) True Area:	Surface: AC 13,043.00 (SqFt)
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Com	nents
1/1/2012	SS-SC	Surface Seal - Seal Coat	0.00	0.00		Estimated Rehab Da	te
1/1/1992	NC-AC	New Construction - AC	0.00	0.00			
Notreorde		TY AIRPO Branch: TW T-			Section:	710	Surface: AC
L.C.D.: 1/1/19							5,895.00 (SqFt)
	Work		ength: 280	.00 (Ft) Wi Thickness	dth: 20. Major	00 (Ft) True Area:	3,693.00 (SqFt)
Work Date	Code	Work Description	Cost	(in)	M&R	Com	nents
1/1/1986	NC-AC	New Construction - AC	0.00	0.00			
Network:	PLANT CI	TY AIRPO Branch: TW T-	HANG T-HAN	NGARS TA	Section:	720	Surface: AC
		e: TAXILAN Rank: P L	ength: 323	.00 (Ft) Wi	dth: 20.	00 (Ft) True Area:	6,460.00 (SqFt)
L.C.D.: 1/1/19	986 Us	C. IAAILAN Kaik, I L					
L.C.D.: 1/1/19 Work Date	986 Us Work Code	Work Description	Cost	Thickness (in)	Major M&R	Com	nents
	Work	Work Description	Cost 0.00			Comi 1986 UNKNOWN A	
Work Date	Work Code IMPORT	Work Description		(in)	M&R		
Work Date 1/1/1986	Work Code IMPORT ED	Work Description	0.00	(in) 0.00	M&R	1986 UNKNOWN A	
Work Date 1/1/1986	Work Code IMPORT ED PLANT CI	Work Description BUILT TY AIRPO Branch: TW T-	0.00	(in) 0.00 NGARS TA	M&R	1986 UNKNOWN A	C SECTION
Work Date 1/1/1986 Network:	Work Code IMPORT ED PLANT CI	Work Description BUILT TY AIRPO Branch: TW T-	0.00 HANG T-HAN	(in) 0.00 NGARS TA	M&R	1986 UNKNOWN A 725	C SECTION Surface: AC 23,407.00 (SqFt)

7/26/2017

Work History Report

Pavement Database: FDOT

Summary:

Work Description	Section Count	Area Total (SqFt)	Thickness Avg (in)	Thickness STD (in)
BUILT	11	659,809.00	1.95	1.95
Complete Reconstruction - AC	1	112,145.00	0.00	0.00
Crack Sealing - AC	4	168,622.00	0.00	0.00
MILL and OVERLAY	4	21,411.00	0.00	0.00
New Construction - AC	4	75,951.00	0.75	1.30
New Construction - Initial	8	170,093.00	0.38	0.99
OVERLAY	9	811,088.00	3.25	2.47
Overlay - AC Thin	7	191,735.00	1.07	0.17
REPAIR	4	139,886.00	0.00	0.00
Surface Seal - Seal Coat	4	182,428.00	0.00	0.00

7/26/2017	7/26/2017 Branch Condition Report Page 1 of 2000 Pavement Database: FDOT											
Branch ID	Average PCI	Standard Deviation PCI	Weighted Average PCI									
AP	6	1,675.00	165.33	313,605.00	APRON	70.67	11.16	73.69				
RW 10-28	3	3,950.00	75.00	296,402.00	RUNWAY	54.00	5.66	57.39				
TW A	9	4,500.00	38.89	193,170.00	TAXIWAY	73.89	18.62	61.26				
TW HANG	1	850.00	60.00	53,871.00	TAXILANE	90.00	0.00	90.00				
TW T-HAN	4	2,033.00	22.50	48,805.00	TAXILANE	53.75	11.92	58.27				

7/26/2017 Pave	7/26/2017 Branch Condition Report Page 2 of 2 Pavement Database: FDOT											
Use Category	Number of Sections	Total Area (SqFt)	Arithmetic Average PCI	Average STD PCI	Weighted Average PCI							
APRON	6	313605.000072188	70.67	11.16	73.69							
RUNWAY	3	296402.000090603	54.00	5.66	57.39							
TAXILANE	5	102676.000031437	61.00	18.00	74.92							
TAXIWAY	9	193170.000055838	73.89	18.62	61.26							
ALL	23	905853.000250066	67.65	17.15	65.84							

7/26/2017		Sectio	on Con	dition Re	eport				Page 1	of 2
Pavement Data	base: FDOT				Netw	orkId:	PCM			
Branch ID	Section ID	Last Const. Date	Surface	Use	Rank	Lanes	True Area (SqFt)	Last Inspection Date	Age At Inspec tion	
AP	4105	3/1/2013	AC	APRON	Р	0	112,145.00	3/28/2017	4	93
AP	4110	1/1/1992	AAC	APRON	Р	0	45,437.00	3/28/2017	25	65
AP	4120	1/1/1992	AAC	APRON	Р	0	46,434.00	3/28/2017	25	63
AP	4130	1/1/1986	AC	APRON	Р	0	77,514.00	3/28/2017	31	59
AP	4135	1/1/2008	AC	APRON	Р	0	29,575.00	3/28/2017	9	69
AP	4140	1/1/2010	PCC	APRON	Р	0	2,500.00	3/28/2017	7	75
RW 10-28	6103	1/1/2002	AAC	RUNWAY	Р	0	15,106.00	3/28/2017	15	46
RW 10-28	6115	1/1/1983	AAC	RUNWAY	Р	0	228,796.00	3/28/2017	34	58
RW 10-28	6120	1/1/2002	AC	RUNWAY	Р	0	52,500.00	3/28/2017	15	58
TW A	110	1/1/2001	AAC	TAXIWAY	Р	0	124,860.00	3/28/2017	16	58
TW A	115	1/1/2001	AC	TAXIWAY	Р	0	33,606.00	3/28/2017	16	55
TW A	120	8/1/2013	AAC	TAXIWAY	Р	0	6,040.00	3/28/2017	4	92
TW A	150	1/1/2001	AAC	TAXIWAY	Р	0	4,773.00	3/28/2017	16	48
TW A	160	1/1/2001	AAC	TAXIWAY	Р	0	5,383.00	3/28/2017	16	53
TW A	165	3/1/2013	AAC	TAXIWAY	Р	0	6,228.00	3/28/2017	4	92
TW A	170	8/1/2013	AAC	TAXIWAY	Р	0	4,870.00	3/28/2017	4	90
TW A	174	8/1/2013	AAC	TAXIWAY	Р	0	4,273.00	3/28/2017	4	94
TW A	175	1/1/2001	AAC	TAXIWAY	Р	0	3,137.00	3/28/2017	16	83
TW HANG	750	1/1/2011	AC	TAXILANE	Р	0	53,871.00	3/28/2017	6	90
TW T-HANG	705	1/1/1992	AC	TAXILANE	Р	0	13,043.00	3/28/2017	25	70
TW T-HANG	710	1/1/1986	AC	TAXILANE	Р	0	5,895.00	3/28/2017	31	40
TW T-HANG	720	1/1/1986	AC	TAXILANE	Р	0	6,460.00	3/28/2017	31	45
TW T-HANG	725	1/1/1997	AC	TAXILANE	Р	0	23,407.00	3/28/2017	20	60

7/26/2017 Section Condition Report (Summary) Page Pavement Database: FDOT												
Age Category	Age Category Average Age at Inspection Total Area (SqFt) Number of Arithmetic Standard Average PCI Deviation PCI											
03-05	4	133,556.00	5	92.20	1.33	92.83						
06-10	7	85,946.00	3	78.00	8.83	82.34						
11-15	15	67,606.00	2	52.00	6.00	55.32						
16-20	17	195,166.00	6	59.50	11.18	57.74						
21-25	25	104,914.00	3	66.00	2.94	64.74						
31-35	32	318,665.00	4	50.50	8.20	57.65						
ALL	16	905,853.00	23	67.65	17.15	65.84						

Statewide Airfield Pavement Management Program



Appendix B

Airfield Pavement Localized Maintenance and Repair and Major Rehabilitation

Network ID	Branch ID	Section ID	Distress Code	Description	Severity	Distress Qty	Distress Unit	Percent Distress	Work Description	Work Qty	Work Unit	Unit Cost	Work Cost
РСМ	AP	4105	52	RAVELING	Low	246.82	SqFt	0.2%	FDOT - SURFACE SEAL	246.49	SqFt	\$ 0.55	\$ 140.00
РСМ	AP	4110	45	DEPRESSION	Low	490.51	SqFt	1.1%	FDOT - PATCHING - AC FULL DEPTH	583.4	SqFt	\$ 6.00	\$ 3,510.00
РСМ	AP	4110	49	OIL SPILLAGE	N/A	25.3	SqFt	0.1%	FDOT - PATCHING - AC PARTIAL DEPTH	49.51	SqFt	\$ 3.00	\$ 150.00
РСМ	AP	4110	52	RAVELING	Low	9087.43	SqFt	20.0%	FDOT - SURFACE SEAL	9086.89	SqFt	\$ 0.55	\$ 5,000.00
РСМ	AP	4120	57	WEATHERING	Medium	9285.27	SqFt	20.0%	FDOT - SURFACE SEAL	9284.95	SqFt	\$ 0.55	\$ 5,110.00
РСМ	AP	4130	48	L&TCR	Medium	568.47	Ft	0.7%	FDOT - CRACK SEALING - AC	568.57	Ft	\$ 3.00	\$ 1,710.00
РСМ	AP	4130	57	WEATHERING	Medium	15504.66	SqFt	20.0%	FDOT - SURFACE SEAL	15504.34	SqFt	\$ 0.55	\$ 8,530.00
РСМ	AP	4135	45	DEPRESSION	Low	47.36	SqFt	0.2%	FDOT - PATCHING - AC FULL DEPTH	78.58	SqFt	\$ 6.00	\$ 480.00
РСМ	AP	4135	52	RAVELING	Low	27291.79	SqFt	92.3%	FDOT - SURFACE SEAL	27291.89	SqFt	\$ 0.55	\$ 15,020.00
РСМ	AP	4140	72	SHAT. SLAB	Low	1	Slabs	6.3%	FDOT - CRACK SEALING - PCC	24.93	Ft	\$ 4.25	\$ 110.00
РСМ	RW 10-28	6103	45	DEPRESSION	Low	98.71	SqFt	0.7%	FDOT - PATCHING - AC FULL DEPTH	143.16	SqFt	\$ 6.00	\$ 860.00
РСМ	RW 10-28	6103	52	RAVELING	Low	9063.64	SqFt	60.0%	FDOT - SURFACE SEAL	9063.21	SqFt	\$ 0.55	\$ 4,990.00
РСМ	RW 10-28	6103	52	RAVELING	Medium	6042.43	SqFt	40.0%	FDOT - PATCHING - AC PARTIAL DEPTH	6042.86	SqFt	\$ 3.00	\$ 18,130.00
РСМ	RW 10-28	6115	48	L&TCR	Medium	42.22	Ft	0.0%	FDOT - CRACK SEALING - AC	42.32	Ft	\$ 3.00	\$ 130.00
РСМ	RW 10-28	6115	52	RAVELING	Low	173650.29	SqFt	75.9%	FDOT - SURFACE SEAL	173649.9	SqFt	\$ 0.55	\$ 95,510.00
РСМ	RW 10-28	6115	52	RAVELING	Medium	55145.67	SqFt	24.1%	FDOT - PATCHING - AC PARTIAL DEPTH	55145.67	SqFt	\$ 3.00	\$ 165,440.00
РСМ	RW 10-28	6120	52	RAVELING	Low	43399.98	SqFt	82.7%	FDOT - SURFACE SEAL	43400.09	SqFt	\$ 0.55	\$ 23,880.00
РСМ	RW 10-28	6120	52	RAVELING	Medium	9100.03	SqFt	17.3%	FDOT - PATCHING - AC PARTIAL DEPTH	9099.81	SqFt	\$ 3.00	\$ 27,300.00
РСМ	TW A	110	52	RAVELING	Low	111425.63	SqFt	89.2%	FDOT - SURFACE SEAL	111425.9	SqFt	\$ 0.55	\$ 61,290.00
РСМ	TW A	110	52	RAVELING	Medium	11663.77	SqFt	9.3%	FDOT - PATCHING - AC PARTIAL DEPTH	11663.77	SqFt	\$ 3.00	\$ 35,000.00
РСМ	TW A	115	48	L & T CR	Medium	41.6	Ft	0.1%	FDOT - CRACK SEALING - AC	41.67	Ft	\$ 3.00	\$ 130.00
PCM	TW A	115	52	RAVELING	Low	28071.42	SqFt	83.5%	FDOT - SURFACE SEAL	28071.2	SqFt	\$ 0.55	\$ 15,440.00
РСМ	TW A	115	52	RAVELING	Medium	5534.59	SqFt	16.5%	FDOT - PATCHING - AC PARTIAL DEPTH	5534.8	SqFt	\$ 3.00	\$ 16,610.00
PCM	TW A	120	52	RAVELING	Low	30.03	SqFt	0.5%	FDOT - SURFACE SEAL	30.14	SqFt	\$ 0.55	\$ 20.00
РСМ	TW A	150	52	RAVELING	Low	3576.96	SqFt	74.9%	FDOT - SURFACE SEAL	3576.85	SqFt	\$ 0.55	\$ 1,970.00
PCM	TW A	150	52	RAVELING	Medium	1012.02	SqFt	21.2%	FDOT - PATCHING - AC PARTIAL DEPTH	1011.81	SqFt	\$ 3.00	\$ 3,040.00
РСМ	TW A	160	52	RAVELING	Low	4233.02	SqFt	78.6%	FDOT - SURFACE SEAL	4233.45	SqFt	\$ 0.55	\$ 2,330.00
PCM	TW A	160	52	RAVELING	Medium	902.02	SqFt	16.8%	FDOT - PATCHING - AC PARTIAL DEPTH	902.02	SqFt	\$ 3.00	\$ 2,710.00
РСМ	TW A	170	52	RAVELING	Low	10.01	SqFt	0.2%	FDOT - SURFACE SEAL	9.69	SqFt	\$ 0.55	\$ 10.00
PCM	TW A	175	57	WEATHERING	Medium	157.05	SqFt	5.0%	FDOT - SURFACE SEAL	157.15	SqFt	\$ 0.55	\$ 90.00
РСМ	TW HANG	750	52	RAVELING	Low	275.99	SqFt	0.5%	FDOT - SURFACE SEAL	275.56	SqFt	\$ 0.55	\$ 160.00
PCM	TW T-HANG	710	48	L&TCR	Medium	200	Ft	3.4%	FDOT - CRACK SEALING - AC	200.13	Ft	\$ 3.00	\$ 600.00
PCM	TW T-HANG	710	52	RAVELING	Low	3000.01	SqFt	50.9%	FDOT - SURFACE SEAL	2999.9	SqFt	\$ 0.55	\$ 1,660.00
PCM	TW T-HANG	710	52	RAVELING	Medium	2831.98	SqFt	48.0%	FDOT - PATCHING - AC PARTIAL DEPTH	2831.98	SqFt	\$ 3.00	\$ 8,500.00
РСМ	TW T-HANG	720	48	L&TCR	Medium	113.06	Ft	1.8%	FDOT - CRACK SEALING - AC	113.19	Ft	\$ 3.00	\$ 340.00
PCM	TW T-HANG	720	52	RAVELING	Low	2583.98	SqFt	40.0%	FDOT - SURFACE SEAL	2584.41	SqFt	\$ 0.55	\$ 1,430.00
РСМ	TW T-HANG	720	52	RAVELING	Medium	2907.01	SqFt	45.0%	FDOT - PATCHING - AC PARTIAL DEPTH	2907.33	SqFt	\$ 3.00	\$ 8,730.00
PCM	TW T-HANG	725	52	RAVELING	Low	18857.08	SqFt	80.6%	FDOT - SURFACE SEAL	18857.29	SqFt	\$ 0.55	\$ 10,380.00

Table B-1 Localized Maintenance and Repair Needs based on Current Condition

Plant City Airport (PCM)



Statewide Airfield Pavement Management ProgramAirport Pavement Evaluation Rep	ent 2017	P	Plant Cit
---	-----------------	---	-----------

Network ID	Branch ID	Section ID	Distress Code	Description	Severity	Distress Qty	Distress Unit	Percent Distress	Work Description	Work Qty	Work Unit	Unit Cost	Work Cost
PCM	TW T-HANG	725	52	RAVELING	Medium	4549.9	SqFt	19.4%	FDOT - PATCHING - AC PARTIAL DEPTH	4549.9	SqFt	\$ 3.00	\$ 13,650.00
PCM	TW T-HANG	725	54	SHOVING	Medium	4.84	SqFt	0.0%	FDOT - MILLING - AC	17.22	SqFt	\$ 2.00	\$ 40.00





Program Year	Network ID	Branch ID	Section ID	Surface	Area (SF)	PCI Before	Rehabilitation Type	Planning Cost
2018	PCM	AP	4110	AAC	45,437	63	AC Restoration	\$ 319,000.00
2018	PCM	AP	4120	AAC	46,434	61	AC Restoration	\$ 326,000.00
2018	PCM	AP	4130	AC	77,514	57	AC Restoration	\$ 543,000.00
2018	PCM	AP	4140	PCC	2,500	73	PCC Restoration	\$ 26,000.00
2018	PCM	RW 10-28	6103	AAC	15,106	43	AC Restoration	\$ 126,000.00
2018	PCM	RW 10-28	6115	AAC	228,796	56	AC Restoration	\$ 1,602,000.00
2018	PCM	RW 10-28	6120	AC	52,500	56	AC Restoration	\$ 368,000.00
2018	PCM	TW A	110	AAC	124,860	56	AC Restoration	\$ 875,000.00
2018	PCM	TW A	115	AC	33,606	53	AC Restoration	\$ 236,000.00
2018	PCM	TW A	150	AAC	4,773	47	AC Restoration	\$ 37,000.00
2018	PCM	TW A	160	AAC	5,383	51	AC Restoration	\$ 38,000.00
2018	PCM	TW T-HANG	710	AC	5,895	38	AC Reconstruction	\$ 54,000.00
2018	PCM	TW T-HANG	720	AC	6,460	43	AC Restoration	\$ 54,000.00
2018	PCM	TW T-HANG	725	AC	23,407	59	AC Restoration	\$ 164,000.00
2020	PCM	AP	4135	AC	29,575	64	AC Restoration	\$ 208,000.00
2023	PCM	TW T-HANG	705	AC	13,043	64	AC Restoration	\$ 92,000.00

 Table B-2 10-Year Major Rehabilitation Planning Needs at Section Level


Statewide Airfield Pavement Management Program



Appendix C

Technical Exhibits





001 - AIRFIELD PAVEMENT NETWORK DEFINITION EXHIBIT


Airport Pavement Evaluation Report

Statewide Airfield Pavement Management Program PLANT CITY AIRPORT - PCM

FDOT



RUNWAY LENGTHS DEPICTED IN THIS DRAWING ARE FOR PAVEMENT MANAGEMENT PURPOSES ONLY AND MAY NOT MATCH PUBLISHED RUNWAY LENGTHS.

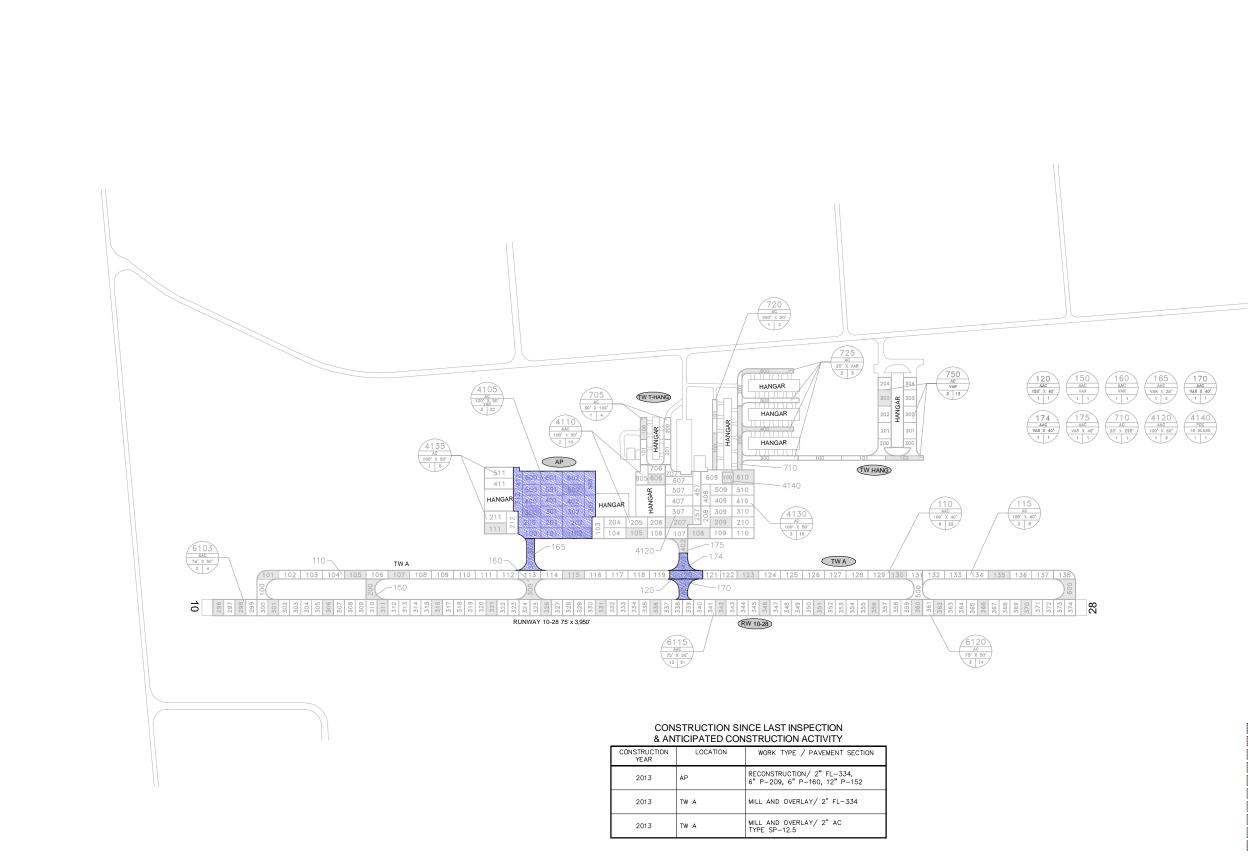





LEGEND

PROJECTS	YEAR	2013
PROJECTS	YEAR	2014
PROJECTS	YEAR	2015
PROJECTS	YEAR	2016
PROJECTS	YEAR	2017
PROJECTS	YEAR	2018
PROJECTS	YEAR	2019
PROJECTS	YEAR	2020
PROJECTS	YEAR	2021
PROJECTS	YEAR	2022

RUNWAY LENGTHS DEPICTED IN THIS DRAWING ARE FOR PAVEMENT MANAGEMENT PURPOSES ONLY AND MAY NOT MATCH PUBLISHED RUNWAY LENGTHS.






003 - AIRFIELD PAVEMENT CONDITION INDEX EXHIBIT





FDOT



RW 13-31 - TYPICAL RUNWAY BRANCH ID - TYPICAL TAXIWAY BRANCH ID

TW A


AP S

LEGEND


PCI 86-100 GOOD
PCI 71-85 SATISFACTORY
PCI 56-70 FAIR
PCI 41-55 POOR
PCI 26-40 VERY POOR
PCI 11-25 SERIOUS
PCI 0-10 FAILED

RUNWAY LENGTHS DEPICTED IN THIS DRAWING ARE FOR PAVEMENT MANAGEMENT PURPOSES ONLY AND MAY NOT MATCH PUBLISHED RUNWAY LENGTHS.

SECTION NO "PCI NO."

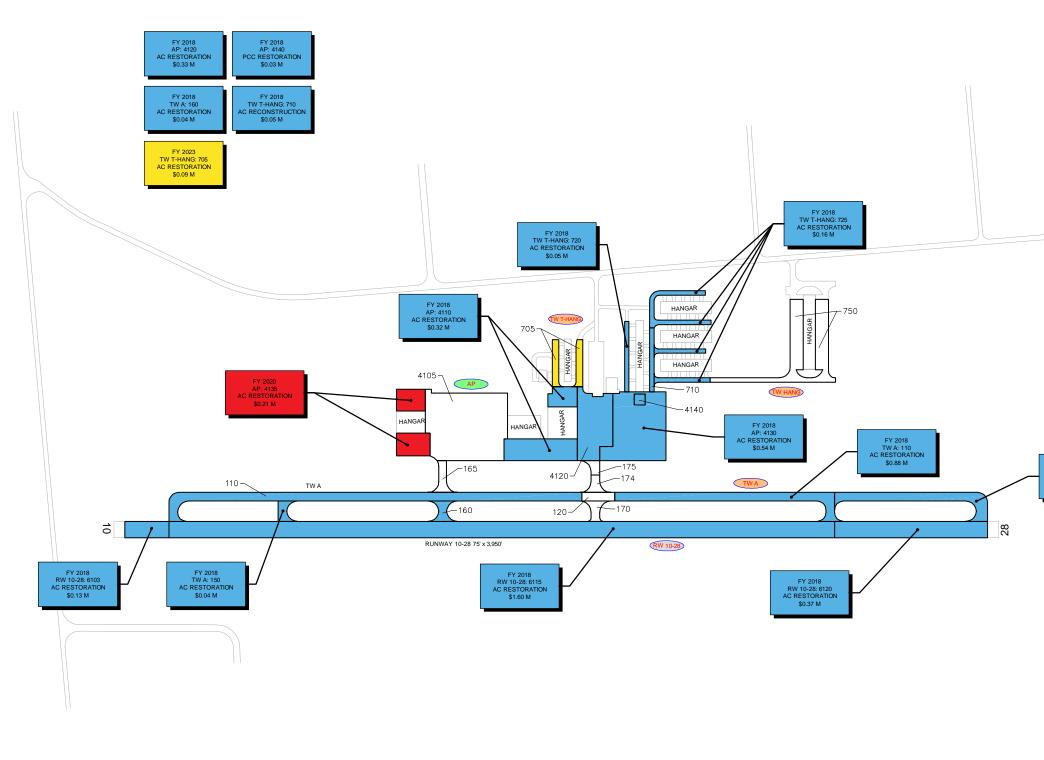








LEGEND

RW 13-31 - TYP	PICAL RUNWAY BRANCH ID
	PICAL TAXIWAY BRANCH ID
AP S TYP	PICAL APRON BRANCH ID

PROGRAM YEAR






RUNWAY LENGTHS DEPICTED IN THIS DRAWING ARE FOR PAVEMENT MANAGEMENT PURPOSES ONLY AND MAY NOT MATCH PUBLISHED RUNWAY LENGTHS.

Statewide Airfield Pavement Management Program



Appendix D

Inspection Photograph Documentation

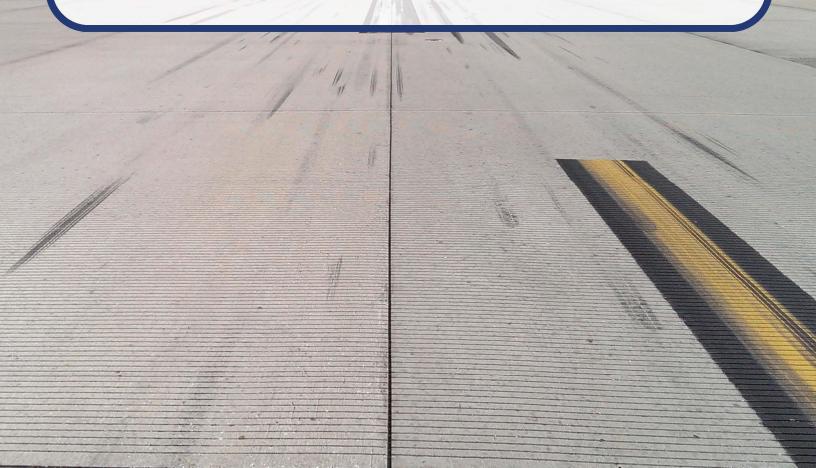

Airport Pavement Evaluation Report **2017**





Runway 10-28, Section 6103, Sample Unit 296 – Low Severity (48) Longitudinal and Transverse Cracking, Low Severity (52) Raveling, Medium Severity (52) Raveling,Low Severity (56) Swelling



Runway 10-28, Section 6115, Sample Unit 321 – Low Severity (48) Longitudinal and Transverse Cracking, Low Severity (52) Raveling, Medium Severity (52) Raveling

Airport Pavement 2017 Evaluation Report





Runway 10-28, Section 6115, Sample Unit 346 – Low Severity (48) Longitudinal and Transverse Cracking, Low Severity (52) Raveling, Medium Severity (52) Raveling



Runway 10-28, Section 6120, Sample Unit 366 – Low Severity (48) Longitudinal and Transverse Cracking, Low Severity (52) Raveling, Medium Severity (52) Raveling

Airport Pavement 2017 Evaluation Report





Taxiway A, Section 110, Sample Unit 101 – Low Severity (48) Longitudinal and Transverse Cracking, Low Severity (52) Raveling



Taxiway A, Section 110, Sample Unit 115 - Low Severity (48) Longitudinal and Transverse Cracking, Low Severity (52) Raveling

Airport Pavement 2017 Evaluation Report





Taxiway A, Section 115, Sample Unit 600 – Medium Severity (48) Longitudinal and Transverse Cracking, Low Severity (52) Raveling, Medium Severity (52) Raveling



Apron, Section 4105, Sample Unit 502 - Low Severity (52) Raveling, Low Severity (57) Weathering



Apron, Section 4135, Sample Unit 111 - Low Severity (45) Depression, Low Severity (52) Raveling



Apron, Section 4130, Sample Unit 610 – Low Severity (43) Block Cracking, Low Severity (48) Longitudinal and Transverse Cracking, Low Severity (57) Weathering






T-Hangars Taxiway, Section 710, Sample Unit 200 – Low Severity (48) Longitudinal and Transverse Cracking, Low Severity (50) Patching, Low Severity (52) Raveling, Medium Severity (52) Raveling

Statewide Airfield Pavement Management Program



Appendix E

Inspection Distress Details

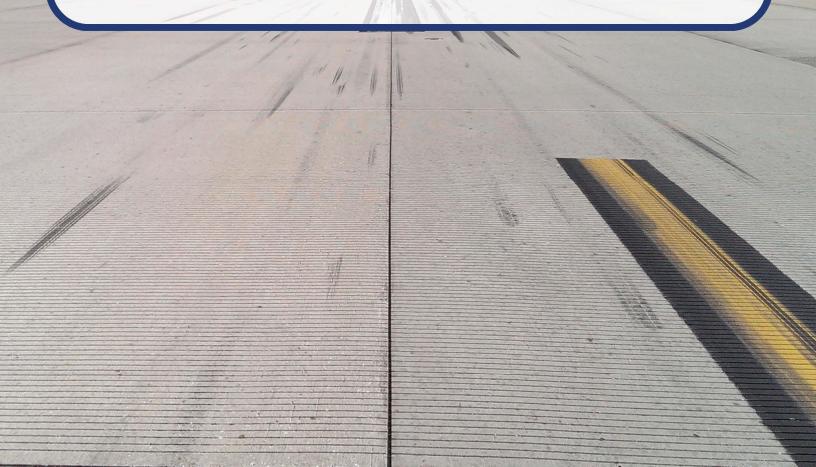

Re-Inspection Report

FDOT																				
Generate	d Date			7/	26/20	017														Page 1
Network:	PCM							Na	me:	PLANT	CITY A	IRPORT								
Branch:	AP				Na	me:	APR	ON			Use:	APRO	N	A	Area:		313	3,605	SqFt	
Section:	4105		0	f 6		F	rom:	-				То	-]	Last	Const.	: 3/1/20
Surface:	AC		Family:	C9	N59-	-GA-AP-	-AC	Zo	ne:			Ca	tegory:					Rank	: P	
Area:		112,14	5 SqFt		Le	ength:		350	Ft	W	idth:		320 Ft							
Slabs:			Slab Lei	igth	:		Ft	t	Slab Wi	dth:		Ft			Joint	Lengt	th:			Ft
Shoulder	:		Street T	ype:					Grade:	0					Lanes	:	0			
Section C	comments:																			
Work Da	te: 1/1/198	86	W	ork	Туре	BUIL	Т				С	ode: IN	IPORTE	D	Is	s Majo	or Mð	&R: ′	True	
							1 . D		AC		C	ode: C	R-AC		Ic	Mai		&R: ′	True	
Work Da	te: 3/1/201	13	W	ork	Туре	e: Comp	lete Reco	Instructi	ion - AC		C				18	wiajo	or wie	an.	True	
				ork	•	1			ion - AC						18	o wrajo		<u>un</u> .	The	
Last Insp	. Date: 3/	/28/2017		ork	•	1	mples:		ion - AC		Surveye				15			<u>.</u>		
Last Insp Conditior	Date: 3/	/28/2017 : 93		ork	•	1			ion - AC						15			<u></u>		
Last Insp Condition Inspection	o. Date: 3/ ns: PCI: n Commen	/28/2017 : 93 nts:	,		,	1	mples:			6711.00	Surveye			92						
Last Insp Condition Inspection Sample N	Date: 3/ ns: PCI: n Commen Number: 1	/28/2017 : 93 nts: 102			,	TotalSa	mples:	22	10n - AC	6711.00	Surveye		PCI:	92				u.		
Last Insp Conditior Inspection Sample N Sample C	D. Date: 3/ ns: PCI: n Commen Jumber: 1 Comments:	/28/2017 : 93 nts: 102	,	pe:		TotalSa	mples:	22 Area:		6711.00	Surveye			92						
Last Insp Condition Inspection Sample N Sample C 52 RA	Date: 3/ ns: PCI: n Commen Number: 1	/28/2017 : 93 hts: 102	,	pe:	,	TotalSa	mples:	22 Area:		6711.00	Surveye			92						
Last Insp Condition Inspection Sample N Sample C 52 RA 57 W	Date: 3/ ns: PCI: n Commen lumber: 1 Comments:	/28/2017 : 93 hts: 102	,	pe:	L L	TotalSa	mples: 34.00 6677.00	22 Area:		6711.00	Surveye									
Last Insp Condition Inspection Sample N Sample C 52 R/ 57 W Sample N	Date: 3/ ns: PCI: n Commen Number: 1 Comments: AVELING EATHERIN	/28/2017 : 93 hts: 102 NG 300	Ţ	pe:	L L	R	mples: 34.00 6677.00	22 Area:) SqFt) SqFt			Surveye		PCI:							
Last Insp Condition Inspection Sample N Sample C 52 R/ 57 W Sample N Sample C	b. Date: 3/ ns: PCI: n Commen Jumber: 1 Comments: A VELING EATHERIN Jumber: 3	/28/2017 : 93 hts: 102 NG 300	Ţ	pe: pe:	L L	R	mples: 34.00 6677.00	22 Area:) SqFt) SqFt Area:			Surveye		PCI:							
Last Insp Condition Inspection Sample N Sample N Sample N Sample C 57 W	b. Date: 3/ ns: PCI: n Commen lumber: 1 Comments: A VELING EATHERIN lumber: 3 Comments:	/28/2017 : 93 hts: 102 NG 300 NG	Ţ	pe: pe:	L L L	R	mples: 34.00 6677.00 4189.00	22 Area:) SqFt) SqFt Area:			Surveye SqFt SqFt		PCI:	94						
Last Insp Condition Inspection Sample N Sample N Sample N Sample N Sample N Sample N	Date: 3/ ns: PCI: n Commen lumber: 1 Comments: AVELING EATHERIN Lumber: 3 Comments: EATHERIN	/28/2017 : 93 hts: 102 NG 300 NG 502	Ty Ty Ty	pe: pe:	L L L	R R	mples: 34.00 6677.00 4189.00	22 Area:) SqFt) SqFt Area:) SqFt		4189.00	Surveye SqFt SqFt		PCI: PCI:	94						
Last Insp Condition Inspection Sample N Sample N Sample N Sample C 57 W Sample N Sample N Sample C	Date: 3/ ns: PCI: n Commen lumber: 1 Comments: AVELING EATHERIN lumber: 3 Comments: EATHERIN	/28/2017 : 93 hts: 102 NG 300 NG 502	Ty Ty Ty	pe: pe:	L L L	R R	mples: 34.00 6677.00 4189.00	22 Area:) SqFt) SqFt Area:) SqFt		4189.00	Surveye SqFt SqFt		PCI: PCI:	94						

Network: PCM		Name:	PLANT CITY A	IRPORT	
Branch: AP	Name:	APRON	Use:		Area: 313,605 SqFt
Section: 4110	of 6 H	rom: -		То: -	Last Const.: 1/1/1992
Surface: AAC	Family: C9N59-GA-AF APC			Category:	Rank: P
Area: 45,43	7 SqFt Length:	450 Ft	Width:	100 Ft	
Slabs:	Slab Length:	Ft Slal	o Width:	Ft	Joint Length: Ft
Shoulder:	Street Type:	Gra	de: 0		Lanes: 0
Section Comments:					
Work Date: 1/1/1970	Work Type: BUIL	Т	C	ode: IMPORTED	Is Major M&R: True
Work Date: 1/1/1992	Work Type: OVE	RLAY	C	ode: IMPORTED	Is Major M&R: True
Work Date: 1/1/2012	Work Type: Surfa	ce Seal - Seal Coat	C	ode: SS-SC	Is Major M&R: False
Last Insp. Date: 3/28/2017	TotalSa	mples: 10	Surveye	d: 2	
Conditions: PCI: 65					
Inspection Comments:					
Sample Number: 105	Type: R	Area:	5000.00 SqFt	PCI: 71	
Sample Comments:					
45 DEPRESSION	L	97.00 SqFt			
48 L & T CR	L	145.00 Ft			
57 WEATHERING	L	4000.00 SqFt			
52 RAVELING	L	1000.00 SqFt			
Sample Number: 606	Type: R	Area:	3985.00 SqFt	PCI: 57	
Sample Comments:					
50 PATCHING	L	266.00 SqFt			
48 L & T CR	L	468.00 Ft			
49 OIL SPILLAGE	Ν	5.00 SqFt			
57 WEATHERING	L	3188.00 SqFt			
52 RAVELING	L	797.00 SqFt			

Network:	PCM				Nam	e: PLA	NT CITY A	IRPORT				
Branch:	AP		Name:	APRO	N		Use:	APRON	Area:	313,6	05 SqFt	
Section:	4120	C	of 6	From: -				То: -		La	ast Const.:	1/1/1992
Surface:	AAC	Family:	C9N59-GA-A APC	AP-AAC-	Zone	:		Category:		Ra	ank: P	
Area:		46,434 SqFt	Length	:	325 Ft		Width:	140 Ft				
Slabs:		Slab Lei	ngth:	Ft		Slab Width:		Ft	Joint L	ength:	Ft	
Shoulder:		Street T	ype:			Grade: 0			Lanes:	0		
Section Co	omments:											
Work Dat	te: 1/1/199	92 W	ork Type: BU	ILT			С	ode: IMPORTED	Is N	/lajor M&F	R: True	
Work Dat	te: 1/1/201	2 W	ork Type: Su	face Seal - Se	al Coat		C	ode: SS-SC	Is N	/lajor M&F	R: False	
Last Insp.	. Date: 3/	28/2017	Total	Samples: 9)		Surveye	ed: 1				
Condition	s: PCI:	63										
Inspection	n Commen	ts:										
Sample Nu	umber: 2	207 Ty	pe: R	Α	rea:	5910	5.00 SqFt	PCI: 6	3			
Sample Co	omments:											
43 BL	OCK CR		L	312.00	SqFt							
48 L &	& T CR		L	523.00	Ft							
57 WI	EATHERIN	NG	L	4733.00	SqFt							
57 WI	EATHERIN	NG	Μ	1183.00	SqFt							

Netwo	ork: PCM					Na	me: P	LANT CITY	Y AIRP	ORT					
Branc	h: AP			Name:	APRO	DN		Us	e: A	PRON	Are	a:	31	3,605 SqFt	
Sectio	n: 4130		of 6		From:	-				To: -				Last Cons	t.: 1/1/1986
Surfa	ce: AC	Fami	ly: C9	N59-GA-A	AP-AC	Zoi	ne:			Category:				Rank: P	
Area:		77,514 SqFt	t	Length:		300	Ft	Width:		250 Ft					
Slabs:		Slab	Length	:	Ft		Slab Widt	h:		Ft		Joint Len	gth:		Ft
Shoul	der:	Stre	et Type:				Grade:	0				Lanes:	0		
Sectio	n Comments:														
Work	Date: 1/1/198	6	Work	Type: BUI	ILT				Code	IMPORTE	D	Is Ma	ijor M	&R: True	
Work	Date: 1/1/201	2	Work	Type: Surf	face Seal - S	eal Coa	ıt		Code	SS-SC		Is Ma	ijor M	&R: False	
Last I	nsp. Date: 3/2	28/2017		Total	Samples:	15		Surv	veyed:	3					
Condi	tions: PCI:	59													
Inspee	ction Comment	ts:													
Samp	le Number: 1	08	Туре:	R	1	Area:	5	113.00 SqFt		PCI:	62				
Samp	le Comments:														
48	L & T CR			L	711.00	Ft									
57	WEATHERIN	IG		L	4090.00	SqFt									
57	WEATHERIN	IG		М	1023.00	SqFt									
Samp	le Number: 2	09	Type:	R	1	Area:	5	000.00 SqFt		PCI:	63				
Samp	le Comments:														
48	L & T CR			L	668.00	Ft									
57	WEATHERIN	IG		L	4000.00										
57	WEATHERIN	IG		М	1000.00	SqFt									
Samp	le Number: 6	10	Type:	R	1	Area:	6	250.00 SqFt		PCI:	53				
Samp	le Comments:														
43	BLOCK CR			L	2500.00	SqFt									
48	L & T CR			L	540.00	-									
48	L & T CR			М	120.00	Ft									
57	WEATHERIN	ΙG		L	5000.00	SqFt									
57	WEATHERIN	IG		М	1250.00	SqFt									

Network:	PCM				Name	: PLA	NT CITY A	IRPORT			
Branch:	AP		Name:	APRON	ł		Use:	APRON	Area:	313,605 SqFt	
Section:	4135	of	6	From: -				To: -		Last Const.	: 1/1/2008
Surface:	AC	Family:	C9N59-GA-A	P-AC	Zone:			Category:		Rank: P	
Area:		29,575 SqFt	Length:		200 Ft		Width:	132 F	ł		
Slabs:		Slab Len	gth:	Ft	5	Slab Width:		Ft	Join	t Length:	Ft
Shoulder:	:	Street Ty	pe:		(Grade: 0			Lan	es: 0	
Section Co	omments:										
Work Dat	te: 1/1/2008	s We	ork Type: New	Construction	n - Initia	l	С	ode: NU-IN		Is Major M&R: True	
Last Insp.	. Date: 3/2	8/2017	Totals	Samples: 5			Surveye	e d: 1			
Condition	s: PCI:	69									
Inspectior	n Comments	s:									
Sample N	umber: 11	1 Typ	e: R	A	rea:	5000).00 SqFt	PCI:	69		
Sample C	omments:										
45 DE	EPRESSION		L	8.00	SqFt						
50 PA	TCHING		L	386.00							
52 RA	AVELING		L	4614.00	SqFt						

Network:	PCM				Name:	PLANT CITY A	AIRPORT		
Branch:	AP		Name:	APRON		Use:	APRON	Area:	313,605 SqFt
Section:	4140	of	6 F	rom: -			То: -		Last Const.: 1/1/2010
Surface:	PCC	Family:	C9N59-GA-AF	P-PCC	Zone:		Category:		Rank: P
Area:		2,500 SqFt	Length:		50 Ft	Width:	50 Ft		
Slabs:	16	Slab Len	gth:	13 Ft	Slab V	Vidth:	13 Ft	Joint Le	ngth: 300 Ft
Shoulder:	:	Street Ty	pe:		Grade	e: 0		Lanes:	0
Section C	omments:								
Work Dat	te: 1/1/2010	We	ork Type: New	Construction	- Initial	(Code: NU-IN	Is N	lajor M&R: True
Last Insp	. Date: 3/28	/2017	TotalSa	amples: 1		Survey	ed: 1		
Condition	ns: PCI:	75							
Inspection	n Comments:								
Sample N	umber: 100) Typ	e: R	Ar	ea:	16.00 Slabs	PCI:	75	
Sample C	omments:								
63 LI	NEAR CR		L	3.00 \$	labs				
72 SH	IAT. SLAB		L	1.00 \$	labs				

Network: PCM		Name:	PLANT CITY AIR	PORT	
Branch: RW 10-28	Name:	RUNWAY 10-28	Use:	RUNWAY Ar	rea: 296,402 SqFt
Section: 6103	of 3	From: -		То: -	Last Const.: 1/1/2002
Surface: AAC	Family: C9N59-GA-R APC	W-AAC- Zone:		Category:	Rank: P
Area: 15,10	06 SqFt Length:	200 Ft	Width:	75 Ft	
Slabs:	Slab Length:	Ft Slab	Width:	Ft	Joint Length: Ft
Shoulder:	Street Type:	Gra	de: 0		Lanes: 0
Section Comments:					
Work Date: 1/1/1900	Work Type: New	Construction - Initial	Cod	le: NU-IN	Is Major M&R: True
Work Date: 1/1/1976	Work Type: OVE	ERLAY	Cod	le: IMPORTED	Is Major M&R: True
Work Date: 1/1/2002	Work Type: Ove	rlay - AC Thin	Cod	le: OL-AT	Is Major M&R: True
Last Insp. Date: 3/28/2017	7 Totals	Samples: 4	Surveyed:	: 2	
Conditions: PCI: 46					
Inspection Comments:					
Sample Number: 296	Type: R	Area:	3750.00 SqFt	PCI: 44	
Sample Comments:					
52 RAVELING	М	1750.00 SqFt			
56 SWELLING	L	80.00 SqFt			
48 L & T CR	L	240.00 Ft			
52 RAVELING	L	2000.00 SqFt			
Sample Number: 298	Type: R	Area:	3750.00 SqFt	PCI: 49	
Sample Comments:					
45 DEPRESSION	L	49.00 SqFt			
56 SWELLING	L	4.00 SqFt			
48 L & T CR	L	98.00 Ft			
52 RAVELING	L	2500.00 SqFt			
52 RAVELING	М	1250.00 SqFt			

Network: PCM		Name:	PLANT CITY AIRPO	ORT	
Branch: RW 10-28	Name:	RUNWAY 10-28			rea: 296,402 SqFt
Section: 6115		From: -		To: -	Last Const.: 1/1/1983
	amily: C9N59-GA-RV			Category:	Rank: P
	APC			Currg,-	
Area: 228,796 S	SqFt Length:	3,050 Ft	Width:	75 Ft	
	Slab Length:	Ft Slab W		Ft	Joint Length: Ft
	Street Type:	Grade	. 0		Lanes: 0
Section Comments:					
Work Date: 1/1/1948	Work Type: BUII	.T	Code:	IMPORTED	Is Major M&R: True
Work Date: 1/1/1960	Work Type: OVE	RLAY	Code:	IMPORTED	Is Major M&R: True
Work Date: 1/1/1976	Work Type: OVE	RLAY	Code:	IMPORTED	Is Major M&R: True
Work Date: 1/1/1983	Work Type: OVE	RLAY	Code:	IMPORTED	Is Major M&R: True
Last Insp. Date: 3/28/2017	TotalS	amples: 61	Surveyed:	13	
Conditions: PCI: 58					
Inspection Comments:					
Sample Number: 301	Type: R	Area:	3750.00 SqFt	PCI: 53	
Sample Comments:					
48 L & T CR	L	130.00 Ft			
52 RAVELING	L	2750.00 SqFt			
56 SWELLING52 RAVELING	L M	64.00 SqFt 1000.00 SqFt			
Sample Number: 306	Type: R	Area:	3750.00 SqFt	PCI: 53	
Sample Comments:	~ *				
52 RAVELING	М	1000.00 SqFt			
56 SWELLING	L	98.00 SqFt			
48 L & T CR	L	125.00 Ft			
52 RAVELING	L Terrer D	2750.00 SqFt	2770.00 0 154	DOI 17	
Sample Number: 311 Sample Comments:	Type: R	Area:	3750.00 SqFt	PCI: 57	
-					
48 L & T CR48 L & T CR	M L	9.00 Ft 110.00 Ft			
52 RAVELING	L	3000.00 SqFt			
52 RAVELING	М	750.00 SqFt			
Sample Number: 316	Type: R	Area:	3750.00 SqFt	PCI: 60	
Sample Comments:					
48 L & T CR	L	84.00 Ft			
52 RAVELING52 RAVELING	L M	2900.00 SqFt 850.00 SqFt			
Sample Number: 321	Type: R	Area:	3750.00 SqFt	PCI: 60	
Sample Comments:	Type.	/ 11 Cu.	5750.00 Sqr 1	101	
48 L & T CR	L	69.00 Ft			
52 RAVELING	М	850.00 SqFt			
52 RAVELING	L	2900.00 SqFt			
Sample Number: 326	Type: R	Area:	3750.00 SqFt	PCI: 60	
Sample Comments:					
48 L & T CR	L	91.00 Ft			
52 RAVELING52 RAVELING	L M	2900.00 SqFt 850.00 SqFt			
Sample Number: 331	Type: R	Area:	3750.00 SqFt	PCI: 59	
Sample Comments:	Type.		5750.00 541	101. 07	
-	T	25.00 SaEt			E-8
56 SWELLING	L	25.00 SqFt			E 0

48	L & T CR		L	70.00				
52	RAVELING		L	2950.00				
52	RAVELING		М	800.00	SqFt			
Samp	ble Number: 336	Type:	R	Ar	rea:	3750.00 SqFt	PCI:	60
Samp	ole Comments:							
52	RAVELING		М	850.00	SaFt			
48	L & T CR		L	103.00				
52	RAVELING		L	2900.00				
Samp	ble Number: 342	Type:	R	Ar	rea:	3750.00 SqFt	PCI:	60
Samp	ole Comments:							
48	L & T CR		L	77.00	Ft			
52	RAVELING		L	2900.00				
52	RAVELING		M	850.00				
	ble Number: 346	Туре:	R		rea:	3750.00 SqFt	PCI:	60
_		Type.	K	AI	ea.	3750.00 SqFt	rcı.	00
Samp	ble Comments:							
48	L & T CR		L	99.00	Ft			
52	RAVELING		L	2900.00	SqFt			
52	RAVELING		М	850.00	SqFt			
Samp	ole Number: 351	Type:	R	Ar	rea:	3750.00 SqFt	PCI:	60
Samp	ole Comments:							
52	RAVELING		М	850.00	SqFt			
48	L & T CR		L	69.00 l	Ft			
52	RAVELING		L	2900.00	SqFt			
Samp	ole Number: 356	Type:	R	Ar	rea:	3750.00 SqFt	PCI:	56
Samp	ole Comments:							
52	RAVELING		М	1000.00	SaFt			
48	L & T CR		L	115.00				
52	RAVELING		L	2750.00				
56	SWELLING		L	20.00 \$				
	ble Number: 360	Type:	R		rea:	3750.00 SqFt	PCI:	55
_	ole Comments:	-7 100				sq. ·		
_			_		_			
48	L & T CR		L	114.00 l				
52	RAVELING		L	2500.00				
52	RAVELING		М	1250.00	SqFt			

Netwo	ork: PCM			Name:	PLANT CITY	AIRPORT		
Branc	h: RW 10-28		Name:	RUNWAY 10-28	3 Use:	RUNWAY	Area:	296,402 SqFt
Sectio	n: 6120	of 3		From: -		То: -		Last Const.: 1/1/2002
Surfa	ce: AC	Family: C91	N59-GA-R	W-AC Zone:		Category:		Rank: P
Area:	52,50	0 SqFt	Length:	700 Ft	Width:	75 Ft		
Slabs:		Slab Length:		Ft SI	ab Width:	Ft	Joint L	ength: Ft
Shoul	der:	Street Type:		G	rade: 0		Lanes:	0
Sectio	n Comments:							
Work	Date: 1/1/1976	Work 7	ype: OVE	ERLAY		Code: IMPORTED	Is I	Major M&R: True
Work	Date: 1/1/2002	Work 7	ype: New	Construction - Initial		Code: NU-IN	Is I	Major M&R: True
Last I	nsp. Date: 3/28/2017	,	TotalS	Samples: 14	Survey	red: 3		
Condi	tions: PCI: 58							
Inspe	ction Comments:							
Samp	le Number: 362	Туре:	R	Area:	3750.00 SqFt	PCI: 58	3	
Samp	le Comments:							
52	RAVELING		М	450.00 SqFt				
56	SWELLING		L	80.00 SqFt				
48	L & T CR		L	219.00 Ft				
52	RAVELING		L	3300.00 SqFt				
Samp	le Number: 366	Type:	R	Area:	3750.00 SqFt	PCI: 60)	
Samp	le Comments:							
48	L & T CR		L	65.00 Ft				
52	RAVELING		L	3000.00 SqFt				
52	RAVELING		М	750.00 SqFt				
56	SWELLING		L	10.00 SqFt				
Samp	le Number: 370	Type:	R	Area:	3750.00 SqFt	PCI: 57	7	
Samp	le Comments:							
48	L & T CR		L	139.00 Ft				
52	RAVELING		L	3000.00 SqFt				
56	SWELLING		L	80.00 SqFt				
52	RAVELING		М	750.00 SqFt				

Network: PCM		Name:	PLANT CITY AIRP	ORT	
Branch: TW A	Name:	TAXIWAY A		TAXIWAY Are	ra: 193,170 SqFt
Section: 110	of 9	From: -		То: -	Last Const.: 1/1/2001
Surface: AAC	Family: C9N59-GA-T APC	W-AAC- Zone:		Category:	Rank: P
Area: 124,	860 SqFt Length:	3,000 Ft	Width:	40 Ft	
Slabs:	Slab Length:	Ft Slab	Width:	Ft	Joint Length: Ft
Shoulder:	Street Type:	Grad	le: 0		Lanes: 0
Section Comments:					
Work Date: 1/1/1963	Work Type: BUI	LT	Code	: IMPORTED	Is Major M&R: True
Work Date: 1/1/1993	Work Type: REF	PAIR	Code	: IMPORTED	Is Major M&R: False
Work Date: 1/1/2001	Work Type: Ove	rlay - AC Thin	Code	: OL-AT	Is Major M&R: True
Work Date: 6/1/2013	Work Type: Crac	ck Sealing - AC	Code	: CS-AC	Is Major M&R: False
Last Insp. Date: 3/28/20	17 Totals	Samples: 32	Surveyed:	6	
Conditions: PCI: 58	6				
Inspection Comments:					
Sample Number: 101	Type: R	Area:	3566.00 SqFt	PCI: 64	
Sample Comments:					
52 RAVELING	L	3494.00 SqFt			
48 L & T CR	L	369.00 Ft			
52 RAVELING	М	72.00 SqFt			
Sample Number: 105	Type: R	Area:	4000.00 SqFt	PCI: 59	
Sample Comments:					
48 L & T CR	L	290.00 Ft			
52 RAVELING	L	3500.00 SqFt			
52 RAVELING	М	500.00 SqFt			
Sample Number: 107	Type: R	Area:	4000.00 SqFt	PCI: 56	
Sample Comments:					
48 L & T CR	L	397.00 Ft			
52 RAVELING	L	3500.00 SqFt			
52 RAVELING	M Turner P	500.00 SqFt	4000 00 8-54	DCI : 50	
Sample Number: 115	Type: R	Area:	4000.00 SqFt	PCI: 59	
Sample Comments:	-				
48 L & T CR52 RAVELING	L M	333.00 Ft 400.00 SqFt			
52 RAVELING 52 RAVELING	L	3600.00 SqFt			
Sample Number: 123	Type: R	Area:	4000.00 SqFt	PCI: 52	
Sample Comments:			-		
52 RAVELING	М	536.00 SqFt			
48 L & T CR	L	435.00 Ft			
50 PATCHING	L	320.00 SqFt			
52 RAVELING	L	3144.00 SqFt			
Sample Number: 130	Type: R	Area:	3000.00 SqFt	PCI: 57	
_	ample size is smaller than pro	-	nodate sample layout upda	ate	
48 L & T CR	L	550.00 Ft			
52 RAVELING	L	2900.00 SqFt			
52 RAVELING	М	100.00 SqFt			

Network: PCM		Name:	PLANT CITY AI	RPORT	
Branch: TW A	Name:	TAXIWAY A	Use:	TAXIWAY A	rea: 193,170 SqFt
Section: 115	of 9	From: -		To: -	Last Const.: 1/1/2001
Surface: AC	Family: C9N59-GA-T	W-AC Zone:		Category:	Rank: P
Area: 33,60	6 SqFt Length:	750 Ft	Width:	40 Ft	
Slabs:	Slab Length:	Ft Sla	b Width:	Ft	Joint Length: Ft
Shoulder:	Street Type:	Gra	ade: 0		Lanes: 0
Section Comments:					
Work Date: 1/1/2001	Work Type: Ove	rlay - AC Thin	Co	ode: OL-AT	Is Major M&R: True
Work Date: 1/1/2001	Work Type: New	Construction - AC	Co	ode: NC-AC	Is Major M&R: True
Work Date: 6/1/2013	Work Type: Crac	ck Sealing - AC	Co	ode: CS-AC	Is Major M&R: False
Last Insp. Date: 3/28/2017	Total	Samples: 8	Surveyee	1: 2	
Conditions: PCI: 55					
Inspection Comments:					
Sample Number: 135	Type: R	Area:	4000.00 SqFt	PCI: 58	
Sample Comments:			-		
48 L & T CR	L	255.00 Ft			
52 RAVELING	L	3300.00 SqFt			
52 RAVELING	М	700.00 SqFt			
Sample Number: 600	Type: R	Area:	5697.00 SqFt	PCI: 53	
Sample Comments:					
48 L & T CR	L	313.00 Ft			
48 L & T CR	М	12.00 Ft			
52 RAVELING	L	4800.00 SqFt			
56 SWELLING	L	240.00 SqFt			
52 RAVELING	М	897.00 SqFt			

Network:	PCM			Name:	PLANT CITY A	IRPORT		
Branch:	TW A		Name:	TAXIWAY A	Use:	TAXIWAY	Area:	193,170 SqFt
Section:	120	0	f 9 F	rom: -		To: -		Last Const.: 8/1/2013
Surface:	AAC	Family:	DEFAULT	Zone:		Category:		Rank: P
Area:		6,040 SqFt	Length:	150 Ft	Width:	40 Ft		
Slabs:		Slab Len	igth:	Ft Slal	b Width:	Ft	Joint Len	gth: Ft
Shoulder:		Street Ty	ype:	Gra	ade: 0		Lanes:	0
Section Co	omments:							
Work Date	e: 1/1/2001	W	ork Type: New	Construction - Initial	С	ode: NU-IN	Is Ma	ijor M&R: True
Work Date	e: 8/1/2013	W	ork Type: MILI	and OVERLAY	С	ode: ML-OV	Is Ma	ijor M&R: True
Last Insp.	Date: 3/28	3/2017	TotalSa	amples: 1	Surveye	ed: 1		
Conditions	s: PCI:	92						
Inspection	Comments	:						
Sample Nu	umber: 120	0 Ty	e: R	Area:	6040.00 SqFt	PCI: 92	2	
Sample Co	omments:							
52 RA	VELING		L	30.00 SqFt				
57 WE	EATHERING	ĩ	L	6010.00 SqFt				

Network:	PCM			N	ame: PL	ANT CITY A	IRPORT			
Branch:	TW A		Name:	TAXIWAY	A	Use:	TAXIWAY	Area:	193,170	SqFt
Section:	150	0	of 9 F	'rom: -			To: -		Last	Const.: 1/1/2001
Surface:	AAC	Family:	C9N59-GA-TV APC	V-AAC- Zo	one:		Category:		Ranl	к: Р
Area:		4,773 SqFt	Length:	120	Ft	Width:	35 Ft			
Slabs:		Slab Ler	ngth:	Ft	Slab Width:		Ft	Joint L	ength:	Ft
Shoulder:		Street T	ype:		Grade: 0			Lanes:	0	
Section Co	omments:									
Work Date	e: 1/1/1963	W	ork Type: BUIL	.T		C	code: IMPORTE	D Is I	Major M&R:	True
Work Date	e: 1/1/1993	W	ork Type: REPA	AIR		C	code: IMPORTE	D Is I	Major M&R:	False
Work Date	e: 1/1/2001	W	ork Type: Overl	ay - AC Thin		С	code: OL-AT	Is I	Major M&R:	True
Work Date	e: 6/1/2013	W	ork Type: Crack	Sealing - AC		С	code: CS-AC	Is I	Major M&R:	False
Last Insp.	Date: 3/28	3/2017	TotalSa	amples: 1		Survey	ed: 1			
Conditions	s: PCI:	48								
Inspection	Comments	:								
Sample Nu	mber: 200) Ty	pe: R	Area:	477	3.00 SqFt	PCI:	48		
- Sample Co	omments:									
52 RA	VELING		М	1012.00 SqF	t					
48 L&	t T CR		L	547.00 Ft						
	TCHING		L	184.00 SqF						
52 RA	VELING		L	3577.00 SqF	t					

Network:	PCM				Name:	PLANT CITY	AIRPO	RT			
Branch:	TW A		Name:	TAXIW	AY A	Use	: TA	XIWAY	Area:	193,170 SqFt	
Section:	160	0	f 9	From: -				To: -		Last Cons	st.: 1/1/2001
Surface:	AAC	Family:	C9N59-GA-T APC	W-AAC-	Zone:			Category:		Rank: P	
Area:		5,383 SqFt	Length	:	125 Ft	Width:		40 Ft			
Slabs:		Slab Ler	ngth:	Ft	Slab Wi	dth:		Ft	Joint Leng	gth:	Ft
Shoulder:		Street T	ype:		Grade:	0			Lanes:	0	
Section Co	omments:										
Work Date	e: 1/1/1986	w	ork Type: OV	ERLAY			Code:	IMPORTED	Is Maj	jor M&R: True	
Work Date	e: 1/1/1986	w	ork Type: BU	ILT			Code:	IMPORTED	Is Maj	jor M&R: True	
Work Date	e: 1/1/1993	W	ork Type: RE	PAIR			Code:	IMPORTED	Is Maj	jor M&R: False	2
Work Date	e: 1/1/2001	W	ork Type: Ove	erlay - AC Thi	n		Code:	OL-AT	Is Maj	jor M&R: True	
Work Date	e: 6/1/2013	W	ork Type: Cra	ck Sealing - A	С		Code:	CS-AC	Is Maj	jor M&R: False	2
Last Insp.	Date: 3/28/	/2017	Total	Samples: 1		Surve	yed: 1	1			
Conditions	s: PCI:	53									
Inspection	Comments:										
Sample Nu	mber: 300	Ty	pe: R	Ar	ea:	5383.00 SqFt		PCI: 53			
Sample Co	omments:										
48 L&	t CR		L	436.00	Ft						
	TCHING		L	248.00							
52 RA	VELING		L	4233.00	SqFt						
52 RA	VELING		М	902.00	SqFt						

Network:	PCM			Name:	PLANT CITY A	IRPORT		
Branch:	TW A		Name:	TAXIWAY A	Use:	TAXIWAY	Area:	193,170 SqFt
Section:	165	of	59 F	rom: -		То: -		Last Const.: 3/1/2013
Surface:	AAC	Family:	DEFAULT	Zone:		Category:		Rank: P
Area:		6,228 SqFt	Length:	65 Ft	Width:	35 Ft		
Slabs:		Slab Len	gth:	Ft Slal	b Width:	Ft	Joint Le	ngth: Ft
Shoulder:		Street Ty	pe:	Gra	ide: 0		Lanes:	0
Section Co	omments:							
Work Dat	e: 1/1/2001	We	ork Type: New	Construction - Initial	С	ode: NU-IN	Is M	ajor M&R: True
Work Dat	e: 3/1/2013	We	ork Type: MILL	and OVERLAY	С	ode: ML-OV	Is M	ajor M&R: True
Last Insp.	Date: 3/28	8/2017	TotalSa	mples: 2	Surveye	e d: 1		
Condition	s: PCI:	92						
Inspection	Comments	:						
Sample Nu	umber: 30	2 Typ	e: R	Area:	3055.00 SqFt	PCI: 9	02	
Sample Co	omments:							
50 PA	TCHING		L	4.00 SqFt				
57 WE	EATHERING	3	L	3051.00 SqFt				

Network:	PCM			Ν	ame: PL	ANT CITY A	IRPORT		
Branch:	TW A		Name:	TAXIWAY	Υ Α	Use:	TAXIWAY	Area:	193,170 SqFt
Section:	170	0	f 9	From: -			To: -		Last Const.: 8/1/2013
Surface:	AAC	Family:	DEFAULT	Z	one:		Category:		Rank: P
Area:		4,870 SqFt	Length	: 12	0 Ft	Width:	40 Ft		
Slabs:		Slab Ler	ngth:	Ft	Slab Width:		Ft	Joint Leng	th: Ft
Shoulder:		Street T	ype:		Grade: 0			Lanes:	0
Section Co	omments:								
Work Dat	e: 1/1/1963	W	ork Type: BU	ILT		С	ode: IMPORTED	Is Maj	or M&R: True
Work Dat	e: 1/1/1993	W	ork Type: RE	PAIR		С	ode: IMPORTED	Is Maj	or M&R: False
Work Dat	e: 1/1/2001	W	ork Type: Ove	erlay - AC Thin		С	ode: OL-AT	Is Maj	or M&R: True
Work Dat	e: 8/1/2013	W	ork Type: MII	LL and OVERLA	Y	С	ode: ML-OV	Is Maj	or M&R: True
Last Insp.	Date: 3/28	/2017	Total	Samples: 1		Surveye	ed: 1		
Condition	s: PCI:	90							
Inspection	Comments:								
Sample Nı	umber: 400) Tyj	pe: R	Area	487	0.00 SqFt	PCI: 90)	
Sample Co	omments:								
48 L&	k T CR		L	3.00 Ft					
	VELING		L	10.00 SqI					
57 WE	EATHERING	ŕ	L	4860.00 SqI	łt				

Network:	PCM			Name	PLANT C	TY AIRPORT		
Branch:	TW A		Name:	TAXIWAY A		Use: TAXIWAY	Area:	193,170 SqFt
Section:	174	0	f 9 F	rom: -		То: -		Last Const.: 8/1/2013
Surface:	AAC	Family:	DEFAULT	Zone:		Category	:	Rank: P
Area:		4,273 SqFt	Length:	100 Ft	Wid	h: 40 1	Ft	
Slabs:		Slab Len	igth:	Ft S	lab Width:	Ft	Join	t Length: Ft
Shoulder:		Street Ty	ype:	0	Grade: 0		Land	es: 0
Section Co	omments:							
Work Dat	e: 1/1/2001	W	ork Type: New (Construction - Initial		Code: NU-IN]	Is Major M&R: True
Work Dat	e: 8/1/2013	W	ork Type: MILL	and OVERLAY		Code: ML-OV]	Is Major M&R: True
Last Insp.	Date: 3/28	8/2017	TotalSa	mples: 1	S	urveyed: 1		
Condition	s: PCI:	94						
Inspection	n Comments:	:						
Sample Nu	umber: 40	1 Ty	pe: R	Area:	4273.00 S	aFt PCI	94	
Sample Co	omments:							
57 WE	EATHERING	Ĵ	L	4273.00 SqFt				

Network:	РСМ				Name:	PLA	NT CITY	AIRPOF	RT				
Branch:	TW A		Name:	TAXIW	AY A		Use	TA	XIWAY	Area:	193,1	70 SqFt	
Section:	175	0	f 9	From: -				[Го: -		La	st Const.:	1/1/2001
Surface:	AAC	Family:	C9N59-GA-T APC	W-AAC-	Zone:			(Category:		Ra	ank: P	
Area:		3,137 SqFt	Length:		70 Ft		Width:		40 Ft				
Slabs:		Slab Lei	ngth:	Ft	Slab V	Vidth:		I	Ft	Joint Le	ngth:	Ft	
Shoulder:		Street T	ype:		Grade	: 0				Lanes:	0		
Section Co	omments:												
Work Date	e: 1/1/1948	W	ork Type: BU	ILT				Code:	IMPORTED	Is M	ajor M&F	R: True	
Work Date	e: 1/1/1960	W	ork Type: OV	ERLAY				Code:	IMPORTED	Is M	ajor M&F	R: True	
Work Date	e: 1/1/1992	W	ork Type: OV	ERLAY				Code:	IMPORTED	Is M	ajor M&F	R: True	
Work Date	e: 1/1/2001	W	ork Type: Ove	erlay - AC Thi	n			Code:	OL-AT	Is M	ajor M&F	R: True	
Last Insp.	Date: 3/28	8/2017	Total	Samples: 1			Surve	yed: 1					
Conditions	s: PCI:	83											
Inspection	Comments	:											
Sample Nu	imber: 40	2 Ty	pe: R	Ar	ea:	3137	.00 SqFt		PCI: 83	;			
Sample Co	omments:												
48 L&	t CR		L	73.00 I	Ft								
	EATHERING		L	2980.00	-								
57 WE	EATHERING	Ĵ	М	157.00 \$	SqFt								

Network:	PCM					Ν	ame: PLA	ANT CITY A	IRPORT				
Branch:	TW HA	ANG		N	Name:	TAXIWAY	TO HANGAR	Use:	TAXILANE	Area:	:	53,871 SqFt	
Section:	750		of	1	Fr	o m: -			To: -			Last Const.	1/1/2011
Surface:	AC	F	Family:	C9N5	59-GA-TW-	AC Z	one:		Category:			Rank: P	
Area:		53,871	SqFt		Length:	850) Ft	Width:	60 H	't			
Slabs:			Slab Len	gth:		Ft	Slab Width:		Ft	J	oint Length:	I	Ŧt
Shoulder:	:		Street Ty	pe:			Grade: 0			L	anes: 0		
Section C	omments:												
Work Dat	te: 1/1/2011	1	Wo	ork Ty	pe: New Co	onstruction - I	nitial	С	ode: NU-IN		Is Major N	A&R: True	
	D (2/2	0/2017			T 4 10			Surveye					
Last Insp.	. Date: 3/2	28/2017			TotalSan	nples: 13		Surveye	ea: 2				
_					TotalSan	nples: 13		Surveye	e u: 2				
Condition		90			TotalSan	npies: 13		Surveye	2 :				
Condition Inspection	ns: PCI:	90 s:	Тур	e:	R	Area:	350	2.00 SqFt	PCI:	90			
Condition Inspection Sample N	ns: PCI: n Comments	90 s:	Тур	e:			350			90			
Condition Inspection Sample N Sample C	ns: PCI: n Comments (umber: 10	90 s:	Тур	e: L			350			90			
Condition Inspection Sample N Sample C 48 L &	ns: PCI: n Comment: [umber: 10 comments:	90 s:	Тур			Area:				90			
Condition Inspection Sample N Sample C 48 L & 52 RA	ns: PCI: n Comment: (umber: 10 comments: & T CR	90 s: 02	Тур	L	R	Area: 1.00 Ft	't			90			
Condition Inspection Sample N Sample C 48 L & 52 RA 57 W1	ns: PCI: n Comments (umber: 10 comments: & T CR AVELING	90 s: 02 G	Тур	L L L	R	Area: 1.00 Ft 18.00 SqF	't 't						
Condition Inspection Sample N Sample C 48 L & 52 RA 57 W1 Sample N	ns: PCI: n Comments (umber: 10 comments: & T CR & VELING EATHERIN	90 s: 02 G		L L L	R	Area: 1.00 Ft 18.00 SqF 3484.00 SqF	't 't	2.00 SqFt	PCI:				
Condition Inspection Sample N Sample C 48 L 4 52 RA 57 WI Sample N Sample C	ns: PCI: n Comments: (umber: 1(comments: & T CR & T CR A VELING EATHERIN (umber: 2(90 s: 02 G		L L L	R	Area: 1.00 Ft 18.00 SqF 3484.00 SqF	't 't	2.00 SqFt	PCI:				
Condition Inspection Sample N Sample C 48 L & 52 RA 57 WI Sample N Sample C 48 L &	ns: PCI: n Comments: (umber: 10 comments: & T CR & T CR A VELING EATHERIN (umber: 20 comments:	90 s: 02 G		L L L	R	Area: 1.00 Ft 18.00 SqF 3484.00 SqF Area:	't t 450	2.00 SqFt	PCI:				

Network:	РСМ				Nan	ne: PL	ANT CITY A	AIRPORT				
Branch:	TW T-HANG		Name:	T-HAN	NGARS	TAXIWAY	Use:	TAXILA	ANE A	Area:	48,805	SqFt
Section: 7	705	of	4 F	rom:	-			To:	-		Last	Const.: 1/1/1992
Surface:	AC	•	C9N59-GA-TV APC	V-AAC-	Zon	e:		Cate	gory:		Rank	: Р
Area:	13,04	3 SqFt	Length:		430 F	řt	Width:		30 Ft			
Slabs:		Slab Lengt	h:	Ft		Slab Width:		Ft		Joint Leng	gth:	Ft
Shoulder:		Street Typ	e:			Grade: 0				Lanes:	0	
Section Con	nments:											
Work Date:	: 1/1/1992	Wor	k Type: New	Constructio	on - AC		(Code: NC-	AC	Is Maj	jor M&R:	True
Work Date:	: 1/1/2012	Wor	k Type: Surfa	ce Seal - Se	eal Coat	İ	(Code: SS-S	SC	Is Maj	jor M&R:	False
Last Insp. D	Date: 3/28/2017	7	TotalSa	amples:	4		Survey	red: 1				
Conditions:	PCI: 70											
Inspection (Comments:											
Sample Nur	mber: 100	Туре:	R	А	rea:	300	0.00 SqFt		PCI: 70			
Sample Con	nments:											
48 L&'	T CR		L	337.00	Ft							
57 WEA	ATHERING		L	3000.00	SqFt							

Network:	PCM				Name	e: PLA	NT CITY A	IRPORT		
Branch:	TW T-HA	NG	Name:	T-HA	NGARS	FAXIWAY	Use:	TAXILANE	Area:	48,805 SqFt
Section:	710	0	f 4	From:	-			To: -		Last Const.: 1/1/1986
Surface:	AC	Family:	C9N59-GA- APC	TW-AAC-	Zone	:		Category:		Rank: P
Area:	5	,895 SqFt	Length	:	280 Ft		Width:	20 F	ťt	
Slabs:		Slab Ler	ngth:	Ft	5	Slab Width:		Ft	Joint I	Length: Ft
Shoulder:		Street T	ype:		(Grade: 0			Lanes:	0
Section Co	mments:									
Work Date	: 1/1/1986	W	ork Type: Ne	w Construction	on - AC		С	ode: NC-AC	Is	Major M&R: True
Last Insp. I	Date: 3/28/2	017	Tota	lSamples:	1		Surveye	ed: 1		
Conditions	: PCI : 4	0								
Inspection	Comments:									
Sample Nu	mber: 200	Туј	pe: R	A	rea:	589:	5.00 SqFt	PCI:	40	
Sample Co	mments:									
48 L&	T CR		L	276.00	Ft					
48 L&	T CR		М	200.00	Ft					
	CHING		L	63.00	SqFt					
50 PAT	onnito									
	VELING		L	3000.00	SqFt					

Network:	PCM			Nam	e: PLANT CI	TY AIRPORT		
Branch:	TW T-HANC	ŕ	Name:	T-HANGARS	TAXIWAY U	Jse: TAXILANE	Area:	48,805 SqFt
Section:	720	of	4 F r	om: -		То: -		Last Const.: 1/1/1986
Surface:	AC	Family:	C9N59-GA-TW	-AC Zone	:	Category:		Rank: P
Area:	6,40	50 SqFt	Length:	323 Ft	Width	: 20 Ft		
Slabs:		Slab Leng	gth:	Ft	Slab Width:	Ft	Joint Length	: Ft
Shoulder:		Street Ty	pe:		Grade: 0		Lanes: 0	
Section Cor	nments:							
Work Date	: 1/1/1986	Wo	rk Type: BUILT	Γ		Code: IMPORTED	Is Major	M&R: True
Last Insp. I	Date: 3/28/201	7	TotalSa	mples: 2	Su	rveyed: 1		
Conditions	PCI: 45							
Inspection	Comments:							
Sample Nu	mber: 100	Туре	e: R	Area:	4000.00 Sql	Ft PCI: 4	15	
Sample Co	mments:							
	TCR		L	222.00 Ft				
48 L&	ICK							
	T CR		М	70.00 Ft				
48 L &			M L	70.00 Ft 1600.00 SqFt				

Network: PCM		Name:	PLANT CITY A	IKFORT		
Branch: TW T-HAN	G Name:	T-HANGARS TA	XIWAY Use:	TAXILANE	Area:	48,805 SqFt
Section: 725	of 4	From: -		То: -		Last Const.: 1/1/1997
Surface: AC	Family: C9N59-GA-T APC	W-AAC- Zone:		Category:		Rank: P
Area: 23,4	407 SqFt Length:	1,000 Ft	Width:	20 Ft		
Slabs:	Slab Length:	Ft Sla	ıb Width:	Ft	Joint Length:	Ft
Shoulder:	Street Type:	Gr	ade: 0		Lanes: 0	
Section Comments:						
Work Date: 1/1/1997	Work Type: New	V Construction - AC	С	ode: NC-AC	Is Major	M&R: True
Last Insp. Date: 3/28/201	17 Totals	Samples: 5	Surveye	ed: 2		
Last Insp. Date: 3/28/201 Conditions: PCI: 60		Samples: 5	Surveye	ed: 2		
-		Samples: 5	Surveye	ed: 2		
Conditions: PCI: 60		Samples: 5 Area:	Surveye 4912.00 SqFt	ed: 2 PCI: 57	7	
Conditions: PCI: 60 Inspection Comments:		-			7	
Conditions: PCI: 60 Inspection Comments: Sample Number: 400 Sample Comments:		-			7	
Conditions: PCI: 60 Inspection Comments: Sample Number: 400 Sample Comments:	Type: R	Area:			7	
Conditions: PCI: 60 Inspection Comments: Sample Number: 400 Sample Comments: 54 SHOVING	Type: R M	Area: 2.00 SqFt			7	
Conditions: PCI: 60 Inspection Comments: Sample Number: 400 Sample Comments: 54 SHOVING 48 L&TCR	Type: R M L	Area: 2.00 SqFt 44.00 Ft			7	
Conditions: PCI: 60 Inspection Comments: Sample Number: 400 Sample Comments: 54 SHOVING 48 L & T CR 52 RAVELING	Type: R M L L	Area: 2.00 SqFt 44.00 Ft 3900.00 SqFt			7	
Conditions: PCI: 60 Inspection Comments: Sample Number: 400 Sample Comments: 54 SHOVING 48 L & T CR 52 RAVELING 54 SHOVING	Type: R M L L L L	Area: 2.00 SqFt 44.00 Ft 3900.00 SqFt 2.00 SqFt				
Conditions: PCI: 60 Inspection Comments: Sample Number: 400 Sample Comments: 54 SHOVING 48 L & T CR 52 RAVELING 54 SHOVING 52 RAVELING	Type: R M L L L L M	Area: 2.00 SqFt 44.00 Ft 3900.00 SqFt 2.00 SqFt 1012.00 SqFt	4912.00 SqFt	PCI: 57		
Conditions: PCI: 60 Inspection Comments: Sample Number: 400 Sample Comments: 54 SHOVING 48 L & T CR 52 RAVELING 54 SHOVING 52 RAVELING Sample Number: 600	Type: R M L L L L M	Area: 2.00 SqFt 44.00 Ft 3900.00 SqFt 2.00 SqFt 1012.00 SqFt	4912.00 SqFt	PCI: 57		
Conditions: PCI: 60 Inspection Comments: Sample Number: 400 Sample Comments: 54 SHOVING 48 L & T CR 52 RAVELING 54 SHOVING 52 RAVELING Sample Number: 600 Sample Comments:	Type: R M L L L L N Type: R	Area: 2.00 SqFt 44.00 Ft 3900.00 SqFt 2.00 SqFt 1012.00 SqFt	4912.00 SqFt	PCI: 57		