

FLORIDA DEPARTMENT OF TRANSPORTATION
AVIATION AND SPACEPORTS OFFICE

Statewide Airfield Pavement Management Program

Airport Pavement Evaluation Report September 2017



**Flagler Executive
Airport (FIN)**
General Aviation Airport
District 5





Florida Department of Transportation

Statewide Airfield Pavement Management Program

Prepared by:

*FDOT Aviation and Spaceports Office
605 Suwannee Street
Tallahassee, Florida 32399-0450*




OFFICE OF FREIGHT, LOGISTICS & PASSENGER OPERATIONS

Table of Contents


Executive Summary.....	10
Program Background.....	10
Summary of Results.....	11
Pavement Condition Index (Latest Inspection)	11
Forecasted Pavement Condition Index 2018-2027.....	13
Major Rehabilitation Planning 2018-2027	14
Summary of Flagler Executive Airport	15
Chapter 1 – Introduction	17
1.1 Background	17
1.2 Statewide Airfield Pavement Management Program (SAPMP) Update 2016-2017	17
1.3 Organization	19
1.3.1 Florida Department of Transportation Aviation and Spaceports Office Program Manager	19
1.3.2 Participating Florida Public-Use and Publicly Owned Airports	19
1.3.3 Florida Department of Transportation District Offices.....	19
1.3.4 Consultant	19
1.4 Purpose of Airport Pavement Evaluation Report	21
1.5 History of the Program	21
1.6 Federal Aviation Administration (FAA)	23
1.7 FDOT SAPMP Objectives and Components	23
1.7.1 Program Objectives.....	23
1.7.2 Program Components	23
1.8 References	27
Chapter 2 – Methodology	29
2.1 Airfield Pavement Database	29
2.2 Airfield Pavement System Inventory	29
2.2.1 Pavement Management Program Network Definition Terminology	30
2.3 Airfield Pavement Structure	32
2.3.1 Pavement Structure Types	32
2.4 Airfield Pavement Work History.....	34
2.4.1 Airfield Pavement Record Keeping	34
2.5 Airfield Pavement Traffic	34
2.6 Airfield Pavement Condition Index (PCI) Survey.....	34
2.6.1 PCI Survey Methodology	34
2.6.2 Pavement Distress Types	36

2.6.3 PCI Survey Inspection Procedures	40
2.6.4 Updates to the ASTM D5340-12	41
Chapter 3 – Airfield Pavement System Inventory	44
3.1 Airfield Pavement Network Information	44
3.1.1 Previous and/or Anticipated Airfield Pavement Construction	44
3.1.2 Estimated Pavement Age	46
3.1.3 Functional Use Classification	48
3.1.4 Pavement Surface Type.....	49
3.1.5 Pavement System Inventory Details	50
Chapter 4 – Airfield Pavement Condition	55
4.1 Airfield Pavement Condition Index (Latest Inspection)	55
4.1.1 Network-Level Analysis	55
4.1.2 Branch-Level Analysis.....	55
4.1.3 Section-Level Analysis	58
4.2 Summary of Pavement Condition Evaluation Results	62
4.2.1 Network-Level Observations	62
4.2.2 Branch-Level Observations.....	62
4.3 Forecasted Pavement Conditions	64
4.3.1 Performance Models and Prediction Curves	64
4.3.2 Branch-Level Pavement Condition Forecast	64
4.3.3 Section-Level Pavement Condition Forecast.....	66
4.3.4 Forecasted PCI Considerations	69
Chapter 5 – Localized Maintenance and Repair Planning.....	71
5.1 Localized Maintenance and Repair	71
5.2 Localized Maintenance and Repair Policy	72
5.3 Localized Maintenance and Repair Analysis and Recommendations	76
Chapter 6 – Major Rehabilitation Planning.....	80
6.1 Major Rehabilitation	80
6.1.1 Critical PCI	82
6.1.2 FDOT Recommended Minimum Service-Level PCI	82
6.2 Major Rehabilitation Policy	83
6.2.1 Major Rehabilitation Pavement Section Development.....	83
6.2.2 Major Rehabilitation Planning-Level Unit Costs.....	84
6.3 Major Rehabilitation Needs	85
6.3.1 10-Year Unconstrained Budget Major Rehabilitation Needs	85
Chapter 7 – Conclusion.....	90
7.1 Recommendations	90
7.1.1 Continued PCI Survey Inspections	90
7.1.2 Localized Maintenance and Repair.....	90

7.1.3 Major Rehabilitation	90
7.1.4 Pavement Management System.....	90
7.2 Supporting Documents.....	91
001 – Airfield Pavement Network Definition Exhibit.....	91
002 – Airfield Pavement System Inventory Exhibit	91
003 – Airfield Pavement Condition Index Exhibit	91
004 – Airfield Pavement Major Rehabilitation Exhibit	91
Inspection Photograph Documentation.....	91
7.3 Conclusion	92

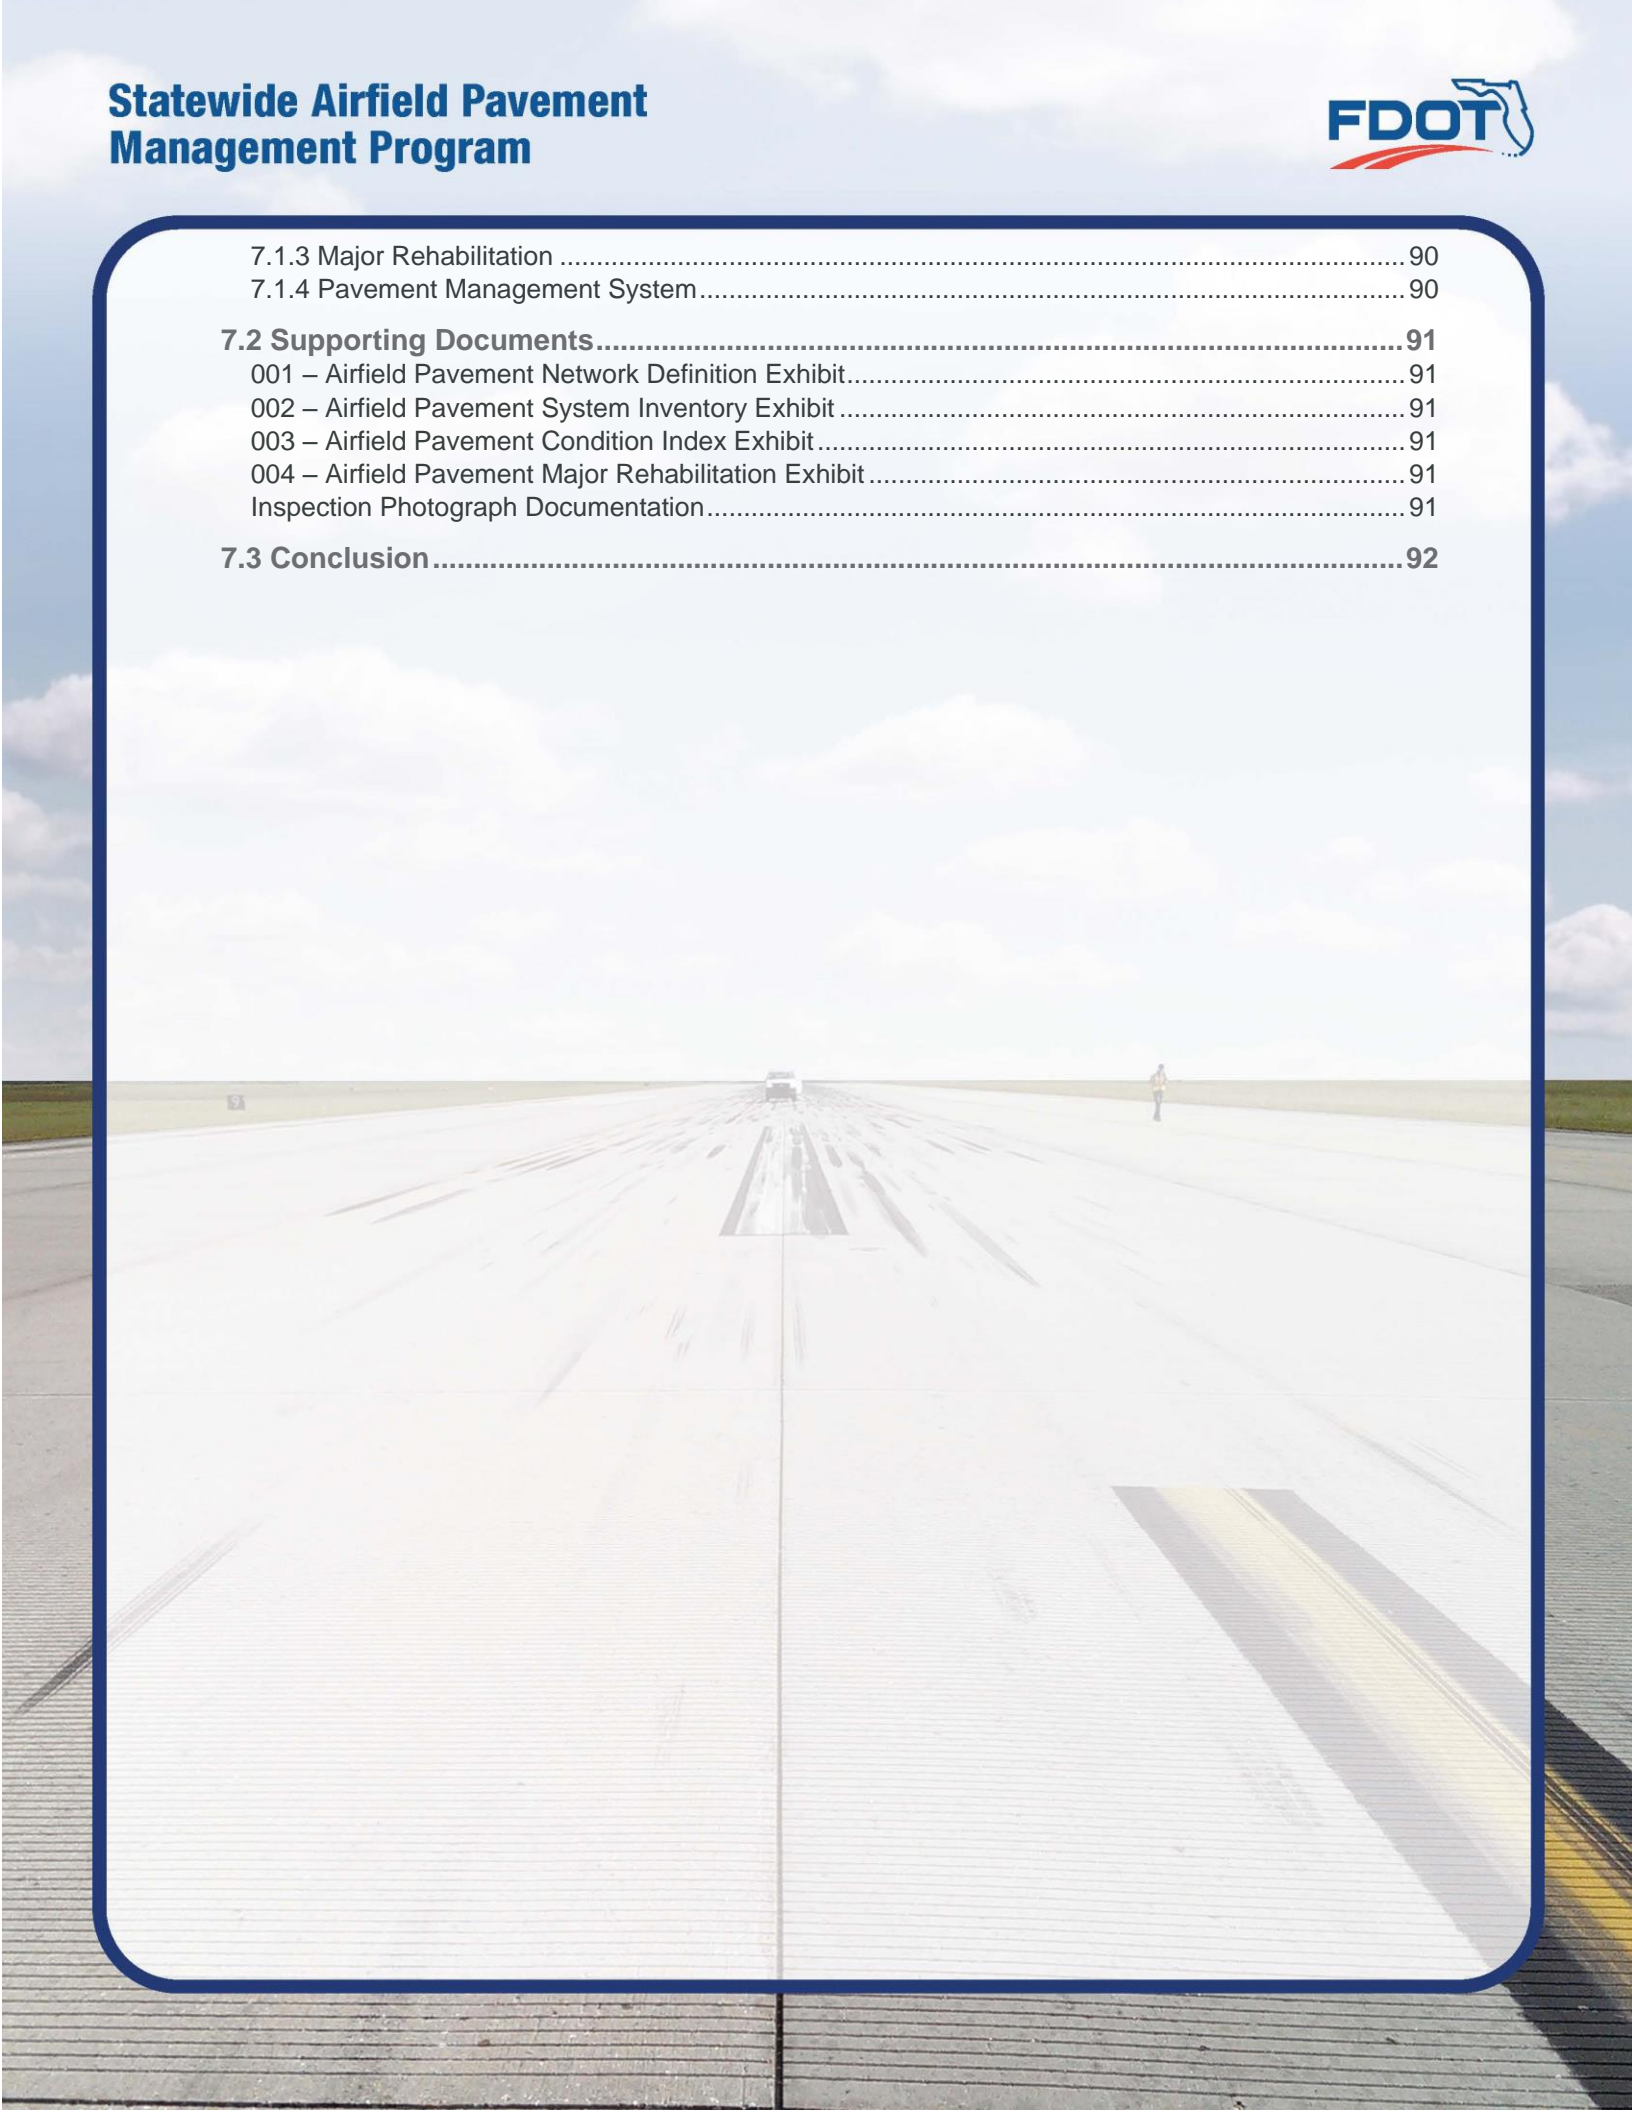

Appendix A	Airfield Pavement Analysis Tables
Appendix B	Airfield Pavement Localized Maintenance and Repair and Major Rehabilitation
Appendix C	Technical Exhibits
Appendix D	Inspection Photograph Documentation
Appendix E	Inspection Distress Details

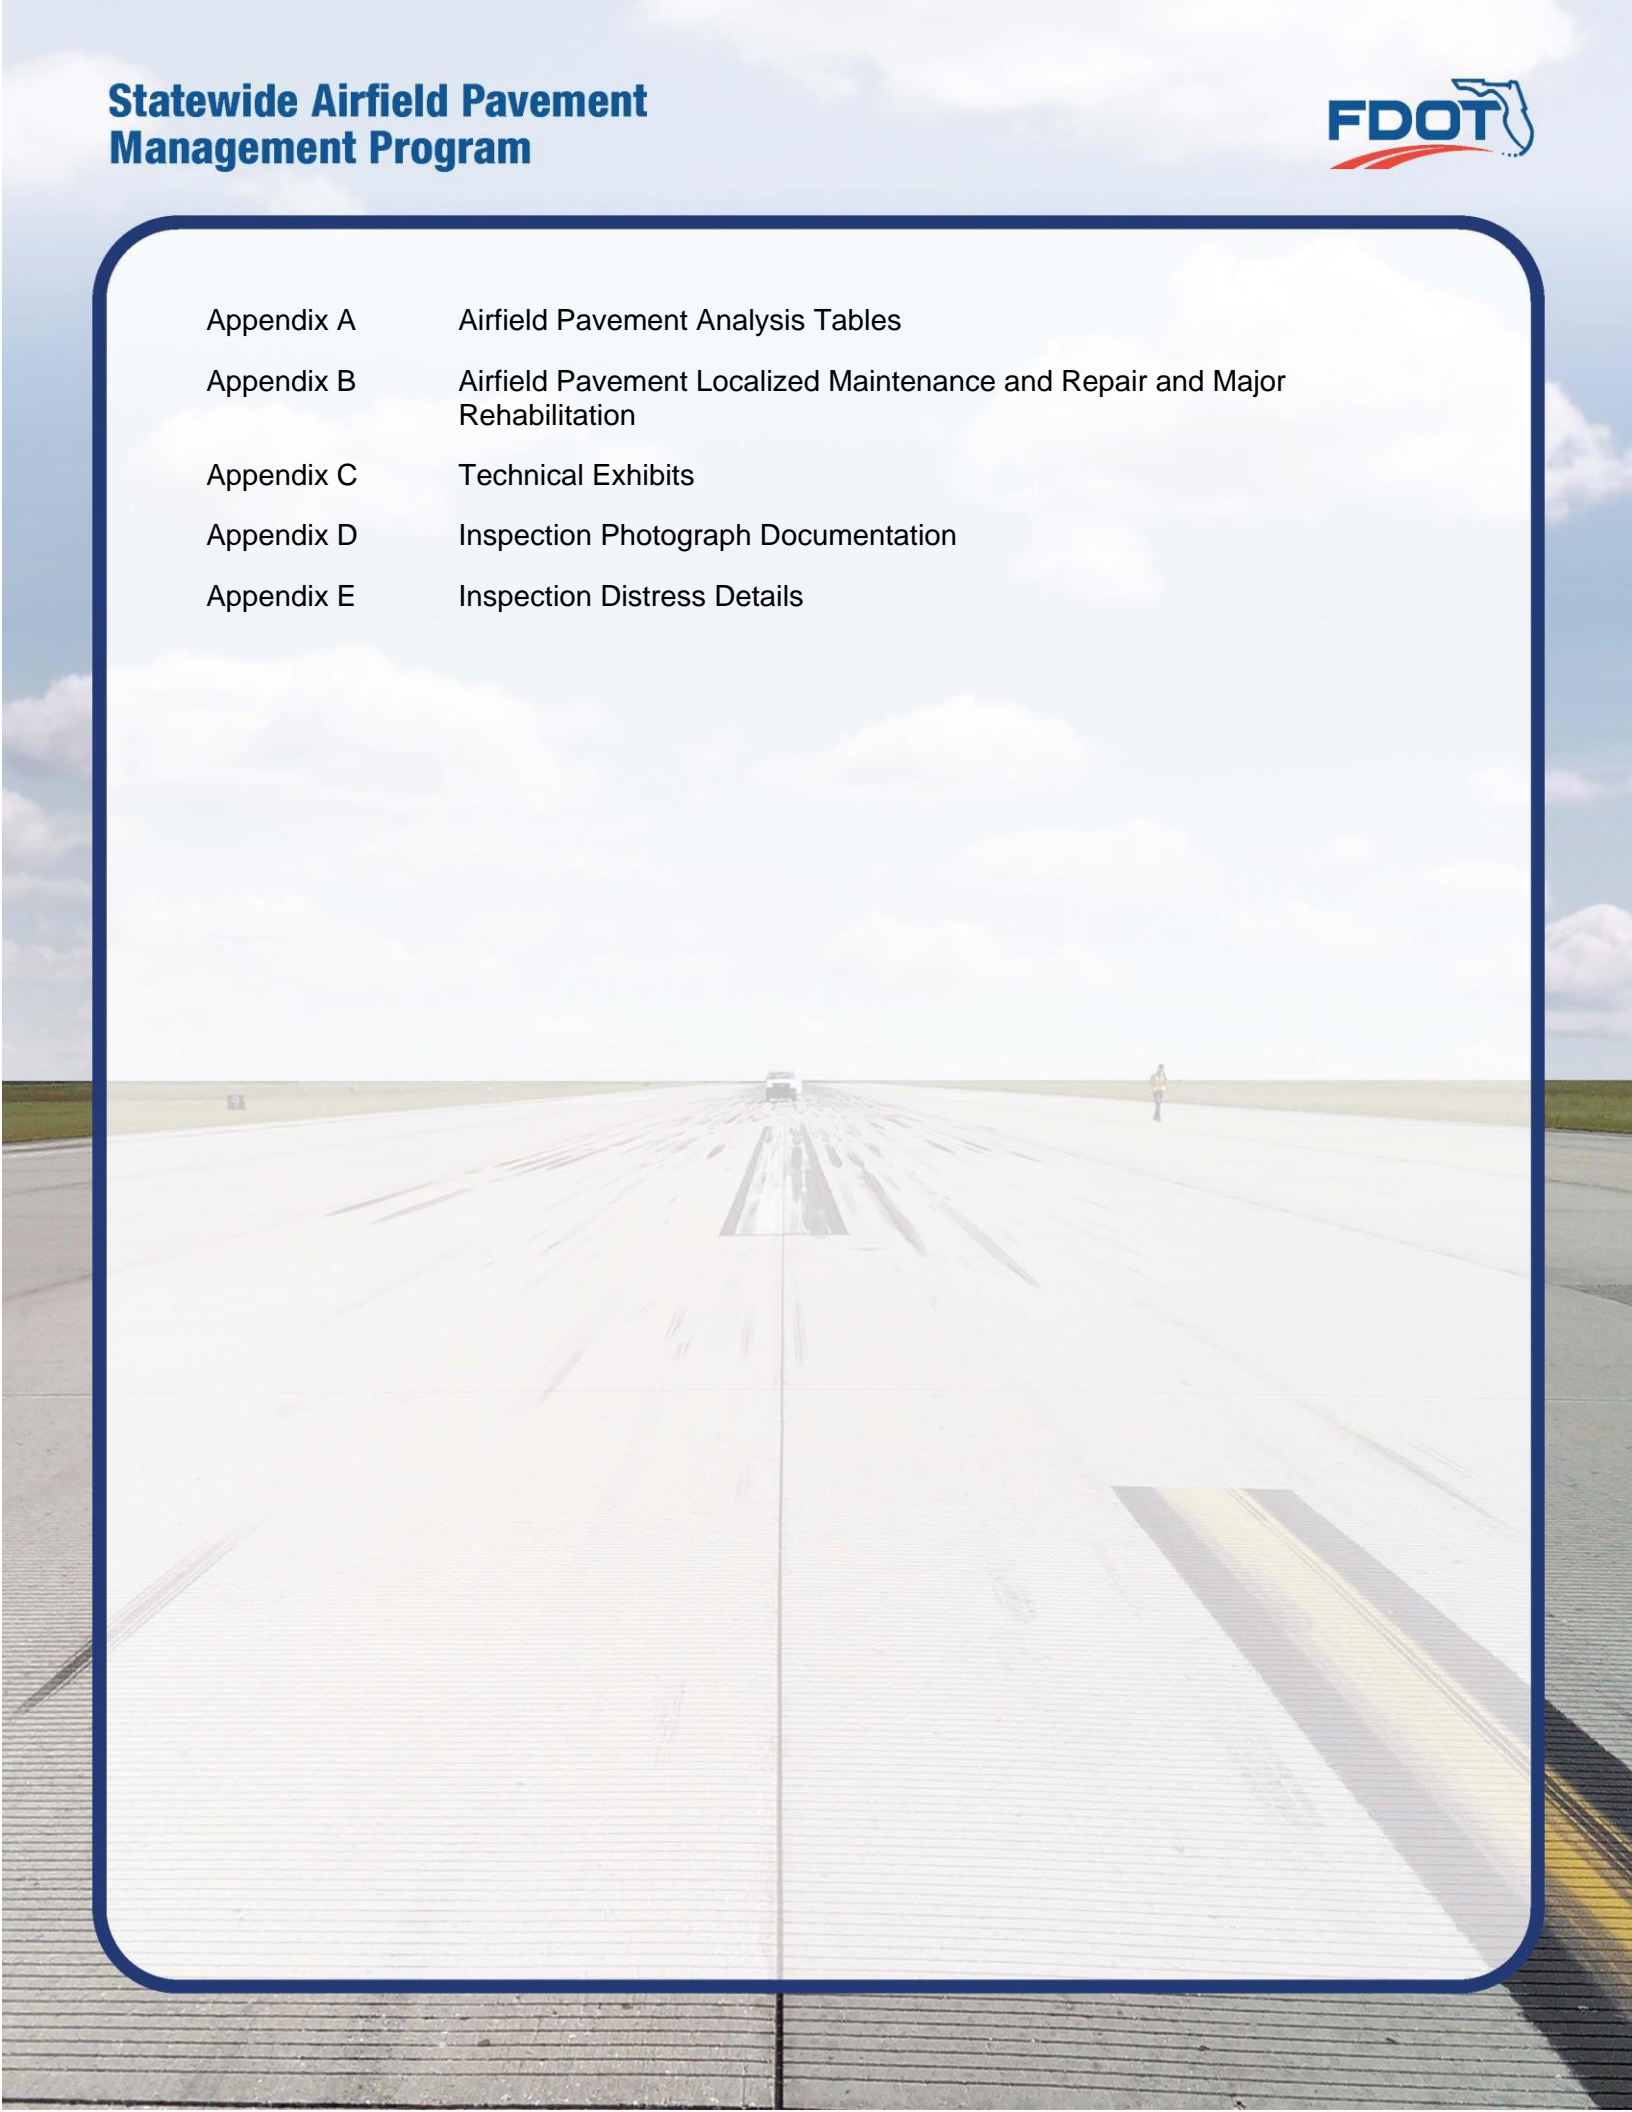

List of Figures

Figure E-4 Major Rehabilitation Planning Annual Budget 2018-2027	15
Figure 1.2 Florida Aviation System (Facilities with Pavement) and FDOT Districts.....	18
Figure 1.7-1 Typical Pavement Condition Life Cycle	24
Figure 1.7-2 General Pavement Treatments by Condition Range	25
Figure 1.7-3 Flexible Asphalt Concrete.....	26
Figure 1.7-4 Rigid Portland Cement Concrete	26
Figure 3.1.1-1 2017 Airfield Pavement Network Definition Exhibit.....	45
Figure 3.1.1-2 2017 Airfield Pavement System Inventory Exhibit.....	46
Figure 3.1.2 Average Age of Pavements at Inspection.....	47
Figure 3.1.3 Airfield Pavement Functional Classification Use by Area	48
Figure 3.1.4 (a) Pavement Surface Type by Area (SF)	49
Figure 3.1.4 (b) Pavement Surface Type by Area (%).....	50
Figure 4.1.1 Latest Condition – Overall Network	55
Figure 4.1.2 (a) Latest Condition – Runway Pavements	56
Figure 4.1.2 (b) Latest Condition – Taxiway Pavements	56
Figure 4.1.2 (c) Latest Condition – Apron Pavements	57
Figure 4.1.2 (d) Latest Condition – Taxilane Pavements.....	57
Figure 4.1.3 2017 Airfield Pavement Condition Index Exhibit.....	61
Figure 4.2.2 Pavement Condition Summary by Facility Use.....	63
Figure 4.3.2 (a) Forecasted Runway Pavement Performance.....	64
Figure 4.3.2 (b) Forecasted Taxiway Pavement Performance	65
Figure 4.3.2 (c) Forecasted Apron Pavement Performance	65
Figure 6.1-1 Major Rehabilitation Planning Decision Diagram, $PCI \leq$ Critical PCI.....	80
Figure 6.1-2 Major Rehabilitation Planning Decision Diagram, $PCI >$ Critical PCI	81
Figure 6.3.1-1 10-Year Major Rehabilitation Needs by Program Year	87
Figure 6.3.1-2 10-Year Major Rehabilitation Needs by Program Year Exhibit.....	88

List of Tables

Table E-1 Pavement Condition Index Summary (Last Inspection) – Section Level.....	11
Table E-2 Pavement Condition Index Forecast 2018-2027	13
Table E-3 Major Rehabilitation Planning 2018-2027	14
Table 2.2.1 Airfield Pavement Database Network Definition Terminology	31
Table 2.6.2-1 (a) Pavement Distress Types – Flexible Asphalt Concrete-Surfaced Airfields	36
Table 2.6.2-1 (b) Pavement Distresses Possible Causes – Flexible Asphalt Concrete-Surfaced Airfields	37
Table 2.6.2-1 (c) Pavement Distresses Possible Effects – Flexible Asphalt Concrete-Surfaced Airfields	37
Table 2.6.2-2 (a) Pavement Distresses – Rigid Portland Cement Concrete-Surfaced Airfields	38
Table 2.6.2-2 (b) Pavement Distresses Possible Causes – Rigid Portland Cement Concrete-Surfaced Airfields	39
Table 2.6.2-2 (c) Pavement Distresses Possible Effects – Rigid Portland Cement Concrete-Surfaced Airfields	39
Table 2.6.3 (a) Recommended Sample Rate Schedule for Flexible Asphalt Concrete	40
Table 2.6.3 (b) Recommended Sample Rate Schedule for Rigid Portland Cement Concrete....	40
Table 2.6.4 Summary of Updates to ASTM D5340-12	42
Table 3.1.1 Previous and/or Anticipated Airfield Pavement Construction.....	44
Table 3.1.5 Pavement System Inventory Details	51
Table 4.1.3 Latest Pavement Condition Index Summary.....	59
Table 4.3.3 Forecasted PCI 2018-2027	67
Table 5.2-1 Localized Maintenance and Repair – Flexible Asphalt Concrete	72
Table 5.2-2 Localized Maintenance and Repair – Rigid Portland Cement Concrete.....	73
Table 5.2-3 (a) Localized Repair Planning-Level Unit Costs – Flexible Asphalt Concrete	75
Table 5.2-3 (b) Localized M&R Planning-Level Unit Costs – Rigid Portland Cement Concrete	75

Table 5.3-1 Summary of Airport Localized M&R Planning Cost and Quantity at Network Level	76
Table 5.3-2 Summary of Airport Localized M&R Planning Cost and Quantity at Section Level	77
Table 5.3-3 Summary of Localized Maintenance	78
Table 6.1.2 FDOT Recommended Minimum Service-Level PCI	82
Table 6.2.1 (a) Conceptual Pavement Section for Major Rehabilitation – Flexible Asphalt Concrete	83
Table 6.2.1 (b) Conceptual Pavement Section for Major Rehabilitation – Rigid Portland Cement Concrete	84
Table 6.2.2 General Aviation Major Rehabilitation Planning-Level Unit Cost by Pavement Type	85
Table 6.3.1 10-Year Major Rehabilitation Needs	86



Executive Summary





Executive Summary

Program Background

Airport airfield pavement infrastructure facilities represent a large capital investment in the Florida Airport System. Timely and appropriate maintenance and strategic rehabilitation are essential as repair costs increase significantly in proportion to deterioration. Airport pavement distresses can also contribute to the development of loose debris and decreased ride quality, which can be a safety concern for aircraft operations.

In 2016, the Florida Department of Transportation (FDOT) Aviation and Spaceports Office (ASO) selected Kimley-Horn and Associates, Inc. with subconsultants Airfield Pavement Management Systems, LLC and AVCON, Inc. to provide professional services in support of FDOT in the continued efforts of performing a system update to the Statewide Airfield Pavement Management Program (SAPMP). This work is to be completed from fiscal year 2016 through fiscal year 2019. The SAPMP has 95 public use airport facilities throughout the seven FDOT Districts that participate in the system update. The results of this system update for this specific airport are presented in this report and can be utilized by FDOT and the Federal Aviation Administration (FAA) to identify, prioritize, and schedule pavement maintenance, repair, and major rehabilitation projects.

Pavement condition was assessed utilizing the pavement condition index (PCI) methodology as defined in the FAA Advisory Circular **150/5380-7B “Airport Pavement Management Program (PMP)”** using the documented procedures set forth by ASTM **D5340-12 “Standard Test Method for Airport Pavement Condition Index Surveys.”**

Pavement deterioration, in accordance with the ASTM D5340-12, was characterized in terms of distinct distress types, severity level of distress, and quantity of distress. This information is utilized to calculate a PCI numeric that represents the overall condition of the pavement in a numeric index that ranges from 0 (a condition category of FAILED) to 100 (GOOD). The PCI methodology analyzes an overall measure of the pavement condition and provides an indication of the degree of maintenance, repair, or rehabilitation efforts that will be required to sustain functional pavement.

The tasks required for the system update at each participating airport consist of the following:

- Obtain recent and anticipated airfield pavement construction work data.
- Update airport airfield pavement system inventory records (construction history, identification, geometry, and facility classification).
- Perform PCI Survey Inspections at each participating airport.
- Update the FDOT SAPMP PAVER™ database system.
- Update the FDOT SAPMP GIS Airfield Navigation GPS enabled Maps.
- Update airfield pavement performance models and pavement condition forecasting.
- Identification of planning-level maintenance, repair, and major rehabilitation to address pavement needs based on functional PCI analysis.
- Development of planning-level opinion of probable construction costs for pavement rehabilitation.



Summary of Results

Pavement Condition Index (Latest Inspection)

Table E-1 Pavement Condition Index Summary (Last Inspection) – Section Level

Network ID	Branch Name	Branch Use	Section ID	Area (SF)	PCI	Condition Rating
FIN	RUNWAY 11-29	RUNWAY	6105	500,300	100	Good
FIN	RUNWAY 6-24	RUNWAY	6205	487,349	50	Poor
FIN	TAXIWAY A	TAXIWAY	102	22,177	59	Fair
FIN	TAXIWAY A	TAXIWAY	104	7,358	25	Serious
FIN	TAXIWAY A	TAXIWAY	105	184,752	33	Very Poor
FIN	TAXIWAY A	TAXIWAY	110	17,576	26	Very Poor
FIN	TAXIWAY A	TAXIWAY	120	15,400	84	Satisfactory
FIN	TAXIWAY A1	TAXIWAY	602	25,816	92	Good
FIN	TAXIWAY B	TAXIWAY	205	88,917	63	Fair
FIN	TAXIWAY C	TAXIWAY	305	28,798	57	Fair
FIN	TAXIWAY C	TAXIWAY	307	11,213	29	Very Poor
FIN	TAXIWAY C	TAXIWAY	310	26,271	100	Good
FIN	TAXIWAY C	TAXIWAY	315	39,970	100	Good
FIN	TAXIWAY C	TAXIWAY	320	15,961	100	Good
FIN	TAXIWAY D	TAXIWAY	410	110,706	100	Good
FIN	TAXIWAY D	TAXIWAY	414	5,779	100	Good
FIN	TAXIWAY D	TAXIWAY	415	18,039	100	Good
FIN	TAXIWAY E	TAXIWAY	505	32,654	100	Good
FIN	TAXIWAY E	TAXIWAY	510	71,339	100	Good
FIN	TAXIWAY E	TAXIWAY	512	19,204	100	Good
FIN	TAXIWAY E	TAXIWAY	515	138,069	100	Good
FIN	TAXIWAY E	TAXIWAY	520	13,104	65	Fair
FIN	TAXIWAY H	TAXIWAY	705	130,070	100	Good
FIN	T-HANGAR TAXILANE	TAXILANE	4305	8,395	47	Poor
FIN	T-HANGAR TAXILANE	TAXILANE	4310	17,531	61	Fair
FIN	T-HANGAR TAXILANE	TAXILANE	4315	8,565	48	Poor
FIN	T-HANGAR TAXILANE	TAXILANE	4320	17,192	94	Good
FIN	APRON	APRON	4105	23,645	0	Failed
FIN	APRON	APRON	4110	50,015	89	Good
FIN	APRON	APRON	4115	20,847	27	Very Poor
FIN	APRON	APRON	4120	9,798	16	Serious
FIN	APRON	APRON	4125	25,668	78	Satisfactory
FIN	APRON	APRON	4130	10,275	17	Serious
FIN	APRON	APRON	4135	111,646	94	Good
FIN	APRON	APRON	4140	8,368	84	Satisfactory



Network ID	Branch Name	Branch Use	Section ID	Area (SF)	PCI	Condition Rating
FIN	NORTH APRON	APRON	4405	30,077	75	Satisfactory
FIN	APRON GA	APRON	4510	17,338	82	Satisfactory
FIN	APRON MID	APRON	4610	38,864	94	Good
FIN	APRON MID	APRON	4615	21,385	94	Good
FIN	RUN-UP APRON AT RW 11	APRON	5103	36,038	32	Very Poor
FIN	RUN-UP APRON AT RW 11	APRON	5105	27,768	50	Poor
FIN	RUN-UP APRON AT RW 6	APRON	5205	30,715	100	Good



Forecasted Pavement Condition Index 2018-2027

Table E-2 Pavement Condition Index Forecast 2018-2027

Network ID	Branch ID	Section ID	Last PCI	Forecasted PCI									
				2018	2019	2020	2021	2022	2023	2024	2025	2026	2027
FIN	AP	4105	0	0	0	0	0	0	0	0	0	0	0
FIN	AP	4110	89	87	85	84	82	81	79	77	76	74	73
FIN	AP	4115	27	25	23	22	20	19	17	15	14	12	11
FIN	AP	4120	16	14	13	12	11	10	9	8	7	6	4
FIN	AP	4125	78	75	73	71	69	67	65	63	62	60	59
FIN	AP	4130	17	15	14	13	12	11	10	9	8	7	5
FIN	AP	4135	94	92	90	89	87	86	84	82	81	79	78
FIN	AP	4140	84	81	79	76	74	72	70	68	66	64	62
FIN	AP GA	4510	82	79	77	74	72	70	68	66	64	63	61
FIN	AP MID	4610	94	92	90	89	87	86	84	82	81	79	78
FIN	AP MID	4615	94	92	90	89	87	86	84	82	81	79	78
FIN	AP N	4405	75	72	70	68	66	65	63	61	60	58	57
FIN	AP RU 11	5103	32	30	28	27	25	24	22	20	19	17	16
FIN	AP RU 11	5105	50	48	46	43	40	37	35	32	30	27	24
FIN	AP RU 6	5205	100	96	95	93	92	90	88	87	85	84	82
FIN	RW 11-29	6105	100	100	98	96	95	93	91	90	88	86	85
FIN	RW 6-24	6205	50	47	44	40	37	34	31	29	26	23	21
FIN	T-HANG	4305	47	46	45	44	43	42	42	41	40	39	38
FIN	T-HANG	4310	61	60	58	57	56	55	53	52	50	49	47
FIN	T-HANG	4315	48	46	44	43	41	40	38	37	35	34	33
FIN	T-HANG	4320	94	91	89	86	84	81	79	77	75	74	72
FIN	TW A	102	59	57	55	54	52	50	49	47	46	45	44
FIN	TW A	104	25	21	17	13	10	6	2	0	0	0	0
FIN	TW A	105	33	32	31	30	29	28	28	27	26	24	23
FIN	TW A	110	26	22	18	14	11	7	3	0	0	0	0
FIN	TW A	120	84	81	79	78	76	75	74	73	72	71	70
FIN	TW A1	602	92	89	86	83	81	79	77	76	75	73	72
FIN	TW B	205	63	62	61	60	59	57	56	55	54	52	51
FIN	TW C	305	57	55	53	52	50	48	47	46	45	44	44
FIN	TW C	307	29	28	27	26	25	23	21	18	14	12	9
FIN	TW C	310	100	93	90	88	85	82	80	78	77	75	74
FIN	TW C	315	100	93	90	88	85	82	80	78	77	75	74
FIN	TW C	320	100	95	93	90	88	85	83	80	78	76	75
FIN	TW D	410	100	93	90	88	85	83	80	78	77	75	74
FIN	TW D	414	100	93	90	88	85	83	80	78	77	75	74




Network ID	Branch ID	Section ID	Last PCI	Forecasted PCI									
				2018	2019	2020	2021	2022	2023	2024	2025	2026	2027
FIN	TW D	415	100	93	90	88	85	83	80	78	77	75	74
FIN	TW E	505	100	90	88	85	83	80	78	77	75	74	73
FIN	TW E	510	100	90	88	85	83	80	78	77	75	74	73
FIN	TW E	512	100	90	88	85	83	80	78	77	75	74	73
FIN	TW E	515	100	90	88	85	83	80	78	77	75	74	73
FIN	TW E	520	65	64	63	62	61	60	59	58	57	55	54
FIN	TW H	705	100	95	93	90	88	85	83	81	78	76	75

Major Rehabilitation Planning 2018-2027

Table E-3 Major Rehabilitation Planning 2018-2027

Program Year	Network ID	Branch ID	Section ID	Surface	Area (SF)	PCI Before	Rehabilitation Type	Planning Cost
2018	FIN	AP	4105	PCC	23,645	0	PCC Reconstruction	\$ 355,000.00
2018	FIN	AP	4115	AC	20,847	25	AC Reconstruction	\$ 188,000.00
2018	FIN	AP	4120	PCC	9,798	14	PCC Reconstruction	\$ 147,000.00
2018	FIN	AP	4130	PCC	10,275	15	PCC Reconstruction	\$ 155,000.00
2018	FIN	AP RU 11	5103	AC	36,038	30	AC Reconstruction	\$ 325,000.00
2018	FIN	AP RU 11	5105	AAC	27,768	48	AC Restoration	\$ 204,000.00
2018	FIN	RW 6-24	6205	AAC	487,349	47	AC Restoration	\$ 3,679,000.00
2018	FIN	T-HANG	4305	PCC	8,395	46	PCC Restoration	\$ 100,000.00
2018	FIN	T-HANG	4310	AC	17,531	60	AC Restoration	\$ 123,000.00
2018	FIN	T-HANG	4315	AC	8,565	46	AC Restoration	\$ 66,000.00
2018	FIN	TW A	102	AAC	22,177	57	AC Restoration	\$ 156,000.00
2018	FIN	TW A	104	AAC	7,358	21	AC Reconstruction	\$ 67,000.00
2018	FIN	TW A	105	AC	184,752	32	AC Reconstruction	\$ 1,663,000.00
2018	FIN	TW A	110	AAC	17,576	22	AC Reconstruction	\$ 159,000.00
2018	FIN	TW B	205	AC	88,917	62	AC Restoration	\$ 623,000.00
2018	FIN	TW C	305	AAC	28,798	55	AC Restoration	\$ 202,000.00
2018	FIN	TW C	307	AC	11,213	28	AC Reconstruction	\$ 101,000.00
2018	FIN	TW E	520	AC	13,104	64	AC Restoration	\$ 92,000.00
2023	FIN	AP N	4405	PCC	30,077	63	PCC Restoration	\$ 301,000.00
2024	FIN	AP	4125	PCC	25,668	63	PCC Restoration	\$ 257,000.00
2025	FIN	AP GA	4510	PCC	17,338	64	PCC Restoration	\$ 174,000.00
2026	FIN	AP	4140	PCC	8,368	64	PCC Restoration	\$ 84,000.00

*All planning cost values have been rounded to the nearest thousand-dollar.

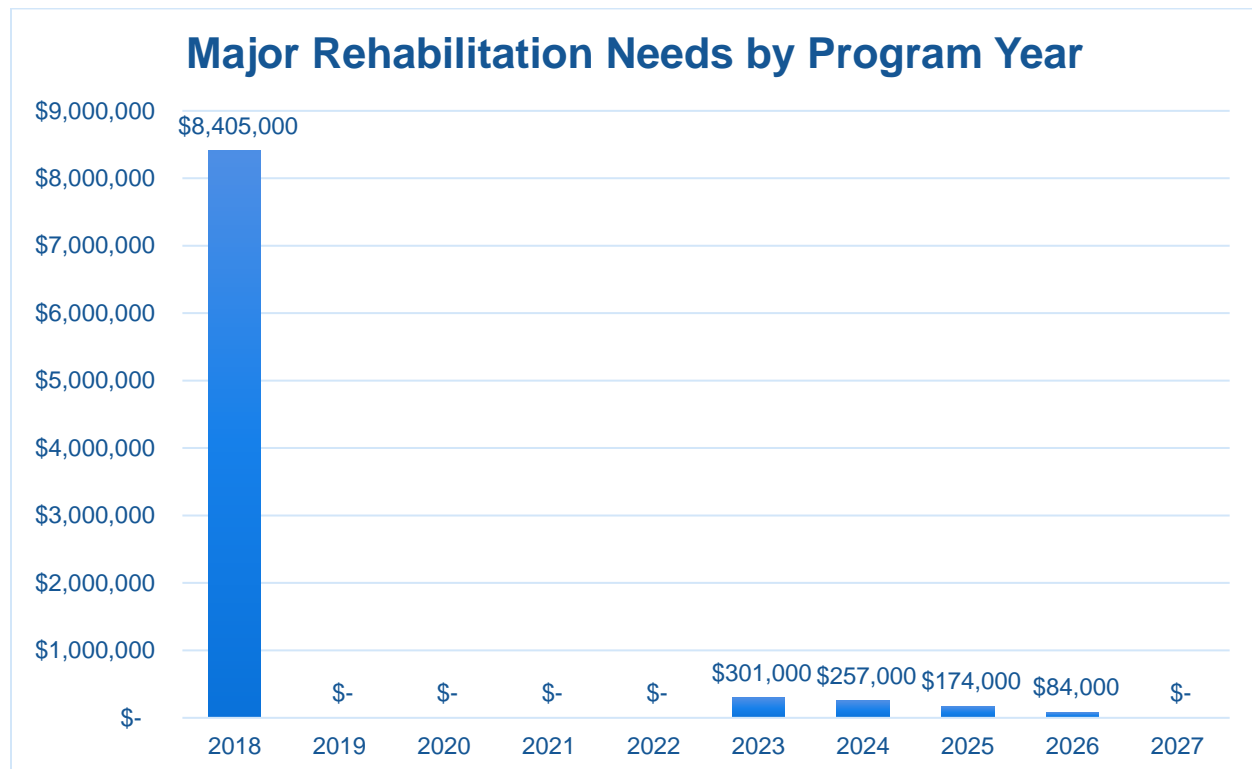
*Figure E-4 Major Rehabilitation Planning Annual Budget 2018-2027*

Summary of Flagler Executive Airport

Flagler Executive Airport was inspected in January 2017 – the overall weighted PCI value was 76, a condition rating of Satisfactory. The results of the maintenance, repair, and major rehabilitation analysis identified \$1,825,940 in localized M&R needs based on current conditions and a 10-Year major rehabilitation need of \$9,221,000 based on forecasted conditions. The current major rehabilitation needs based on the latest inspection consist of \$8,405,000 for pavements below critical condition.

Localized maintenance and repair identified within this report are categorized as preventive or stopgap; the FDOT SAPMP has defined maintenance policies based on FAA recommendations. Major rehabilitation is identified within the FDOT SAPMP as major construction activity that would result in an improvement or resetting of the pavement section's PCI to a value of 100. Such activities could include: mill and hot-mix asphalt overlay, rigid pavement repair and slab replacement, and full-depth reconstruction. It is recommended that the airport use this as a planning tool for future project development and prioritization – all localized maintenance and repair and major rehabilitation recommendations should be considered as planning-level only. All final localized maintenance, repair, and major rehabilitation is subject to change based on airport prioritization and further design-level evaluation.

Chapter 1

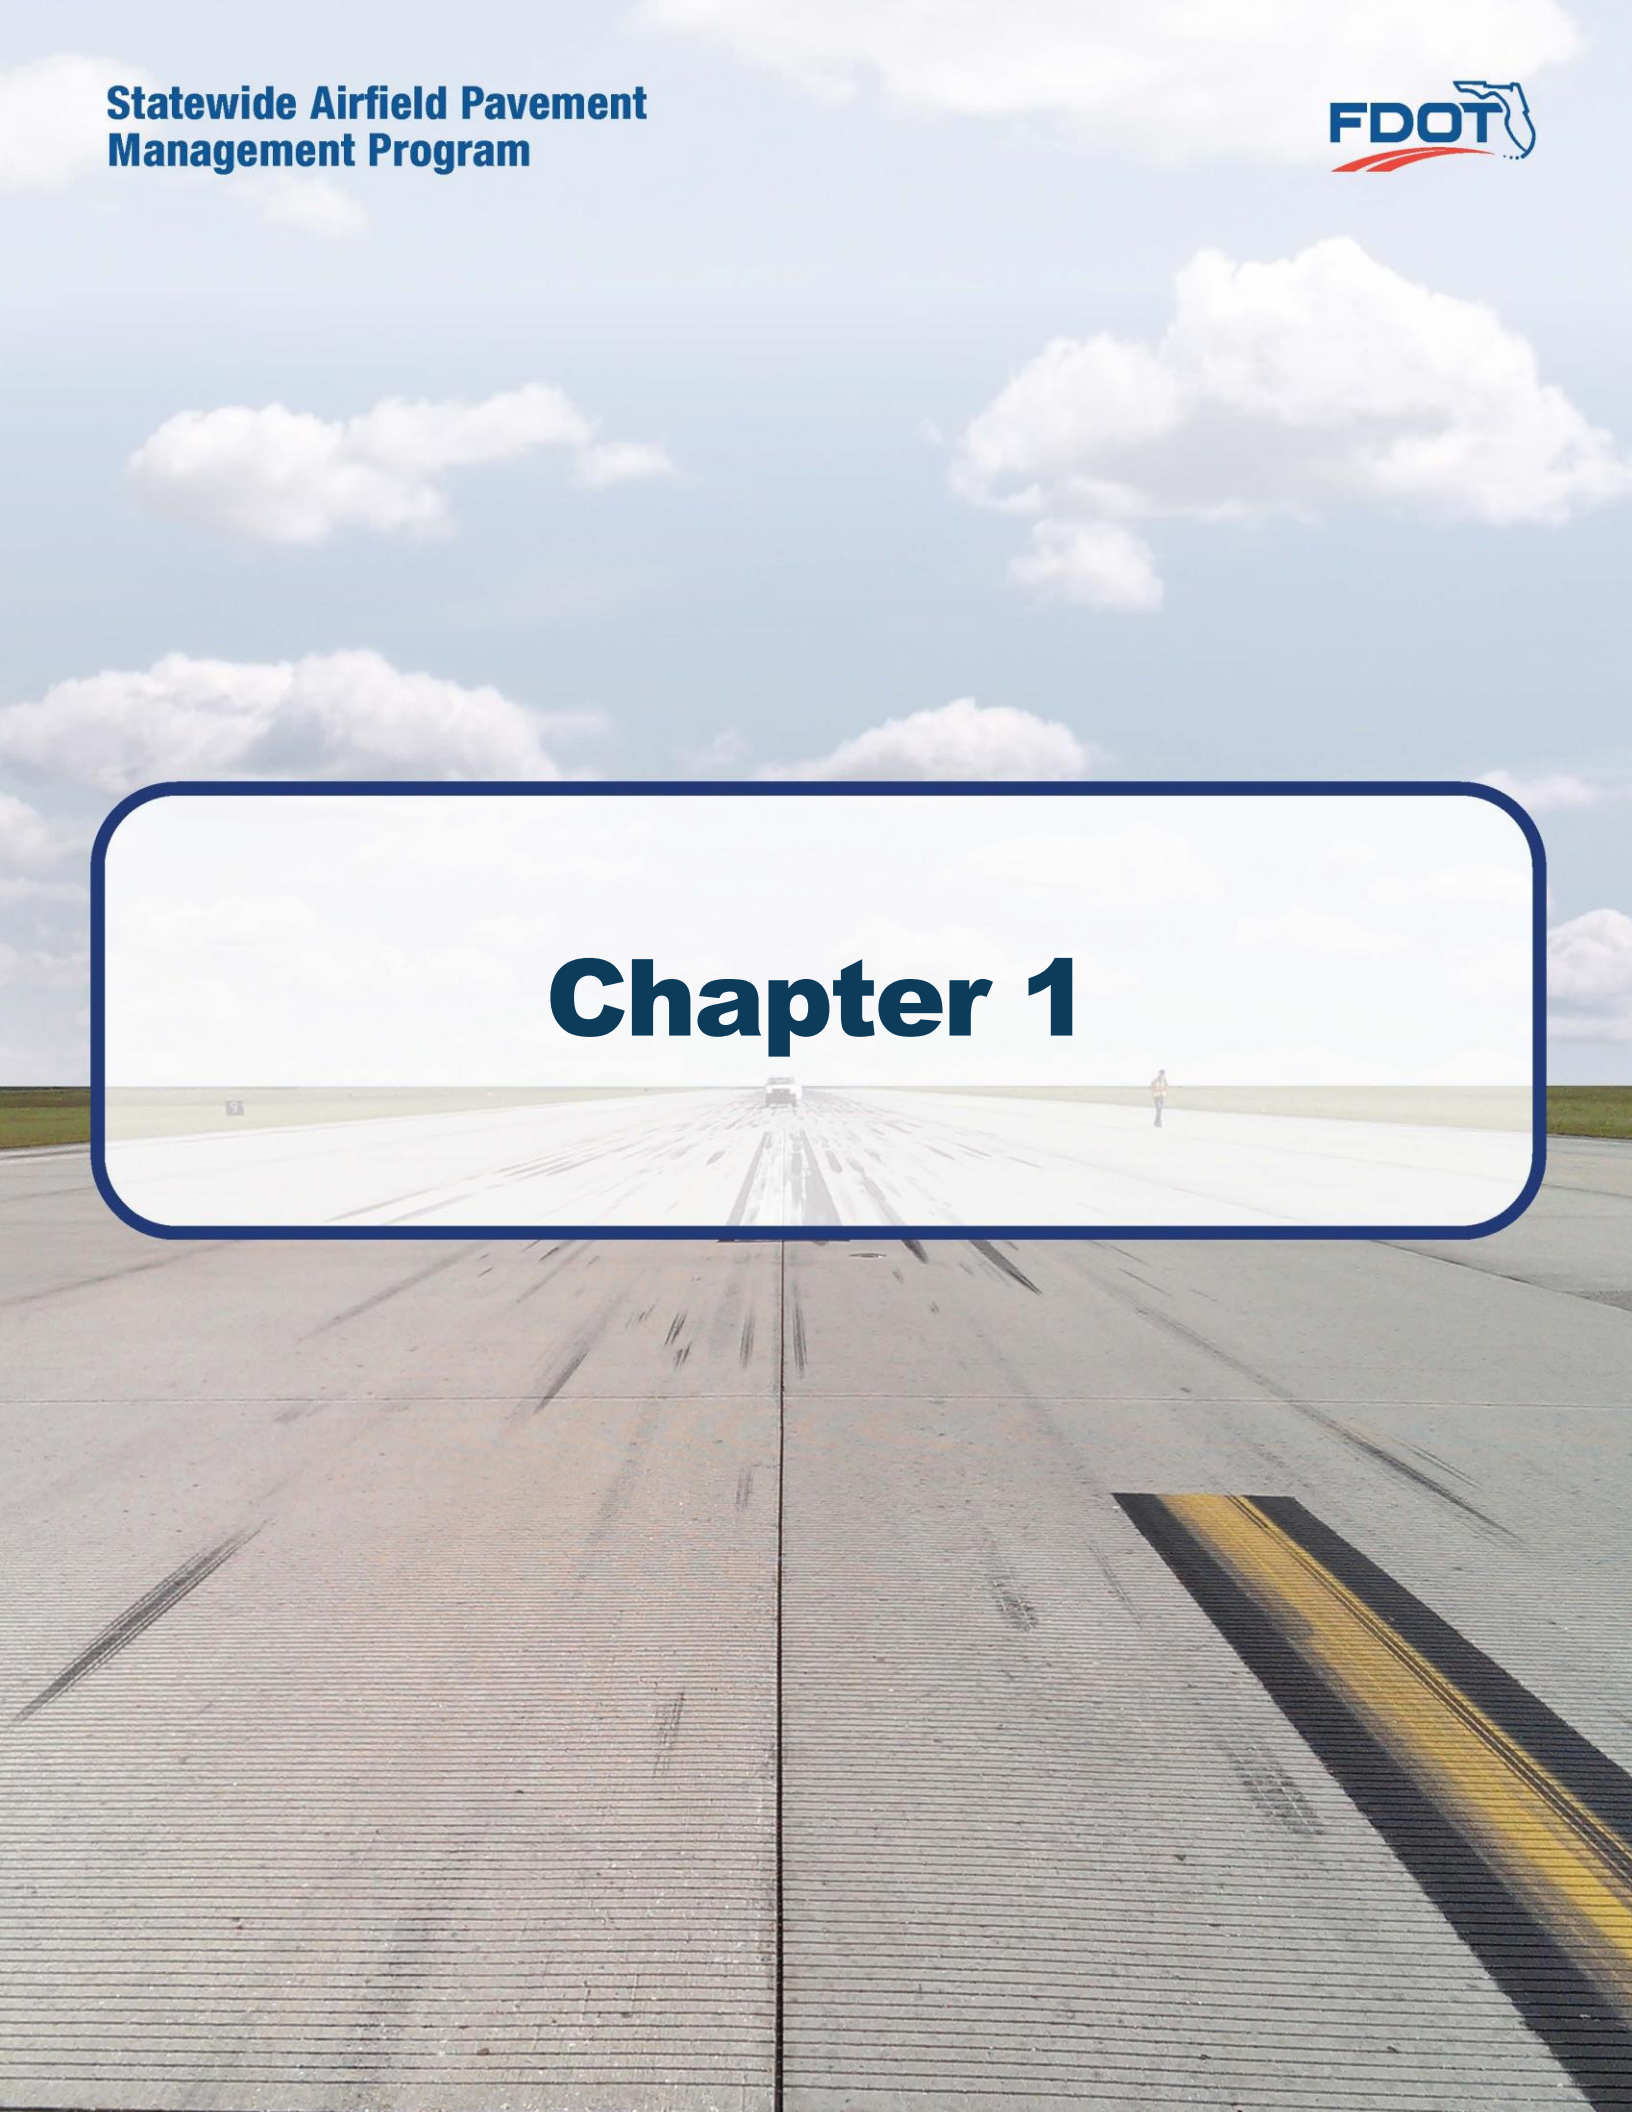



Chapter 1 – Introduction

1.1 Background

The State of Florida has 128 public airports of which 100 public-use airports are recognized as part of the Federal Aviation Administration's (FAA) National Plan of Integrated Airport Systems (NPIAS) that are vital to the Florida economy as well as the economy of the United States. The Florida Aviation System (FAS) provides opportunities for the State to capitalize on an increasingly global marketplace. Florida's system of commercial service and general aviation (GA) airports are important to businesses throughout the entire State. Air travel is essential to tourism, Florida's number one industry.

There are millions of square feet of pavement infrastructure that consists of runways, taxiways, aprons, ramps, and other areas of airports that are vital to the support and safety of aircraft operations. Timely pavement maintenance, repair and major rehabilitation of these pavements will support the airport in operating safely, efficiently, economically and without excessive down time.

In general, adherence to the FAA Advisory Circulars are mandatory for all projects funded with federal grant monies through the Airport Improvement Program (AIP) and with revenue from the Passenger Facilities Charges (PFC) Program. Further information is detailed in FAA Grant Assurance No. 11 "Pavement Maintenance," No. 34 "Policies, Standards, and Specifications," and PFC Assurance No. 9 "Standards and Specifications." The Florida Department of Transportation (FDOT) performs the Statewide Airfield Pavement Management Program (SAPMP) System Updates for the benefit of participating public-use and publicly owned airports through the Aviation and Spaceports Office (ASO).


The SAPMP addresses the requirements of maintaining an effective pavement management program for the participating airports at the network level. Network-level management of pavement assets provides insight for short-term and long-term budget needs, understanding of the overall condition of the network (current and future), and pavement facilities that are subject for project consideration. A network-level evaluation can be supportive in the identification of maintenance, repair, and major rehabilitation needs and budgetary planning-level opinions of probable construction costs.

1.2 Statewide Airfield Pavement Management Program (SAPMP) Update 2016-2017

In 1992, the FDOT established the Statewide Airfield Pavement Management Program (SAPMP) to provide program managers, District Aviation and Spaceport Offices, and airport operators a system to proactively manage airport airfield pavement infrastructure within the Florida Aviation System. The SAPMP performs network-level Pavement Condition Index (PCI) survey inspections for airport facilities that are categorized as General Aviation (GA), Reliever (RL), and Commercial (PR). Currently, the program consists of 95 actively participating public-use airports with pavement facilities and provides users with comprehensive data to better manage pavement assets.



Figure 1.2 Florida Aviation System (Facilities with Pavement) and FDOT Districts

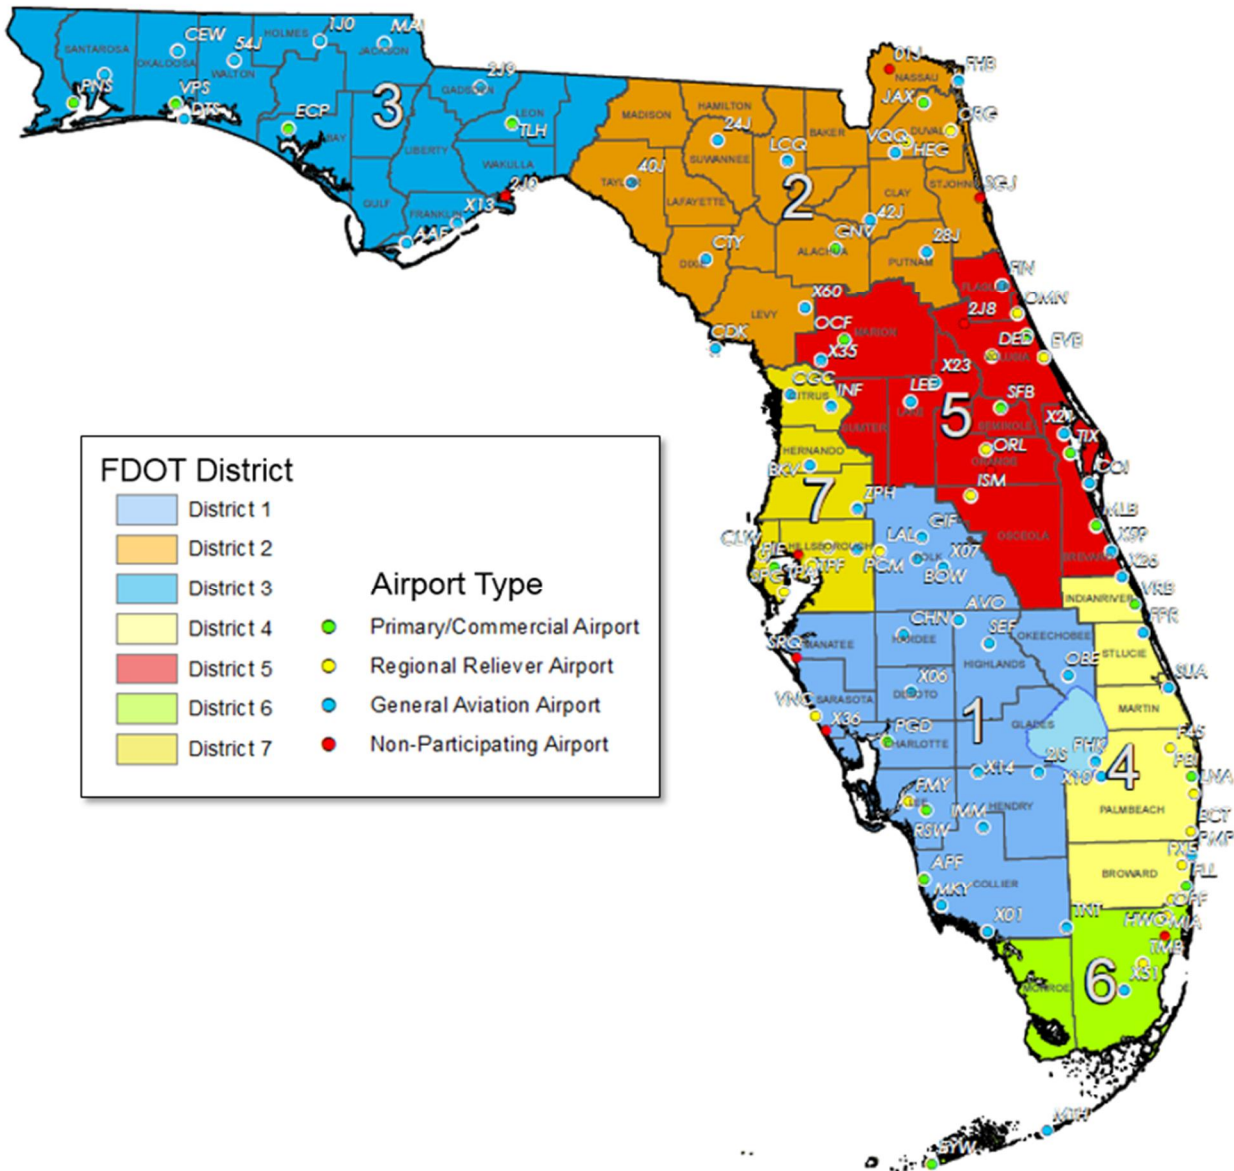

In 2016, the Florida Department of Transportation Aviation and Spaceports Office contracted Kimley-Horn and Associates, Inc. along with subconsultants Airfield Pavement Management Systems, LLC and AVCON, Inc. to provide professional services in support of FDOT in the continued efforts of performing a system update to the SAPMP. This work is to be completed from fiscal year 2016 through fiscal year 2019.



1.3 Organization

1.3.1 Florida Department of Transportation Aviation and Spaceports Office Program Manager

The FDOT Aviation and Spaceports Office (ASO) Aviation Engineering Manager serves as the Program Manager (ASO-PM) for the SAPMP. The ASO-PM monitors the work performed by the designated Consultant for the program. The ASO-PM has review and approval authority for each program task and manages the program's day-to-day details and pertinent updates.

The ASO-PM reports updates and milestones to the FDOT State Aviation and Spaceports Manager and Development Administrator.

1.3.2 Participating Florida Public-Use and Publicly Owned Airports

The airports are the end-user and beneficiary of the SAPMP. The SAPMP provides a specific Airport Pavement Evaluation Report that meets the requirements of the FAA Advisory Circular **150/5380-7B "Airport Pavement Management Program (PMP)."** Individual participating airports will be provided a final Airport Pavement Evaluation Report by the designated Consultant that is specific to each airport's airfield pavement condition index survey. The ASO-PM has full authority and final approval of each report prior to finalization. In advance of each PCI survey and prior to completion of each Airport Pavement Evaluation Report, participating airports are asked to provide the necessary record documentation for the proper analysis efforts. Relevant record documentation artifacts may consist of but are not limited to: Airport Layout Plans (ALP), Construction Bid Tabulations, As-Built Construction Drawings, Engineer's Reports, and/or field pavement inspection reports.

1.3.3 Florida Department of Transportation District Offices

The seven (7) FDOT District Offices, specifically the Aviation representatives (currently the Freight and Logistics personnel), provide essential support to the SAPMP update and the ASO-PM. Each District supports the SAPMP's on-going efforts by providing local construction cost information throughout the State. The construction cost information, typically consisting of plans and bid tabulations, are used as the basis of the development maintenance, repair, and major rehabilitation opinions of probable construction costs for planning purposes. Each District Office receives copies of individual Airport Pavement Evaluation Reports for the participating airport facilities located within their respective Districts.

1.3.4 Consultant

The Consultant, Kimley-Horn and Associates, Inc., provides technical and administrative support to the ASO-PM for the SAPMP update. The support consists of airfield pavement system inventory updates, performance of PCI Surveys in accordance with ASTM **D5340-12 "Standard Test Method for Airport Pavement Condition Index Surveys,"** evaluation and reporting of the pavement condition in accordance with the FAA Advisory Circular **150/5380-7B "Airport Pavement Management Program (PMP)."**

The Consultant Team consists of Kimley-Horn, Airfield Pavement Management Systems, LLC., and AVCON, Inc.



A brief description of the general scope of work undertaken to update the SAPMP includes but is not limited to:

- ▶ **Research and evaluation of existing record documentation** was performed to identify construction projects that have taken place since the most recent major update of the SAPMP. This data is used to update the pavement inventory and network definition.
- ▶ **An update to the existing Network Definition Map** was made to reflect geometric changes, pavement composition updates, and section characterization. Furthermore, an update to the PCI Survey sample units were made to reflect the field investigation efforts.
- ▶ **A functional pavement evaluation with PCI Survey inspections** was completed on all airfield pavements maintained by the Airport. The PCI Survey procedure, as defined by ASTM D5340-12, was used as the basis of the functional pavement evaluation. For this specific evaluation, the sample units defined by prior studies were inspected as to better develop performance models for prediction curves. Pavement subject to construction or anticipated construction during scheduled PCI Survey inspection or within 2 years were omitted from inspection based on confirmation of airport personnel.
- ▶ **Condition Analysis** was performed based on the distress data observed, rated, measured, and recorded in accordance with the ASTM D5340-12 for the calculation of PCI values and ratings. The results of the current condition analysis were used in concert with the historic PCI Survey data and construction work history to develop performance models to forecast future PCI values for each section for a 10-year study duration.
- ▶ **Maintenance, Repair, and Rehabilitation Planning** was performed predicated on the results of the condition analysis with updated policies and planning-level unit costs. The policies, or M&R policies, have been updated to reflect standard practices for maintenance, repair, and major rehabilitation as defined by the FAA **AC 150/5380-6C “Guidelines and Procedures for Maintenance of Airport Pavements.”** Planning-level unit costs were developed based on representative construction bid tabulations provided by participating airports. The bid tabulations consisted of limited airfield pavement construction projects that took place between 2009 and 2015 at participating airports.



1.4 Purpose of Airport Pavement Evaluation Report

The individual airport airfield pavement evaluation report discusses the work performed, a summary of findings, condition analysis results, and recommendations for maintenance, repair, and major rehabilitation (M&R) planning associated with the SAPMP system update. It also briefly describes the procedures used to ensure that the appropriate engineering and scientific standards of care, quality, budget, schedules, and safety requirements were implemented during the performance of this work.

The purpose of this Airfield Pavement Evaluation Report is to achieve the following:

- Describe the goals, procedures, and purpose of the SAPMP
- Provide a brief technical explanation of the pavement management methodology, standard practices, and objectives
- Analyze pavement distresses data for the determination of pavement conditions and for identification of airfield pavement maintenance, repair, and major rehabilitation needs based on functional PCI trends

The identification of rehabilitation needs has been determined at the planning level. Design-level investigation is recommended prior to developing construction-level design documents and budgets.

In compliance with FAA Grant Assurances 11 and 19; the FDOT SAPMP provides airports with airfield pavement evaluation reports in accordance with FAA **AC 150/5380-7B Airport Pavement Management Program (PMP)** and **AC 150/5380-6C Guidelines and Procedures for Maintenance of Airport Pavements**. The application of the results of a PCI survey are for planning purposes and are limited to the visual observation of deteriorated pavements in limited sampling; design-level investigation is recommended in accordance with the FAA procedures defined in **AC 5320-6F Airport Pavement Design and Evaluation** and **AC 150/5370-11B Use of Nondestructive Testing in the Evaluation of Airport Pavements**. The aforementioned ACs provide the design-level material properties of in-situ pavement and subgrade layers for the determination of appropriate rehabilitation actions. The FDOT Statewide Airfield Pavement Management Program is organized to provide airports with planning-level data and does not intend to preclude the responsible engineer in performing the appropriate level of investigation and analysis in determining the appropriate design details of a pavement rehabilitation. It would not be advisable to solely base design-level rehabilitation without the appropriate level of investigation and determination of pavement deterioration beyond that of a visual functional condition assessment.

1.5 History of the Program

In 1992, the FDOT implemented the SAPMP to understand the pavement conditions at public airports in the FAS, systematically update pavement infrastructure information, and assist airport operators with recommendations of pavement maintenance, repair, and major rehabilitation needs. The 1992 SAPMP implementation provided the FDOT and the participating airports valuable information for establishing and performing timely and appropriate pavement rehabilitation.



During the 1992-1993 implementation and again during the 1998-1999 updates; the SAPMP performed the development with proprietary software for pavement management system analysis. This development allowed for the creation of pavement management database file system populated with airport attributes and condition data. The pavement management database was used to establish maintenance, repair, and rehabilitation policies; consider planning-level unit costs; and develop recommendations for performing pavement maintenance. This system, known as AIRPAV, was initially developed during the 1992-1993 SAPMP implementation for the analysis of distress data. The AIRPAV system was used again in the 1998-1999 SAPMP update.

In 2004, the SAPMP system update included the review of the AIRPAV software compared to other industry available non-proprietary software packages. As a result of this review, MicroPAVER™ (currently known as PAVER™) was selected for implementation of the system update. MicroPAVER™ was developed by the U.S. Army Corps of Engineers Construction Engineering Research Laboratory for pavement management. Data from the 1998-1999 FDOT SAPMP update, which was built upon the initial 1992-1993 implementation of AIRPAV, was reviewed and converted to be compatible with the MicroPAVER™ system. This data conversion included all documented pavement facilities, classifications, types, histories, geometries, PCI condition data and pertinent attributes gathered from airport feedback at the time. This information was used to develop the inventory of each participating airport's pavement facilities in a consistent format. This was the development of Airfield Pavement Network Definition Exhibits. These inventory exhibits visually depicted the branch, section, and sample units that were based upon the pavement construction history and composition information provided by each airport.

In the 2006-2008 system update, the SAPMP was updated again with continued use of the MicroPAVER™ system. Based on the distress data collected, a maintenance repair and major rehabilitation planning program was developed for each airport. As part of this SAPMP update, the procedures for the inspection and the collection of the pavement distress data were documented, and an interactive website (<http://www.dot.state.fl.us/aviation/pavement.shtm>) was established for input of data.

In the 2010-2012 system update, the SAPMP was updated using new global positioning system (GPS) integrated technology to digitally collect pavement distress data. Interactive geographic information system (GIS) map files were developed from updated Airfield Pavement Network Definition Exhibits to aid pavement condition inspectors in the collection of sample distress data. The data collected was utilized to develop pavement performance models to predict future pavement PCI values and make recommendations for major rehabilitation.

In the 2013-2015 system update, the SAPMP integrated PAVER™ and FieldInspector™ with the use of GPS and GIS capable field tablets. Furthermore, the update included continued adherence to the ASTM **D5340-12 "Standard Test Method for Airport Pavement Condition Index Surveys."** The ASTM update consisted of refinement of distress definition types and deduction values for select asphalt concrete and Portland Cement Concrete distresses.



1.6 Federal Aviation Administration (FAA)

Currently, airports participating in the Airport Improvement Program (AIP) Grant Program are required by the FAA to develop and implement a pavement maintenance program to be eligible for funding (FAA Advisory Circular **150/5380-6C “Guidelines and Procedures for Maintenance of Airport Pavements”** and **150/5380-7B “Airport Pavement Management Program (PMP)”**). This program requires detailed inspection of airfield pavement conditions by trained personnel. The inspections are required to be performed at least once a year using the PASER method or every three years if the pavement is inspected as defined by the PCI survey procedure in accordance with the ASTM **D5340-12 “Standard Test Method for Airport Pavement Condition Index Surveys.”**

In general, adherence to the Advisory Circulars are mandatory for all projects funded with federal grant monies through the AIP program and with revenue from the Passenger Facilities Charges (PFC) Program. Further information is detailed in FAA Grant Assurance No. 11 “Pavement Maintenance,” No. 34 “Policies, Standards, and Specifications,” and PFC Assurance No. 9 “Standards and Specifications.”

1.7 FDOT SAPMP Objectives and Components

The FDOT SAPMP is a program that provides the FAS support in implementing and/or maintaining a network-level Pavement Management Program in a consistent and regularly scheduled manner.

In accordance with FAA AC **150/5380-7B “Airport Pavement Management Program (PMP)”** an effective Pavement Management Program consists of a system that achieves specific objectives. The FDOT SAPMP objectives are as follows:

1.7.1 Program Objectives

- 1 A systematic means for collecting and storing information regarding existing pavement structure and condition.
- 2 An objective and repeatable system for evaluating pavement condition.
- 3 Procedures for predicting future pavement condition.
- 4 Procedures for modeling both past and future pavement performance conditions.
- 5 Procedures to determine the budget requirements to meet management objectives, such as the maintenance, repair, and major rehabilitation budget required to keep a pavement at a specified PCI level or the budget required to improve to target PCI level.
- 6 Procedures for formulating and prioritizing maintenance, repair, and major rehabilitation projects.

The objectives are accomplished by the following components:

1.7.2 Program Components

- A. Database
- B. Pavement Inventory
- C. Pavement Structure
- D. Pavement Work History
- E. Pavement Condition Data




F. Pavement Performance Modeling for the Prediction/Forecast of PCI

G. Maintenance, Repair, and Major Rehabilitation Policies and Budget Simulation

A well-maintained network-level pavement management program may provide airport staff a better understanding of the airfield pavement performance for developing and planning for specific maintenance, repair, and major rehabilitation projects. The understanding of specific distress types and severities will assist the airport in addressing pavement maintenance and repair with the appropriate treatments as defined by the FAA Advisory Circular **150/5380-6C “Guidelines and Procedures for Maintenance of Airport Pavements.”** The development of projects with an understanding of system inventory, deterioration details, and pavement condition forecasts may assist airport staff in developing practical rehabilitation actions and budgets. Furthermore, the understanding of pavements’ past performance and forecasted condition may assist airport staff in addressing pavement rehabilitation in a timely and cost-effective manner. **Figure 1.7-1 Typical Pavement Condition Life Cycle**, which is based on the FAA Advisory Circular **150/5380-7B “Airport Pavement Management Program (PMP).”** **Figure 1.7-1 Typical Pavement Condition Life Cycle**, depicts a general duration of a pavement section and identifies the ideal condition to perform rehabilitative treatments at an optimal cost rather than allowing significant increase in rate of deterioration that would result in increased costs.

Figure 1.7-1 Typical Pavement Condition Life Cycle

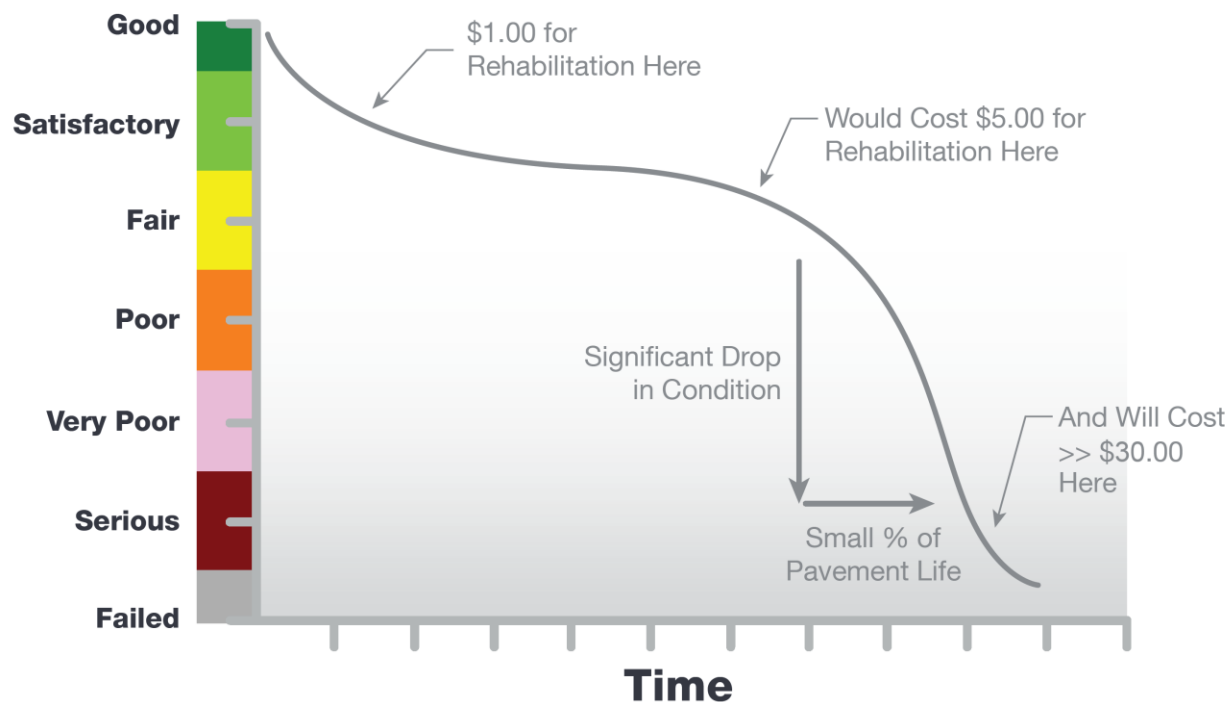


**Figure is for conceptual purposes only – unit costs are not specific to airfield pavements (AC vs PCC).*

Figure 1.7-2 General Pavement Treatments by Condition Range depicts generic flexible asphalt concrete (AC) pavement treatments that are effective at specific condition ranges. This graphic is a general concept and will vary based on pavement surface type and overall



composition. The intent is to convey various treatment types that would be effective based on the condition of the pavement along the deterioration model.

Figure 1.7-2 General Pavement Treatments by Condition Range

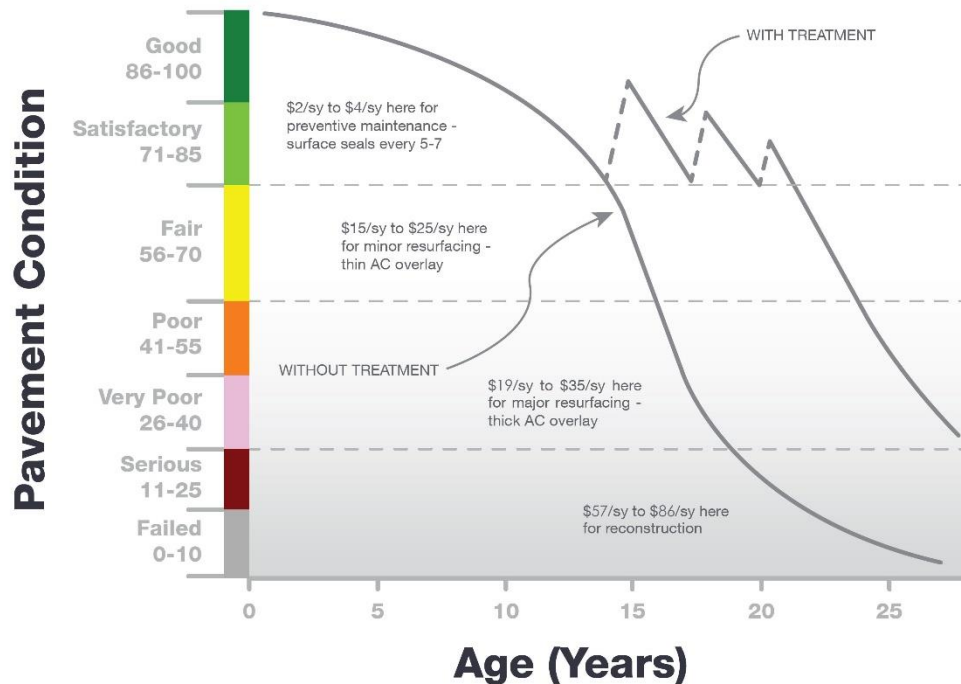

Pavement maintenance, repair, and major rehabilitation would be quite anticipatory if all pavements behaved as depicted in **Figures 1.7-1 and 1.7-2**, however pavement condition performance vary significantly based on several factors. Factors that contribute to a pavement section's condition and deterioration performance may include: functional design life, material type, material construction quality, climatic conditions, aircraft loading type and frequency, non-aircraft loading type and frequency, maintenance history, subgrade conditions, and other infrastructure in the vicinity. The list of factors is not all-inclusive of all factors that may contribute to a pavement's life cycle, it is intended to clarify that unique conditions certainly will affect a pavement's deterioration.

Figures 1.7-3 and Figure 1.7-4 depict visual conditions of pavement facilities, for both AC and PCC respectively, with approximated PCI ranges and corresponding repair and rehabilitation measures.



Figure 1.7-3 Flexible Asphalt Concrete









	PCI Range	Representative PCI	Representative Pavement Surface	Rehabilitation Activities
Routine Maintenance	86-100	90		Pavements with PCI values above 85, or 'Good', may require periodic joint/crack sealing and local patching.
Pavement Preservation	65-85	70		Pavements with PCI conditions ranging from 'Fair' to 'Satisfactory' may require surface treatments (seal coat), thin overlays, and/or joint/crack sealing.
Major Rehabilitation	40-64	50		Pavements that have deteriorated below a PCI 65, or within the range of 'Very Poor' to 'Fair' conditions, may require major rehabilitation such as pavement mill and overlay or partial full-depth reconstruction.
Major Reconstruction	0-39	15		Pavements that have deteriorated below a PCI 40, or within the range of 'Failed' to 'Very Poor' conditions, may require major reconstruction.

Figure 1.7-4 Rigid Portland Cement Concrete

	PCI Range	Representative PCI	Representative Pavement Surface	Rehabilitation Activities
Routine Maintenance	86-100	90		Pavements with PCI values above 85, or 'Good', may require periodic joint/crack sealing and local patching.
Pavement Preservation	65-85	70		Pavements with PCI conditions ranging from 'Fair' to 'Satisfactory' may require patches and/or joint/crack sealing.
Major Rehabilitation	40-64	50		Pavements that have deteriorated below a PCI 65, or within the range of 'Very Poor' to 'Fair' conditions may require major rehabilitation such as slab replacement and PCC restoration activity.
Major Reconstruction	0-39	15		Pavements that have deteriorated below a PCI 40, or within the range of 'Failed' to 'Very Poor' conditions, may require major reconstruction.




1.8 References

The following reference documents were referenced as specific guidelines and procedures for maintaining airport pavements; establishing an effective pavement maintenance program; and identifying specific pavement distresses, probable causes of distresses, inspection guidelines, and recommended methods of repair:

- ASTM D5340-12 “Standard Test Method for Airport Pavement Condition Index Surveys.”
- FAA Advisory Circular 150/5380-7B 150/5380-7B “Airport Pavement Management Program.”
- FAA Advisory Circular 150/5380-6C “Guidelines and Procedures for Maintenance of Airport Pavements.”
- FAA Advisory Circular 150/5320-6F “Airport Pavement Design and Evaluation.”
- Department of the Air Force, Air Force Civil Engineer Center “Engineering Technical Letter (ETL) 14-3: Preventive Maintenance Plan (PMP) for Airfield Pavements.”
- Unified Facilities Criteria (UFC) 3-260-16FA 16 “Airfield Pavement Condition Survey Procedures Pavements.”
- Unified Facilities Criteria (UFC) 3-260-03 “Airfield Pavement Evaluation.”
- Pavement Management for Airports, Roads, and Parking Lots 2nd Edition, M.Y. Shahin.

Chapter 2

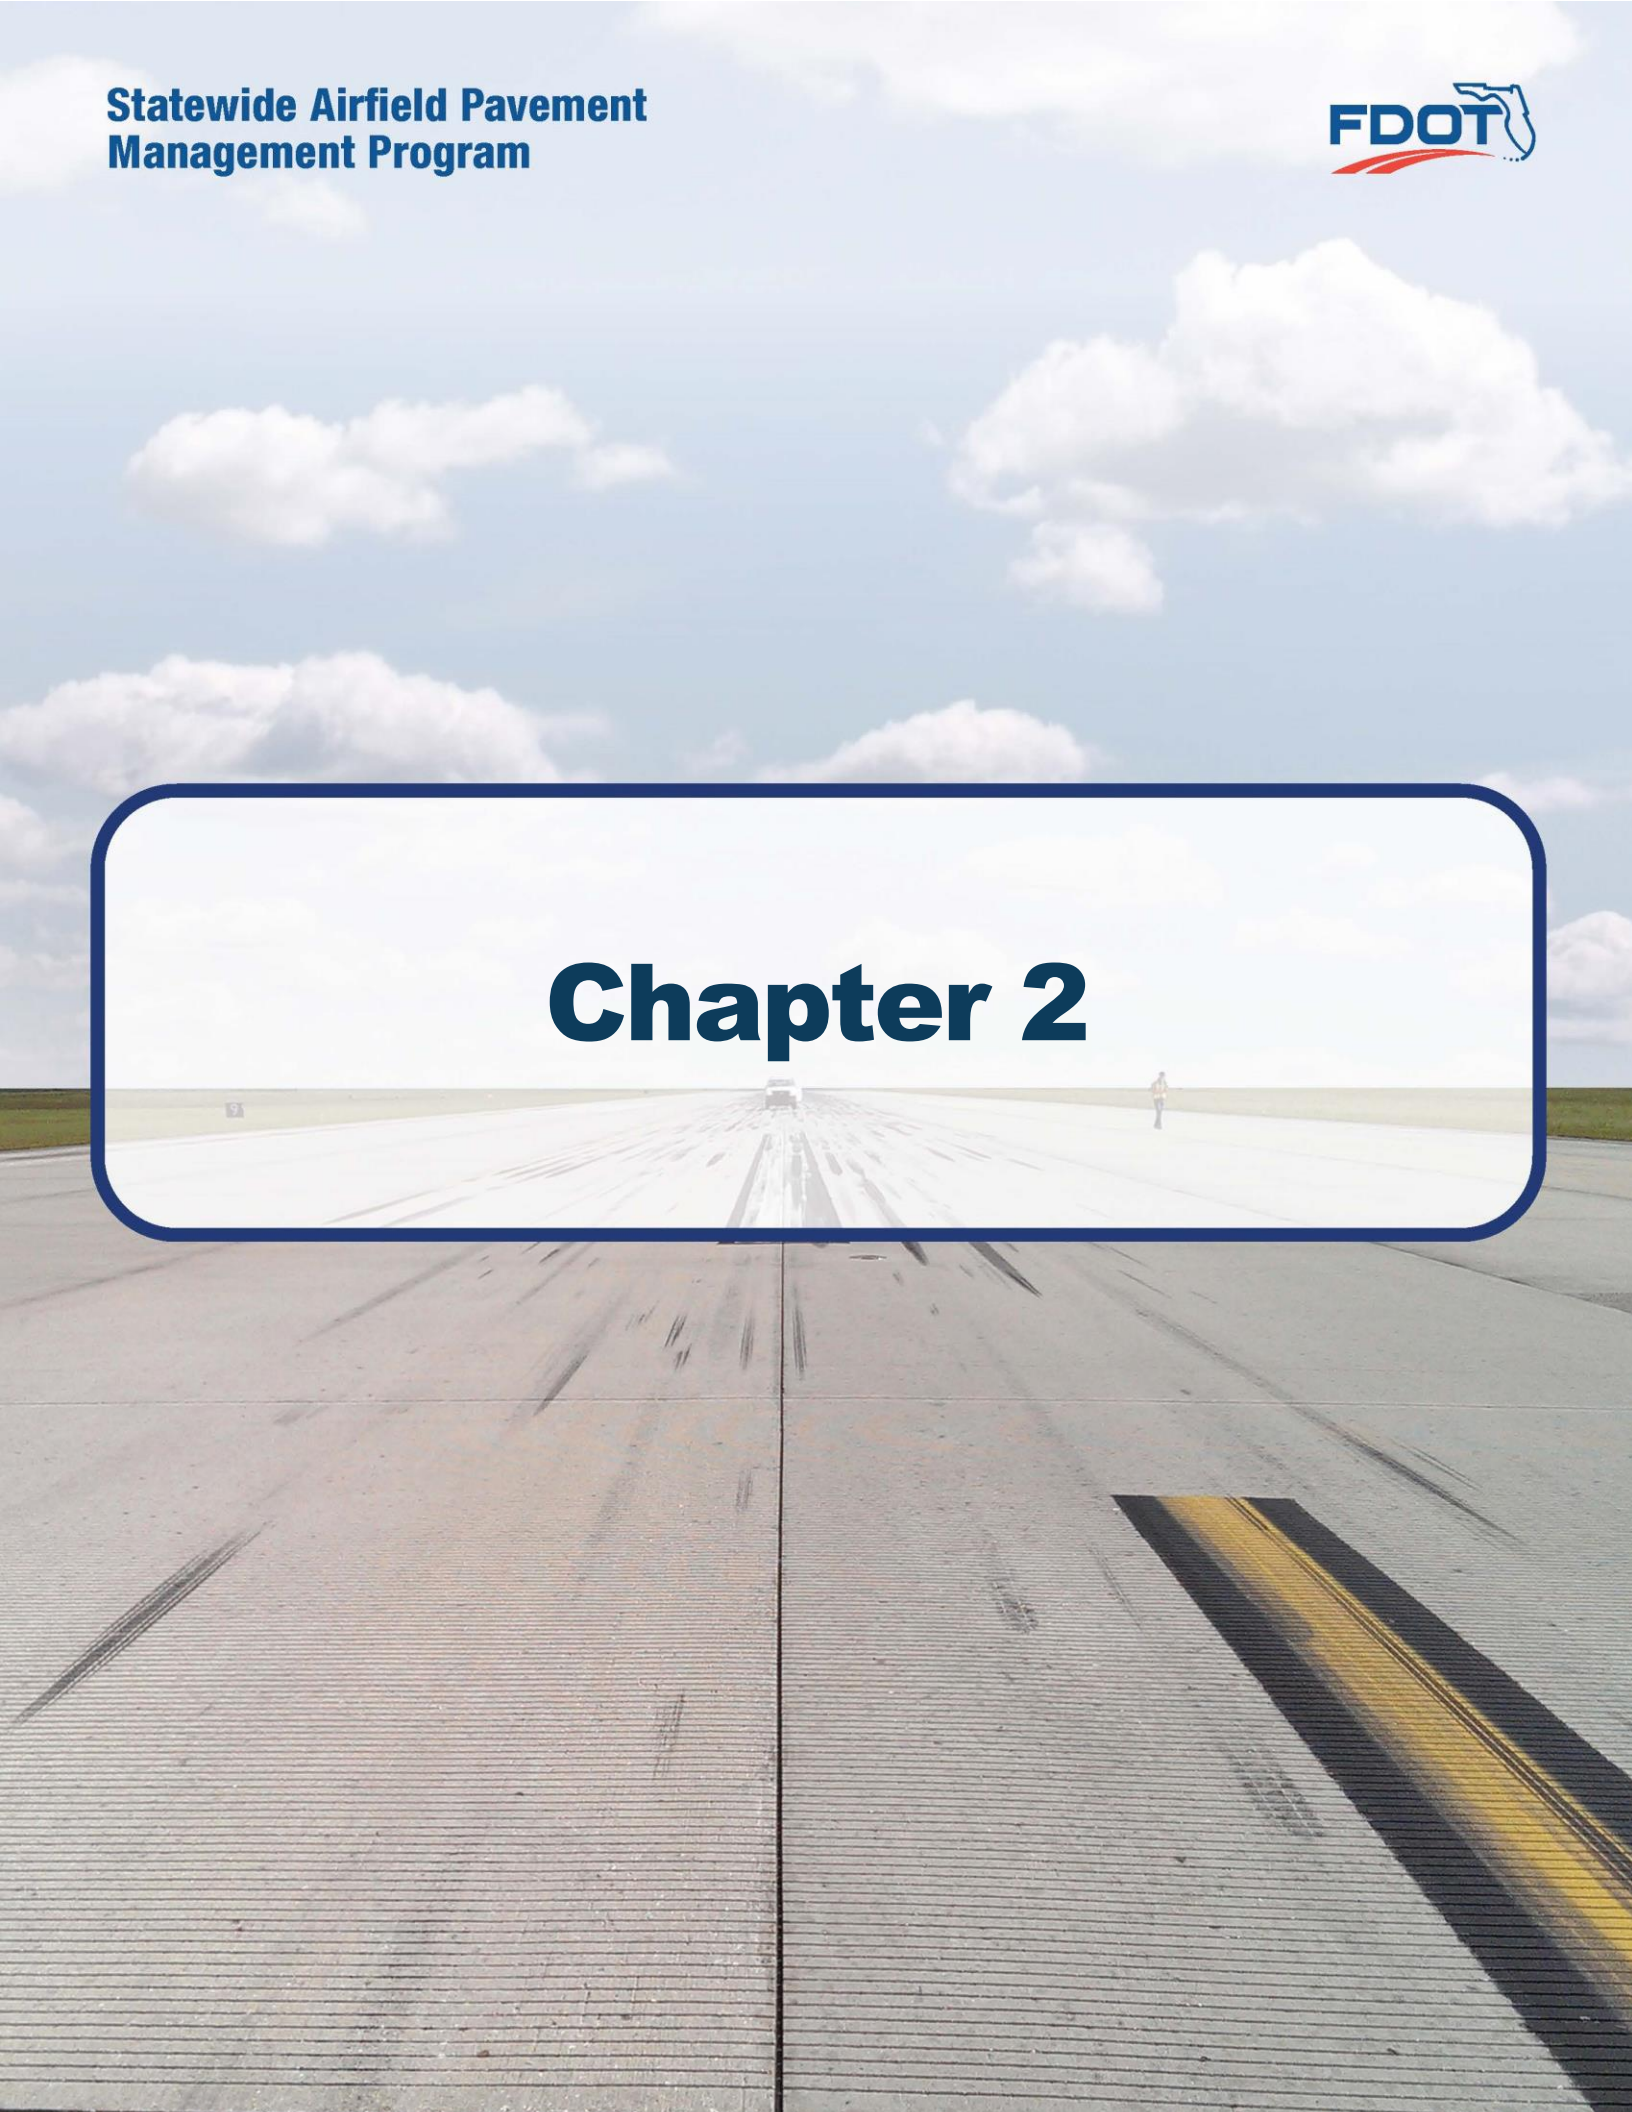



Chapter 2 – Methodology

An effective pavement management program incorporates the regular collection of pavement condition information and communication of information to appropriate sponsors. This chapter of the report defines the specific methods utilized as part of the SAPMP System Update to meet the requirements of an effective pavement management system as defined by the FAA Advisory Circular **150/5380-7B “Airport Pavement Management Program (PMP).”**

2.1 Airfield Pavement Database

The SAPMP program has historically utilized PAVER™ (formerly MicroPAVER™); the current update has maintained the use of the PAVER™ 7.0 version of the software. The PAVER™ software application was developed by the U.S. Army Construction Engineering Research Laboratory sponsored by the FAA, Federal Highway Administration, U.S. Army, U.S. Air Force, and the U.S. Navy to meet the objectives of an effective pavement management system. The SAPMP consists of a network-level database of the airport's airfield pavement facilities that are part of the program. PAVER™ can achieve the following pavement management objectives: a manageable inventory system, the analysis of the current condition of pavements in accordance with the ASTM D5340, the development of pavement performance models to forecast conditions, and the development of maintenance, repair, and major rehabilitation recommendations based on budgetary scenarios.

PAVER™ inventory management is based on a tiered organizational structure that consists of networks, branches, and sections, with the section being the smallest unit of management. Critical elements of an effective pavement management program are maintained within the network-level PAVER™ database. These elements typically consist of pavement inventory characteristics, pavement structure, work history, historic condition records, and analytical customization.

The SAPMP System Update consisted of the conversion of the previous database from a PAVER™ version 6.5 to a version 7.0.

2.2 Airfield Pavement System Inventory

An airfield pavement system inventory typically maintains the location of all runways, taxiways, and aprons; geometric characteristics; type of pavement structure, year of construction and/or last major rehabilitation; and general composition details of the pavement.

The pavement inventory for an airport's airfield is an assembly of pavement infrastructure information that builds an inventory of branches and sections that codifies the airport's airfield pavement network. General geometry characteristics, estimated length, width, functional classification, pavement surface type, and operational function are among the characteristics identified at this initial phase in the pavement management process. The development of a pavement inventory that reasonably reflects the airport's airfield pavement facilities that are maintained by the airport provides a defined scope of the inspection and analysis efforts. As in the past, the SAPMP scope of work is specific to the airport-maintained airfield pavements as defined in the field network definition exhibits presented to current airport personnel.



A critical input to the pavement system inventory and network definition in the development of the SAPMP update is the date of last major rehabilitation/construction performed on the pavement assets that would set the asset at a PCI of 100 and a condition rating of Good. The airport provided a limited combination of record drawings, reports, and staff input that was pertinent information in developing the construction history of the airport's pavements from inception. Major rehabilitation/construction activities performed in the last 24-months or anticipated in the next 24-months are assumed to restore the PCI to 100. These activities include; pavement overlay, mill and replace, mill and overlay, new construction, and/or complete reconstruction.

Aerial imagery was obtained through the FDOT Surveying & Mapping Office's *Aerial Photo Look Up System (APLUS)*. This spatially projected imagery was utilized with computer-aided drafting software (AutoCAD) in concert with geographical information system software (ArcGIS) to develop a planning-level representative model that reasonably reflects the pavement assets at the airport.

2.2.1 Pavement Management Program Network Definition Terminology

There are several terms that are common in the communication of the results of the SAPMP System Update, these terms are defined as follows:

Pavement Network

A pavement network is a logical unit for organizing pavements into a structure for pavement management. A network will typically consist of one or more pavement *branches*, which are typically comprised of one or many pavement *sections*. The network is the starting point of the hierarchy of pavement management organization. For example, a network can be all the pavements within an airport's airfield or all the pavements in a statewide program. For the FDOT SAPMP, a network represents an individual airport's airfield pavement facilities maintained by the airport.

The SAPMP System Update consists of research and evaluation of existing record documentation for the participating airports' airfield facilities. The pavement network is typically limited to the pavement facilities subject to aircraft use that is also maintained by the airport owner and eligible for public funding.

Pavement Branch

A pavement branch, also known as a facility, is a logical unit of generally identifiable pavement of a network with distinct functional classification. For example, within an airfield each runway, taxiway, or apron is considered a branch. A branch must consist of at least one section.

Pavement Section

A pavement section, also known as a feature, is the most specific management unit when considering the application and selection of maintenance, repair, and/or major rehabilitation treatments on an area of pavement within a branch. Each branch consists of at least one section, but may consist of more if pavement feature characteristics are distinct throughout the branch. Characteristics considered when subdividing branches into sections include, but are not limited to: pavement structure, type, age, condition, and function; traffic composition and frequency (current and future); geometric location; construction history; and other related



infrastructure features (e.g. drainage). A pavement section is defined as a subordinate of a pavement branch, which is a subordinate of a “parent” pavement network.

Pavement Sample Unit

A pavement sample unit is a subdivision of a pavement section that has a standard size range: twenty (20) continuous slabs (± 8 slabs) for Portland Cement Concrete (PCC) pavement and 5,000 contiguous square feet ($\pm 2,000$ ft²) for flexible asphalt concrete (AC) or porous friction course pavements.

Table 2.2.1 Airfield Pavement Database Network Definition Terminology

PMS Network Level	Common Definition	Airport Example
Network	Overall pavement assets maintained by the Airport	“Tallahassee International Airport – Airfield Pavements”
Branch Name	Commonly defined asset name as established by Airport and by use	“Runway 18-36”
Branch ID	Codified shorthand name for commonly defined asset established for database identification	“RW 18-36” RW, Branch Use, “Runway” 18-36, Runway Facility
Section ID	Codified identification for pavement asset that is distinct by the following: <ul style="list-style-type: none"> • Pavement Composition • Construction Work History • Aircraft Traffic • Condition Records 	“6105”
Sample Unit	A numeric identification of an area of pavement (5,000 \pm 2,000 SF of AC or 20 \pm 8 slabs of PCC) that has been inspected in accordance with ASTM D5340-12.	“300”



2.3 Airfield Pavement Structure

2.3.1 Pavement Structure Types

Airport airfield pavements are constructed to provide adequate support for the loads imposed by aircraft and produce a firm, stable, smooth, all-year, all-weather surface free of debris or other particles that may be blown or dislocated by propeller wash or jet blast. Typical pavement planning and design requires coordination of factors that include but are not limited to; subgrade conditions, material layer types, aircraft fleet mix (type, frequency, and traffic growth), and functional use. A pavement structure is composed of constructed layers that consist of subgrade, subbase, base course, structural courses, and surfaces courses. For the FDOT SAPMP, two major pavement structure types are classified for evaluation and analysis: Flexible Asphalt Concrete Surface and Rigid Portland Cement Concrete Surface. Additionally, Composite Structures known as Whitetopping Pavements are also present at limited airports within the Florida Airports System; these unique pavement structures are evaluated separately.

Flexible Asphalt Concrete Surface

A pavement comprised of aggregate mixture with an asphalt cement binder. The FDOT SAPMP consists of three (3) asphalt concrete surface types: Asphalt Concrete (AC), Asphalt Concrete Overlaid on Asphalt Concrete (AAC), and Asphalt Concrete Overlaid on Portland Cement Concrete (APC).

Asphalt Concrete (AC)

A flexible pavement section consisting of aggregate mixture with asphalt cement binder layered on engineered base course material that is layered on subbase and subgrade soil material.

Asphalt Concrete Overlaid on Asphalt Concrete (AAC)

A flexible pavement section consisting of aggregate mixture with asphalt cement binder layered on an existing flexible AC pavement section. Flexible airfield pavement sections are AAC when a pavement rehabilitation consists of a pavement milling operation and a resurfacing of asphalt layers; or a direct overlay of asphalt concrete without surface preparation.

Asphalt Concrete Overlaid on Portland Cement Concrete (APC)

A flexible pavement section consisting of aggregate mixture with asphalt cement binder layered on an existing Rigid PCC pavement section. This unique pavement composition may result in distinct pavement distress manifestations known as reflective joint cracking.



Rigid Portland Cement Concrete Surface

A pavement comprised of aggregate mixture with a Portland Cement binder. The FDOT SAPMP recognizes Portland Cement Concrete (PCC) as the primary rigid pavement section.

Portland Cement Concrete (PCC)

A rigid pavement section composed of Portland cement concrete placed on a granular or treated base course that is supported on a compacted subgrade. The concrete surface must provide a texture of nonskid qualities, prevent the infiltration of surface water into the subgrade, and provide structural support to the airplanes. Rigid pavement construction requires the layout of appropriately designed joint spacing.

Composite Structure – Whitetopping Pavement

A composite pavement comprised of relatively thin Portland Cement Concrete overlaid on an existing flexible asphalt concrete pavement structure. There are three (3) types of Whitetopping Pavements; Conventional (WHT), Thin (TWT), and Ultra-Thin (UTW).

Conventional Whitetopping (WHT)

A composite pavement structure consisting of a modified PCC overlaid on an existing flexible AC pavement section area. The modified PCC layer is typically greater than 6-inches in thickness.

Thin Whitetopping (TWT)

A composite pavement structure consisting of a modified PCC overlaid on an existing flexible asphalt concrete pavement section. The modified PCC layer is typically between 4 and 6 inches in thickness.

Ultra-Thin Whitetopping (UTW)

A composite pavement structure consisting of a modified PCC overlaid on an existing flexible asphalt concrete pavement section. The Portland Cement Concrete layer is typically between 2 and 4 inches in thickness.



2.4 Airfield Pavement Work History

2.4.1 Airfield Pavement Record Keeping

It is strongly recommended that airports maintain records of all airfield construction and maintenance related to the pavement facilities. A history of all maintenance and repair performed and its associated costs (construction and soft costs) can provide valuable information on the effectiveness of various treatments on pavements. An airport should maintain detailed records of maintenance (routine, emergency, and proactive) activities. The records should consist of the following:

1. Location and Limits of Work.
2. Types and Severity of Distresses Repaired.
3. Type of Work.
4. Cost of Work.
5. Supporting Documents (contract documents, construction drawings, specifications, bid tabulations, repair product, photograph records, etc.).

2.5 Airfield Pavement Traffic

A pavement section is typically designed to meet the needs of the user (airlines, air cargo, general aviation, and/or military) in providing a safe, smooth, operational surface. Pavement deterioration generally occurs gradually through increased roughness and/or fatigue cracking caused by successive and heavy aircraft traffic.

This study does not consist of a study or analysis of each individual airport's airfield aircraft fleet mix or traffic operations. However, it is strongly recommended that airports incorporate the requirements of FAA Advisory Circular **150/5320-6F Airport Pavement Design and Evaluation** when developing design-level rehabilitation activities. The AC provides guidance on incorporation of aircraft traffic fleet mix data.

2.6 Airfield Pavement Condition Index (PCI) Survey

2.6.1 PCI Survey Methodology

In adherence to the FAA Advisory Circular **150/5380-7B "Airport Pavement Management Program (PMP),"** the FDOT SAPMP utilizes the PCI Survey Method of inspection to collect pavement distress data and analyze the condition. The PCI Survey Inspection procedure is a visual statistical sampling of pavements for recording primary distress types (e.g. cracking and deformation), associated severities, and quantities as defined by the ASTM D5340-12. This effort is the primary means of obtaining and recording pavement distress data. The survey inspection consists primarily of visual inspection of pavement surfaces for signs of distress and deterioration resulting from loading (aircraft) and environmental influences.

A visual pavement condition survey provides an indication of the cause and rate of deterioration of a pavement section from a functional point of view and can be an indicator of structural distress. The functional condition analysis assesses the rating of the operational surface. A visual PCI Survey Inspection does not predict the remaining structural life of a pavement section, or its ability to support loads. The functional condition determined by the PCI method



can provide a cost-effective means to plan for pavement rehabilitation projects. The timely application of pavement rehabilitation may lead to the extension of functional life of individual pavement sections. This method varies from structural evaluation; functional condition is limited to visually observed distresses and indicative modes of pavement deterioration. A formal structural evaluation analyzes subsurface conditions, material characteristics, and qualitative pavement structure attributes. A structural evaluation may consist of; subsurface geotechnical exploration, falling weight deflectometer testing, petrographic testing, material coring, and/or flexural testing.



2.6.2 Pavement Distress Types

For each section, the severity and quantity of defined distresses are recorded and then analyzed in accordance with the ASTM D5340-12 standard. The standard identifies 17 distinct flexible asphalt concrete distress types and 16 distinct rigid Portland Cement Concrete distress types.

Table 2.6.2-1 (a) Pavement Distress Types – Flexible Asphalt Concrete-Surfaced Airfields

Distress	Common Distress Mechanisms
Alligator Cracking	Load / Fatigue
Bleeding	Construction Quality/ Mix Design
Block Cracking	Climate / Age
Corrugation	Load / Construction Quality
Depression	Load / Subsurface
Jet Blast	Aircraft
Joint Reflection - Cracking	Climate / Subsurface Pavement / Traffic Load
Longitudinal/Transverse Cracking	Climate / Construction Quality
Oil Spillage	Aircraft / Vehicle
Patching	Utility / Pavement Repair / Age
Polished Aggregate	Repeated Traffic Loading
Raveling	Climate / Age
Rutting	Load / Fatigue
Shoving	PCC Pavement Growth / Movement
Slippage Cracking	Load / Pavement Bond / Mix Design
Swelling	Climate / Subsurface
Weathering	Climate / Age



Table 2.6.2-1 (b) Pavement Distresses Possible Causes – Flexible Asphalt Concrete-Surfaced Airfields

Classification by Possible Causes			
Load	Climate / Durability	Moisture / Drainage	Others
<ul style="list-style-type: none"> Alligator Cracking Corrugation Depression Patching of Load-based distress Polished Aggregate Rutting Slippage Cracking 	<ul style="list-style-type: none"> Bleeding Block Cracking Joint Reflection Cracking L/T Cracking Patching of climate / durability-caused distresses Shoving from PCC Raveling Weathering Swelling 	<ul style="list-style-type: none"> Alligator Cracking Depression Patching of moisture / drainage caused distress Swelling Raveling Weathering 	<ul style="list-style-type: none"> Oil Spillage Jet Blast Erosion Polished Aggregate

Table 2.6.2-1 (c) Pavement Distresses Possible Effects – Flexible Asphalt Concrete-Surfaced Airfields

Classification by Possible Effects			
Roughness	Skid / Hydroplaning Potential	FOD Potential	Rate of Deterioration and Maintenance Requirements
<ul style="list-style-type: none"> Corrugation Depression Rutting Shoving of asphalt pavement Swelling Raveling Weathering 	<ul style="list-style-type: none"> Bleeding Depression Polished Aggregate Rutting 	<ul style="list-style-type: none"> Block Cracking Joint Reflection Cracking L/T Cracking Slippage Cracking 	<ul style="list-style-type: none"> All Distresses



Table 2.6.2-2 (a) Pavement Distresses – Rigid Portland Cement Concrete-Surfaced Airfields

Distress	Common Distress Mechanisms
Blowup	Climate / ASR
Corner Break	Load Repetition / Curling Stresses
Linear Cracking	Load Repetition / Curling Stresses / Shrinkage Stresses
Durability Cracking	Freeze-Thaw Cycling
Joint Seal Damage	Material Deterioration / Construction Quality / Age
Small Patch	Pavement Repair
Large Patch/Utility Cut	Utility / Pavement Repair
Popout	Freeze-Thaw Cycling / ASR / Material Quality
Pumping	Load Repetition / Poor Joint Sealant
Scaling	Construction Quality / Freeze-Thaw Cycling
Faulting	Subgrade Quality / ASR / Inadequate Load Transfer
Shattered Slab	Overloading
Shrinkage Cracking	Construction Quality / Climate
Joint Spalling	Load Repetition / Infiltration of Incompressible Material / Deterioration of Dowel (Load Transfer) Bars
Corner Spalling	Load Repetition / Infiltration of Incompressible Material / Deterioration of Dowel (Load Transfer) Bars
Alkali-Silica Reaction (ASR)	Construction Quality / Climate / Chemical Reaction



Table 2.6.2-2 (b) Pavement Distresses Possible Causes – Rigid Portland Cement Concrete-Surfaced Airfields

Classification by Possible Causes			
Load	Climate / Durability	Moisture / Drainage	Others
<ul style="list-style-type: none"> • Corner Break • Shattered Slab • L/T/D Cracking • Pumping • Patching of Load-associated distress • Spalling 	<ul style="list-style-type: none"> • Blowup • "D" Cracking • Joint Seal Damage • Popouts • Scaling • Patch of Climate/Durability-associated distress • Shrinkage Cracking • Spalling • L/T/D Cracking 	<ul style="list-style-type: none"> • Corner Break • Shattered Slab • Pumping • Patching of Moisture/Drainage-associated distress 	<ul style="list-style-type: none"> • Settlement / Faulting

Table 2.6.2-2 (c) Pavement Distresses Possible Effects – Rigid Portland Cement Concrete-Surfaced Airfields

Classification by Possible Effects			
Roughness	Skid / Hydroplaning Potential	FOD Potential	Rate of Deterioration and Maintenance Requirements
<ul style="list-style-type: none"> • Blowup • Corner Break • L/T/D Cracking • Shattered Slab • Settlement / Faulting • Spalling 	<ul style="list-style-type: none"> • Settlement / Faulting • Spalling 	<ul style="list-style-type: none"> • Corner Break • L/T/D Cracking • "D" Cracking • Joint Seal Damage • Shattered Slab • Popouts • Scaling 	<ul style="list-style-type: none"> • All distresses



2.6.3 PCI Survey Inspection Procedures

Inspection Sampling Rate

The FDOT SAPMP performs PCI Survey Inspections on sample units defined in the previous update. The sample units are subject to change at the discretion of the inspection personnel and/or to major pavement rehabilitation treatments. Furthermore, access to the sample units based on accessibility or impacts to operations may affect the overall sampling rate effort at each airport. The following **Tables 2.6.3 (a) and (b)** define the sampling criteria used by the FDOT SAPMP. A higher sampling rate may be utilized to achieve a greater statistical confidence should the airport have the available resources to perform PCI Survey Inspections independent of the FDOT SAPMP.

Table 2.6.3 (a) Recommended Sample Rate Schedule for Flexible Asphalt Concrete

Number of Total Sample Units in Section	Sample Units to Inspect	
	Runways	Taxiways, Aprons, and Others
1 - 4	1	1
5 - 10	2	1
11 - 15	3	2
16 - 30	5	3
31 - 40	7	4
41 - 50	8	5
51 or more	20% but ≤20	10% but ≤10

Table 2.6.3 (b) Recommended Sample Rate Schedule for Rigid Portland Cement Concrete

Number of Total Sample Units in Section	Sample Units to Inspect	
	Runways	Taxiways, Aprons, and Others
1 - 3	1	1
4 - 6	2	1
7 - 10	3	2
11 - 15	4	2
16 - 20	5	3
21 - 30	7	3
31 - 40	8	4
41 - 50	10	5
51 or more	20% but ≤20	10% but ≤10



2.6.4 Updates to the ASTM D5340-12

Airfield pavement distresses and conditions were surveyed in accordance with the methods outlined in FAA Advisory Circular 150/5380-6C and ASTM D5340-12. These procedures define distress type, severity, and quantity for sampling areas within each defined pavement section area to analyze and determine the PCI value and condition rating. During the 2013-2015 System Update, the incorporation of the significant changes to the ASTM D5340 (version D5340-12) resulted in an adjusted pavement condition indices on pavement sections subject to the distress types updated. Furthermore, the revision of the PCI deduction curves and the separation of distress types from the original, such as Weathering and Raveling, have in select cases increased the PCI value of the section without any rehabilitation performed.

Flexible Asphalt Concrete Pavement Distress Updates

The previous methodology which featured “(52) Weathering and Raveling” distress has been separated into two distresses “(52) Raveling” and “(57) Weathering.” Previously, areas that were recorded as “Weathering and Raveling” were considered as one distress with a high deduction. Based on the updated methodology, in certain situations where “Weathering” only exists and does not meet the definition of “Raveling,” the PCI deduction is not as high as the former “Weathering and Raveling.” Therefore, areas identified only as “(57) Weathering” based on current ASTM standards, which were previously identified as “(52) Weathering and Raveling,” may be subject to an improvement in PCI. In instances where pavement PCI has increased due to this update, it is not due to an improvement in actual condition, however indicative of the adjusted distress deterioration effects.

Rigid Portland Cement Concrete Pavement Distress Updates


The previous methodology defined “(70) Scaling” as a distress that consisted of surface deterioration caused by construction defects, material defects, and environmental factors. The distress included *Alkali-Silica Reaction*, also known as ASR. The current methodology has separated Alkali-Silica Reaction as a distress identified as “(76) Alkali-Silica Reaction / ASR.” As a result the previous “(70) Scaling” numerical deduction contribution to the PCI has been reduced. Previous inspections that recorded “(70) Scaling,” and currently do not exhibit “(76) Alkali-Silica Reactivity / ASR” may potentially see an increase in PCI. Additionally, “(73) Shrinkage Cracks” has been redefined as “(73) Shrinkage Cracking”. Shrinkage Cracking is characterized in two forms; drying shrinkage and plastic shrinkage. Drying shrinkage occurs over time as moisture leaves the pavement, it develops when hardened pavement continues to shrink as excess water not needed for cement hydration evaporates. It forms when subsurface resistance to the shrinkage is present and may extend through the entire depth of the slab. Plastic shrinkage develops when there is rapid loss of water in the surface of recently placed pavement or can form from over finishing/overworking of the pavement during construction. These shrinkage cracks appear as a series of inter-connected hairline cracks, or pattern cracking, and are often observed throughout the majority of the slab surface. This condition is also referred to as map cracking or crazing.



Table 2.6.4 Summary of Updates to ASTM D5340-12

Distress Updates to Reflect ASTM 5340-12				
Use and Surface Type	Updated Distress	Former Distress in Prior to 5340-10	Deduction Curve	Potential Effect
AC/AAC/ APC Airfield	(52) Raveling - Low	(52) Weathering and Raveling - Low	No Change	N/A
	(52) Raveling - Medium	(52) Weathering and Raveling - Medium	No Change	N/A
	(52) Raveling - High	(52) Weathering and Raveling - High	No Change	N/A
	(57) Weathering - Low	N/A – was part of 'Weathering and Raveling'	New	Increase in PCI with no maintenance
	(57) Weathering - Medium	N/A – was part of 'Weathering and Raveling'	New	Increase in PCI with no maintenance
	(57) Weathering - High	N/A – was part of 'Weathering and Raveling'	New	Increase in PCI with no maintenance
PCC Airfield	(70) Scaling - Low	(70) Scaling, Map Cracking, and Crazeing - Low	New	Increase in PCI with no maintenance
	(70) Scaling - Medium	(70) Scaling, Map Cracking, and Crazeing - Medium	New	Increase in PCI with no maintenance
	(70) Scaling - High	(70) Scaling, Map Cracking, and Crazeing - High	New	Increase in PCI with no maintenance
	(76) Alkali Silica Reaction – Low	N/A – was part of 'Scaling, Map Cracking, and Crazeing'	New	Increase in PCI with no maintenance
	(76) Alkali Silica Reaction – Medium	N/A – was part of 'Scaling, Map Cracking, and Crazeing'	New	Increase in PCI with no maintenance
	(76) Alkali Silica Reaction – High	N/A – was part of 'Scaling, Map Cracking, and Crazeing'	New	Increase in PCI with no maintenance
	(73) Shrinkage Cracking	(73) Shrinkage Cracking	No Change	Prior distress types identified as 'Scaling, Map Cracking, and Crazeing' may now be identified as 'Shrinkage Cracking'

Chapter 3

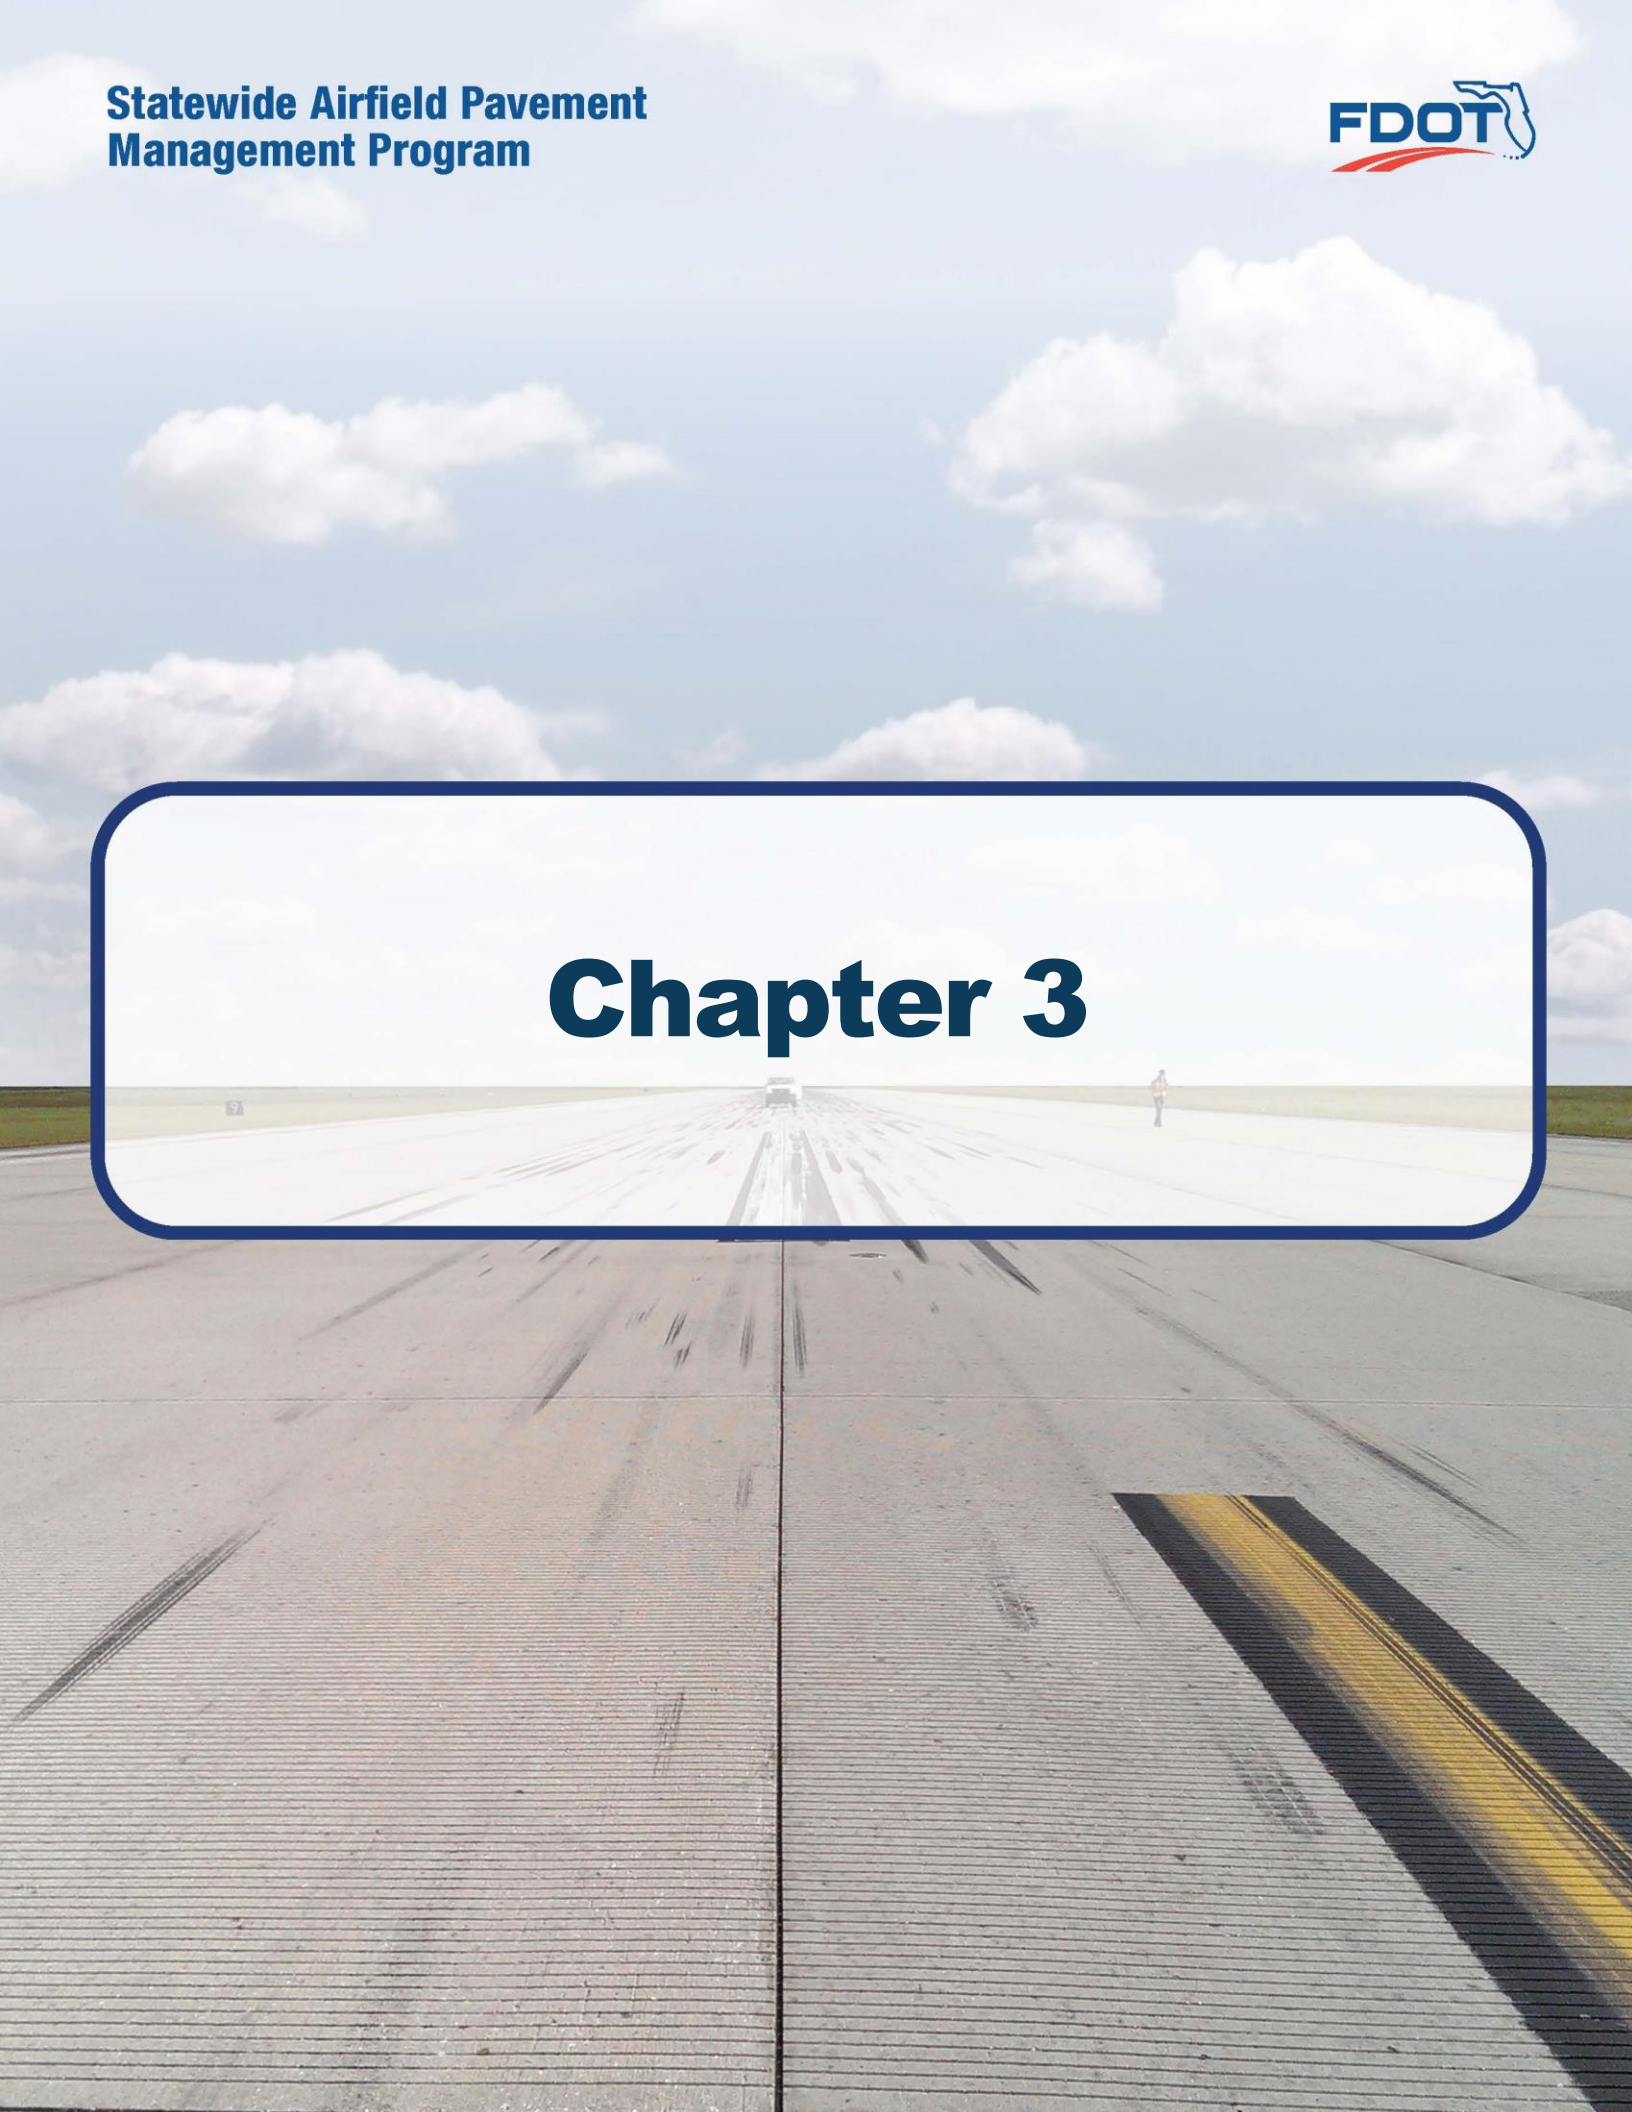



Chapter 3 – Airfield Pavement System Inventory

A significant element of an effective airfield pavement management system is the appropriate record keeping of changes due to construction or operational use of the pavement facilities. This chapter discusses the inventory data collected from the airport and summarizes network-level characteristics of the airport's airfield pavements. At the start of each FDOT SAPMP System Update, all airports are asked to review the existing Airfield Pavement Network Definition exhibit for accuracy. Furthermore, participating airports are asked to provide documentation for any recent or anticipated construction related to their airfield pavements.

3.1 Airfield Pavement Network Information

3.1.1 Previous and/or Anticipated Airfield Pavement Construction

Based on information provided by the airport, the following **Table 3.1.1** summarizes the airfield pavement construction projects that have been incorporated into the SAPMP database system since the 2013-2015 System Update. **Figure 3.1.1-1** and **Figure 3.1.1-2** provides an inset view of the 2017 Airfield Pavement Network Definition Exhibit and the 2017 Airfield Pavement System Inventory Exhibits that depict the updated network details for the airport reflected in the PAVER Database. Large format exhibits are referenced in **Appendix C Technical Exhibits**.


Table 3.1.1 Previous and/or Anticipated Airfield Pavement Construction

Year	General Work Description
2015	AP RU 6 - New Construction
	TW C - New Construction
	TW C - Mill and Overlay
	TW E - Mill and Overlay
2016	TW D - Mill and Overlay
	TW H - New Construction
2018	RW 11-29 - Complete Reconstruction

The airport provided a limited combination of record drawings, reports, and staff input that was pertinent information in developing the construction history of the airport's pavements from inception. Major rehabilitation/construction activities performed in the last 24-months or anticipated in the next 24-months are assumed to restore the PCI to 100. These activities include: pavement overlay, mill and replace, mill and overlay, new construction, and/or complete reconstruction. These pavements were not formally subject to a PCI Survey and actual conditions may vary. Furthermore, any localized maintenance or repair performed that would improve the PCI will be considered in the condition analysis, if performed within inspection areas.




Figure 3.1.1-1 2017 Airfield Pavement Network Definition Exhibit

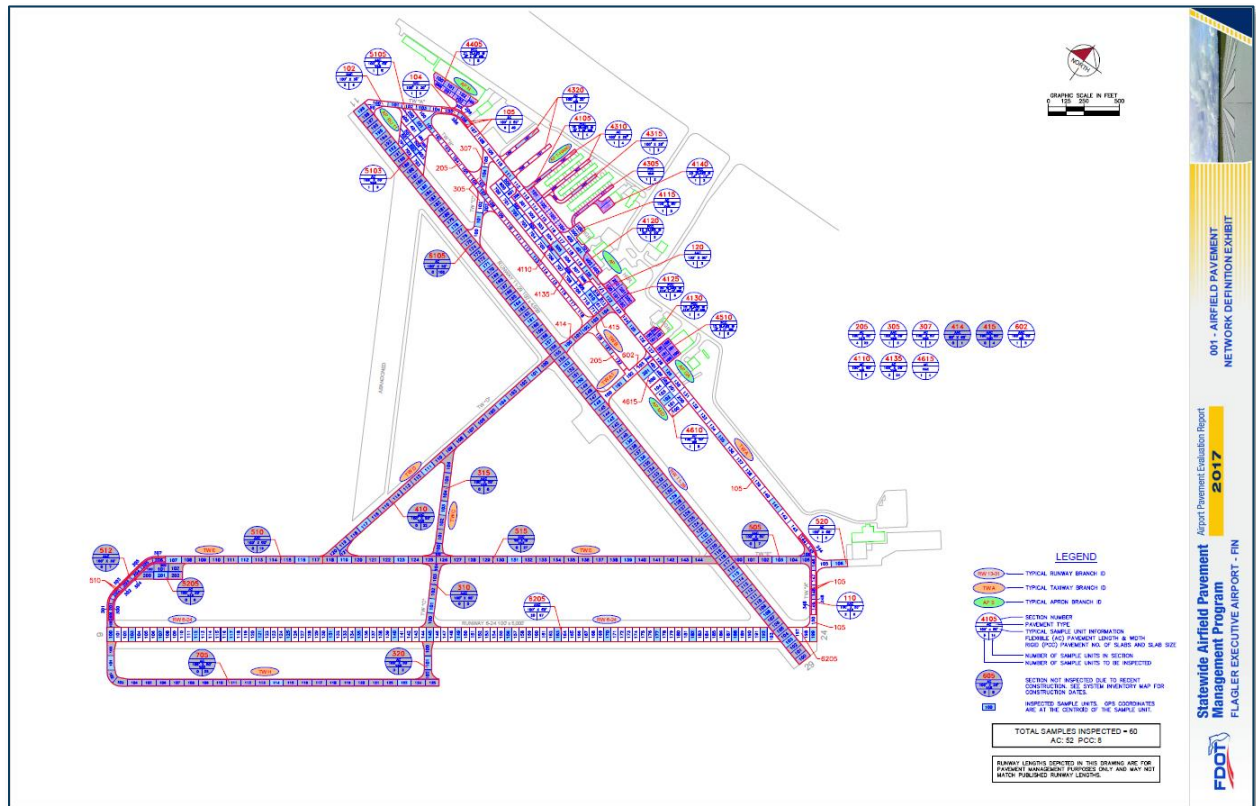

The Airfield Pavement Network Definition Exhibit provides details to the PCI Survey inspection efforts. The exhibit identifies the pavement facilities, surface type, section definition, and sample unit delineation.




Figure 3.1.1-2 2017 Airfield Pavement System Inventory Exhibit

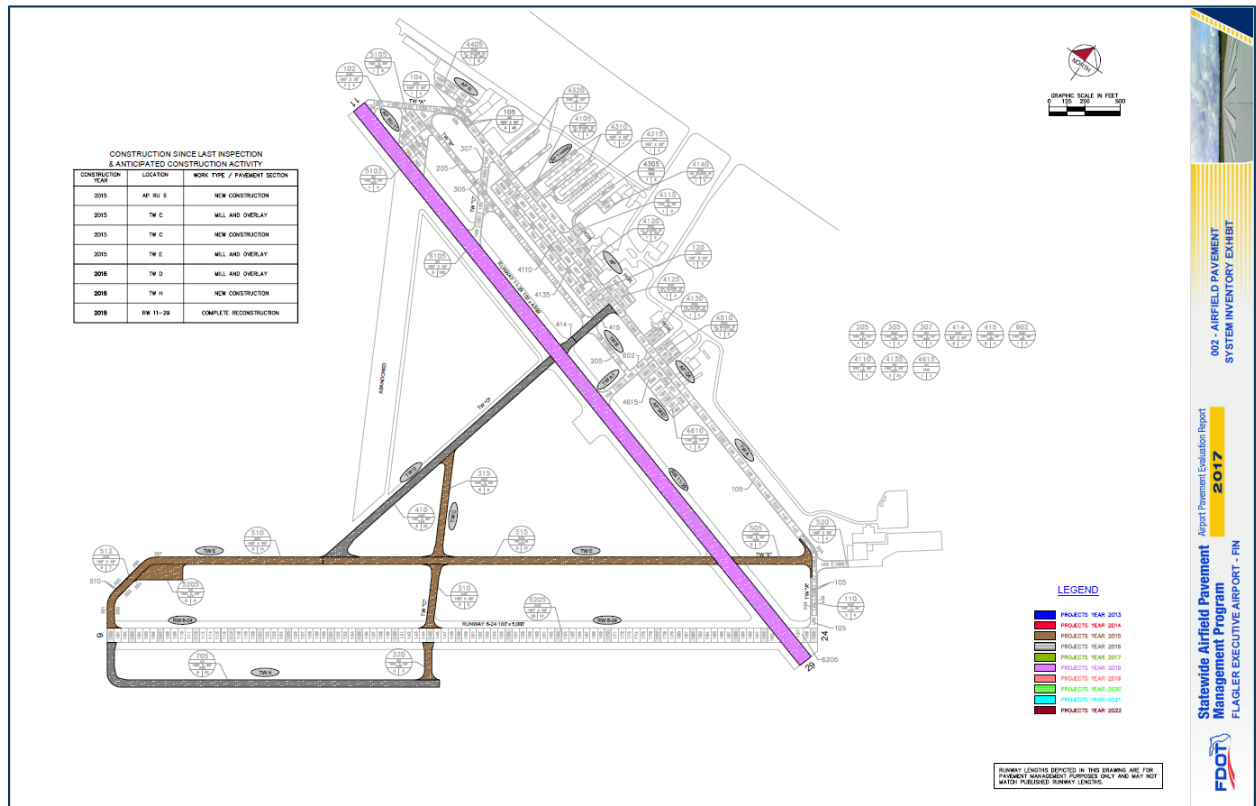

The Airfield Pavement System Inventory Exhibit provides details to the work history updates communicated by the Airport. The Exhibit provides the approximate limits of recent and/or anticipated construction on the airfield pavement facilities. The limits are based on documentation provided by the Airport and, if constructed, observed in the field.

3.1.2 Estimated Pavement Age

Standard pavement design practice considers a design life of a 20-year period. Design inputs typically require subgrade soil conditions, pavement section layer material characteristics, and anticipated loading (aircraft fleet mix) for the design-life period. Based on the review of the historic airfield pavement construction, **Figure 3.1.2** summarizes the average age of the pavement sections since any major construction activity has occurred during the PCI Survey inspection. This is intended to be a rough estimate based on interpretation of the limited data available at the time of report.

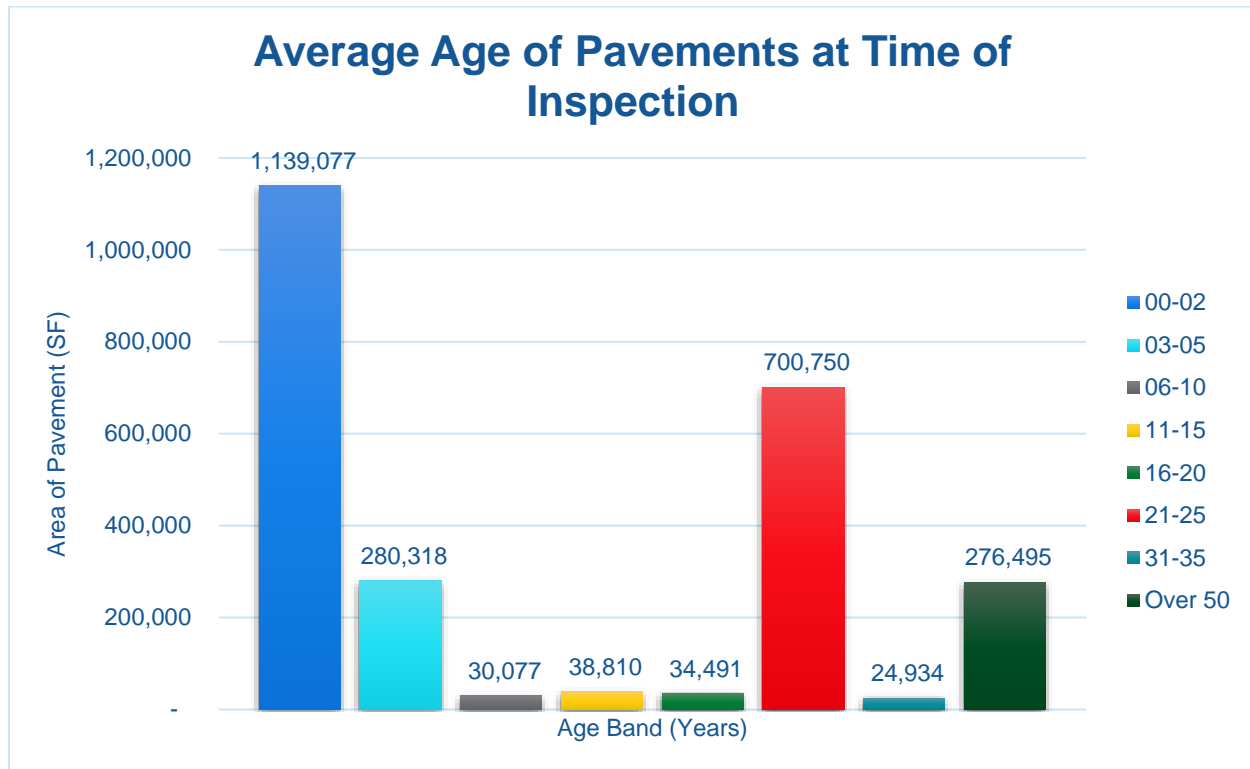*Figure 3.1.2 Average Age of Pavements at Inspection*


The estimation of the pavement age is based on information requested and provided by participating airports. Additionally, data collected in the prior system updates since 1992 have been relied upon.



3.1.3 Functional Use Classification

Pavements are subject to varying aircraft loading patterns based on utilization and overall operations. For this SAPMP Update, the following categories of airfield functional use have been identified and associated with the following possible pavement branch facilities: Apron, Runway, Taxiway, and Taxilane. **Figure 3.1.3** summarizes the identified pavements' functional use by area in square feet. The pavement areas reviewed exclude shoulder pavement facilities.

Figure 3.1.3 Airfield Pavement Functional Classification Use by Area

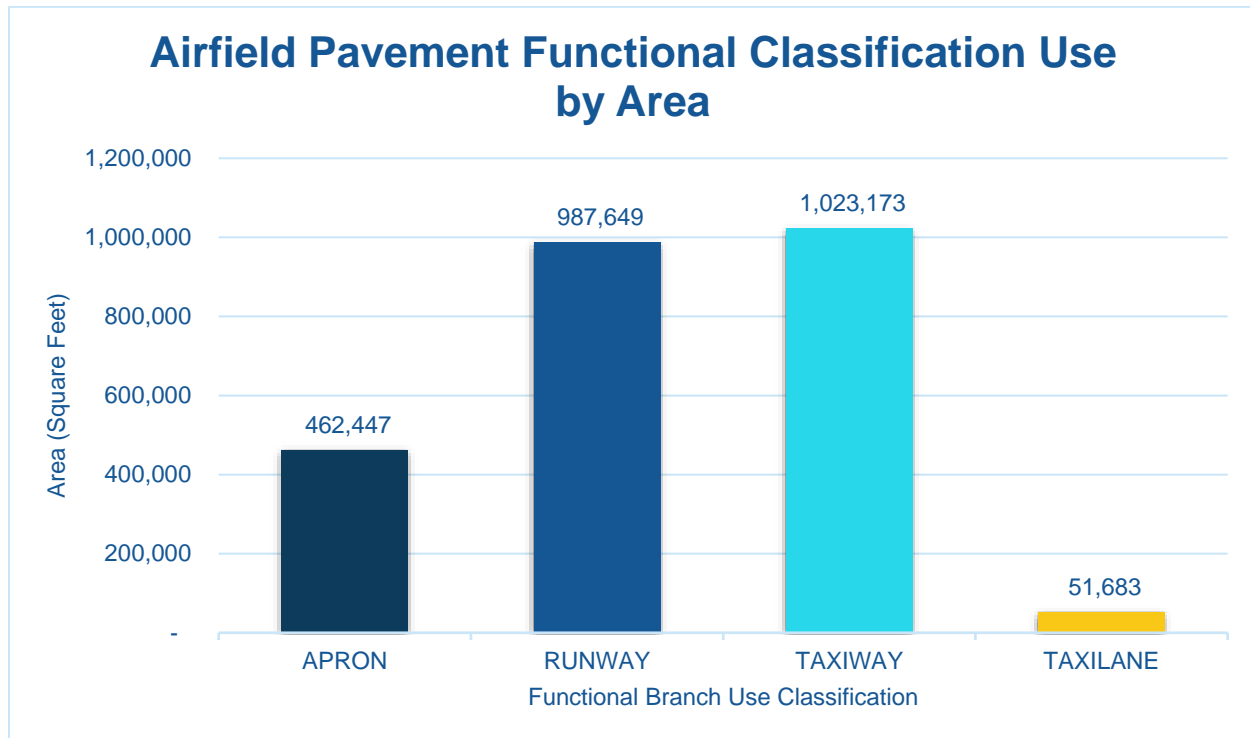





3.1.4 Pavement Surface Type

The airfield pavement facility surface types within the SAPMP include four common types of pavement: Portland cement concrete (PCC), asphalt concrete (AC), asphalt concrete overlaid on asphalt concrete (AAC), and asphalt concrete overlaid on Portland cement concrete (APC).

Based on the record documentation incorporated within the SAPMP database throughout the years, the pavement surface types have been assigned to the various pavement sections in accordance to its work history composition. The following **Figures 3.1.4 (a) and (b)** summarize the applicable pavement types observed at this specific airport's airfield.

Figure 3.1.4 (a) Pavement Surface Type by Area (SF)

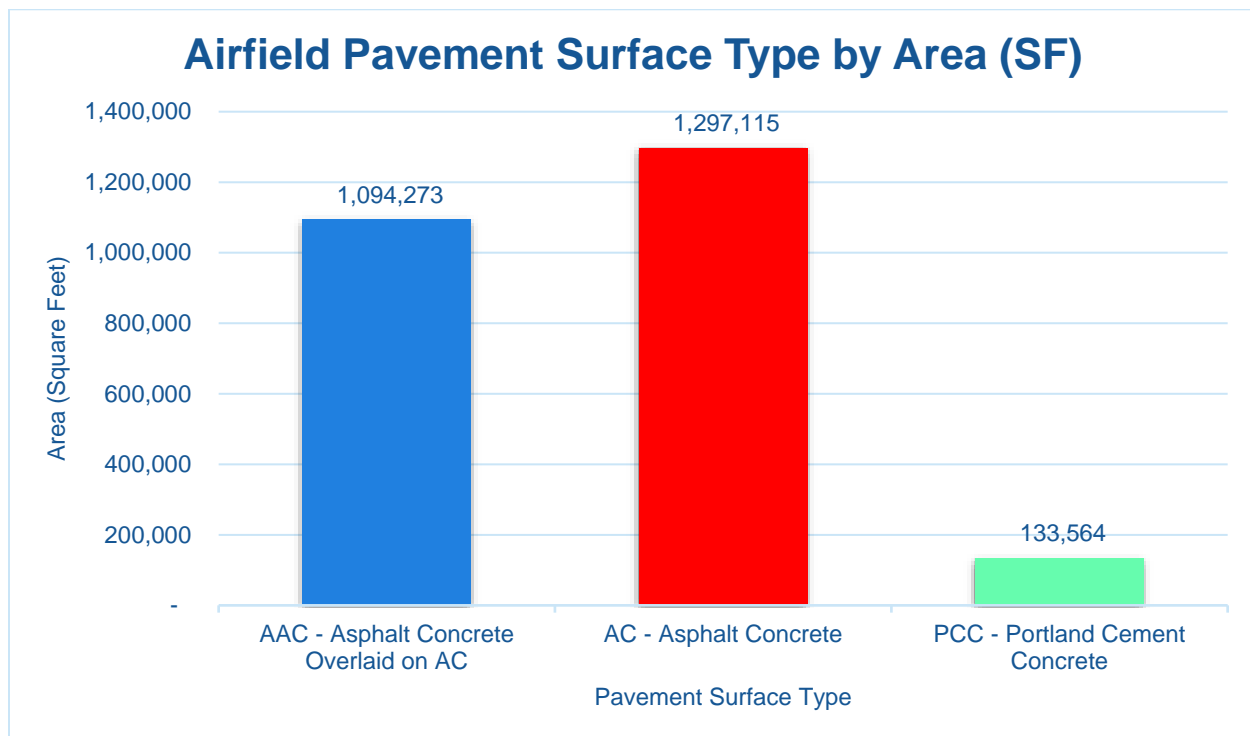

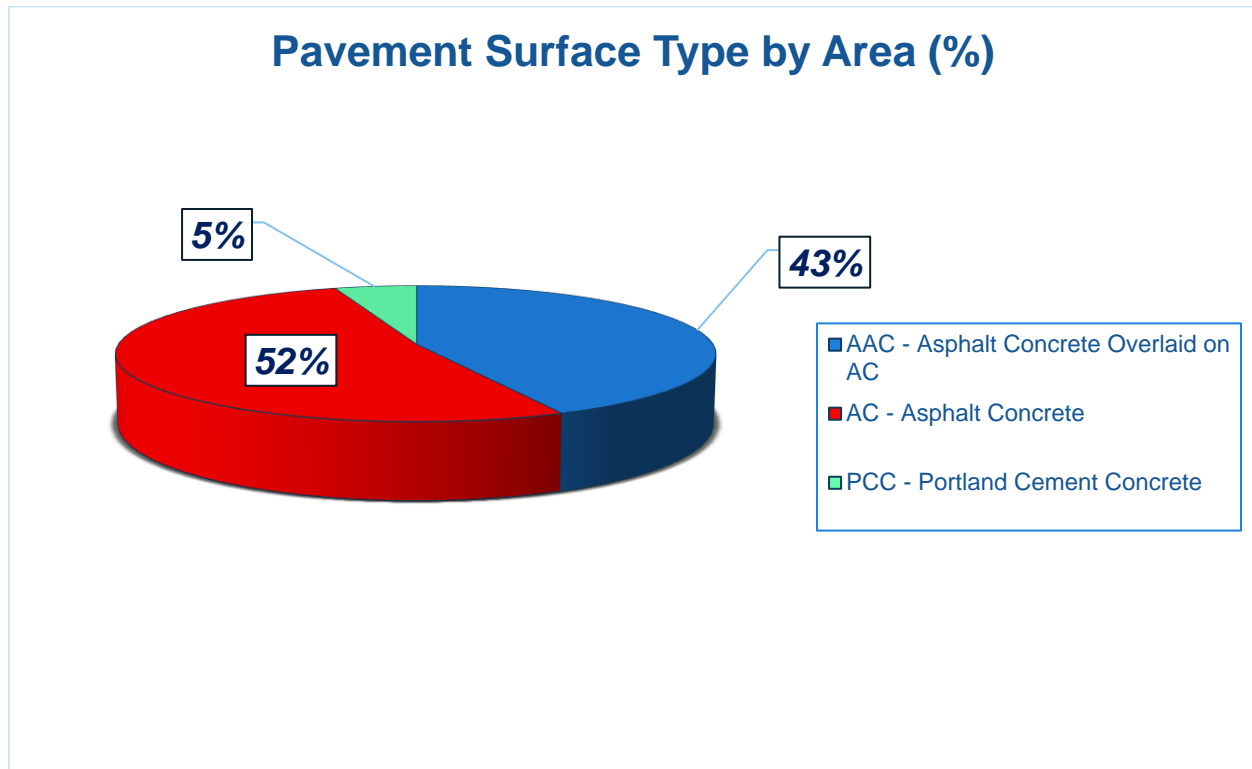*Figure 3.1.4 (b) Pavement Surface Type by Area (%)*

3.1.5 Pavement System Inventory Details

The following **Table 3.1.5** displays the section-level details assembled as part of this update. The section-level details are based on the record documentation provided by the airports to FDOT and from SAPMP System Updates. The details assembled rely on the accuracy and the adequacy of data provided; however, it should be noted that characteristics such as pavement areas may be based on aerial interpretation of spatially projected imagery. The accuracy of data is presented with the intention of a network planning-level document; should the airport elect to perform rehabilitation work, it is recommended that further investigation be performed at the project level for construction purposes.

In summary, the scope of the pavement inventory update resulted in the updating of select existing pavement geometry and the development of an AutoCAD model with spatial projection for use within GIS. **Appendix A** includes the Airfield Pavement Network Definition Exhibit and the Airfield Pavement System Inventory Exhibit which visually summarize the results of the Airfield Pavement System Inventory analysis and reporting.



Table 3.1.5 Pavement System Inventory Details

Network ID	Branch Name	Branch ID	Branch Use	Section ID	Length (FT)	Width (FT)	Area (SF)	Surface Type	Est. Last Construction Date
FIN	APRON	AP	APRON	4105	220	60	23,645	PCC	1/1/1942
FIN	APRON	AP	APRON	4110	820	60	50,015	AC	1/1/2012
FIN	APRON	AP	APRON	4115	152.5	200	20,847	AC	1/1/1950
FIN	APRON	AP	APRON	4120	140	60	9,798	PCC	1/1/1992
FIN	APRON	AP	APRON	4125	220	110	25,668	PCC	1/1/1992
FIN	APRON	AP	APRON	4130	90	110	10,275	PCC	1/1/1992
FIN	APRON	AP	APRON	4135	1170	70	111,646	AC	1/1/2012
FIN	APRON	AP	APRON	4140	100	84	8,368	PCC	1/1/2004
FIN	APRON GA	AP GA	APRON	4510	140	120	17,338	PCC	1/1/2005
FIN	APRON MID	AP MID	APRON	4610	260	150	38,864	AC	12/1/2012
FIN	APRON MID	AP MID	APRON	4615	150	140	21,385	AC	1/1/2012
FIN	NORTH APRON	AP N	APRON	4405	350	85	30,077	PCC	1/1/2009
FIN	RUN-UP APRON AT RW 11	AP RU 11	APRON	5103	280	120	36,038	AC	1/1/1942
FIN	RUN-UP APRON AT RW 11	AP RU 11	APRON	5105	280	180	27,768	AAC	1/1/1992
FIN	RUN-UP APRON AT RW 6	AP RU 6	APRON	5205	300	100	30,715	AC	12/25/2015
FIN	RUNWAY 11-29	RW 11-29	RUNWAY	6105	5000	100	500,300	AC	1/1/2018
FIN	RUNWAY 6-24	RW 6-24	RUNWAY	6205	4850	100	487,349	AAC	1/1/1995
FIN	T-HANGAR TAXILANE	T-HANG	TAXILANE	4305	400	20	8,395	PCC	12/25/1999
FIN	T-HANGAR TAXILANE	T-HANG	TAXILANE	4310	340	20	17,531	AC	12/25/1999
FIN	T-HANGAR TAXILANE	T-HANG	TAXILANE	4315	1330	20	8,565	AC	12/25/1999
FIN	T-HANGAR TAXILANE	T-HANG	TAXILANE	4320	300	25	17,192	AC	12/1/2012
FIN	TAXIWAY A	TW A	TAXIWAY	102	500	50	22,177	AAC	1/1/1992
FIN	TAXIWAY A	TW A	TAXIWAY	104	250	30	7,358	AAC	1/1/1982
FIN	TAXIWAY A	TW A	TAXIWAY	105	3740	50	184,752	AC	1/1/1942




Network ID	Branch Name	Branch ID	Branch Use	Section ID	Length (FT)	Width (FT)	Area (SF)	Surface Type	Est. Last Construction Date
FIN	TAXIWAY A	TW A	TAXIWAY	110	587	30	17,576	AAC	1/1/1982
FIN	TAXIWAY A	TW A	TAXIWAY	120	290	50	15,400	AAC	1/1/2012
FIN	TAXIWAY A1	TW A1	TAXIWAY	602	500	50	25,816	AAC	12/1/2012
FIN	TAXIWAY B	TW B	TAXIWAY	205	2450	35	88,917	AC	1/1/1992
FIN	TAXIWAY C	TW C	TAXIWAY	305	410	50	28,798	AAC	1/1/1992
FIN	TAXIWAY C	TW C	TAXIWAY	307	200	50	11,213	AC	1/1/1942
FIN	TAXIWAY C	TW C	TAXIWAY	310	450	50	26,271	AAC	12/25/2015
FIN	TAXIWAY C	TW C	TAXIWAY	315	650	50	39,970	AAC	12/25/2015
FIN	TAXIWAY C	TW C	TAXIWAY	320	300	50	15,961	AC	12/25/2015
FIN	TAXIWAY D	TW D	TAXIWAY	410	2000	50	110,706	AAC	1/1/2016
FIN	TAXIWAY D	TW D	TAXIWAY	414	80	50	5,779	AAC	1/1/2016
FIN	TAXIWAY D	TW D	TAXIWAY	415	310	50	18,039	AAC	1/1/2016
FIN	TAXIWAY E	TW E	TAXIWAY	505	550	35	32,654	AAC	1/1/2015
FIN	TAXIWAY E	TW E	TAXIWAY	510	1100	50	71,339	AAC	1/1/2015
FIN	TAXIWAY E	TW E	TAXIWAY	512	645	30	19,204	AAC	1/1/2015
FIN	TAXIWAY E	TW E	TAXIWAY	515	1670	50	138,069	AAC	1/1/2015
FIN	TAXIWAY E	TW E	TAXIWAY	520	465	50	13,104	AC	1/1/2004
FIN	TAXIWAY H	TW H	TAXIWAY	705	2600	50	130,070	AC	1/1/2016



PAGE INTENTIONALLY LEFT BLANK

Chapter 4

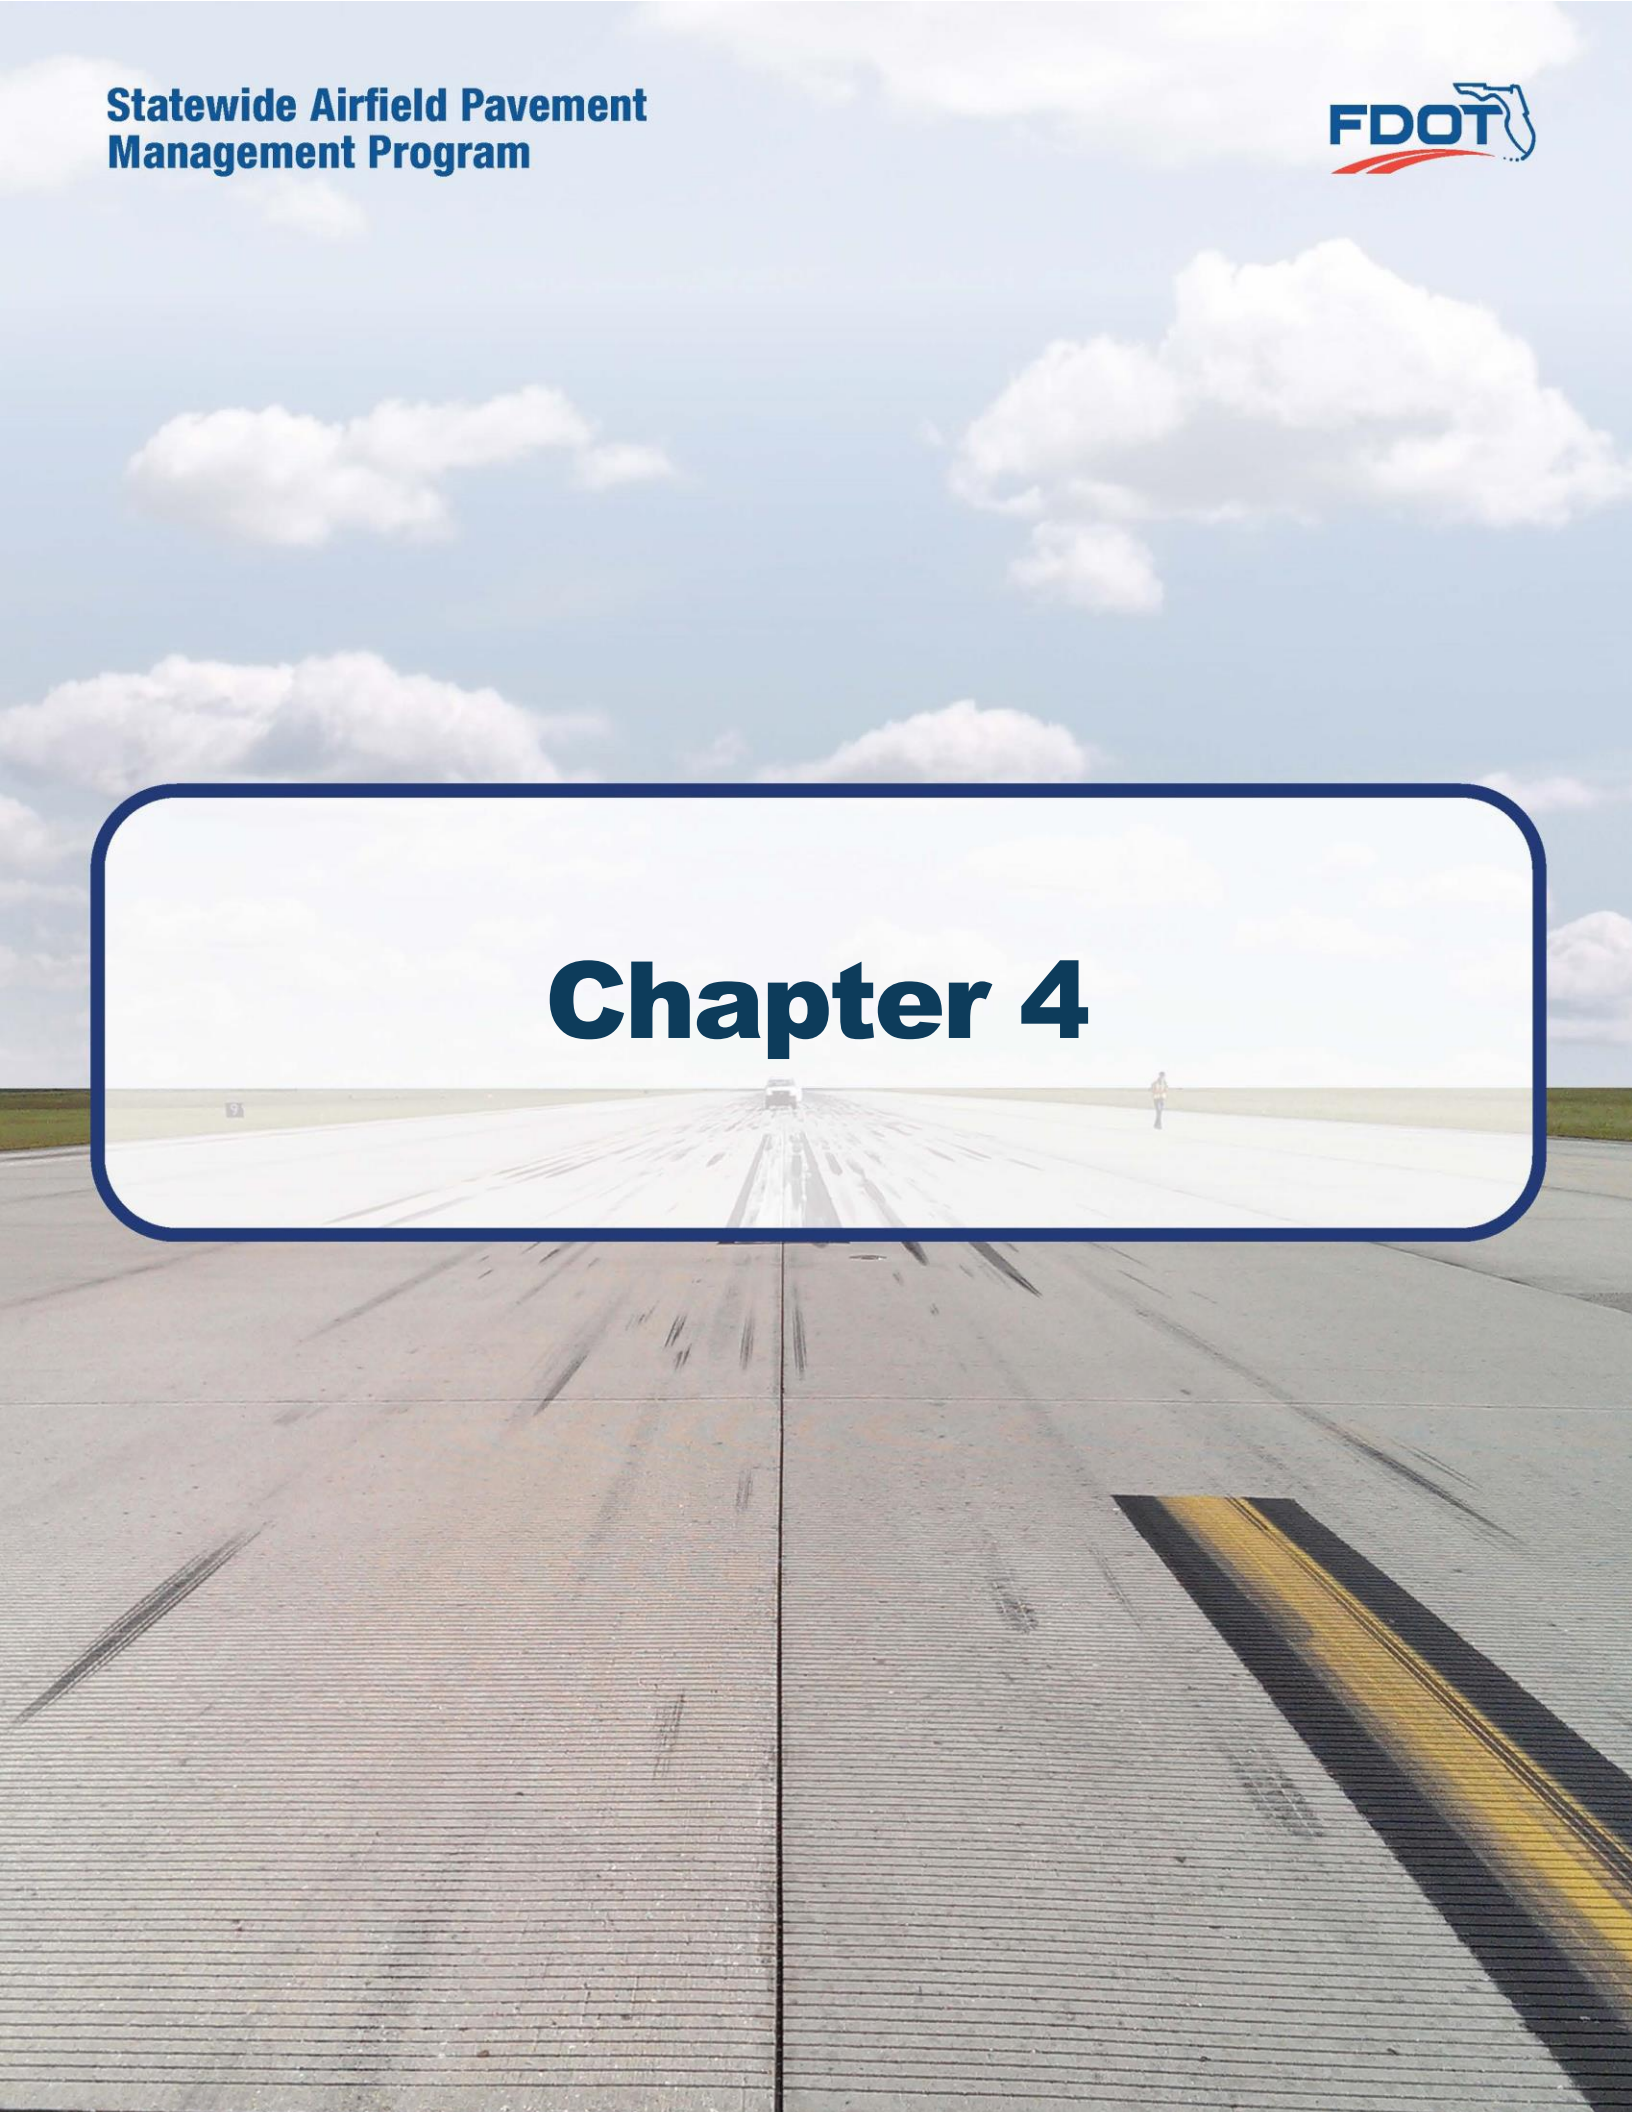



Chapter 4 – Airfield Pavement Condition


The examination of specific distress types (with causes attributed to load, climate, or other defined distress mechanism), determination of the severity of distress, and determination of the quantity of distress manifestation are required in the computation of a PCI value. The PCI provides valuable information that can be used to determine the existing condition of the pavement, possible cause of the pavement deterioration, and eventually aid in the planning of the rehabilitation of pavements. It should be noted that the PCI method of pavement condition evaluation is strictly a visual and functional evaluation. Further evaluation of the pavement condition may be necessary for design and/or project-level determination of pavement rehabilitation.

4.1 Airfield Pavement Condition Index (Latest Inspection)

4.1.1 Network-Level Analysis

The following **Figure 4.1.1** summarizes the network-level pavement condition analysis based on the most recent PCI Survey inspection results.

Figure 4.1.1 Latest Condition – Overall Network

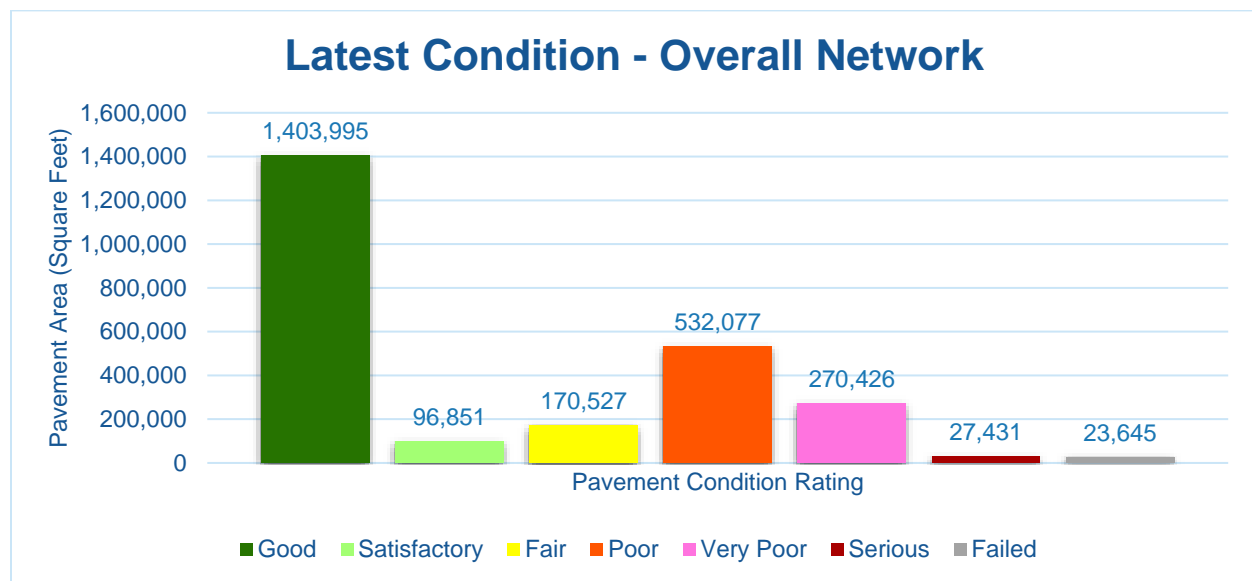

4.1.2 Branch-Level Analysis

The following **Figures 4.1.2 (a) through (d)** summarize the branch-level pavement condition analysis based on the most recent PCI Survey inspection results; the following Figures provide overall branch-level conditions by branch use.



Figure 4.1.2 (a) Latest Condition – Runway Pavements

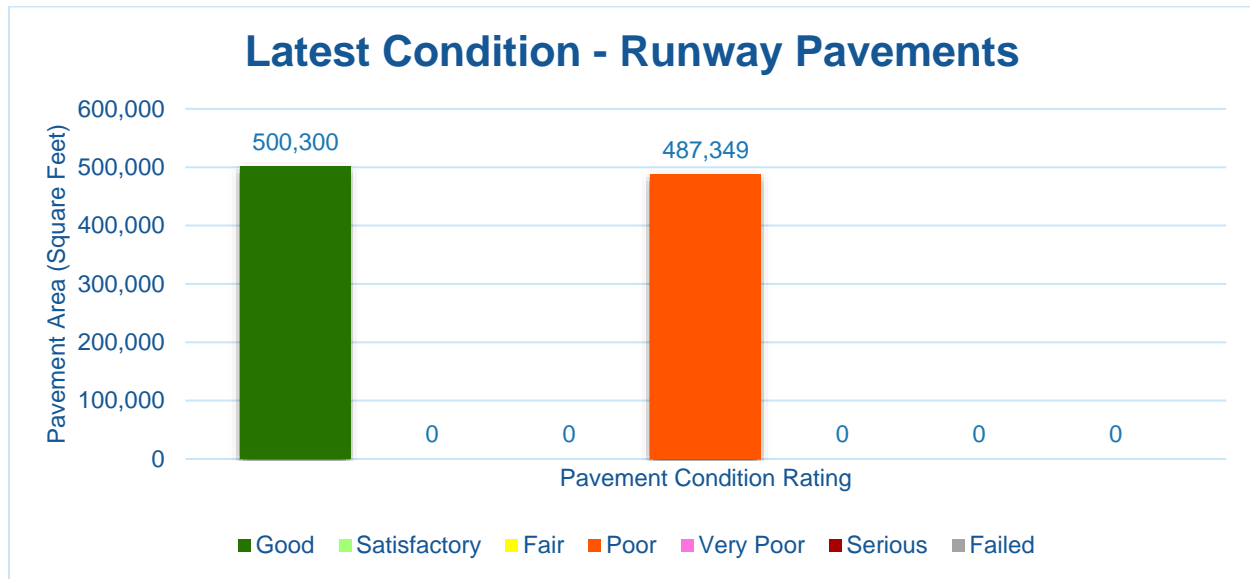


Figure 4.1.2 (b) Latest Condition – Taxiway Pavements

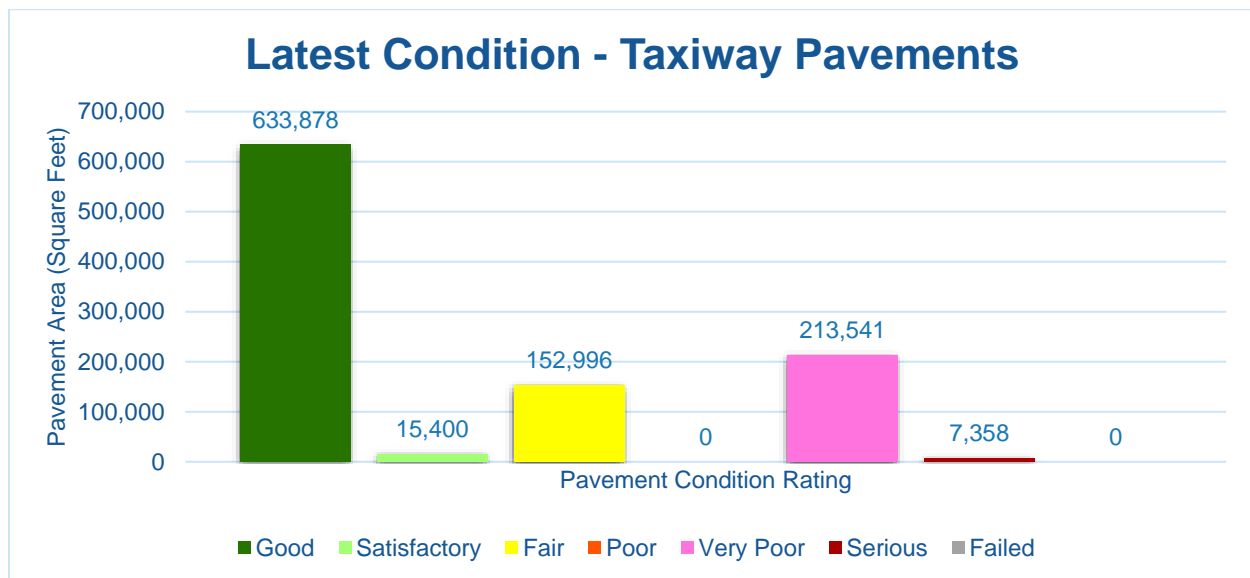




Figure 4.1.2 (c) Latest Condition – Apron Pavements


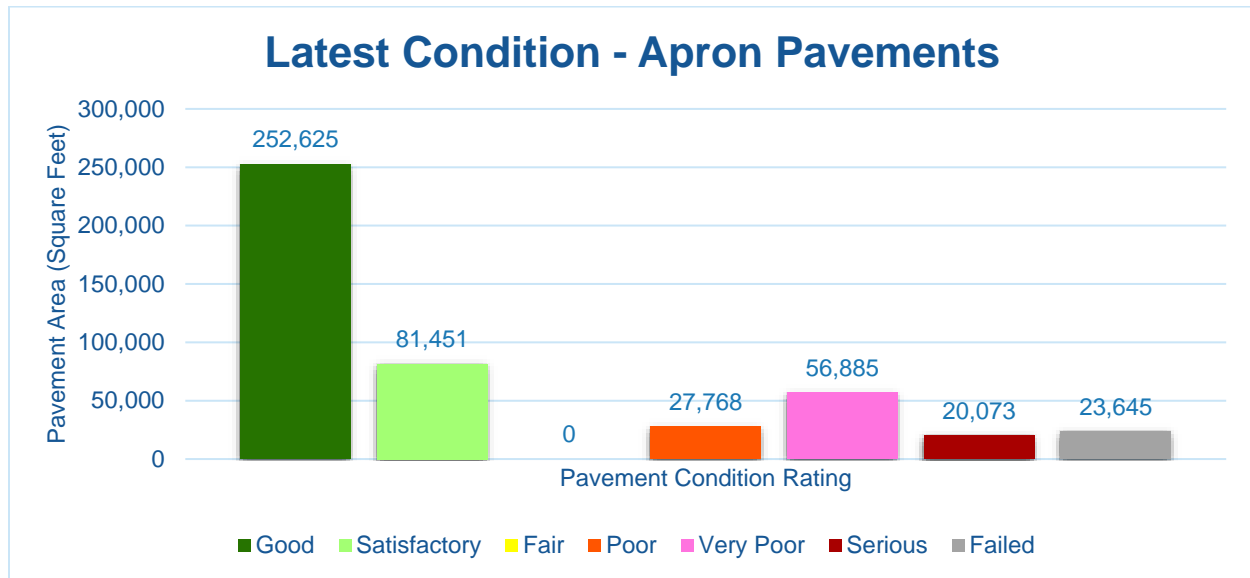


Figure 4.1.2 (d) Latest Condition – Taxiway Pavements



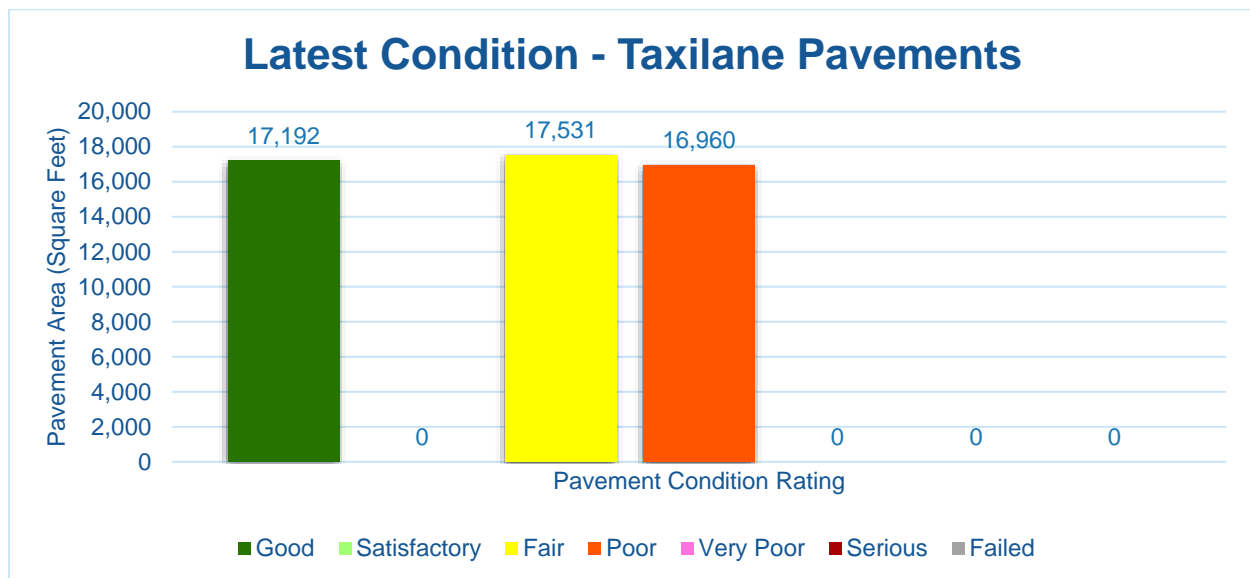

4.1.3 Section-Level Analysis

The following **Table 4.1.3** provides details for each pavement section of its area-weighted average PCI and the percent of distress which is related to load, climate, or other factors. The amount of distress attributed to the various causes provides insight into maintenance, repair, and rehabilitation needs. Load-related distress indicates that pavements are reaching the end of their structural design life, and for those pavements exhibiting a significant amount of these distress types, rehabilitation should be planned to strengthen or reconstruct the pavement.

Appendix C Technical Exhibits provides a technical exhibit that graphically depicts the PCI values and ratings determined from this SAPMP System Update.

Any pavement facilities subject to pavement construction within the past 2 years or anticipated for construction within the next year may have been omitted from inspection. Pavement subject to major rehabilitation will be set to a PCI of 100.



Table 4.1.3 Latest Pavement Condition Index Summary

Network ID	Branch ID	Branch Name	Branch Use	Section ID	Area (SF)	Surface	PCI	PCI Rating	PCI Pct Climate	PCI Pct Load	PCI Pct Other	Sample Units Inspected	Total Sample Units in Section
FIN	AP	APRON	APRON	4105	23,645	PCC	0	Failed	7%	92%	1%	1	4
FIN	AP	APRON	APRON	4110	50,015	AC	89	Good	100%	0%	0%	1	9
FIN	AP	APRON	APRON	4115	20,847	AC	27	Very Poor	52%	42%	6%	1	5
FIN	AP	APRON	APRON	4120	9,798	PCC	16	Serious	9%	76%	15%	1	2
FIN	AP	APRON	APRON	4125	25,668	PCC	78	Satisfactory	55%	0%	45%	1	6
FIN	AP	APRON	APRON	4130	10,275	PCC	17	Serious	7%	73%	20%	1	4
FIN	AP	APRON	APRON	4135	111,646	AC	94	Good	100%	0%	0%	3	24
FIN	AP	APRON	APRON	4140	8,368	PCC	84	Satisfactory	74%	0%	26%	1	2
FIN	AP GA	APRON GA	APRON	4510	17,338	PCC	82	Satisfactory	56%	39%	5%	1	6
FIN	AP MID	APRON MID	APRON	4610	38,864	AC	94	Good	100%	0%	0%	1	8
FIN	AP MID	APRON MID	APRON	4615	21,385	AC	94	Good	100%	0%	0%	1	4
FIN	AP N	NORTH APRON	APRON	4405	30,077	PCC	75	Satisfactory	39%	57%	4%	1	8
FIN	AP RU 11	RUN-UP APRON AT RW 11	APRON	5103	36,038	AC	32	Very Poor	85%	0%	15%	1	9
FIN	AP RU 11	RUN-UP APRON AT RW 11	APRON	5105	27,768	AAC	50	Poor	46%	0%	54%	1	5
FIN	AP RU 6	RUN-UP APRON AT RW 6	APRON	5205	30,715	AC	100	Good	0%	0%	0%	0	6
FIN	RW 11-29	RUNWAY 11-29	RUNWAY	6105	500,300	AC	100	Good	0%	0%	0%	0	100
FIN	RW 6-24	RUNWAY 6-24	RUNWAY	6205	487,349	AAC	50	Poor	91%	6%	3%	20	97
FIN	T-HANG	T-HANGAR TAXILANE	TAXILANE	4305	8,395	PCC	47	Poor	15%	61%	24%	1	2
FIN	T-HANG	T-HANGAR TAXILANE	TAXILANE	4310	17,531	AC	61	Fair	100%	0%	0%	1	4
FIN	T-HANG	T-HANGAR TAXILANE	TAXILANE	4315	8,565	AC	48	Poor	73%	0%	27%	1	2
FIN	T-HANG	T-HANGAR TAXILANE	TAXILANE	4320	17,192	AC	94	Good	100%	0%	0%	1	4
FIN	TW A	TAXIWAY A	TAXIWAY	102	22,177	AAC	59	Fair	91%	0%	9%	2	6
FIN	TW A	TAXIWAY A	TAXIWAY	104	7,358	AAC	25	Serious	100%	0%	0%	1	2
FIN	TW A	TAXIWAY A	TAXIWAY	105	184,752	AC	33	Very Poor	71%	29%	0%	6	40
FIN	TW A	TAXIWAY A	TAXIWAY	110	17,576	AAC	26	Very Poor	55%	45%	0%	2	6
FIN	TW A	TAXIWAY A	TAXIWAY	120	15,400	AAC	84	Satisfactory	94%	0%	6%	1	3
FIN	TW A1	TAXIWAY A1	TAXIWAY	602	25,816	AAC	92	Good	100%	0%	0%	1	5
FIN	TW B	TAXIWAY B	TAXIWAY	205	88,917	AC	63	Fair	92%	0%	8%	4	22
FIN	TW C	TAXIWAY C	TAXIWAY	305	28,798	AAC	57	Fair	97%	0%	3%	1	5
FIN	TW C	TAXIWAY C	TAXIWAY	307	11,213	AC	29	Very Poor	65%	35%	0%	1	2
FIN	TW C	TAXIWAY C	TAXIWAY	310	26,271	AAC	100	Good	0%	0%	0%	0	5
FIN	TW C	TAXIWAY C	TAXIWAY	315	39,970	AAC	100	Good	0%	0%	0%	0	8
FIN	TW C	TAXIWAY C	TAXIWAY	320	15,961	AC	100	Good	0%	0%	0%	0	3
FIN	TW D	TAXIWAY D	TAXIWAY	410	110,706	AAC	100	Good	0%	0%	0%	0	22
FIN	TW D	TAXIWAY D	TAXIWAY	414	5,779	AAC	100	Good	0%	0%	0%	0	1
FIN	TW D	TAXIWAY D	TAXIWAY	415	18,039	AAC	100	Good	0%	0%	0%	0	4
FIN	TW E	TAXIWAY E	TAXIWAY	505	32,654	AAC	100	Good	0%	0%	0%	0	7




Network ID	Branch ID	Branch Name	Branch Use	Section ID	Area (SF)	Surface	PCI	PCI Rating	PCI Pct Climate	PCI Pct Load	PCI Pct Other	Sample Units Inspected	Total Sample Units in Section
FIN	TW E	TAXIWAY E	TAXIWAY	510	71,339	AAC	100	Good	0%	0%	0%	0	19
FIN	TW E	TAXIWAY E	TAXIWAY	512	19,204	AAC	100	Good	0%	0%	0%	0	7
FIN	TW E	TAXIWAY E	TAXIWAY	515	138,069	AAC	100	Good	0%	0%	0%	0	27
FIN	TW E	TAXIWAY E	TAXIWAY	520	13,104	AC	65	Fair	57%	0%	43%	1	2
FIN	TW H	TAXIWAY H	TAXIWAY	705	130,070	AC	100	Good	0%	0%	0%	0	26



Figure 4.1.3 is an inset view of the 2017 Airfield Pavement Condition Index Exhibit that visually represents the results of the latest PCI Survey inspection. A large format exhibit is located in **Appendix C Technical Exhibits**.

Figure 4.1.3 2017 Airfield Pavement Condition Index Exhibit

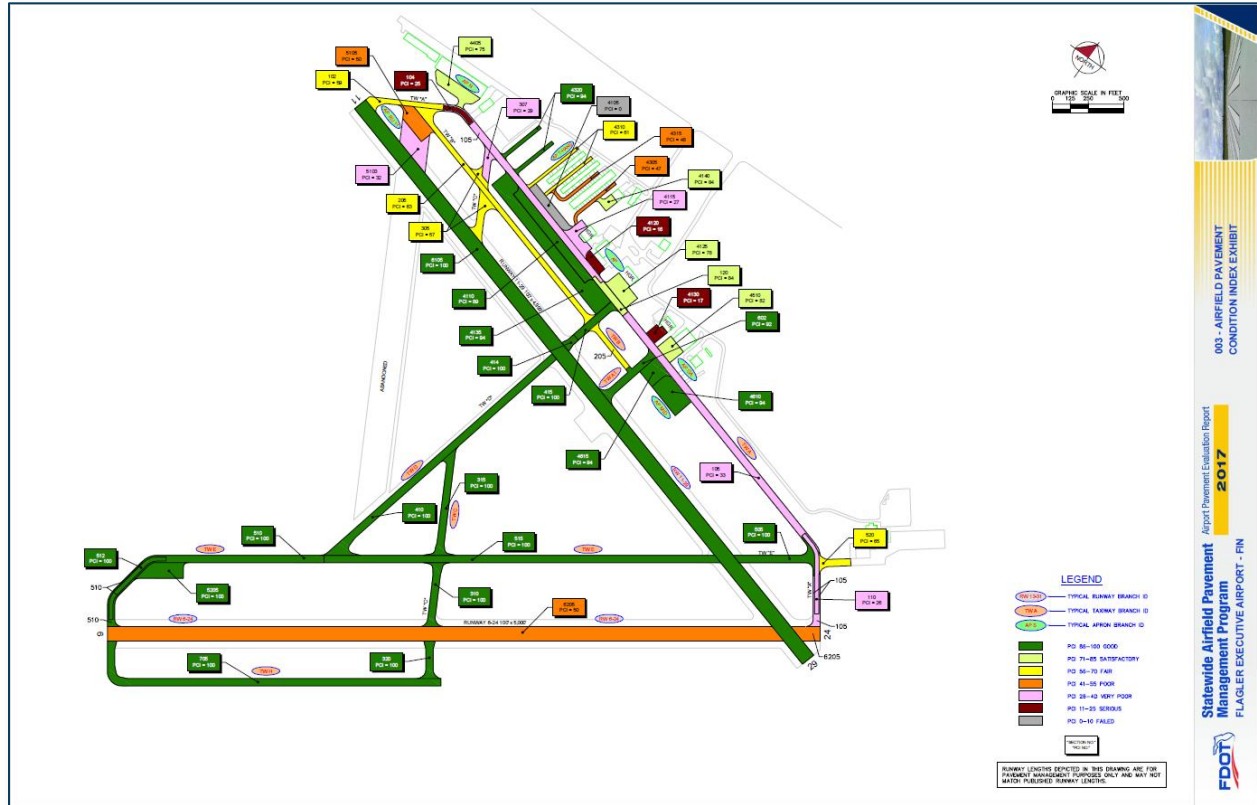



4.2 Summary of Pavement Condition Evaluation Results

4.2.1 Network-Level Observations

The field PCI Survey performed at Flagler Executive Airport (FIN) started on 01/24/2017 and was completed on 01/25/2017. The resulting overall average area-weighted PCI value was 76 representing a condition rating of Satisfactory. Flagler Executive Airport consist of two intersecting runways. Runway 06-24 is 100-ft wide and 5,000-ft long and Runway 11-29 is 100-ft wide and 4,999-ft long.

Runway 11-29 was not inspected at the direction of the Airport staff because it was scheduled for construction starting in February. Runway 11-29 will be relocated south to allow for the existing runway location to be used as a parallel taxiway and the existing taxiway areas to be expanded to a larger ramp area. This construction is scheduled to completed at the beginning of 2018.

Based on the FAA 5010 Report as of 06/12/2017 the Airport has reported 158,726 operations for 12 months ending 02/16/2016.

4.2.2 Branch-Level Observations

The following branch-level observations are intended to be an overall summary of select pavement facilities identified during the PCI Survey; further detail at the section and sample-level may be referenced for all pavements assessed as part of this System Update. The branch-level observations discussed are limited to select branches based on use and condition.

Runway 06-24

Runway 6-24 consists of 1 section constructed of AAC. The last construction year for Runway 6-24 was 1995. The average area-weighted PCI for Runway 6-24 is 50 representing a Poor condition rating. The pavement distresses observed were related to Climate, Load, and Other distress classifications. Distresses observed in Runway 6-24 consist of Alligator Cracking, Block Cracking, Depression, Longitudinal & Transverse Cracking, Raveling, and Swelling.

Taxiway A

Taxiway A consists of 5 sections constructed of AC and AAC. The last construction years range from 1942 to 2012. The average area-weighted PCI for Taxiway A is 37 representing a Very Poor condition rating. The pavement distresses observed were related to Climate, Load, and Other distress classifications. Distresses observed in Taxiway A consist of Alligator Cracking, Block Cracking, Depression, Longitudinal & Transverse Cracking, Patching, Raveling, Rutting, Swelling, and Weathering.

Taxiway B

Taxiway B consists of 1 section constructed of AC. The last construction year for Taxiway B was 1992. The average area-weighted PCI for Taxiway B is 63 representing a Fair condition rating. The pavement distresses observed were related to Climate and Other distress classifications. Distresses observed in Taxiway B consist of Longitudinal & Transverse Cracking, Oil Spillage, Raveling, Swelling, and Weathering.



Taxiway C

Taxiway C consists of 5 sections constructed of AC and AAC. The last construction years range from 1942 to 2015. The average area-weighted PCI for Taxiway C is 83 representing a Satisfactory condition rating. The pavement distresses observed were related to Climate, Load, and Other distress classifications. Distresses observed in Taxiway C consist of Alligator Cracking, Block Cracking, Depression, Longitudinal & Transverse Cracking, and Raveling.

North Apron

North Apron consists of 1 section constructed of PCC. The last construction year for North Apron was 2009. The average area-weighted PCI for North Apron is 75 representing a Satisfactory condition rating. The pavement distresses observed were related to Climate, Load, and Other distress classifications. Distresses observed in North Apron consist of Linear Cracking, Joint Seal Damage, and Shrinkage Cracking.

AP GA

The general aviation apron consists of 1 section constructed of PCC. The last construction year for Apron Ga was 2005. The average area-weighted PCI for Apron Ga is 82 representing a Satisfactory condition rating. The pavement distresses observed were related to Climate, Load, and Other distress classifications. Distresses observed in Apron Ga consist of Linear Cracking, Joint Seal Damage, and Shrinkage Cracking.

Apron

Apron consists of 8 sections constructed of AC and PCC. The last construction years range from 1942 to 2012. The average area-weighted PCI for Apron is 71 representing a Satisfactory condition rating. The pavement distresses observed were related to Climate, Load, and Other distress classifications. Distresses observed in Apron consist of Alligator Cracking, Block Cracking, Depression, Longitudinal & Transverse Cracking, Raveling, Weathering, Corner Break, Linear Cracking, Joint Seal Damage, Shattered Slab, Shrinkage Cracking, Joint Spall, and Corner Spall.

Figure 4.2.2 Pavement Condition Summary by Facility Use

Facility Use	Average Area-Weighted PCI	Condition Rating
Runway	75	Satisfactory
Taxiway	79	Satisfactory
Apron	72	Satisfactory
Taxilane	67	Fair



4.3 Forecasted Pavement Conditions

4.3.1 Performance Models and Prediction Curves

Pavement Performance Models are developed from the distress data and historic construction records collected for the SAPMP. This data is consolidated in a database and organized by inspection/construction date, pavement type, age, and pavement use. The pavement Performance Models are used to develop broad Prediction Curves, alternatively known as deterioration curves or family curves. These Prediction Curves are utilized to develop forecasted PCI values based on historic trends and statistical models.

4.3.2 Branch-Level Pavement Condition Forecast

The following **Figures 4.3.2 (a) through (c)** depict the branch-level pavement condition forecast by Branch Use (Runway, Taxiway, and/or Apron). The forecasted conditions are for a 10-year duration starting in January 2018 through January 2027.

Figure 4.3.2 (a) Forecasted Runway Pavement Performance

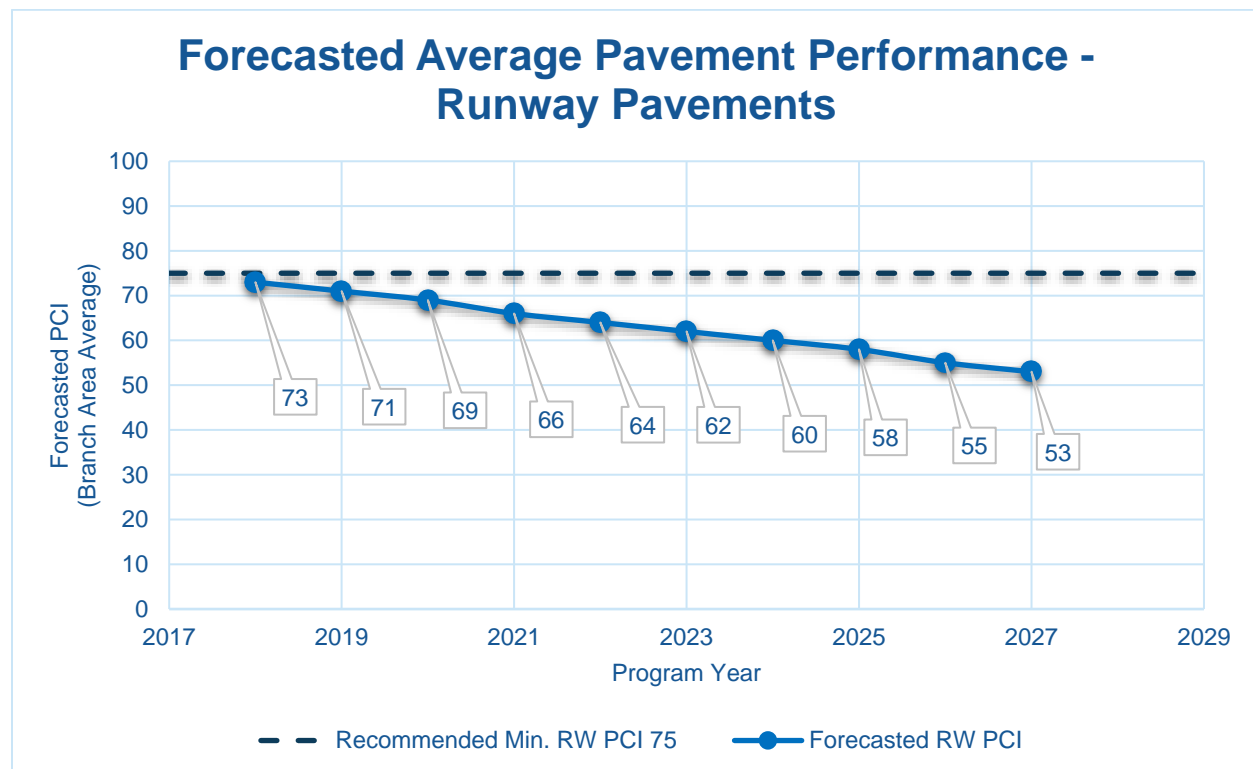




Figure 4.3.2 (b) Forecasted Taxiway Pavement Performance


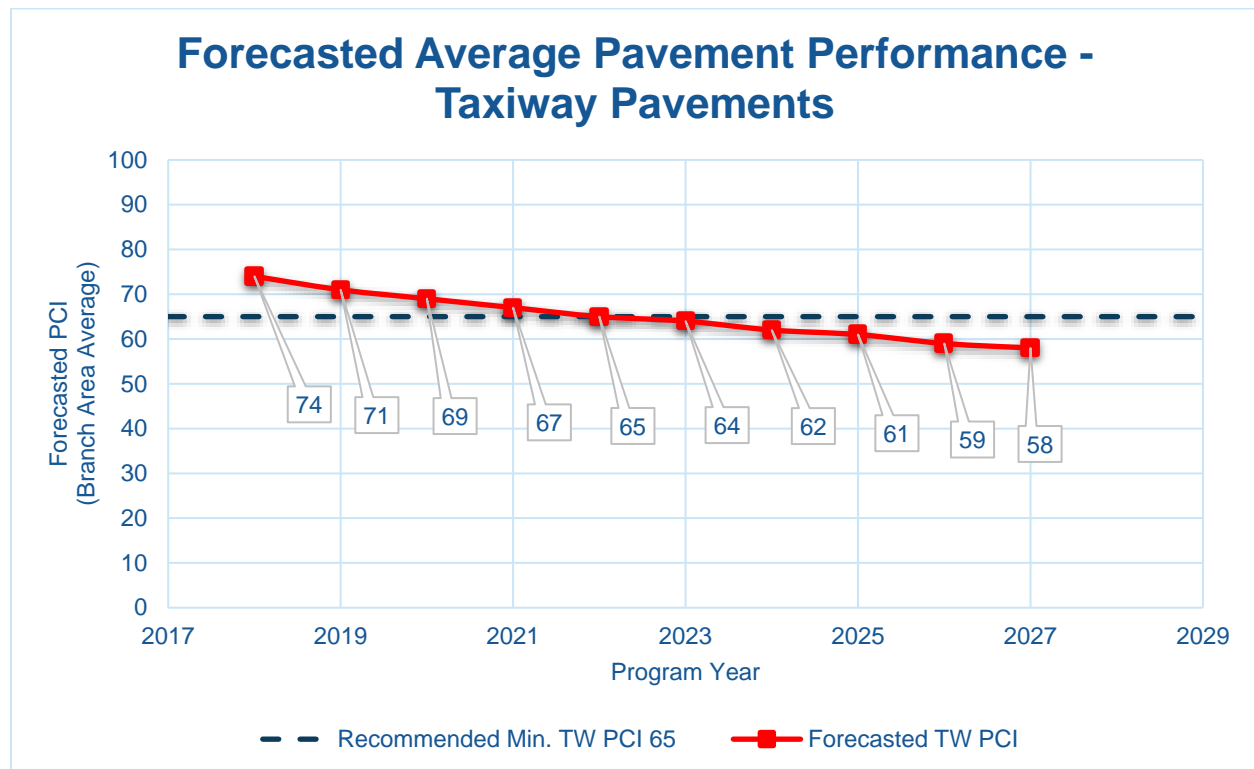


Figure 4.3.2 (c) Forecasted Apron Pavement Performance



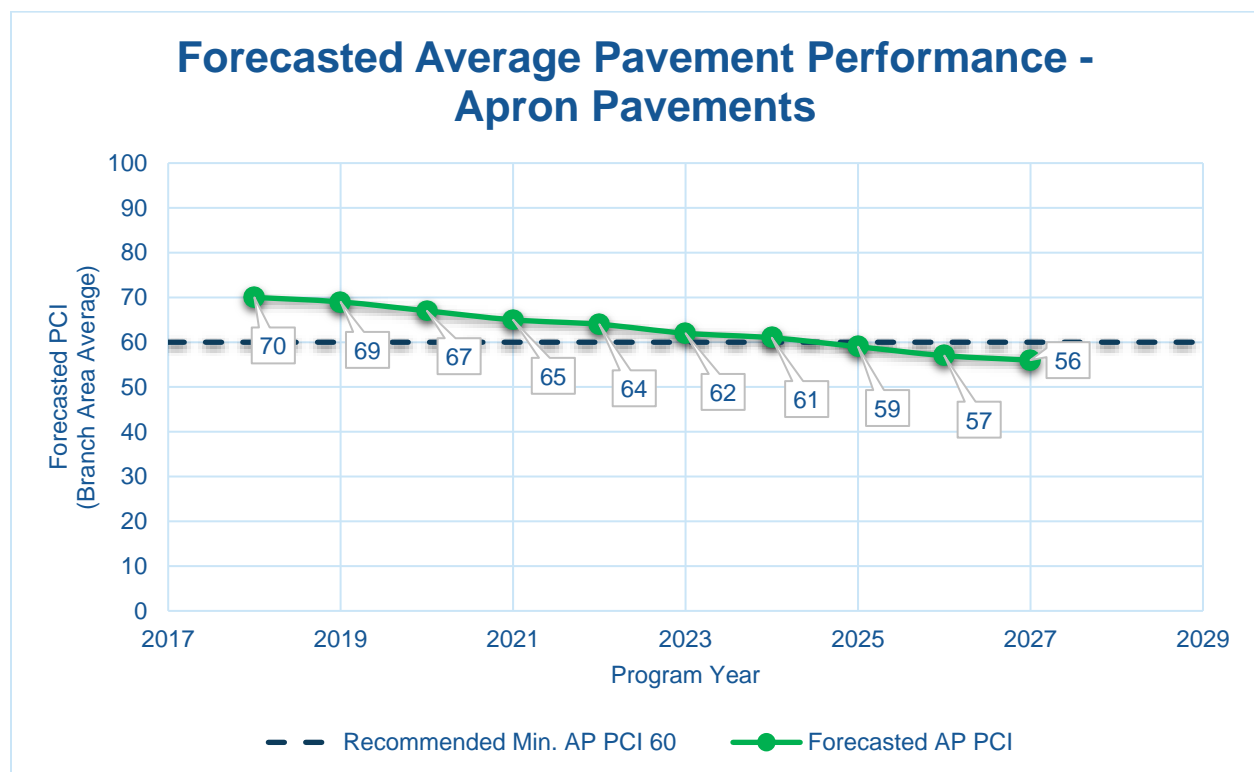

4.3.3 Section-Level Pavement Condition Forecast

The following **Table 4.3.3** provides detail to the forecasted PCI values for each section inspected. Please note the forecasted Branch- and Section-Level PCI's are for planning purposes and are subject to the sensitivities in changes in traffic and maintenance frequency. Airport staff should perform annual visual condition assessments to maintain recent understanding of pavement conditions.



Table 4.3.3 Forecasted PCI 2018-2027

Network ID	Branch ID	Section ID	Last PCI	Forecasted PCI									
				2018	2019	2020	2021	2022	2023	2024	2025	2026	2027
FIN	AP	4105	0	0	0	0	0	0	0	0	0	0	0
FIN	AP	4110	89	87	85	84	82	81	79	77	76	74	73
FIN	AP	4115	27	25	23	22	20	19	17	15	14	12	11
FIN	AP	4120	16	14	13	12	11	10	9	8	7	6	4
FIN	AP	4125	78	75	73	71	69	67	65	63	62	60	59
FIN	AP	4130	17	15	14	13	12	11	10	9	8	7	5
FIN	AP	4135	94	92	90	89	87	86	84	82	81	79	78
FIN	AP	4140	84	81	79	76	74	72	70	68	66	64	62
FIN	AP GA	4510	82	79	77	74	72	70	68	66	64	63	61
FIN	AP MID	4610	94	92	90	89	87	86	84	82	81	79	78
FIN	AP MID	4615	94	92	90	89	87	86	84	82	81	79	78
FIN	AP N	4405	75	72	70	68	66	65	63	61	60	58	57
FIN	AP RU 11	5103	32	30	28	27	25	24	22	20	19	17	16
FIN	AP RU 11	5105	50	48	46	43	40	37	35	32	30	27	24
FIN	AP RU 6	5205	100	96	95	93	92	90	88	87	85	84	82
FIN	RW 11-29	6105	100	100	98	96	95	93	91	90	88	86	85
FIN	RW 6-24	6205	50	47	44	40	37	34	31	29	26	23	21
FIN	T-HANG	4305	47	46	45	44	43	42	42	41	40	39	38
FIN	T-HANG	4310	61	60	58	57	56	55	53	52	50	49	47
FIN	T-HANG	4315	48	46	44	43	41	40	38	37	35	34	33
FIN	T-HANG	4320	94	91	89	86	84	81	79	77	75	74	72
FIN	TW A	102	59	57	55	54	52	50	49	47	46	45	44
FIN	TW A	104	25	21	17	13	10	6	2	0	0	0	0
FIN	TW A	105	33	32	31	30	29	28	28	27	26	24	23
FIN	TW A	110	26	22	18	14	11	7	3	0	0	0	0




Network ID	Branch ID	Section ID	Last PCI	Forecasted PCI									
				2018	2019	2020	2021	2022	2023	2024	2025	2026	2027
FIN	TW A	120	84	81	79	78	76	75	74	73	72	71	70
FIN	TW A1	602	92	89	86	83	81	79	77	76	75	73	72
FIN	TW B	205	63	62	61	60	59	57	56	55	54	52	51
FIN	TW C	305	57	55	53	52	50	48	47	46	45	44	44
FIN	TW C	307	29	28	27	26	25	23	21	18	14	12	9
FIN	TW C	310	100	93	90	88	85	82	80	78	77	75	74
FIN	TW C	315	100	93	90	88	85	82	80	78	77	75	74
FIN	TW C	320	100	95	93	90	88	85	83	80	78	76	75
FIN	TW D	410	100	93	90	88	85	83	80	78	77	75	74
FIN	TW D	414	100	93	90	88	85	83	80	78	77	75	74
FIN	TW D	415	100	93	90	88	85	83	80	78	77	75	74
FIN	TW E	505	100	90	88	85	83	80	78	77	75	74	73
FIN	TW E	510	100	90	88	85	83	80	78	77	75	74	73
FIN	TW E	512	100	90	88	85	83	80	78	77	75	74	73
FIN	TW E	515	100	90	88	85	83	80	78	77	75	74	73
FIN	TW E	520	65	64	63	62	61	60	59	58	57	55	54
FIN	TW H	705	100	95	93	90	88	85	83	81	78	76	75



4.3.4 Forecasted PCI Considerations

As FDOT continues to update the SAPMP with future PCI Survey inspections and assembly of airfield pavement construction work history, the performance models will be further refined. With the refinement of additional PCI and work history data points, the forecasting of pavement conditions will continue to better reflect the performance trends of airfield pavements in the Florida Airports System. Forecasted or predicted pavement conditions for the airport are intended for planning purposes only. Design-level recommendations for pavement rehabilitation and/or reconstruction will require the appropriate application of the procedures defined in FAA **AC 150/5320-6F Airport Pavement Design and Evaluation** and **AC 150/5370-11B Use of Nondestructive Testing in the Evaluation of Airport Pavements** to determine structural and/or functional conditions at the time of project.

Chapter 5

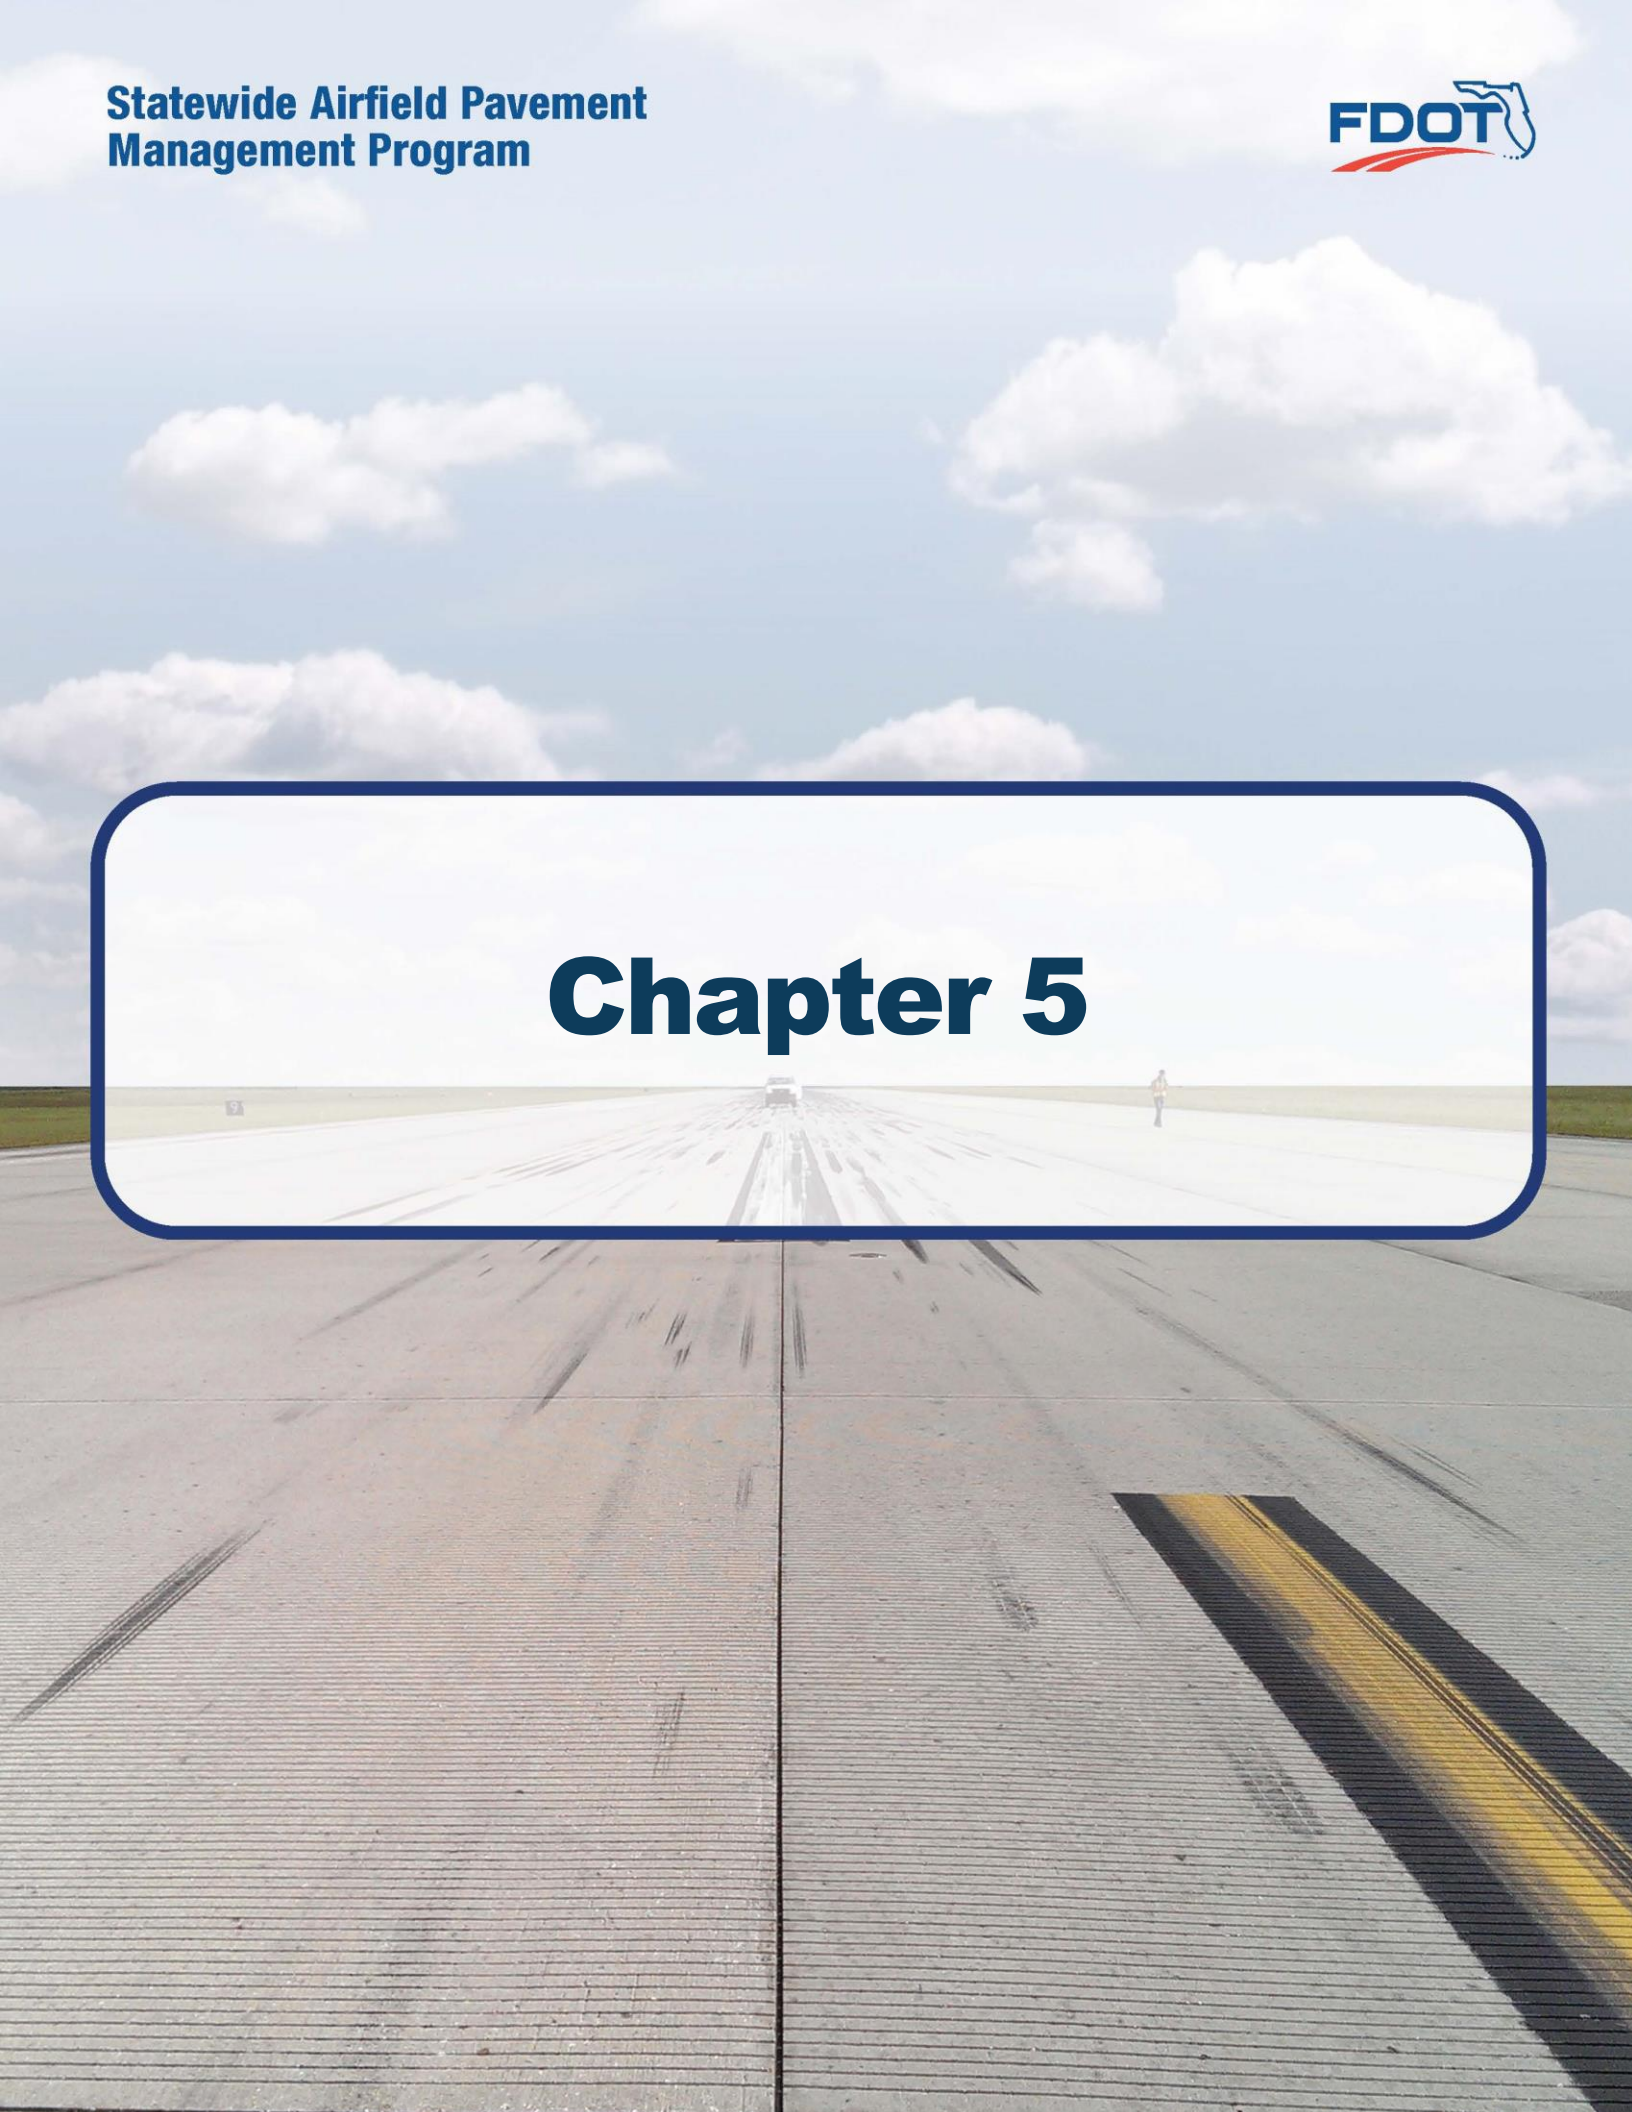



Chapter 5 – Localized Maintenance and Repair Planning

General Maintenance and Rehabilitation (M&R) methods are characterized under three broad categories: localized maintenance and repair, global treatments, and major rehabilitation.

- **Localized Maintenance and Repair** includes patching and crack sealing.
- **Global Treatments** includes surface seals and rejuvenators (flexible pavements).
- **Major Rehabilitation** includes overlays, significant slab replacement, and reconstruction.

This chapter discusses the FDOT SAPMP Localized Maintenance and Repair Planning approach. Proactive localized maintenance and repair, specifically preservation, is highly recommended to the airports. However, it is certainly recognized that once pavements have deteriorated below a certain condition, the facility would benefit from a more substantial rehabilitation in lieu of localized efforts. Chapter 6 Major Rehabilitation Planning discusses the addressing of pavements through timely rehabilitation once it has deteriorated below a critical PCI where localized repairs may not be as cost effective.

5.1 Localized Maintenance and Repair

Localized maintenance and repair is best applied as a conservation measure and is oftentimes applied to slow the rate of deterioration of distress pavements; however, may be applied as a temporary corrective measure in isolated areas. Localized maintenance and repair can be applied either as a safety (“stopgap”) measure or preventive measure. Example distress types subject to localized preventive maintenance and repair may consist of low-severity longitudinal and transverse cracking and low-severity weathering. In many cases however, localized stopgap repair is applied as a safety measure to address high-severity distress manifestations when major rehabilitation is not funded for a given section with a PCI value below critical PCI. Some agencies may elect to define both types; preventative and stopgap, as localized maintenance.

Localized Stopgap/Safety Maintenance and Repair

Localized Stopgap or Safety Maintenance and Repair is defined as the localized distress repair needed to keep pavements operational in a safe condition. These activities are typically applied to high-severity distresses or distresses affecting operational activities. Typical pavement section PCIs will range from 0 to 65.

Localized Preventive Maintenance and Repair

Localized Preventive Maintenance and Repair is defined as distress maintenance activities performed with the primary objective of slowing the rate of deterioration. These activities typically include crack sealing and patching. Typical pavement section PCIs will be above 65.



5.2 Localized Maintenance and Repair Policy

The resulting Localized Maintenance and Repair recommendations are identified based on the policy defined in **Table 5.2.1** and **Table 5.2.2**, for flexible asphalt concrete and rigid Portland cement concrete pavements, respectively. The activities identified were based on the research of practical pavement treatments in consideration of the FAA **AC 150/5380-6C “Guidelines and Procedures for Maintenance of Airport Pavements”** and the **FDOT Airfield Pavement Distress Repair Manual**. Additionally, the **Engineering Technical Letter (ETL) 14-3: Preventive Maintenance Plan (PMP) for Airfield Pavements** was referenced for conservative application of pavement treatments. The Localized Maintenance and Repair Policy and associated planning-level unit costs were developed in consideration of a network-level analysis – it is strictly intended to provide a glimpse of the condition of the airport pavements with a limited PCI survey effort.

The developed Localized Maintenance and Repair Policy and associated planning-level unit costs were based on a statewide consideration of pavement treatments and review of state construction costs for both Airfield Pavements and from the FDOT Historical Cost Information archives. Furthermore, a consideration of limited repair quantities was factored in the determination of conservative planning-level unit costs. The identified Localized maintenance activities for both preventive and stopgap activities are based on a statewide network approach; project-specific evaluation and maintenance quantities should be developed prior to any construction.

Table 5.2-1 Localized Maintenance and Repair – Flexible Asphalt Concrete

Distress	Severity	Description	Code	Work Type	Work Unit
41	Low	ALLIGATOR CR	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
41	Medium	ALLIGATOR CR	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
41	High	ALLIGATOR CR	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
42	N/A	BLEEDING	FDOT-MO-PV	FDOT - MONITOR	N/A
43	Low	BLOCK CR	FDOT-MO-PV	FDOT - MONITOR	N/A
43	Medium	BLOCK CR	FDOT-CS-AC	FDOT - CRACK SEALING - AC	Ft
43	High	BLOCK CR	FDOT-PA-AP	FDOT - PATCHING - AC PARTIAL DEPTH	SqFt
44	Low	CORRUGATION	FDOT-ML-AC	FDOT - MILLING - AC	SqFt
44	Medium	CORRUGATION	FDOT-ML-AC	FDOT - MILLING - AC	SqFt
44	High	CORRUGATION	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
45	Low	DEPRESSION	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
45	Medium	DEPRESSION	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
45	High	DEPRESSION	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
46	High	JET BLAST	FDOT-PA-AP	FDOT - PATCHING - AC PARTIAL DEPTH	SqFt
46	N/A	JET BLAST	FDOT-PA-AP	FDOT - PATCHING - AC PARTIAL DEPTH	SqFt
47	Low	JT REF. CR	FDOT-MO-PV	FDOT - MONITOR	N/A
47	Medium	JT REF. CR	FDOT-CS-AC	FDOT - CRACK SEALING - AC	Ft
47	High	JT REF. CR	FDOT-CS-AC	FDOT - CRACK SEALING - AC	Ft



Distress	Severity	Description	Code	Work Type	Work Unit
48	Low	L & T CR	FDOT-MO-PV	FDOT - MONITOR	N/A
48	Medium	L & T CR	FDOT-CS-AC	FDOT - CRACK SEALING - AC	Ft
48	High	L & T CR	FDOT-CS-AC	FDOT - CRACK SEALING - AC	Ft
49	N/A	OIL SPILLAGE	FDOT-PA-AP	FDOT - PATCHING - AC PARTIAL DEPTH	SqFt
50	Low	PATCHING	FDOT-MO-PV	FDOT - MONITOR	N/A
50	Medium	PATCHING	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
50	High	PATCHING	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
51	N/A	POLISHED AG	FDOT-SS-LO	FDOT - SURFACE SEAL	SqFt
52	Low	RAVELING	FDOT-SS-LO	FDOT - SURFACE SEAL	SqFt
52	Medium	RAVELING	FDOT-PA-AP	FDOT - PATCHING - AC PARTIAL DEPTH	SqFt
52	High	RAVELING	FDOT-PA-AP	FDOT - PATCHING - AC PARTIAL DEPTH	SqFt
53	Low	RUTTING	FDOT-MO-PV	FDOT - MONITOR	N/A
53	Medium	RUTTING	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
53	High	RUTTING	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
54	Low	SHOVING	FDOT-MO-PV	FDOT - MONITOR	N/A
54	Medium	SHOVING	FDOT-ML-AC	FDOT - MILLING - AC	SqFt
54	High	SHOVING	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
55	N/A	SLIPPAGE CR	FDOT-PA-AP	FDOT - PATCHING - AC PARTIAL DEPTH	SqFt
56	Low	SWELLING	FDOT-MO-PV	FDOT - MONITOR	N/A
56	Medium	SWELLING	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
56	High	SWELLING	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
57	Low	WEATHERING	FDOT-MO-PV	FDOT - MONITOR	N/A
57	Medium	WEATHERING	FDOT-SS-LO	FDOT - SURFACE SEAL	SqFt
57	High	WEATHERING	FDOT-PA-AP	FDOT - PATCHING - AC PARTIAL DEPTH	SqFt

Table 5.2-2 Localized Maintenance and Repair – Rigid Portland Cement Concrete

Distress	Severity	Description	Code	Work Type	Work Unit
61	Low	BLOW-UP	FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	SqFt
61	Medium	BLOW-UP	FDOT-PA-PF	FDOT - PATCHING - PCC FULL DEPTH	SqFt
61	High	BLOW-UP	FDOT-SL-PC	FDOT - SLAB REPLACEMENT - PCC	SqFt
62	Low	CORNER BREAK	FDOT-CS-PC	FDOT - CRACK SEALING - PCC	Ft
62	Medium	CORNER BREAK	FDOT-PA-PF	FDOT - PATCHING - PCC FULL DEPTH	SqFt
62	High	CORNER BREAK	FDOT-PA-PF	FDOT - PATCHING - PCC FULL DEPTH	SqFt
63	Low	LINEAR CR	FDOT-MO-PV	FDOT - MONITOR	N/A
63	Medium	LINEAR CR	FDOT-CS-PC	FDOT - CRACK SEALING - PCC	Ft
63	High	LINEAR CR	FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	SqFt



Distress	Severity	Description	Code	Work Type	Work Unit
64	Low	DURABIL. CR	FDOT-MO-PV	FDOT - MONITOR	N/A
64	Medium	DURABIL. CR	FDOT-PA-PF	FDOT - PATCHING - PCC FULL DEPTH	SqFt
64	High	DURABIL. CR	FDOT-SL-PC	FDOT - SLAB REPLACEMENT - PCC	SqFt
65	Low	JT SEAL DMG	FDOT-JS-PC	FDOT - JOINT SEAL - PCC	Ft
65	Medium	JT SEAL DMG	FDOT-JS-PC	FDOT - JOINT SEAL - PCC	Ft
65	High	JT SEAL DMG	FDOT-JS-PC	FDOT - JOINT SEAL - PCC	Ft
66	Low	SMALL PATCH	FDOT-MO-PV	FDOT - MONITOR	N/A
66	Medium	SMALL PATCH	FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	SqFt
66	High	SMALL PATCH	FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	SqFt
67	Low	LARGE PATCH	FDOT-MO-PV	FDOT - MONITOR	N/A
67	Medium	LARGE PATCH	FDOT-PA-PF	FDOT - PATCHING - PCC FULL DEPTH	SqFt
67	High	LARGE PATCH	FDOT-PA-PF	FDOT - PATCHING - PCC FULL DEPTH	SqFt
68	N/A	POPOUTS	FDOT-PO-FL	FDOT - POPOUT FILLER	SqFt
69	N/A	PUMPING	FDOT-SB-PC	FDOT - SLAB STABILIZATION - PCC	SqFt
70	Low	SCALING	FDOT-MO-PV	FDOT - MONITOR	N/A
70	Medium	SCALING	FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	SqFt
70	High	SCALING	FDOT-SL-PC	FDOT - SLAB REPLACEMENT - PCC	SqFt
71	Low	FAULTING	FDOT-MO-PV	FDOT - MONITOR	N/A
71	Medium	FAULTING	FDOT-GR-PP	FDOT - GRINDING (LOCALIZED)	Ft
71	High	FAULTING	FDOT-GR-PP	FDOT - GRINDING (LOCALIZED)	Ft
72	Low	SHAT. SLAB	FDOT-CS-PC	FDOT - CRACK SEALING - PCC	Ft
72	Medium	SHAT. SLAB	FDOT-SL-PC	FDOT - SLAB REPLACEMENT - PCC	SqFt
72	High	SHAT. SLAB	FDOT-SL-PC	FDOT - SLAB REPLACEMENT - PCC	SqFt
73	N/A	SHRINKAGE CR	FDOT-MO-PV	FDOT - MONITOR	N/A
74	Low	JOINT SPALL	FDOT-CS-PC	FDOT - CRACK SEALING - PCC	Ft
74	Medium	JOINT SPALL	FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	SqFt
74	High	JOINT SPALL	FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	SqFt
75	Low	CORNER SPALL	FDOT-CS-PC	FDOT - CRACK SEALING - PCC	Ft
75	Medium	CORNER SPALL	FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	SqFt
75	High	CORNER SPALL	FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	SqFt
76	Low	ASR	FDOT-MO-PV	FDOT - MONITOR	N/A
76	Medium	ASR	FDOT-PA-PF	FDOT - PATCHING - PCC FULL DEPTH	SqFt
76	High	ASR	FDOT-SL-PC	FDOT - SLAB REPLACEMENT - PCC	SqFt



Table 5.2-3 (a) Localized Repair Planning-Level Unit Costs – Flexible Asphalt Concrete

Code	Name	Cost	Units
FDOT-SS-LO	FDOT - SURFACE SEAL	\$0.55	SqFt
FDOT-ML-AC	FDOT - MILLING - AC	\$2.00	SqFt
FDOT-GR-PP	FDOT - GRINDING (LOCALIZED)	\$2.00	Ft
FDOT-CS-AC	FDOT - CRACK SEALING - AC	\$3.00	Ft
FDOT-MO-PV	FDOT - MONITOR	\$0.00	SqFt
FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	\$6.00	SqFt
FDOT-PA-AP	FDOT - PATCHING - AC PARTIAL DEPTH	\$3.00	SqFt

Table 5.2-3 (b) Localized M&R Planning-Level Unit Costs – Rigid Portland Cement Concrete

Code	Name	Cost	Units
FDOT-PA-PF	FDOT - PATCHING - PCC FULL DEPTH	\$100.00	SqFt
FDOT-SL-PC	FDOT - SLAB REPLACEMENT - PCC	\$30.00	SqFt
FDOT-SB-PC	FDOT - SLAB STABILIZATION - PCC	\$30.00	SqFt
FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	\$72.00	SqFt
FDOT-PO-FL	FDOT - POPOUT FILLER	\$0.05	SqFt
FDOT-GR-PP	FDOT - GRINDING (LOCALIZED)	\$2.00	Ft
FDOT-CS-PC	FDOT - CRACK SEALING - PCC	\$4.25	Ft
FDOT-MO-PV	FDOT - MONITOR	\$0.00	N/A
FDOT-JS-PC	FDOT - JOINT SEAL - PCC	\$2.75	Ft

*PCC Patching (Full Depth and Partial Depth) consider high-early-strength and high-performing repair material.



5.3 Localized Maintenance and Repair Analysis and Recommendations

The SAPMP provides a planning-level estimation of Localized Maintenance and Repair based on the results of the latest PCI Survey Inspection performed at the airport. Based on the limited sample units inspected, a statistical extrapolation of distresses at the section level is used to estimate the quantities of recommended repair activities based on the policies defined in **5.2 Localized M&R Policy**. The PCI Survey Inspections did not consist of 100% inspection of all sample units; therefore, the section-level distress quantities used to estimate the Localized Maintenance and Repair needs are for conceptual planning purposes. The accuracy of the extrapolated distresses, and therefore work quantities, is subject to the amount of sample units inspected and the concentration of distress types observed in sample units. **Appendix B** provides the estimated Localized Maintenance and Repair based on this SAPMP's PCI Survey Inspection efforts. Localized Preventive Maintenance and Repair is typically applied to pavements that are in a condition at or above the Critical PCI of 65. Localized Stopgap Maintenance and Repair is typically applied to pavements that are below the Critical PCI of 65. It is recommended that airport staff evaluate the application of Localized Maintenance and Repair in concert with the planning of Major Rehabilitation efforts identified in Chapter 6 Major Rehabilitation Planning. Pavements with Stopgap recommendations that are subject to near-term Major Rehabilitation efforts may remove the need to perform localized maintenance efforts.

The following **Table 5.3-1** summarizes the anticipated Localized Maintenance and Repair efforts based on the PCI Survey Inspection efforts performed at this airport as part of this SAPMP System Update. The following table depicts planning-level costs rounded to the nearest ten dollars.

Table 5.3-1 Summary of Airport Localized M&R Planning Cost and Quantity at Network Level

Work Description	Work Category	Rough Estimate of Work Quantity	Work Units	Planning Material Cost
FDOT - CRACK SEALING - PCC	PREVENTIVE	25	Ft	\$ 100.00
FDOT - PATCHING - PCC PARTIAL DEPTH	PREVENTIVE	35	SqFt	\$ 2,210.00
FDOT - JOINT SEAL - PCC	PREVENTIVE	10,210	Ft	\$ 28,080.00
FDOT - SLAB REPLACEMENT - PCC	STOPGAP	24,365	SqFt	\$ 730,950.00
FDOT - PATCHING - AC PARTIAL DEPTH	STOPGAP	77,935	SqFt	\$ 233,800.00
FDOT - CRACK SEALING - PCC	STOPGAP	850	Ft	\$ 3,610.00
FDOT - PATCHING - PCC FULL DEPTH	STOPGAP	580	SqFt	\$ 57,700.00
FDOT - PATCHING - PCC PARTIAL DEPTH	STOPGAP	60	SqFt	\$ 4,180.00
FDOT - JOINT SEAL - PCC	STOPGAP	3,645	Ft	\$ 10,020.00
FDOT - PATCHING - AC FULL DEPTH	STOPGAP	14,110	SqFt	\$ 84,660.00
FDOT - SURFACE SEAL	STOPGAP	863,880	SqFt	\$ 475,140.00
FDOT - CRACK SEALING - AC	STOPGAP	65,165	Ft	\$ 195,490.00



The following **Table 5.3-2** provides further breakdown of the anticipated planning-level cost at the section level for the pavements exhibiting distresses that would benefit from Localized M&R. The table shows the approximate improved “End Condition” of the section after the application of Localized M&R. The following table depicts planning-level costs rounded to the nearest ten dollars.

Table 5.3-2 Summary of Airport Localized M&R Planning Cost and Quantity at Section Level

Network ID	Branch ID	Section ID	Area (SF)	Start Condition	End Condition	Cost
FIN	AP	4105	23,645	0	80	\$ 617,470.00
FIN	AP	4110	50,015	89	89	\$ -
FIN	AP	4115	20,847	27	60	\$ 35,270.00
FIN	AP	4120	9,798	16	49	\$ 42,700.00
FIN	AP	4125	25,668	78	92	\$ 11,170.00
FIN	AP	4130	10,275	17	67	\$ 125,010.00
FIN	AP	4135	111,646	94	94	\$ -
FIN	AP	4140	8,368	84	96	\$ 2,890.00
FIN	AP GA	4510	17,338	82	90	\$ 6,630.00
FIN	AP MID	4610	38,864	94	94	\$ -
FIN	AP MID	4615	21,385	94	94	\$ -
FIN	AP N	4405	30,077	75	81	\$ 9,720.00
FIN	AP RU 11	5103	36,038	32	59	\$ 61,860.00
FIN	AP RU 11	5105	27,768	50	71	\$ 63,610.00
FIN	AP RU 6	5205	30,715	100	100	\$ -
FIN	RW 11-29	6105	500,300	100	100	\$ -
FIN	RW 6-24	6205	487,349	50	67	\$ 476,270.00
FIN	T-HANG	4305	8,395	47	71	\$ 21,350.00
FIN	T-HANG	4310	17,531	61	76	\$ 8,040.00
FIN	T-HANG	4315	8,565	48	58	\$ 4,070.00
FIN	T-HANG	4320	17,192	94	94	\$ -
FIN	TW A	102	22,177	59	85	\$ 13,350.00
FIN	TW A	104	7,358	25	51	\$ 22,090.00
FIN	TW A	105	184,752	33	58	\$ 186,410.00
FIN	TW A	110	17,576	26	58	\$ 33,880.00
FIN	TW A	120	15,400	84	84	\$ -
FIN	TW A1	602	25,816	92	92	\$ -
FIN	TW B	205	88,917	63	84	\$ 47,930.00
FIN	TW C	305	28,798	57	86	\$ 17,590.00
FIN	TW C	307	11,213	29	60	\$ 18,210.00
FIN	TW C	310	26,271	100	100	\$ -
FIN	TW C	315	39,970	100	100	\$ -
FIN	TW C	320	15,961	100	100	\$ -




Network ID	Branch ID	Section ID	Area (SF)	Start Condition	End Condition	Cost
FIN	TW D	410	110,706	100	100	\$ -
FIN	TW D	414	5,779	100	100	\$ -
FIN	TW D	415	18,039	100	100	\$ -
FIN	TW E	505	32,654	100	100	\$ -
FIN	TW E	510	71,339	100	100	\$ -
FIN	TW E	512	19,204	100	100	\$ -
FIN	TW E	515	138,069	100	100	\$ -
FIN	TW E	520	13,104	65	70	\$ 730.00
FIN	TW H	705	130,070	100	100	\$ -

The following **Table 5.3-3** provides a summary of the anticipated planning-level costs for Localized Preventive Maintenance and Repair and Localized Stopgap Maintenance and Repair. The following table depicts planning-level costs rounded to the nearest ten dollars.

Table 5.3-3 Summary of Localized Maintenance

Work Category	Cost
Preventive	\$ 30,390.00
Stopgap	\$ 1,795,550.00
Planning-Level Localized M&R Needs =	\$ 1,825,940.00

Chapter 6

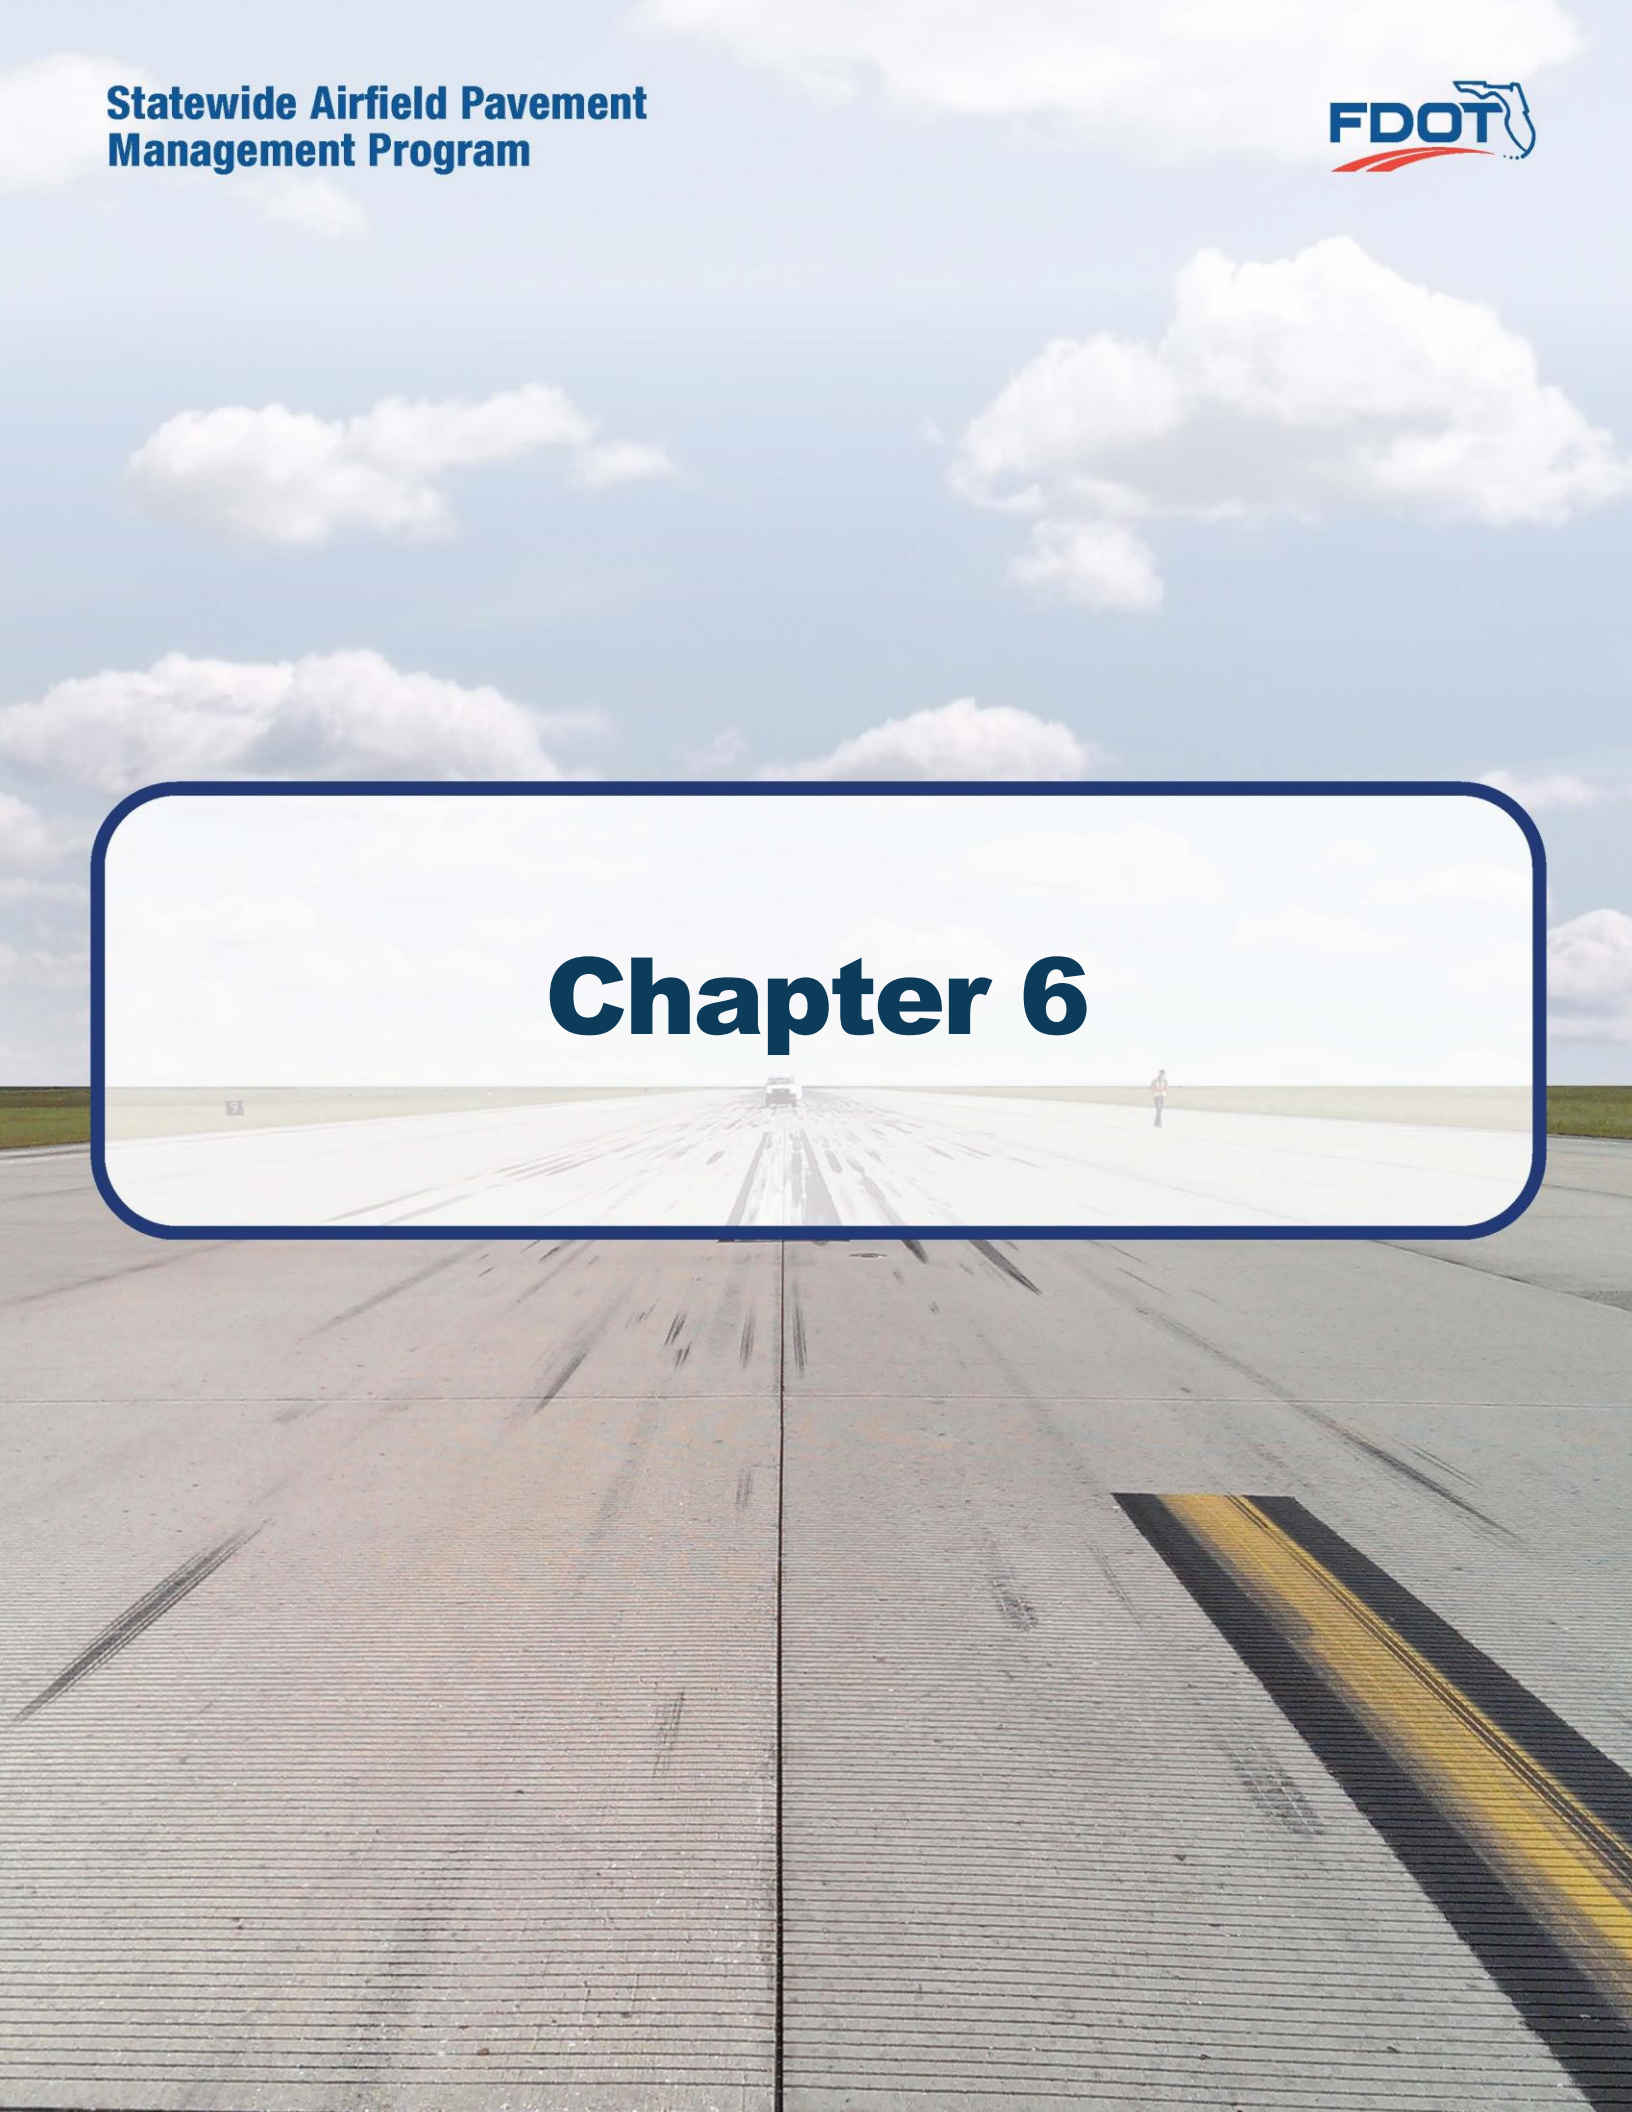



Chapter 6 – Major Rehabilitation Planning

6.1 Major Rehabilitation

Major rehabilitation is recommended to correct or improve structural deficiencies and/or functional deterioration for pavement sections within a network. Often, when pavements are subject to significant changes in the aircraft fleet mix (frequency and type), major rehabilitation is required to provide a pavement section to meet the traffic demand. Major rehabilitation is recommended when a pavement section falls below the Critical PCI value that is defined during the system customization or if a pavement section has a significant observation of load-related distress. Observation of any load-related distress potentially indicates that the section may be structurally deficient or that the aircraft loads being applied to the pavement section are different than what the section was designed for. **Figures 6.1-1 and 6.1-2** depict the decision process for major rehabilitation project identification with the assumption of available funds. Should funding be unavailable for pavement sections in need of major rehabilitation, the airport may elect to apply the appropriate localized stopgap repair.

Figure 6.1-1 Major Rehabilitation Planning Decision Diagram, $PCI \leq \text{Critical PCI}$


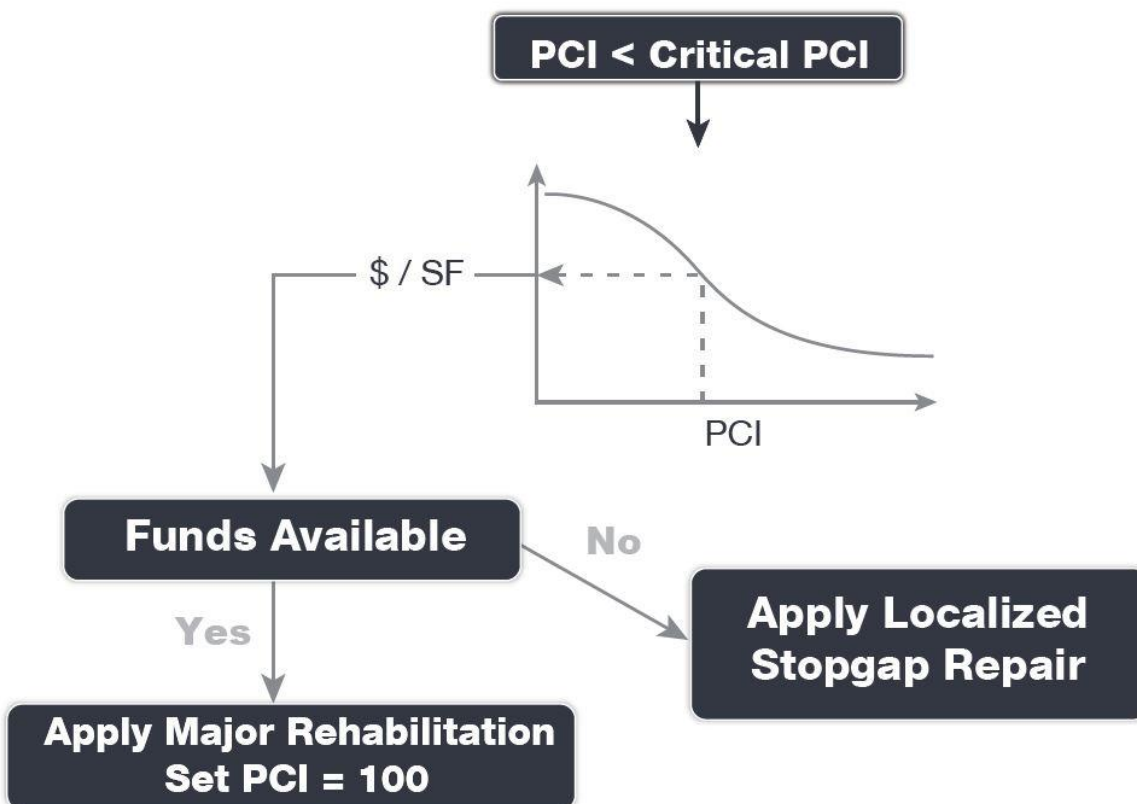




Figure 6.1-2 Major Rehabilitation Planning Decision Diagram, $PCI > \text{Critical } PCI$



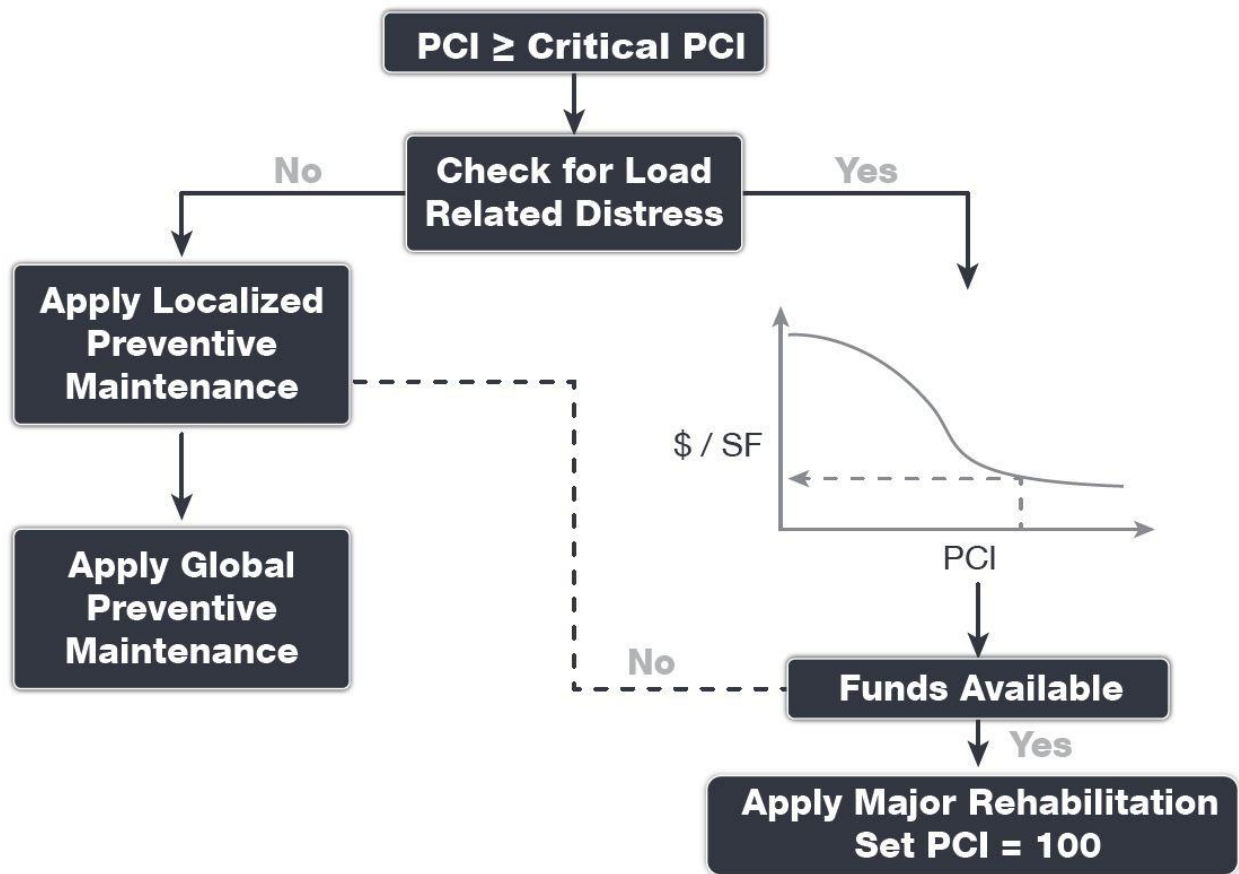

6.1.1 Critical PCI

For the FDOT SAPMP the development of a major rehabilitation program is based on the Critical PCI concept. The **Critical PCI** concept assumes that it is more cost-effective to maintain pavements above, rather than below their critical PCI. It is assumed that once a pavement section deteriorates to the Critical PCI value that it is more cost-effective to complete a major rehabilitation project rather than continuing to apply preventive maintenance. This method includes defining the Critical PCI and introducing major rehabilitation work types.

Identification of annual and long-range Major Rehabilitation work plans are typically based on the Critical PCI concept. The Critical PCI is defined as the PCI value at which the rate of loss (deterioration) increases with time, or the cost of applying localized maintenance and repair increases or is not effective. A Critical PCI is usually within a range of 55 and 70; the following procedure is standard approach in developing a specific Critical PCI:

1. Develop a pavement performance model and refine a prediction model for the pavements considered.
2. Select a localized maintenance and repair policy to be used in developing a work plan.
3. Apply the selected localized policy to the pavement sections for a range of PCI.
4. Compute the unit cost per area for each PCI range.
5. Plot the cost versus the PCI.
6. Determine the Critical PCI based on the point where the cost is insignificant.

The FDOT SAPMP defines the Critical PCI at 65 – this is based on the historic trends in pavement performance and Statewide planning efforts.

6.1.2 FDOT Recommended Minimum Service-Level PCI

The FDOT has recommended **Minimum Service-Level PCI** for airports' airfield pavements based on the following characteristics; airport type within FDOT SAPMP, branch use, and expected aircraft operations. For the purposes of Major Rehabilitation, the Critical PCI is typically the threshold condition that triggers major construction, however it is recommended that the airports maintain the Minimum Service-Level PCI with a combination of Localized Maintenance and Repair and timely Major Rehabilitation. **Table 6.1.2** summarizes the FDOT Recommended Minimum Service-Level PCI.

Table 6.1.2 FDOT Recommended Minimum Service-Level PCI

Branch Use	FDOT Recommended PCI	Additional Consideration
Runway	75	Aircraft Fleet Mix Changes Primary Runway
Taxiway / Taxilane	65	Aircraft Fleet Mix Changes Expected Operations
Aprons / Run-Ups / Ramps	60	Ground Service Equipment Non-Aircraft Operations (e.g. fueling)



6.2 Major Rehabilitation Policy

6.2.1 Major Rehabilitation Pavement Section Development

The review of the existing as-built record documentation within the participating airports' archives was used as the basis of the conceptual pavement design sections. Refinement of the pavement section layers was performed in consideration of the FAA **AC 150/5320-6F "Airport Pavement Design and Evaluation."** It should be noted that no subsurface geotechnical investigation, ALTA/ACSM Survey, topographic survey, utilities survey, environmental, or site specific air traffic study(s) have been utilized in the development of the design criteria. No warranty or assurance is implied in this document for final design nor construction for any airfield pavements discussed within this report. The following **Tables 6.2.1 (a) and (b)** provide details on the conceptual pavement sections developed for this study.

Major rehabilitation is divided into two policy categories as part of this program: Full-Depth Reconstruction (Reconstruction) and Intermediate-Level Major Rehabilitation (Restoration). Based on the pavement type, the general categories are defined as AC Reconstruction and AC Restoration for AC, AAC, and APC flexible pavement types and PCC Reconstruction and PCC Restoration for PCC rigid pavement types. The pavement sections have been based on the average GA Airport Type requirements; no pavement design has been performed in accordance with AC 150/5320-6F for the determined conceptual sections.

Table 6.2.1 (a) Conceptual Pavement Section for Major Rehabilitation – Flexible Asphalt Concrete

Rehabilitation Type	General Aviation (GA) Airport
AC Restoration <i>Combination of asphalt pavement milling and overlay with 25% of the areas subject to full-depth reconstruction.</i> PCI = 41 to 65	75% Mill and Overlay P-101 AC Milling (2") P-603 Bituminous Tack P-401 (HMA) (2") 25% AC Reconstruction P-101 Pavement Removal P-152 Subgrade (12") P-211 Base (6") P-602 Bituminous Prime P-603 Bituminous Tack P-401 HMA (2") <i>Excludes any paved shoulder features.</i>
AC Reconstruction <i>Full-depth asphalt pavement section reconstruction.</i> PCI = 40 or less	P-101 Pavement Removal P-152 Subgrade (12") P-211 Base (6") P-602 Bituminous Prime P-603 Bituminous Tack P-401 HMA (2") <i>Excludes any paved shoulder features.</i>



Table 6.2.1 (b) Conceptual Pavement Section for Major Rehabilitation – Rigid Portland Cement Concrete

Rehabilitation Type	General Aviation (GA) Airport
PCC Restoration <i>Restoration of PCC pavement with a combination of crack sealing, joint seal replacement, and replacement of 25% of slab panels.</i> PCI = 41 to 65	P-101 Pavement Removal P-605 Joint Seal Repair P-152 Subgrade (6") P-211 Base (if needed, typical) (6") P-501 Rigid PCC (10") *Select Slabs (25%) **Crack Seal and Limited Patching
PCC Reconstruction <i>Full-depth rigid pavement section reconstruction.</i> PCI = 40 or less	P-101 Pavement Removal P-605 Joint Seal Repair P-152 Subgrade (6") P-211 Base (6") P-501 Rigid PCC (10")

The identification of rehabilitation needs and conceptual pavement sections have been determined at the planning level. Design-level investigation is recommended prior to developing construction-level design documents and budgets.

In compliance with FAA Grant Assurances 11 and 19, the FDOT SAPMP provides airports with airfield pavement evaluation reports in accordance with **FAA AC 150/5380-7B Airport Pavement Management Program (PMP)** and **AC 150/5380-6C Guidelines and Procedures for Maintenance of Airport Pavements**. The application of the results of a PCI survey are for planning purposes and are limited to the visual observation of deteriorated pavements in limited sampling; design-level investigation is recommended in accordance with the FAA procedures defined in **AC 5320-6F Airport Pavement Design and Evaluation** and **AC 150/5370-11B Use of Nondestructive Testing in the Evaluation of Airport Pavements**. The aforementioned ACs provide the design-level material properties of in-situ pavement and subgrade layers for the determination of appropriate rehabilitation actions. The FDOT SAPMP is organized to provide airports with planning-level data and does not intend to preclude the responsible engineer in performing the appropriate level of investigation and analysis in determining the appropriate design details of a pavement rehabilitation. It would not be advisable to solely base design-level rehabilitation without the appropriate level of investigation and determination of pavement deterioration beyond that of a visual functional condition assessment.

6.2.2 Major Rehabilitation Planning-Level Unit Costs

Planning-level opinion of probable construction unit costs developed for this System Update was based on archived bid tabulations and records from airfield pavement projects provided by participating airports. A review of cost trends and cost factors have been incorporated to assist airports in planning for project budgets. Neither FDOT nor the Consultant Team has control over the cost of labor, materials, equipment, or over the Contractor's methods of determining prices or over competitive bidding or market conditions. Opinions of probable construction costs



provided herein are based on the information known to FDOT at this time and represent only the Consultant Team's judgment as a design professional familiar with the construction industry. This report cannot and does not guarantee that proposals, bids, or actual construction costs will not vary from its opinions of probable construction costs.

Table 6.2.2 General Aviation Major Rehabilitation Planning-Level Unit Cost by Pavement Type

Rehabilitation Type	PCI Range	Flexible Asphalt Concrete Cost Per SF	Rigid Portland Cement Concrete Cost per SF
Restoration	41 to 65	\$ 7.00	\$ 10.00
Reconstruction	0 to 40	\$ 9.00	\$ 15.00

Planning-level opinion of probable construction unit costs consider factors for non-pavement improvements, QA/QC testing, and administrative costs.

6.3 Major Rehabilitation Needs

The objective of the major pavement rehabilitation needs analysis is to provide planning-level projects within an airport's airfield pavement network. Major rehabilitation activities are recommended when a pavement section has deteriorated below the Critical PCI value, a point at which localized maintenance and repair activities may not be the most cost-effective solution. In addition, major rehabilitation is also recommended when the Section PCI is at or above the Critical PCI but the section has significant load-related PCI distresses. Identification of rehabilitation needs is done at the Airfield Pavement Network Definition's section level. This however does not limit the airport from further refining limits of project planning areas.

Major rehabilitation is identified within the FDOT SAPMP as major construction activity that would result in an improvement or resetting of the pavement section's PCI to a value of 100. Major rehabilitation recommendations (AC Restoration, AC Reconstruction, PCC Restoration, and PCC Reconstruction) should be considered as planning-level only. Additional design-level investigation in accordance to the FAA Advisory Circulars will be required. Recommendations identified within this planning document do not imply final design.

6.3.1 10-Year Unconstrained Budget Major Rehabilitation Needs

An unconstrained budget (unlimited budget) is performed for a 10-year duration to identify pavement rehabilitation needs based on current or forecasted PCI values deteriorating below the Critical PCI. FDOT recognizes airports are constrained by budgets and does not intend to convey an unrealistic approach of addressing pavement rehabilitation. The intent of the 10-Year Major Rehabilitation Needs analysis is to identify pavements that will warrant rehabilitation. It is highly recommended that airport staff utilize this information in support of the development of a practical Capital Improvement Program based on priorities, further design/project-level investigation, and budgetary constraints. The following **Table 6.3.1** summarizes all identified section-level major rehabilitation needs forecasted for the next 10-year period. It should be noted that the following table depicts planning-level costs and have been rounded for planning purposes.



Table 6.3.1 10-Year Major Rehabilitation Needs

Program Year	Network ID	Branch ID	Section ID	Surface	Area (SF)	PCI Before	Rehabilitation Type	Planning Cost
2018	FIN	AP	4105	PCC	23,645	0	PCC Reconstruction	\$ 355,000.00
2018	FIN	AP	4115	AC	20,847	25	AC Reconstruction	\$ 188,000.00
2018	FIN	AP	4120	PCC	9,798	14	PCC Reconstruction	\$ 147,000.00
2018	FIN	AP	4130	PCC	10,275	15	PCC Reconstruction	\$ 155,000.00
2018	FIN	AP RU 11	5103	AC	36,038	30	AC Reconstruction	\$ 325,000.00
2018	FIN	AP RU 11	5105	AAC	27,768	48	AC Restoration	\$ 204,000.00
2018	FIN	RW 6-24	6205	AAC	487,349	47	AC Restoration	\$ 3,679,000.00
2018	FIN	T-HANG	4305	PCC	8,395	46	PCC Restoration	\$ 100,000.00
2018	FIN	T-HANG	4310	AC	17,531	60	AC Restoration	\$ 123,000.00
2018	FIN	T-HANG	4315	AC	8,565	46	AC Restoration	\$ 66,000.00
2018	FIN	TW A	102	AAC	22,177	57	AC Restoration	\$ 156,000.00
2018	FIN	TW A	104	AAC	7,358	21	AC Reconstruction	\$ 67,000.00
2018	FIN	TW A	105	AC	184,752	32	AC Reconstruction	\$ 1,663,000.00
2018	FIN	TW A	110	AAC	17,576	22	AC Reconstruction	\$ 159,000.00
2018	FIN	TW B	205	AC	88,917	62	AC Restoration	\$ 623,000.00
2018	FIN	TW C	305	AAC	28,798	55	AC Restoration	\$ 202,000.00
2018	FIN	TW C	307	AC	11,213	28	AC Reconstruction	\$ 101,000.00
2018	FIN	TW E	520	AC	13,104	64	AC Restoration	\$ 92,000.00
2023	FIN	AP N	4405	PCC	30,077	63	PCC Restoration	\$ 301,000.00
2024	FIN	AP	4125	PCC	25,668	63	PCC Restoration	\$ 257,000.00
2025	FIN	AP GA	4510	PCC	17,338	64	PCC Restoration	\$ 174,000.00
2026	FIN	AP	4140	PCC	8,368	64	PCC Restoration	\$ 84,000.00

*All values have been rounded to the nearest thousand-dollar.

The following **Figure 6.3.1-1** summarizes the section-level major rehabilitation needs for a 10-year period between 2018 and 2027. **Figure 6.3.1-2** provides an inset view of Airfield Pavement Major Rehabilitation Exhibit, a large format exhibit is located in **Appendix C Technical Exhibits**. The exhibit graphically depicts the Major Rehabilitation Needs with rounded costs.



Figure 6.3.1-1 10-Year Major Rehabilitation Needs by Program Year



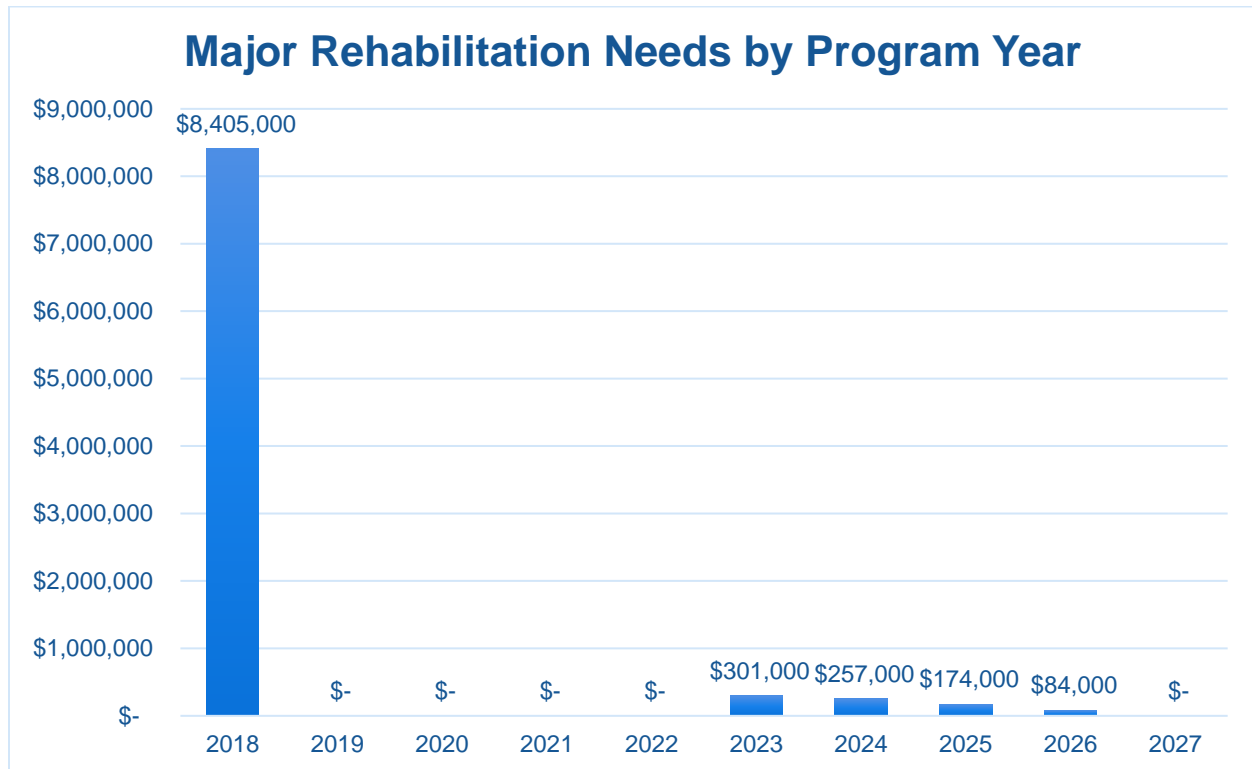




Figure 6.3.1-2 10-Year Major Rehabilitation Needs by Program Year Exhibit

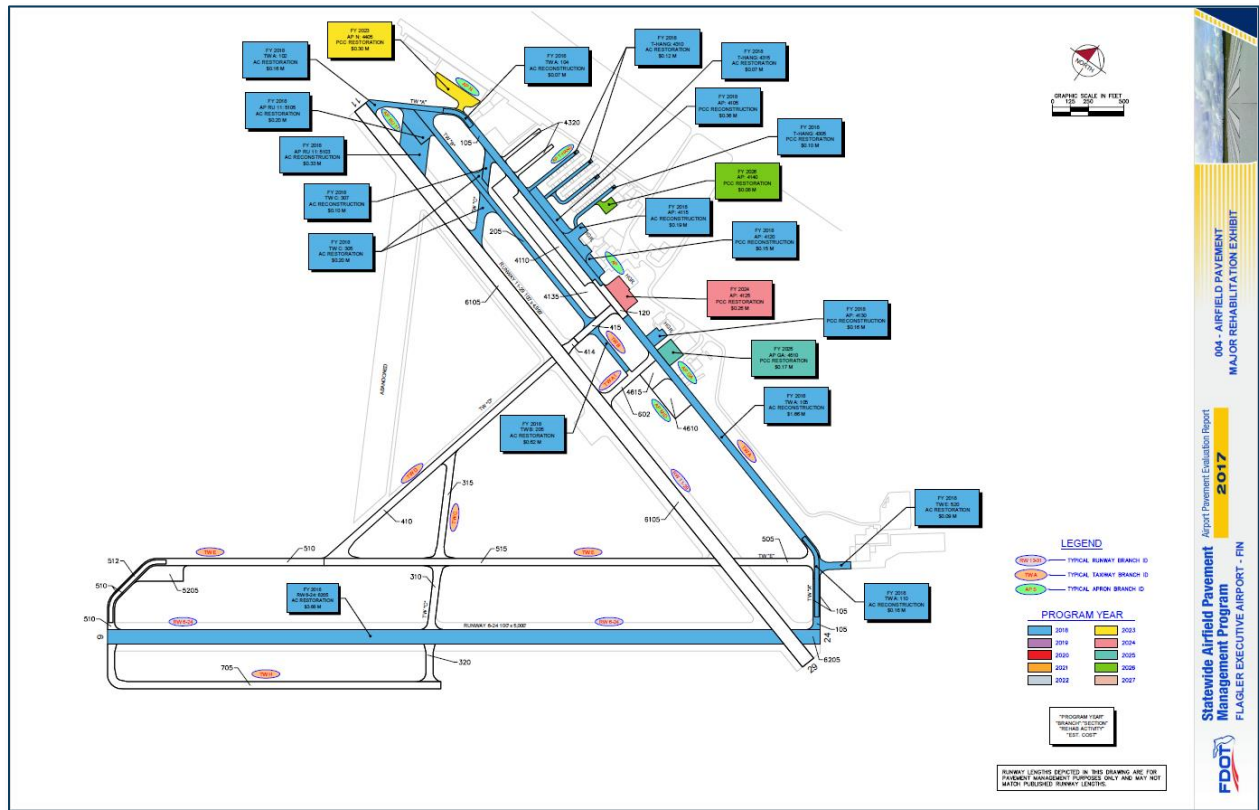

Chapter 7

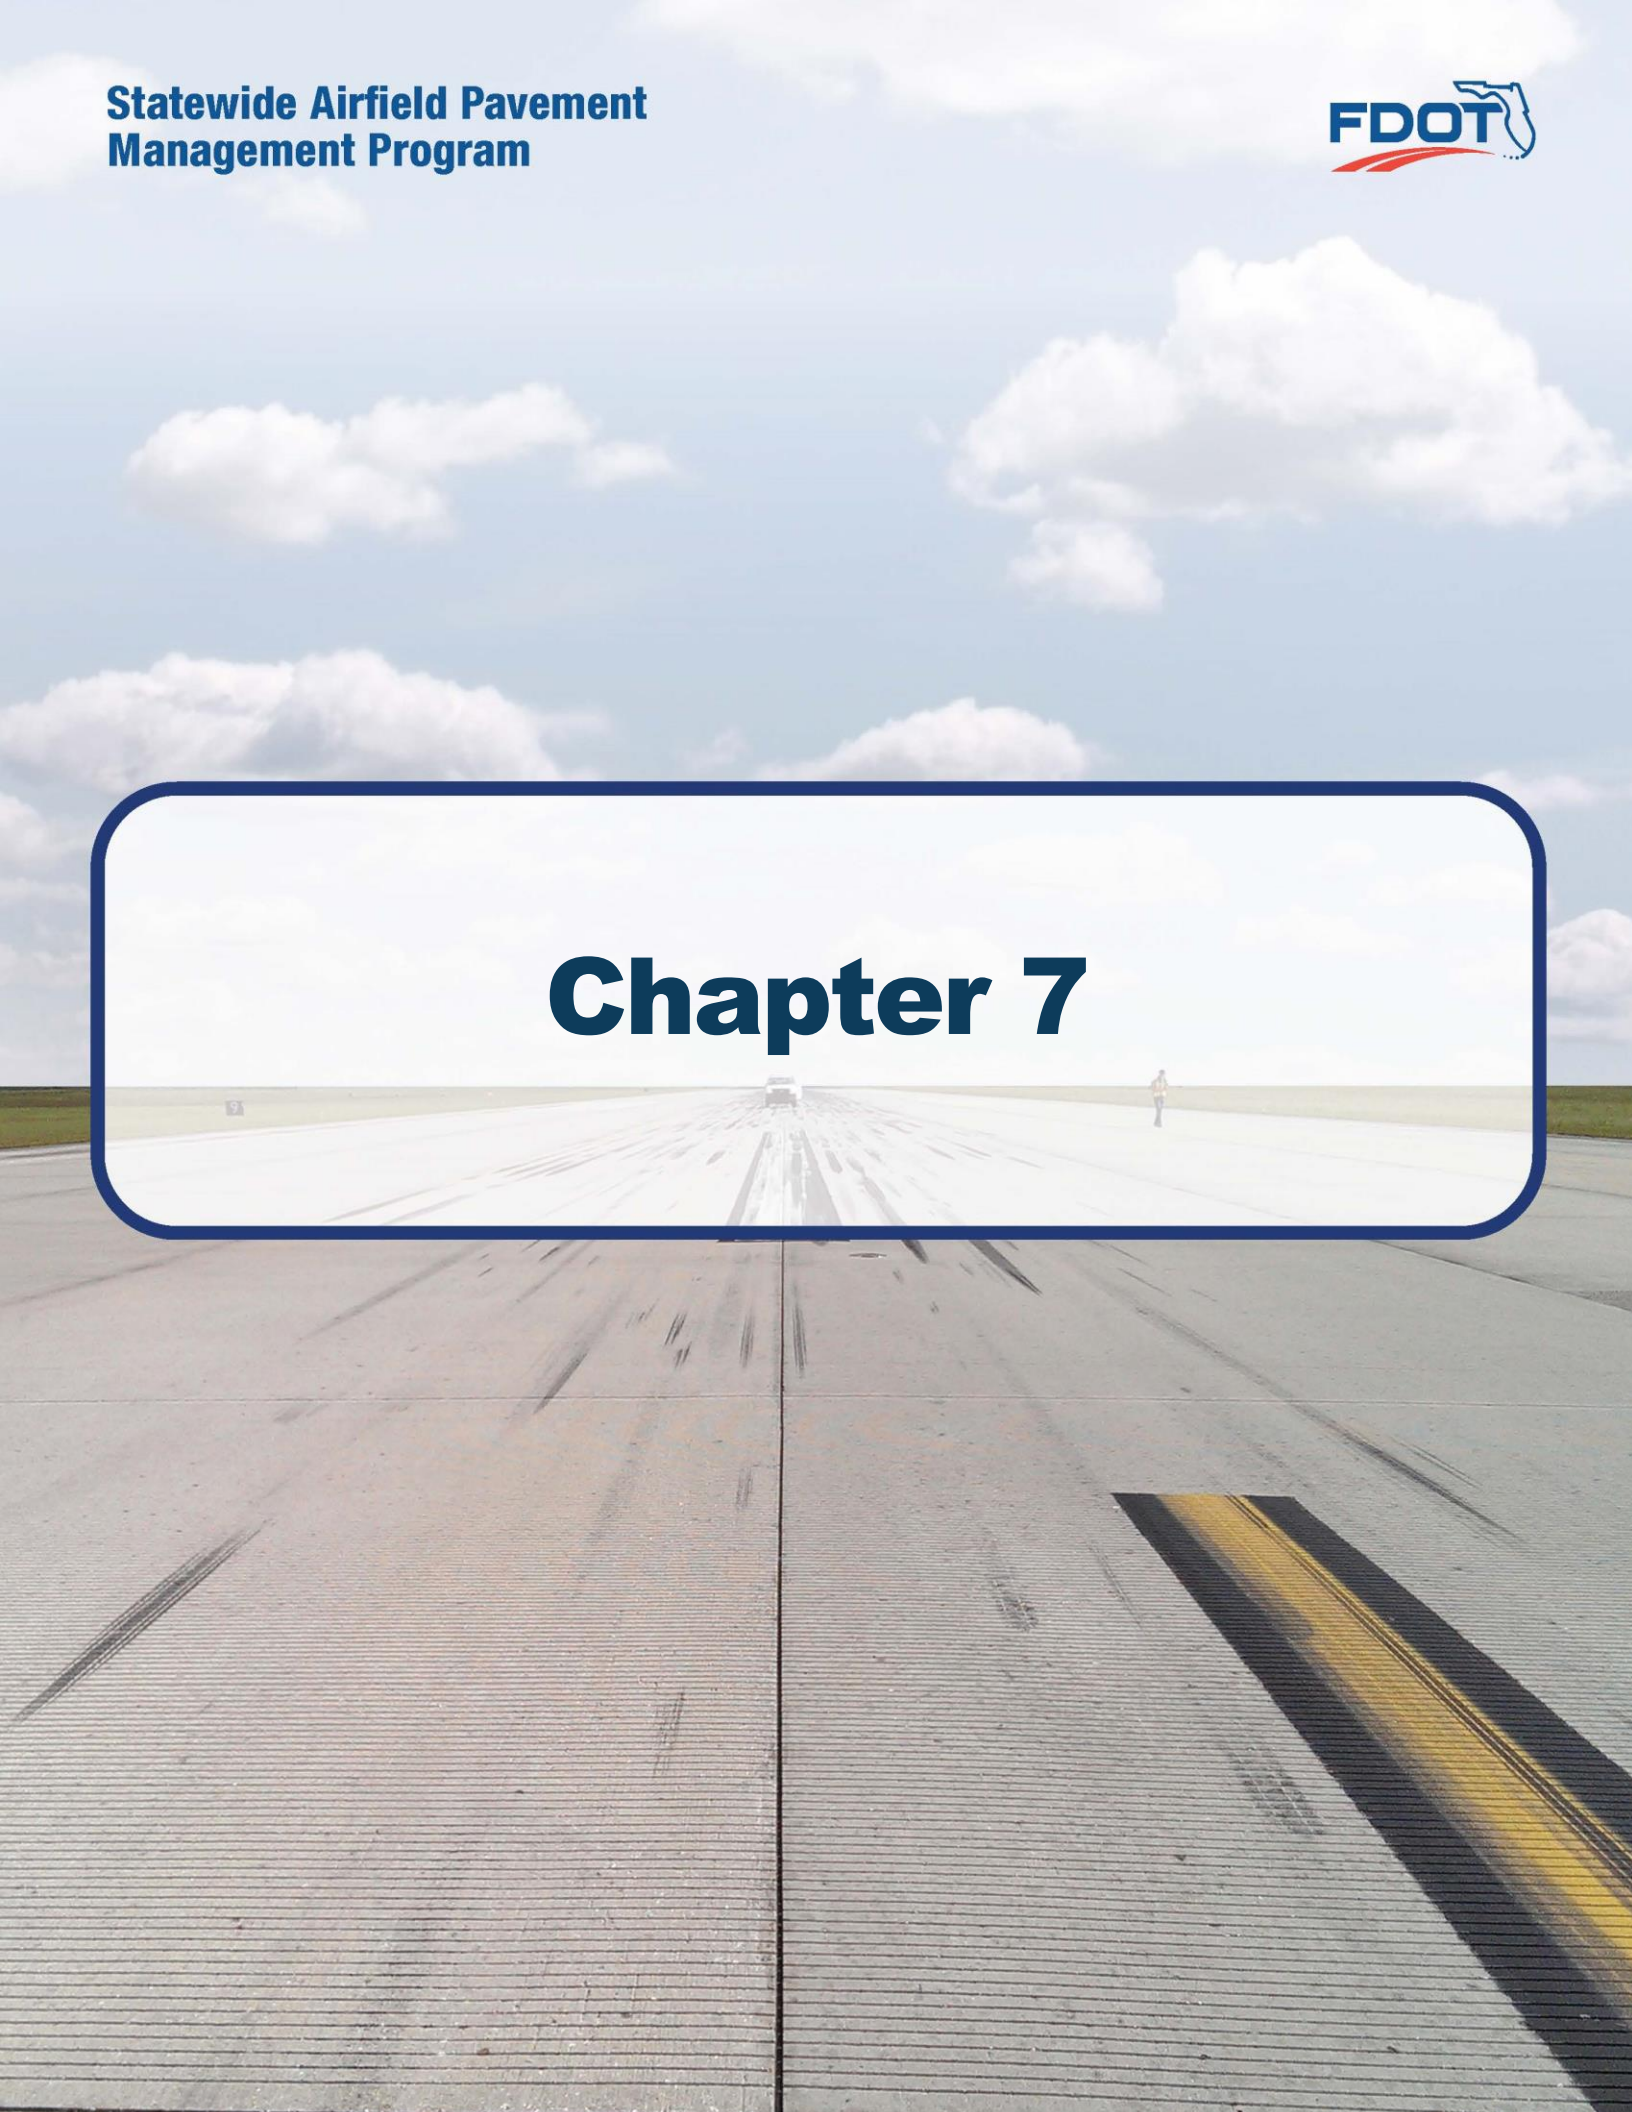



Chapter 7 – Conclusion

7.1 Recommendations

7.1.1 Continued PCI Survey Inspections

It is recommended that the airport continue to perform regularly scheduled PCI Survey inspections in accordance with the ASTM D5340-12 (or latest edition) to monitor the condition of the airfield pavement facilities.

A high priority should be considered for continuous maintenance record keeping and re-inspection of all the airport's maintained pavement facilities to ensure continued safe aircraft operations. A series of scheduled periodic inspections must be carried out for an effective maintenance program. Re-inspection of pavements should be scheduled in a timely manner to ensure that all areas, particularly those that may not come under day-to-day observation, are thoroughly evaluated and reported.

7.1.2 Localized Maintenance and Repair

While deterioration of the pavements due to usage and exposure to the environment cannot be completely prevented, applying timely and effective maintenance efforts can slow the anticipated rate of deterioration. Lack of adequate and timely maintenance is the significant factor in pavement deterioration.

It is recommended that airport sponsors coordinate with their respective Airport Maintenance staff and Airport Engineer when developing project-level maintenance and repair efforts.

7.1.3 Major Rehabilitation

Chapter 6 – Major Rehabilitation Planning identified major pavement rehabilitation project needs from 2018-2027. The identification of the rehabilitation needs was performed at the section level for manageable project areas with the assumption of an unconstrained budget scenario. Given the uncertainty in the airport-specific budget information and prioritization goals, the unconstrained budget scenario was performed to evaluate the worst-case scenario and identify all the inspected pavements' needs in a 10-year period. Certainly, it is understood that most airports are faced with constrained budgets; further evaluation of projects based on prioritization, operational criticality, funding availability, and practicality is recommended.

7.1.4 Pavement Management System

The following recommendations are made to fully implement an effective pavement management program for the airport:

- ▶ Develop a detailed preventive maintenance program for the airport.
- ▶ Further refine and implement the identified 10-year major rehabilitation needs.
- ▶ Maintain detailed records on pavement maintenance, construction, and inspection.
- ▶ Maintain records on major pavement construction projects (year, scope, cost, and construction documents).



7.2 Supporting Documents

001 – Airfield Pavement Network Definition Exhibit

The Airfield Pavement Network Definition Exhibit is located in **Appendix C Technical Exhibits**. The exhibit depicts the airfield layout in a manner that defines the airfield pavement infrastructure as branches, sections, and sample units in accordance with the ASTM D5340-12. The exhibit is intended for planning purposes only – further detail on facilities can be found on the Airport's adopted Airport Layout Plan. Detailed characteristics are tabulated in **Appendix A Pavement Analysis Tables**.

002 – Airfield Pavement System Inventory Exhibit

The Airfield Pavement System Inventory Exhibit is located in **Appendix C Technical Exhibits**. The exhibit depicts any recent and/or anticipated construction activity within the airfield pavement facilities reported by airport staff. The exhibit is intended to schematically identify the pavement limits of works and general work description. The information reported on the **Airport Response Form** provided by each participating airport was used as the basis of the changes; furthermore, changes are confirmed at the airport with airport staff during the in-brief and debrief meeting.

003 – Airfield Pavement Condition Index Exhibit

The Airfield Pavement Condition Index Exhibit is located in **Appendix C Technical Exhibits**. The exhibit is a visual summary of the latest conditions calculated from the results of the PCI Survey performed at the airport. The analysis of the distresses surveyed in accordance with the ASTM D5340-12 (referenced in **Appendix E Inspection Distress Details**) were analyzed using PAVER™ software to determine PCI values. The PCI values are identified in the exhibit and graphically represented using the standard ASTM D5340-12 colors for condition rating categories.

004 – Airfield Pavement Major Rehabilitation Exhibit

The Airfield Pavement Major Rehabilitation Exhibit is located in **Appendix C Technical Exhibits**. The exhibit has been prepared based on the section condition analysis, pavement condition forecasts, and major rehabilitation needs analysis. The exhibit graphically depicts the inventory with the associated rehabilitation type activity, program year, and the planning-level costs. The area limits, rehabilitation type, and planning-level costs should not be considered a design-level recommendation. A tabulation of the 10-Year Major Rehabilitation is located in **Appendix B Airfield Pavement Localized Maintenance and Repair and Major Rehabilitation**.

Inspection Photograph Documentation

Representative field conditions from the PCI Survey are documented with digital photographs located in **Appendix D Inspection Photograph Documentation**. Select photographs are provided with limited caption on the distresses observed – the Appendix does not contain photographs for every sample unit.



7.3 Conclusion

The FDOT SAPMP Update Phase 1 2016-2017 was completed for the airport on behalf of the FDOT ASO in accordance with the Advisory Circulars **150/5380-7B “Airport Pavement Management Program (PMP)”** and **150/5380-6C “Guidelines and Procedures for Maintenance of Airport Pavements.”** FDOT’s implementation of the SAPMP has assisted public airports with this requirement in performing PCI survey inspections and analysis in accordance with the ASTM **D5340-12 “Standard Test Method for Airport Pavement Condition Index Surveys.”**

Appendix A

Airfield Pavement Analysis Tables



Table A-1 Pavement System Inventory Details

Network ID	Branch Name	Branch ID	Branch Use	Section ID	Length (FT)	Width (FT)	Area (SF)	Surface Type	Est. Last Construction Date
FIN	APRON	AP	APRON	4105	220	60	23,645	PCC	1/1/1942
FIN	APRON	AP	APRON	4110	820	60	50,015	AC	1/1/2012
FIN	APRON	AP	APRON	4115	152.5	200	20,847	AC	1/1/1950
FIN	APRON	AP	APRON	4120	140	60	9,798	PCC	1/1/1992
FIN	APRON	AP	APRON	4125	220	110	25,668	PCC	1/1/1992
FIN	APRON	AP	APRON	4130	90	110	10,275	PCC	1/1/1992
FIN	APRON	AP	APRON	4135	1170	70	111,646	AC	1/1/2012
FIN	APRON	AP	APRON	4140	100	84	8,368	PCC	1/1/2004
FIN	APRON GA	AP GA	APRON	4510	140	120	17,338	PCC	1/1/2005
FIN	APRON MID	AP MID	APRON	4610	260	150	38,864	AC	12/1/2012
FIN	APRON MID	AP MID	APRON	4615	150	140	21,385	AC	1/1/2012
FIN	NORTH APRON	AP N	APRON	4405	350	85	30,077	PCC	1/1/2009
FIN	RUN-UP APRON AT RW 11	AP RU 11	APRON	5103	280	120	36,038	AC	1/1/1942
FIN	RUN-UP APRON AT RW 11	AP RU 11	APRON	5105	280	180	27,768	AAC	1/1/1992
FIN	RUN-UP APRON AT RW 6	AP RU 6	APRON	5205	300	100	30,715	AC	12/25/2015
FIN	RUNWAY 11-29	RW 11-29	RUNWAY	6105	5000	100	500,300	AC	1/1/2018
FIN	RUNWAY 6-24	RW 6-24	RUNWAY	6205	4850	100	487,349	AAC	1/1/1995
FIN	T-HANGAR TAXILANE	T-HANG	TAXILANE	4305	400	20	8,395	PCC	12/25/1999
FIN	T-HANGAR TAXILANE	T-HANG	TAXILANE	4310	340	20	17,531	AC	12/25/1999
FIN	T-HANGAR TAXILANE	T-HANG	TAXILANE	4315	1330	20	8,565	AC	12/25/1999
FIN	T-HANGAR TAXILANE	T-HANG	TAXILANE	4320	300	25	17,192	AC	12/1/2012
FIN	TAXIWAY A	TW A	TAXIWAY	102	500	50	22,177	AAC	1/1/1992
FIN	TAXIWAY A	TW A	TAXIWAY	104	250	30	7,358	AAC	1/1/1982
FIN	TAXIWAY A	TW A	TAXIWAY	105	3740	50	184,752	AC	1/1/1942
FIN	TAXIWAY A	TW A	TAXIWAY	110	587	30	17,576	AAC	1/1/1982
FIN	TAXIWAY A	TW A	TAXIWAY	120	290	50	15,400	AAC	1/1/2012
FIN	TAXIWAY A1	TW A1	TAXIWAY	602	500	50	25,816	AAC	12/1/2012
FIN	TAXIWAY B	TW B	TAXIWAY	205	2450	35	88,917	AC	1/1/1992
FIN	TAXIWAY C	TW C	TAXIWAY	305	410	50	28,798	AAC	1/1/1992
FIN	TAXIWAY C	TW C	TAXIWAY	307	200	50	11,213	AC	1/1/1942
FIN	TAXIWAY C	TW C	TAXIWAY	310	450	50	26,271	AAC	12/25/2015
FIN	TAXIWAY C	TW C	TAXIWAY	315	650	50	39,970	AAC	12/25/2015
FIN	TAXIWAY C	TW C	TAXIWAY	320	300	50	15,961	AC	12/25/2015
FIN	TAXIWAY D	TW D	TAXIWAY	410	2000	50	110,706	AAC	1/1/2016
FIN	TAXIWAY D	TW D	TAXIWAY	414	80	50	5,779	AAC	1/1/2016
FIN	TAXIWAY D	TW D	TAXIWAY	415	310	50	18,039	AAC	1/1/2016



Network ID	Branch Name	Branch ID	Branch Use	Section ID	Length (FT)	Width (FT)	Area (SF)	Surface Type	Est. Last Construction Date
FIN	TAXIWAY E	TW E	TAXIWAY	505	550	35	32,654	AAC	1/1/2015
FIN	TAXIWAY E	TW E	TAXIWAY	510	1100	50	71,339	AAC	1/1/2015
FIN	TAXIWAY E	TW E	TAXIWAY	512	645	30	19,204	AAC	1/1/2015
FIN	TAXIWAY E	TW E	TAXIWAY	515	1670	50	138,069	AAC	1/1/2015
FIN	TAXIWAY E	TW E	TAXIWAY	520	465	50	13,104	AC	1/1/2004
FIN	TAXIWAY H	TW H	TAXIWAY	705	2600	50	130,070	AC	1/1/2016



Table A-2 Pavement Condition Index Summary (Last Inspection) – Section Level

Network ID	Branch Name	Branch Use	Section ID	Area (SF)	PCI	Condition Rating
FIN	RUNWAY 11-29	RUNWAY	6105	500,300	100	Good
FIN	RUNWAY 6-24	RUNWAY	6205	487,349	50	Poor
FIN	TAXIWAY A	TAXIWAY	102	22,177	59	Fair
FIN	TAXIWAY A	TAXIWAY	104	7,358	25	Serious
FIN	TAXIWAY A	TAXIWAY	105	184,752	33	Very Poor
FIN	TAXIWAY A	TAXIWAY	110	17,576	26	Very Poor
FIN	TAXIWAY A	TAXIWAY	120	15,400	84	Satisfactory
FIN	TAXIWAY A1	TAXIWAY	602	25,816	92	Good
FIN	TAXIWAY B	TAXIWAY	205	88,917	63	Fair
FIN	TAXIWAY C	TAXIWAY	305	28,798	57	Fair
FIN	TAXIWAY C	TAXIWAY	307	11,213	29	Very Poor
FIN	TAXIWAY C	TAXIWAY	310	26,271	100	Good
FIN	TAXIWAY C	TAXIWAY	315	39,970	100	Good
FIN	TAXIWAY C	TAXIWAY	320	15,961	100	Good
FIN	TAXIWAY D	TAXIWAY	410	110,706	100	Good
FIN	TAXIWAY D	TAXIWAY	414	5,779	100	Good
FIN	TAXIWAY D	TAXIWAY	415	18,039	100	Good
FIN	TAXIWAY E	TAXIWAY	505	32,654	100	Good
FIN	TAXIWAY E	TAXIWAY	510	71,339	100	Good
FIN	TAXIWAY E	TAXIWAY	512	19,204	100	Good
FIN	TAXIWAY E	TAXIWAY	515	138,069	100	Good
FIN	TAXIWAY E	TAXIWAY	520	13,104	65	Fair
FIN	TAXIWAY H	TAXIWAY	705	130,070	100	Good
FIN	T-HANGAR TAXILANE	TAXILANE	4305	8,395	47	Poor
FIN	T-HANGAR TAXILANE	TAXILANE	4310	17,531	61	Fair
FIN	T-HANGAR TAXILANE	TAXILANE	4315	8,565	48	Poor
FIN	T-HANGAR TAXILANE	TAXILANE	4320	17,192	94	Good
FIN	APRON	APRON	4105	23,645	0	Failed
FIN	APRON	APRON	4110	50,015	89	Good
FIN	APRON	APRON	4115	20,847	27	Very Poor
FIN	APRON	APRON	4120	9,798	16	Serious
FIN	APRON	APRON	4125	25,668	78	Satisfactory
FIN	APRON	APRON	4130	10,275	17	Serious
FIN	APRON	APRON	4135	111,646	94	Good
FIN	APRON	APRON	4140	8,368	84	Satisfactory
FIN	NORTH APRON	APRON	4405	30,077	75	Satisfactory
FIN	APRON GA	APRON	4510	17,338	82	Satisfactory
FIN	APRON MID	APRON	4610	38,864	94	Good



Network ID	Branch Name	Branch Use	Section ID	Area (SF)	PCI	Condition Rating
FIN	APRON MID	APRON	4615	21,385	94	Good
FIN	RUN-UP APRON AT RW 11	APRON	5103	36,038	32	Very Poor
FIN	RUN-UP APRON AT RW 11	APRON	5105	27,768	50	Poor
FIN	RUN-UP APRON AT RW 6	APRON	5205	30,715	100	Good



Table A-3 Forecasted PCI 2018-2027

Network ID	Branch ID	Section ID	Last PCI	Forecasted PCI									
				2018	2019	2020	2021	2022	2023	2024	2025	2026	2027
FIN	AP	4105	0	0	0	0	0	0	0	0	0	0	0
FIN	AP	4110	89	87	85	84	82	81	79	77	76	74	73
FIN	AP	4115	27	25	23	22	20	19	17	15	14	12	11
FIN	AP	4120	16	14	13	12	11	10	9	8	7	6	4
FIN	AP	4125	78	75	73	71	69	67	65	63	62	60	59
FIN	AP	4130	17	15	14	13	12	11	10	9	8	7	5
FIN	AP	4135	94	92	90	89	87	86	84	82	81	79	78
FIN	AP	4140	84	81	79	76	74	72	70	68	66	64	62
FIN	AP GA	4510	82	79	77	74	72	70	68	66	64	63	61
FIN	AP MID	4610	94	92	90	89	87	86	84	82	81	79	78
FIN	AP MID	4615	94	92	90	89	87	86	84	82	81	79	78
FIN	AP N	4405	75	72	70	68	66	65	63	61	60	58	57
FIN	AP RU 11	5103	32	30	28	27	25	24	22	20	19	17	16
FIN	AP RU 11	5105	50	48	46	43	40	37	35	32	30	27	24
FIN	AP RU 6	5205	100	96	95	93	92	90	88	87	85	84	82
FIN	RW 11-29	6105	100	100	98	96	95	93	91	90	88	86	85
FIN	RW 6-24	6205	50	47	44	40	37	34	31	29	26	23	21
FIN	T-HANG	4305	47	46	45	44	43	42	42	41	40	39	38
FIN	T-HANG	4310	61	60	58	57	56	55	53	52	50	49	47
FIN	T-HANG	4315	48	46	44	43	41	40	38	37	35	34	33
FIN	T-HANG	4320	94	91	89	86	84	81	79	77	75	74	72
FIN	TW A	102	59	57	55	54	52	50	49	47	46	45	44
FIN	TW A	104	25	21	17	13	10	6	2	0	0	0	0
FIN	TW A	105	33	32	31	30	29	28	28	27	26	24	23
FIN	TW A	110	26	22	18	14	11	7	3	0	0	0	0
FIN	TW A	120	84	81	79	78	76	75	74	73	72	71	70
FIN	TW A1	602	92	89	86	83	81	79	77	76	75	73	72
FIN	TW B	205	63	62	61	60	59	57	56	55	54	52	51
FIN	TW C	305	57	55	53	52	50	48	47	46	45	44	44
FIN	TW C	307	29	28	27	26	25	23	21	18	14	12	9
FIN	TW C	310	100	93	90	88	85	82	80	78	77	75	74
FIN	TW C	315	100	93	90	88	85	82	80	78	77	75	74
FIN	TW C	320	100	95	93	90	88	85	83	80	78	76	75
FIN	TW D	410	100	93	90	88	85	83	80	78	77	75	74
FIN	TW D	414	100	93	90	88	85	83	80	78	77	75	74
FIN	TW D	415	100	93	90	88	85	83	80	78	77	75	74
FIN	TW E	505	100	90	88	85	83	80	78	77	75	74	73



Network ID	Branch ID	Section ID	Last PCI	Forecasted PCI									
				2018	2019	2020	2021	2022	2023	2024	2025	2026	2027
FIN	TW E	510	100	90	88	85	83	80	78	77	75	74	73
FIN	TW E	512	100	90	88	85	83	80	78	77	75	74	73
FIN	TW E	515	100	90	88	85	83	80	78	77	75	74	73
FIN	TW E	520	65	64	63	62	61	60	59	58	57	55	54
FIN	TW H	705	100	95	93	90	88	85	83	81	78	76	75

7/18/2017

Work History Report

Page 1 of 8

Pavement Database: FDOT

Network: FLAGLER EXECUTI Branch: AP GA APRON GA Section: 4510 Surface: PCC L.C.D.: 1/1/2005 Use: APRON Rank: P Length: 140.00 (Ft) Width: 120.00 (Ft) True Area: 17,338.00 (SqFt)						
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2005	NU-IN	New Construction - Initial	0.00	0.00	<input checked="" type="checkbox"/>	

Network: FLAGLER EXECUTI Branch: AP MID APRON MID Section: 4610 Surface: AC L.C.D.: 12/1/2012 Use: APRON Rank: P Length: 260.00 (Ft) Width: 150.00 (Ft) True Area: 38,864.00 (SqFt)						
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
12/1/2012	NU-IN	New Construction - Initial	0.00	0.00	<input checked="" type="checkbox"/>	4" P401, 6" comp. base. consisting of 4"

Network: FLAGLER EXECUTI Branch: AP MID APRON MID Section: 4615 Surface: AC L.C.D.: 1/1/2012 Use: APRON Rank: P Length: 150.00 (Ft) Width: 140.00 (Ft) True Area: 21,385.00 (SqFt)						
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2012	NU-IN	New Construction - Initial	0.00	0.00	<input checked="" type="checkbox"/>	4" p401 on comp base

Network: FLAGLER EXECUTI Branch: AP N NORTH APRON Section: 4405 Surface: PCC L.C.D.: 1/1/2009 Use: APRON Rank: S Length: 350.00 (Ft) Width: 85.00 (Ft) True Area: 30,077.00 (SqFt)						
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2009	NU-IN	New Construction - Initial	0.00	0.00	<input checked="" type="checkbox"/>	

Network: FLAGLER EXECUTI Branch: AP RU 11 RUN-UP APRON Section: 5103 Surface: AC L.C.D.: 1/1/1942 Use: APRON Rank: P Length: 280.00 (Ft) Width: 120.00 (Ft) True Area: 36,038.00 (SqFt)						
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/1942	NU-IN	New Construction - Initial	0.00	0.00	<input checked="" type="checkbox"/>	

Network: FLAGLER EXECUTI Branch: AP RU 11 RUN-UP APRON Section: 5105 Surface: AAC L.C.D.: 1/1/1992 Use: APRON Rank: P Length: 280.00 (Ft) Width: 180.00 (Ft) True Area: 27,768.00 (SqFt)						
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/1992	IMPORT ED	BUILT	0.00	0.00	<input checked="" type="checkbox"/>	1992: AC OVERLAY

Network: FLAGLER EXECUTI Branch: AP RU 6 RUN-UP APRON Section: 5205 Surface: AC L.C.D.: 12/25/201 Use: APRON Rank: P Length: 300.00 (Ft) Width: 100.00 (Ft) True Area: 30,715.00 (SqFt)						
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
12/25/2015	NC-AC	New Construction - AC	0.00	0.00	<input checked="" type="checkbox"/>	

7/18/2017

Work History Report

Page 2 of 8

Pavement Database: FDOT

Network: FLAGLER EXECUTI		Branch: AP		APRON		Section: 4105		Surface: PCC	
L.C.D.: 1/1/1942		Use: APRON		Rank: P		Length: 220.00 (Ft)		Width: 60.00 (Ft) True Area: 23,645.00 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments			
1/1/1942	IMPORT ED	BUILT	0.00	8.00	<input checked="" type="checkbox"/>	1942: 8" PCC PAVEMENT			
1/1/1942	IMPORT ED	OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	SOIL: SP			

Network: FLAGLER EXECUTI		Branch: AP		APRON		Section: 4110		Surface: AC	
L.C.D.: 1/1/2012		Use: APRON		Rank: P		Length: 820.00 (Ft)		Width: 60.00 (Ft) True Area: 50,015.00 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments			
1/1/2012	CR-AC	Complete Reconstruction - AC	0.00	0.00	<input checked="" type="checkbox"/>	4" P-401, 6" COMP BASE OF 4" RECL			
1/1/1942	IMPORT ED	OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	SOIL: SP			
1/1/1942	IMPORT ED	BUILT	0.00	8.00	<input checked="" type="checkbox"/>	1942: 8" PCC PAVEMENT			

Network: FLAGLER EXECUTI		Branch: AP		APRON		Section: 4115		Surface: AC	
L.C.D.: 1/1/1950		Use: APRON		Rank: P		Length: 152.50 (Ft)		Width: 200.00 (Ft) True Area: 20,847.00 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments			
1/1/1950	IMPORT ED	OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	SOIL: SP			
1/1/1950	IMPORT ED	BUILT	0.00	0.00	<input checked="" type="checkbox"/>	ESTIMATE 1950 AC PAVEMENT			

Network: FLAGLER EXECUTI		Branch: AP		APRON		Section: 4120		Surface: PCC	
L.C.D.: 1/1/1992		Use: APRON		Rank: P		Length: 140.00 (Ft)		Width: 60.00 (Ft) True Area: 9,798.00 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments			
1/1/1992	IMPORT ED	BUILT	0.00	0.00	<input checked="" type="checkbox"/>	1992: PORTLAND CEMENT CONCRETE			

Network: FLAGLER EXECUTI		Branch: AP		APRON		Section: 4125		Surface: PCC	
L.C.D.: 1/1/1992		Use: APRON		Rank: P		Length: 220.00 (Ft)		Width: 110.00 (Ft) True Area: 25,668.00 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments			
1/1/1992	IMPORT ED	BUILT	0.00	0.00	<input checked="" type="checkbox"/>	1992: PORTLAND CEMENT PAVEMENT			

Network: FLAGLER EXECUTI		Branch: AP		APRON		Section: 4130		Surface: PCC	
L.C.D.: 1/1/1992		Use: APRON		Rank: P		Length: 90.00 (Ft)		Width: 110.00 (Ft) True Area: 10,275.00 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments			
1/1/1992	IMPORT ED	BUILT	0.00	0.00	<input checked="" type="checkbox"/>	1992: PORTLAND CEMENT PAVEMENT			

7/18/2017

Work History Report

Page 3 of 8

Pavement Database: FDOT

Network: FLAGLER EXECUTI		Branch: AP	APRON		Section: 4135	Surface: AC
L.C.D.: 1/1/2012	Use: APRON	Rank: P	Length: 1,170.00 (Ft)	Width: 70.00 (Ft)	True Area: 111,646.00 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2012	HI-AG	New Construction	0.00	0.00	<input checked="" type="checkbox"/>	FULL DEP RECLAMATION, ROTO T 1992: AC PAVEMENT
1/1/1992	IMPORT ED	BUILT	0.00	0.00	<input checked="" type="checkbox"/>	

Network: FLAGLER EXECUTI		Branch: AP	APRON		Section: 4140	Surface: PCC
L.C.D.: 1/1/2004	Use: APRON	Rank: S	Length: 100.00 (Ft)	Width: 84.00 (Ft)	True Area: 8,368.00 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2004	NU-IN	New Construction - Initial	0.00	0.00	<input checked="" type="checkbox"/>	Estimated Construction Date

Network: FLAGLER EXECUTI		Branch: RW 11-29	RUNWAY 11-29		Section: 6105	Surface: AC
L.C.D.: 2/1/2018	Use: RUNWAY	Rank: P	Length: 5,000.00 (Ft)	Width: 100.00 (Ft)	True Area: 500,300.00 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
2/1/2018	CR-AC	Complete Reconstruction - AC	2,501,500.00	0.00	<input checked="" type="checkbox"/>	Estimated Construction Date
1/1/1988	IMPORT ED	OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	ESTIMATE 1988 P-401 OVERLAY
1/1/1988	IMPORT ED	OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	SOIL: SP
1/1/1942	IMPORT ED	BUILT	0.00	2.00	<input checked="" type="checkbox"/>	1942: 2" AC ON 6" LIME ROCK BASE

Network: FLAGLER EXECUTI		Branch: RW 6-24	RUNWAY 6-24		Section: 6205	Surface: AAC
L.C.D.: 1/1/1995	Use: RUNWAY	Rank: P	Length: 4,850.00 (Ft)	Width: 100.00 (Ft)	True Area: 487,349.00 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/1995	IMPORT ED	OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	SOIL: SP
1/1/1995	IMPORT ED	OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	1995: AC OVERLAY
1/1/1942	IMPORT ED	BUILT	0.00	2.00	<input checked="" type="checkbox"/>	1942: 2" AC ON 6" LIME ROCK BASE

Network: FLAGLER EXECUTI		Branch: T-HANG	T-HANGAR TAX		Section: 4305	Surface: PCC
L.C.D.: 12/25/199	Use: TAXILAN	Rank: S	Length: 400.00 (Ft)	Width: 20.00 (Ft)	True Area: 8,395.00 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
12/25/1999	NU-IN	New Construction - Initial	0.00	0.00	<input checked="" type="checkbox"/>	

Network: FLAGLER EXECUTI		Branch: T-HANG	T-HANGAR TAX		Section: 4310	Surface: AC
L.C.D.: 12/25/199	Use: TAXILAN	Rank: S	Length: 340.00 (Ft)	Width: 20.00 (Ft)	True Area: 17,531.00 (SqFt)	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
12/25/1999	NU-IN	New Construction - Initial	0.00	0.00	<input checked="" type="checkbox"/>	

7/18/2017

Work History Report

Page 4 of 8

Pavement Database: FDOT

Network: FLAGLER EXECUTI Branch: T-HANG T-HANGAR TAX Section: 4315 Surface: AC L.C.D.: 12/25/199 Use: TAXILAN Rank: S Length: 1,330.00 (Ft) Width: 20.00 (Ft) True Area: 8,565.00 (SqFt)						
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
12/25/1999	NU-IN	New Construction - Initial	0.00	0.00	<input checked="" type="checkbox"/>	

Network: FLAGLER EXECUTI Branch: T-HANG T-HANGAR TAX Section: 4320 Surface: AC L.C.D.: 12/1/2012 Use: TAXILAN Rank: P Length: 300.00 (Ft) Width: 25.00 (Ft) True Area: 17,192.00 (SqFt)						
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
12/1/2012	NU-IN	New Construction - Initial	0.00	0.00	<input checked="" type="checkbox"/>	

Network: FLAGLER EXECUTI Branch: TW A TAXIWAY A Section: 102 Surface: AAC L.C.D.: 1/1/1992 Use: TAXIWAY Rank: P Length: 500.00 (Ft) Width: 50.00 (Ft) True Area: 22,177.00 (SqFt)						
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/1992	IMPORT ED	BUILT	0.00	0.00	<input checked="" type="checkbox"/>	1992: AC OVERLAY

Network: FLAGLER EXECUTI Branch: TW A TAXIWAY A Section: 104 Surface: AAC L.C.D.: 1/1/1982 Use: TAXIWAY Rank: P Length: 250.00 (Ft) Width: 30.00 (Ft) True Area: 7,358.00 (SqFt)						
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/1982	IMPORT ED	BUILT	0.00	1.00	<input checked="" type="checkbox"/>	ESTIMATE 1982 1" AC OVERLAY

Network: FLAGLER EXECUTI Branch: TW A TAXIWAY A Section: 105 Surface: AC L.C.D.: 1/1/1942 Use: TAXIWAY Rank: P Length: 3,740.00 (Ft) Width: 50.00 (Ft) True Area: 184,752.00 (SqFt)						
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/1942	IMPORT ED	BUILT	0.00	0.00	<input checked="" type="checkbox"/>	ESTIMATE 1942 AC

Network: FLAGLER EXECUTI Branch: TW A TAXIWAY A Section: 110 Surface: AAC L.C.D.: 1/1/1982 Use: TAXIWAY Rank: P Length: 587.00 (Ft) Width: 30.00 (Ft) True Area: 17,576.00 (SqFt)						
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/1982	IMPORT ED	BUILT	0.00	0.00	<input checked="" type="checkbox"/>	ESTIMATE 1982 AC OVERLAY ON EXISTING AC PAVEMENT SOIL: SP
1/1/1982	IMPORT ED	OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	

Network: FLAGLER EXECUTI Branch: TW A TAXIWAY A Section: 120 Surface: AAC L.C.D.: 1/1/2012 Use: TAXIWAY Rank: P Length: 290.00 (Ft) Width: 50.00 (Ft) True Area: 15,400.00 (SqFt)						
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2012	ML-OV	MILL and OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	FULL DEP RECLAMATION, ROTO T ESTIMATE 1942 AC
1/1/1942	IMPORT ED	BUILT	0.00	0.00	<input checked="" type="checkbox"/>	

7/18/2017

Work History Report

Page 5 of 8

Pavement Database: FDOT

Network: FLAGLER EXECUTI Branch: TW A1 TAXIWAY A1 Section: 602 Surface: AAC L.C.D.: 12/1/2012 Use: TAXIWAY Rank: P Length: 500.00 (Ft) Width: 50.00 (Ft) True Area: 25,816.00 (SqFt)						
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
12/1/2012	ML-OV	MILL and OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	2" p101 mill and 2" p401 asphalt overlay
1/1/1942	NU-IN	New Construction - Initial	0.00	0.00	<input checked="" type="checkbox"/>	2" AC ON 6" LR BASE

Network: FLAGLER EXECUTI Branch: TW B TAXIWAY B Section: 205 Surface: AC L.C.D.: 1/1/1992 Use: TAXIWAY Rank: P Length: 2,450.00 (Ft) Width: 35.00 (Ft) True Area: 88,917.00 (SqFt)						
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/1992	IMPORT ED	BUILT	0.00	0.00	<input checked="" type="checkbox"/>	1992: AC PAVEMENT

Network: FLAGLER EXECUTI Branch: TW C TAXIWAY C Section: 305 Surface: AAC L.C.D.: 1/1/1992 Use: TAXIWAY Rank: P Length: 410.00 (Ft) Width: 50.00 (Ft) True Area: 28,798.00 (SqFt)						
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/1992	IMPORT ED	BUILT	0.00	0.00	<input checked="" type="checkbox"/>	1992: AC OVERLAY

Network: FLAGLER EXECUTI Branch: TW C TAXIWAY C Section: 307 Surface: AC L.C.D.: 1/1/1942 Use: TAXIWAY Rank: P Length: 200.00 (Ft) Width: 50.00 (Ft) True Area: 11,213.00 (SqFt)						
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/1942	IMPORT ED	BUILT	0.00	0.00	<input checked="" type="checkbox"/>	1942 AC PAVEMENT

Network: FLAGLER EXECUTI Branch: TW C TAXIWAY C Section: 310 Surface: AAC L.C.D.: 12/25/201 Use: TAXIWAY Rank: P Length: 450.00 (Ft) Width: 50.00 (Ft) True Area: 26,271.00 (SqFt)						
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
12/25/2015	ML-OV	MILL and OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	Estimated Construction Date
1/1/1942	IMPORT ED	BUILT	0.00	0.00	<input checked="" type="checkbox"/>	EST 1942: AC PAVEMENT

Network: FLAGLER EXECUTI Branch: TW C TAXIWAY C Section: 315 Surface: AAC L.C.D.: 12/25/201 Use: TAXIWAY Rank: P Length: 650.00 (Ft) Width: 50.00 (Ft) True Area: 39,970.00 (SqFt)						
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
12/25/2015	ML-OV	MILL and OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	Estimated Construction Date
1/1/2007	NC-AC	New Construction - AC	0.00	0.00	<input checked="" type="checkbox"/>	
1/1/1992	NU-IN	New Construction - Initial	0.00	0.00	<input checked="" type="checkbox"/>	

Network: FLAGLER EXECUTI Branch: TW C TAXIWAY C Section: 320 Surface: AC L.C.D.: 12/25/201 Use: TAXIWAY Rank: P Length: 300.00 (Ft) Width: 50.00 (Ft) True Area: 15,961.00 (SqFt)						
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
12/25/2015	NC-AC	New Construction - AC	0.00	0.00	<input checked="" type="checkbox"/>	

7/18/2017

Work History Report

Page 6 of 8

Pavement Database: FDOT

Network: FLAGLER EXECUTI Branch: TW D TAXIWAY D Section: 410 Surface: AAC L.C.D.: 1/1/2016 Use: TAXIWAY Rank: P Length: 2,000.00 (Ft) Width: 50.00 (Ft) True Area: 110,706.00 (SqFt)						
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2016	ML-OV	MILL and OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	2" P-401 Mill and Overlay. Estimated C
1/1/1942	IMPORT ED	BUILT	0.00	0.00	<input checked="" type="checkbox"/>	ESTIMATE 1942 AC PAVEMENT

Network: FLAGLER EXECUTI Branch: TW D TAXIWAY D Section: 414 Surface: AAC L.C.D.: 1/1/2016 Use: TAXIWAY Rank: P Length: 80.00 (Ft) Width: 50.00 (Ft) True Area: 5,779.00 (SqFt)						
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2016	ML-OV	MILL and OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	2" P-401 Mill and Overlay. Estimated C
1/1/1942	IMPORT ED	BUILT	0.00	0.00	<input checked="" type="checkbox"/>	1942 AC PAVEMENT

Network: FLAGLER EXECUTI Branch: TW D TAXIWAY D Section: 415 Surface: AAC L.C.D.: 1/1/2016 Use: TAXIWAY Rank: P Length: 310.00 (Ft) Width: 50.00 (Ft) True Area: 18,039.00 (SqFt)						
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2016	ML-OV	MILL and OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	2" P-401 Mill and Overlay. Estimated C
1/1/1992	IMPORT ED	BUILT	0.00	0.00	<input checked="" type="checkbox"/>	1992: AC OVERLAY

Network: FLAGLER EXECUTI Branch: TW E TAXIWAY E Section: 505 Surface: AAC L.C.D.: 1/1/2015 Use: TAXIWAY Rank: P Length: 550.00 (Ft) Width: 35.00 (Ft) True Area: 32,654.00 (SqFt)						
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2015	ML-OV	MILL and OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	Estimated Construction Date
1/1/1942	IMPORT ED	OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	SOIL: SP
1/1/1942	IMPORT ED	BUILT	0.00	2.00	<input checked="" type="checkbox"/>	1942: 2" AC ON 6" LIME ROCK BASE

Network: FLAGLER EXECUTI Branch: TW E TAXIWAY E Section: 510 Surface: AAC L.C.D.: 1/1/2015 Use: TAXIWAY Rank: P Length: 1,100.00 (Ft) Width: 50.00 (Ft) True Area: 71,339.00 (SqFt)						
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2015	ML-OV	MILL and OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	Estimated Construction Date
1/1/1942	IMPORT ED	OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	SOIL: SP
1/1/1942	IMPORT ED	BUILT	0.00	2.00	<input checked="" type="checkbox"/>	1942: 2" AC ON 6" LIME ROCK BASE

Network: FLAGLER EXECUTI Branch: TW E TAXIWAY E Section: 512 Surface: AAC L.C.D.: 1/1/2015 Use: TAXIWAY Rank: P Length: 645.00 (Ft) Width: 30.00 (Ft) True Area: 19,204.00 (SqFt)						
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2015	ML-OV	MILL and OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	Estimated Construction Date
1/1/1982	IMPORT ED	BUILT	0.00	0.00	<input checked="" type="checkbox"/>	ESTIMATE 1982 AC OVERLAY ON EXISTING AC PAVEMENT

7/18/2017

Work History Report

Page 7 of 8

Pavement Database: FDOT

Network: FLAGLER EXECUTI Branch: TW E TAXIWAY E Section: 515 Surface: AAC L.C.D.: 1/1/2015 Use: TAXIWAY Rank: P Length: 1,670.00 (Ft) Width: 50.00 (Ft) True Area: 138,069.00 (SqFt)						
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2015	ML-OV	MILL and OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	Estimated Construction Date
1/1/1942	IMPORT ED	BUILT	0.00	2.00	<input checked="" type="checkbox"/>	1942: 2" AC ON 6" LIME ROCK BASE
1/1/1942	IMPORT ED	OVERLAY	0.00	0.00	<input checked="" type="checkbox"/>	SOIL: SP

Network: FLAGLER EXECUTI Branch: TW E TAXIWAY E Section: 520 Surface: AC L.C.D.: 1/1/2004 Use: TAXIWAY Rank: P Length: 465.00 (Ft) Width: 50.00 (Ft) True Area: 13,104.00 (SqFt)						
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2004	NU-IN	New Construction - Initial	0.00	4.00	<input checked="" type="checkbox"/>	4"AC/6"Limerock/12"Stabilization

Network: FLAGLER EXECUTI Branch: TW H TAXIWAY H Section: 705 Surface: AC L.C.D.: 1/1/2016 Use: TAXIWAY Rank: P Length: 2,600.00 (Ft) Width: 50.00 (Ft) True Area: 130,070.00 (SqFt)						
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2016	NC-AC	New Construction - AC	0.00	0.00	<input checked="" type="checkbox"/>	

Work History Report*Pavement Database: FDOT***Summary:**

Work Description	Section Count	Area Total (SqFt)	Thickness Avg (in)	Thickness STD (in)
BUILT	26	2,065,563.00	1.04	2.16
Complete Reconstruction - AC	2	550,315.00	0.00	0.00
MILL and OVERLAY	11	503,247.00	0.00	0.00
New Construction	1	111,646.00	0.00	0.00
New Construction - AC	4	216,716.00	0.00	0.00
New Construction - Initial	13	282,643.00	0.31	1.07
OVERLAY	11	2,329,443.00	0.00	0.00

Branch ID	Number of Sections	Sum Section Length (Ft)	Avg Section Width (Ft)	True Area (SqFt)	Use	Average PCI	Standard Deviation PCI	Weighted Average PCI
AP	8	2,912.50	94.25	260,262.00	APRON	50.63	36.52	71.26
AP GA	1	140.00	120.00	17,338.00	APRON	82.00	0.00	82.00
AP MID	2	410.00	145.00	60,249.00	APRON	94.00	0.00	94.00
AP N	1	350.00	85.00	30,077.00	APRON	75.00	0.00	75.00
AP RU 11	2	560.00	150.00	63,806.00	APRON	41.00	9.00	39.83
AP RU 6	1	300.00	100.00	30,715.00	APRON	100.00	0.00	100.00
RW 11-29	1	5,000.00	100.00	500,300.00	RUNWAY	100.00	0.00	100.00
RW 6-24	1	4,850.00	100.00	487,349.00	RUNWAY	50.00	0.00	50.00
T-HANG	4	2,370.00	21.25	51,683.00	TAXILANE	62.50	19.01	67.55
TW A	5	5,367.00	42.00	247,263.00	TAXIWAY	45.40	22.90	37.77
TW A1	1	500.00	50.00	25,816.00	TAXIWAY	92.00	0.00	92.00
TW B	1	2,450.00	35.00	88,917.00	TAXIWAY	63.00	0.00	63.00
TW C	5	2,010.00	50.00	122,213.00	TAXIWAY	77.20	29.29	83.35
TW D	3	2,390.00	50.00	134,524.00	TAXIWAY	100.00	0.00	100.00
TW E	5	4,430.00	43.00	274,370.00	TAXIWAY	93.00	14.00	98.33
TW H	1	2,600.00	50.00	130,070.00	TAXIWAY	100.00	0.00	100.00

7/18/2017

Branch Condition Report

Page 2 of 2

Pavement Database: FDOT

Use Category	Number of Sections	Total Area (SqFt)	Arithmetic Average PCI	Average STD PCI	Weighted Average PCI
APRON	15	462447.000122943	62.13	33.47	72.44
RUNWAY	2	987649.000148971	75.00	25.00	75.33
TAXILANE	4	51683.0000157983	62.50	19.01	67.55
TAXIWAY	21	1023173.00031276	77.76	28.19	79.11
ALL	42	2524952.00060047	70.60	30.33	76.17

Pavement Database: FDOT

NetworkId: FIN

Branch ID	Section ID	Last Const. Date	Surface	Use	Rank	Lanes	True Area (SqFt)	Last Inspection Date	Age At Inspection	PCI
AP	4105	1/1/1942	PCC	APRON	P	0	23,645.00	1/24/2017	75	0
AP	4110	1/1/2012	AC	APRON	P	0	50,015.00	1/24/2017	5	89
AP	4115	1/1/1950	AC	APRON	P	0	20,847.00	1/24/2017	67	27
AP	4120	1/1/1992	PCC	APRON	P	0	9,798.00	1/24/2017	25	16
AP	4125	1/1/1992	PCC	APRON	P	0	25,668.00	1/24/2017	25	78
AP	4130	1/1/1992	PCC	APRON	P	0	10,275.00	1/24/2017	25	17
AP	4135	1/1/2012	AC	APRON	P	0	111,646.00	1/24/2017	5	94
AP	4140	1/1/2004	PCC	APRON	S	0	8,368.00	1/24/2017	13	84
AP GA	4510	1/1/2005	PCC	APRON	P	0	17,338.00	1/24/2017	12	82
AP MID	4610	12/1/2012	AC	APRON	P	0	38,864.00	1/24/2017	5	94
AP MID	4615	1/1/2012	AC	APRON	P	0	21,385.00	1/24/2017	5	94
AP N	4405	1/1/2009	PCC	APRON	S	0	30,077.00	1/24/2017	8	75
AP RU 11	5103	1/1/1942	AC	APRON	P	0	36,038.00	1/24/2017	75	32
AP RU 11	5105	1/1/1992	AAC	APRON	P	0	27,768.00	1/24/2017	25	50
AP RU 6	5205	12/25/2015	AC	APRON	P	0	30,715.00	12/25/2015	0	100
RW 11-29	6105	2/1/2018	AC	RUNWAY	P	0	500,300.00	2/1/2018	0	100
RW 6-24	6205	1/1/1995	AAC	RUNWAY	P	0	487,349.00	1/24/2017	22	50
T-HANG	4305	12/25/1999	PCC	TAXILANE	S	0	8,395.00	1/24/2017	18	47
T-HANG	4310	12/25/1999	AC	TAXILANE	S	0	17,531.00	1/24/2017	18	61
T-HANG	4315	12/25/1999	AC	TAXILANE	S	0	8,565.00	1/24/2017	18	48
T-HANG	4320	12/1/2012	AC	TAXILANE	P	0	17,192.00	1/24/2017	5	94
TW A	102	1/1/1992	AAC	TAXIWAY	P	0	22,177.00	1/24/2017	25	59
TW A	104	1/1/1982	AAC	TAXIWAY	P	0	7,358.00	1/24/2017	35	25
TW A	105	1/1/1942	AC	TAXIWAY	P	0	184,752.00	1/24/2017	75	33
TW A	110	1/1/1982	AAC	TAXIWAY	P	0	17,576.00	1/24/2017	35	26
TW A	120	1/1/2012	AAC	TAXIWAY	P	0	15,400.00	1/24/2017	5	84
TW A1	602	12/1/2012	AAC	TAXIWAY	P	0	25,816.00	1/24/2017	5	92
TW B	205	1/1/1992	AC	TAXIWAY	P	0	88,917.00	1/24/2017	25	63
TW C	305	1/1/1992	AAC	TAXIWAY	P	0	28,798.00	1/24/2017	25	57
TW C	307	1/1/1942	AC	TAXIWAY	P	0	11,213.00	1/24/2017	75	29
TW C	310	12/25/2015	AAC	TAXIWAY	P	0	26,271.00	12/25/2015	0	100
TW C	315	12/25/2015	AAC	TAXIWAY	P	0	39,970.00	12/25/2015	0	100
TW C	320	12/25/2015	AC	TAXIWAY	P	0	15,961.00	12/25/2015	0	100
TW D	410	1/1/2016	AAC	TAXIWAY	P	0	110,706.00	1/1/2016	0	100
TW D	414	1/1/2016	AAC	TAXIWAY	P	0	5,779.00	1/1/2016	0	100
TW D	415	1/1/2016	AAC	TAXIWAY	P	0	18,039.00	1/1/2016	0	100
TW E	505	1/1/2015	AAC	TAXIWAY	P	0	32,654.00	1/1/2015	0	100
TW E	510	1/1/2015	AAC	TAXIWAY	P	0	71,339.00	1/1/2015	0	100
TW E	512	1/1/2015	AAC	TAXIWAY	P	0	19,204.00	1/1/2015	0	100
TW E	515	1/1/2015	AAC	TAXIWAY	P	0	138,069.00	1/1/2015	0	100
TW E	520	1/1/2004	AC	TAXIWAY	P	0	13,104.00	1/24/2017	13	65
TW H	705	1/1/2016	AC	TAXIWAY	P	0	130,070.00	1/1/2016	0	100

7/18/2017

Section Condition Report (Summary)

Page 2 of 2

Pavement Database: FDOT

Age Category	Average Age at Inspection	Total Area (SqFt)	Number of Sections	Arithmetic Average PCI	Standard Deviation PCI	Weighted Average PCI
00-02		1,139,077.00	13	100.00	0.00	100.00
03-05	5	280,318.00	7	91.57	3.54	92.37
06-10	8	30,077.00	1	75.00	0.00	75.00
11-15	13	38,810.00	3	77.00	8.52	76.69
16-20	18	34,491.00	3	52.00	6.38	54.36
21-25	25	700,750.00	8	48.75	20.36	52.29
31-35	35	24,934.00	2	25.50	0.50	25.70
ALL	18	2,524,952.00	42	70.60	30.33	76.17
Over 50	73	276,495.00	5	24.20	12.29	29.43

Appendix B

Airfield Pavement Localized Maintenance and Repair and
Major Rehabilitation



Table B-1 Localized Maintenance and Repair Needs based on Current Condition

Network ID	Branch ID	Section ID	Distress Code	Description	Severity	Distress Qty	Distress Unit	Percent Distress	Work Description	Work Qty	Work Unit	Unit Cost	Work Cost
FIN	AP	4105	63	LINEAR CR	Medium	3.93	Slabs	6.7%	FDOT - CRACK SEALING - PCC	78.74	Ft	\$ 4.25	\$ 340.00
FIN	AP	4105	65	JT SEAL DMG	High	59	Slabs	100.0%	FDOT - JOINT SEAL - PCC	1040.03	Ft	\$ 2.75	\$ 2,860.00
FIN	AP	4105	72	SHAT. SLAB	Low	3.93	Slabs	6.7%	FDOT - CRACK SEALING - PCC	157.48	Ft	\$ 4.25	\$ 670.00
FIN	AP	4105	72	SHAT. SLAB	Medium	39.33	Slabs	66.7%	FDOT - SLAB REPLACEMENT - PCC	15733.61	SqFt	\$ 30.00	\$ 472,000.00
FIN	AP	4105	72	SHAT. SLAB	High	11.8	Slabs	20.0%	FDOT - SLAB REPLACEMENT - PCC	4719.97	SqFt	\$ 30.00	\$ 141,600.00
FIN	AP	4115	41	ALLIGATOR CR	Low	59.74	SqFt	0.3%	FDOT - PATCHING - AC FULL DEPTH	94.72	SqFt	\$ 6.00	\$ 570.00
FIN	AP	4115	41	ALLIGATOR CR	Medium	149.3	SqFt	0.7%	FDOT - PATCHING - AC FULL DEPTH	202.36	SqFt	\$ 6.00	\$ 1,220.00
FIN	AP	4115	41	ALLIGATOR CR	High	74.59	SqFt	0.4%	FDOT - PATCHING - AC FULL DEPTH	113.02	SqFt	\$ 6.00	\$ 690.00
FIN	AP	4115	43	BLOCK CR	Medium	20563.37	SqFt	98.6%	FDOT - CRACK SEALING - AC	6267.72	Ft	\$ 3.00	\$ 18,810.00
FIN	AP	4115	45	DEPRESSION	Low	339.6	SqFt	1.6%	FDOT - PATCHING - AC FULL DEPTH	417.64	SqFt	\$ 6.00	\$ 2,510.00
FIN	AP	4115	52	RAVELING	Low	20847	SqFt	100.0%	FDOT - SURFACE SEAL	20846.47	SqFt	\$ 0.55	\$ 11,470.00
FIN	AP	4120	63	LINEAR CR	Medium	3.2	Slabs	13.3%	FDOT - CRACK SEALING - PCC	63.98	Ft	\$ 4.25	\$ 280.00
FIN	AP	4120	65	JT SEAL DMG	High	24	Slabs	100.0%	FDOT - JOINT SEAL - PCC	640.09	Ft	\$ 2.75	\$ 1,760.00
FIN	AP	4120	72	SHAT. SLAB	Low	9.6	Slabs	40.0%	FDOT - CRACK SEALING - PCC	383.86	Ft	\$ 4.25	\$ 1,640.00
FIN	AP	4120	72	SHAT. SLAB	Medium	3.2	Slabs	13.3%	FDOT - SLAB REPLACEMENT - PCC	1279.83	SqFt	\$ 30.00	\$ 38,400.00
FIN	AP	4120	75	CORNER SPALL	Medium	3.2	Slabs	13.3%	FDOT - PATCHING - PCC PARTIAL DEPTH	8.61	SqFt	\$ 72.00	\$ 620.00
FIN	AP	4125	65	JT SEAL DMG	High	133	Slabs	100.0%	FDOT - JOINT SEAL - PCC	3219.49	Ft	\$ 2.75	\$ 8,860.00
FIN	AP	4125	74	JOINT SPALL	Low	14.25	Slabs	10.7%	FDOT - CRACK SEALING - PCC	23.29	Ft	\$ 4.25	\$ 100.00
FIN	AP	4125	74	JOINT SPALL	Medium	4.75	Slabs	3.6%	FDOT - PATCHING - PCC PARTIAL DEPTH	30.14	SqFt	\$ 72.00	\$ 2,210.00
FIN	AP	4130	62	CORNER BREAK	Medium	13.4	Slabs	20.0%	FDOT - PATCHING - PCC FULL DEPTH	432.71	SqFt	\$ 100.00	\$ 43,280.00
FIN	AP	4130	62	CORNER BREAK	High	4.47	Slabs	6.7%	FDOT - PATCHING - PCC FULL DEPTH	144.24	SqFt	\$ 100.00	\$ 14,430.00
FIN	AP	4130	63	LINEAR CR	Medium	4.47	Slabs	6.7%	FDOT - CRACK SEALING - PCC	55.77	Ft	\$ 4.25	\$ 240.00
FIN	AP	4130	65	JT SEAL DMG	High	67	Slabs	100.0%	FDOT - JOINT SEAL - PCC	1450.13	Ft	\$ 2.75	\$ 3,990.00
FIN	AP	4130	72	SHAT. SLAB	Medium	4.47	Slabs	6.7%	FDOT - SLAB REPLACEMENT - PCC	669.52	SqFt	\$ 30.00	\$ 20,100.00
FIN	AP	4130	72	SHAT. SLAB	High	8.93	Slabs	13.3%	FDOT - SLAB REPLACEMENT - PCC	1340.11	SqFt	\$ 30.00	\$ 40,200.00
FIN	AP	4130	74	JOINT SPALL	Low	17.87	Slabs	26.7%	FDOT - CRACK SEALING - PCC	29.2	Ft	\$ 4.25	\$ 130.00
FIN	AP	4130	74	JOINT SPALL	High	4.47	Slabs	6.7%	FDOT - PATCHING - PCC PARTIAL DEPTH	36.6	SqFt	\$ 72.00	\$ 2,600.00
FIN	AP	4130	75	CORNER SPALL	Low	4.47	Slabs	6.7%	FDOT - CRACK SEALING - PCC	7.22	Ft	\$ 4.25	\$ 40.00
FIN	AP	4140	65	JT SEAL DMG	High	47	Slabs	100.0%	FDOT - JOINT SEAL - PCC	1048.88	Ft	\$ 2.75	\$ 2,890.00
FIN	AP GA	4510	65	JT SEAL DMG	High	99	Slabs	100.0%	FDOT - JOINT SEAL - PCC	2408.14	Ft	\$ 2.75	\$ 6,630.00
FIN	AP N	4405	65	JT SEAL DMG	High	133	Slabs	100.0%	FDOT - JOINT SEAL - PCC	3531.82	Ft	\$ 2.75	\$ 9,720.00
FIN	AP RU 11	5103	43	BLOCK CR	Medium	36038	SqFt	100.0%	FDOT - CRACK SEALING - AC	10984.25	Ft	\$ 3.00	\$ 32,960.00
FIN	AP RU 11	5103	45	DEPRESSION	Low	1146.68	SqFt	3.2%	FDOT - PATCHING - AC FULL DEPTH	1287.36	SqFt	\$ 6.00	\$ 7,730.00
FIN	AP RU 11	5103	52	RAVELING	Low	35491.95	SqFt	98.5%	FDOT - SURFACE SEAL	35491.84	SqFt	\$ 0.55	\$ 19,530.00
FIN	AP RU 11	5103	52	RAVELING	Medium	546.05	SqFt	1.5%	FDOT - PATCHING - AC PARTIAL DEPTH	545.73	SqFt	\$ 3.00	\$ 1,640.00
FIN	AP RU 11	5105	45	DEPRESSION	Low	7697.27	SqFt	27.7%	FDOT - PATCHING - AC FULL DEPTH	8054.63	SqFt	\$ 6.00	\$ 48,330.00
FIN	AP RU 11	5105	52	RAVELING	Low	27767.98	SqFt	100.0%	FDOT - SURFACE SEAL	27767.66	SqFt	\$ 0.55	\$ 15,280.00
FIN	RW 6-24	6205	41	ALLIGATOR CR	Low	24.33	SqFt	0.0%	FDOT - PATCHING - AC FULL DEPTH	48.44	SqFt	\$ 6.00	\$ 290.00



Network ID	Branch ID	Section ID	Distress Code	Description	Severity	Distress Qty	Distress Unit	Percent Distress	Work Description	Work Qty	Work Unit	Unit Cost	Work Cost
FIN	RW 6-24	6205	43	BLOCK CR	Medium	2529.2	SqFt	0.5%	FDOT - CRACK SEALING - AC	771	Ft	\$ 3.00	\$ 2,320.00
FIN	RW 6-24	6205	45	DEPRESSION	Low	24.33	SqFt	0.0%	FDOT - PATCHING - AC FULL DEPTH	48.44	SqFt	\$ 6.00	\$ 290.00
FIN	RW 6-24	6205	48	L & T CR	Medium	11673.03	Ft	2.4%	FDOT - CRACK SEALING - AC	11672.9	Ft	\$ 3.00	\$ 35,020.00
FIN	RW 6-24	6205	52	RAVELING	Low	417841.01	SqFt	85.7%	FDOT - SURFACE SEAL	417841	SqFt	\$ 0.55	\$ 229,820.00
FIN	RW 6-24	6205	52	RAVELING	Medium	69508.06	SqFt	14.3%	FDOT - PATCHING - AC PARTIAL DEPTH	69507.95	SqFt	\$ 3.00	\$ 208,530.00
FIN	T-HANG	4305	65	JT SEAL DMG	High	29	Slabs	100.0%	FDOT - JOINT SEAL - PCC	513.45	Ft	\$ 2.75	\$ 1,420.00
FIN	T-HANG	4305	72	SHAT. SLAB	Low	2.07	Slabs	7.1%	FDOT - CRACK SEALING - PCC	72.51	Ft	\$ 4.25	\$ 310.00
FIN	T-HANG	4305	72	SHAT. SLAB	Medium	2.07	Slabs	7.1%	FDOT - SLAB REPLACEMENT - PCC	621.08	SqFt	\$ 30.00	\$ 18,650.00
FIN	T-HANG	4305	74	JOINT SPALL	Medium	2.07	Slabs	7.1%	FDOT - PATCHING - PCC PARTIAL DEPTH	12.92	SqFt	\$ 72.00	\$ 970.00
FIN	T-HANG	4310	52	RAVELING	Low	14409.54	SqFt	82.2%	FDOT - SURFACE SEAL	14409.65	SqFt	\$ 0.55	\$ 7,930.00
FIN	T-HANG	4310	52	RAVELING	Medium	33.69	SqFt	0.2%	FDOT - PATCHING - AC PARTIAL DEPTH	33.37	SqFt	\$ 3.00	\$ 110.00
FIN	T-HANG	4315	45	DEPRESSION	Low	41.23	SqFt	0.5%	FDOT - PATCHING - AC FULL DEPTH	71.04	SqFt	\$ 6.00	\$ 430.00
FIN	T-HANG	4315	52	RAVELING	Low	6600.54	SqFt	77.1%	FDOT - SURFACE SEAL	6600.43	SqFt	\$ 0.55	\$ 3,640.00
FIN	TW A	102	45	DEPRESSION	Low	72.87	SqFt	0.3%	FDOT - PATCHING - AC FULL DEPTH	110.87	SqFt	\$ 6.00	\$ 670.00
FIN	TW A	102	52	RAVELING	Low	21986.9	SqFt	99.1%	FDOT - SURFACE SEAL	21987.44	SqFt	\$ 0.55	\$ 12,100.00
FIN	TW A	102	52	RAVELING	Medium	190.09	SqFt	0.9%	FDOT - PATCHING - AC PARTIAL DEPTH	190.52	SqFt	\$ 3.00	\$ 580.00
FIN	TW A	104	43	BLOCK CR	Medium	2624.67	SqFt	35.7%	FDOT - CRACK SEALING - AC	799.87	Ft	\$ 3.00	\$ 2,410.00
FIN	TW A	104	52	RAVELING	Medium	6559.85	SqFt	89.2%	FDOT - PATCHING - AC PARTIAL DEPTH	6559.53	SqFt	\$ 3.00	\$ 19,680.00
FIN	TW A	105	41	ALLIGATOR CR	Low	682.22	SqFt	0.4%	FDOT - PATCHING - AC FULL DEPTH	791.15	SqFt	\$ 6.00	\$ 4,750.00
FIN	TW A	105	41	ALLIGATOR CR	Medium	468.66	SqFt	0.3%	FDOT - PATCHING - AC FULL DEPTH	559.72	SqFt	\$ 6.00	\$ 3,360.00
FIN	TW A	105	43	BLOCK CR	Medium	85005.51	SqFt	46.0%	FDOT - CRACK SEALING - AC	25909.78	Ft	\$ 3.00	\$ 77,730.00
FIN	TW A	105	45	DEPRESSION	Low	89.02	SqFt	0.1%	FDOT - PATCHING - AC FULL DEPTH	131.32	SqFt	\$ 6.00	\$ 790.00
FIN	TW A	105	48	L & T CR	Medium	391.5	Ft	0.2%	FDOT - CRACK SEALING - AC	391.4	Ft	\$ 3.00	\$ 1,180.00
FIN	TW A	105	50	PATCHING	Medium	106.78	SqFt	0.1%	FDOT - PATCHING - AC FULL DEPTH	152.85	SqFt	\$ 6.00	\$ 920.00
FIN	TW A	105	52	RAVELING	Low	177592.04	SqFt	96.1%	FDOT - SURFACE SEAL	177591.6	SqFt	\$ 0.55	\$ 97,680.00
FIN	TW A	110	41	ALLIGATOR CR	Low	1414.59	SqFt	8.1%	FDOT - PATCHING - AC FULL DEPTH	1570.45	SqFt	\$ 6.00	\$ 9,430.00
FIN	TW A	110	43	BLOCK CR	Medium	16161.37	SqFt	92.0%	FDOT - CRACK SEALING - AC	4925.85	Ft	\$ 3.00	\$ 14,780.00
FIN	TW A	110	52	RAVELING	Low	17575.96	SqFt	100.0%	FDOT - SURFACE SEAL	17576.39	SqFt	\$ 0.55	\$ 9,670.00
FIN	TW B	205	49	OIL SPILLAGE	N/A	82.56	SqFt	0.1%	FDOT - PATCHING - AC PARTIAL DEPTH	122.71	SqFt	\$ 3.00	\$ 370.00
FIN	TW B	205	52	RAVELING	Low	82731.63	SqFt	93.0%	FDOT - SURFACE SEAL	82731.42	SqFt	\$ 0.55	\$ 45,510.00
FIN	TW B	205	52	RAVELING	Medium	682.32	SqFt	0.8%	FDOT - PATCHING - AC PARTIAL DEPTH	682.43	SqFt	\$ 3.00	\$ 2,050.00
FIN	TW C	305	45	DEPRESSION	Low	86.33	SqFt	0.3%	FDOT - PATCHING - AC FULL DEPTH	128.09	SqFt	\$ 6.00	\$ 770.00
FIN	TW C	305	48	L & T CR	Medium	86.38	Ft	0.3%	FDOT - CRACK SEALING - AC	86.29	Ft	\$ 3.00	\$ 260.00
FIN	TW C	305	52	RAVELING	Low	28510.05	SqFt	99.0%	FDOT - SURFACE SEAL	28510.37	SqFt	\$ 0.55	\$ 15,690.00
FIN	TW C	305	52	RAVELING	Medium	287.93	SqFt	1.0%	FDOT - PATCHING - AC PARTIAL DEPTH	287.4	SqFt	\$ 3.00	\$ 870.00
FIN	TW C	307	41	ALLIGATOR CR	Low	12.81	SqFt	0.1%	FDOT - PATCHING - AC FULL DEPTH	31.22	SqFt	\$ 6.00	\$ 190.00
FIN	TW C	307	41	ALLIGATOR CR	Medium	204.19	SqFt	1.8%	FDOT - PATCHING - AC FULL DEPTH	265.87	SqFt	\$ 6.00	\$ 1,600.00
FIN	TW C	307	43	BLOCK CR	Medium	10995.98	SqFt	98.1%	FDOT - CRACK SEALING - AC	3351.71	Ft	\$ 3.00	\$ 10,060.00
FIN	TW C	307	45	DEPRESSION	Low	12.81	SqFt	0.1%	FDOT - PATCHING - AC FULL DEPTH	31.22	SqFt	\$ 6.00	\$ 190.00



Network ID	Branch ID	Section ID	Distress Code	Description	Severity	Distress Qty	Distress Unit	Percent Distress	Work Description	Work Qty	Work Unit	Unit Cost	Work Cost
FIN	TW C	307	52	RAVELING	Low	11212.98	SqFt	100.0%	FDOT - SURFACE SEAL	11212.77	SqFt	\$ 0.55	\$ 6,170.00
FIN	TW E	520	52	RAVELING	Low	1310.4	SqFt	10.0%	FDOT - SURFACE SEAL	1309.97	SqFt	\$ 0.55	\$ 730.00




Table B-2 10-Year Major Rehabilitation Planning Needs at Section Level

Program Year	Network ID	Branch ID	Section ID	Surface	Area (SF)	PCI Before	Rehabilitation Type	Planning Cost
2018	FIN	AP	4105	PCC	23,645	0	PCC Reconstruction	\$ 355,000.00
2018	FIN	AP	4115	AC	20,847	25	AC Reconstruction	\$ 188,000.00
2018	FIN	AP	4120	PCC	9,798	14	PCC Reconstruction	\$ 147,000.00
2018	FIN	AP	4130	PCC	10,275	15	PCC Reconstruction	\$ 155,000.00
2018	FIN	AP RU 11	5103	AC	36,038	30	AC Reconstruction	\$ 325,000.00
2018	FIN	AP RU 11	5105	AAC	27,768	48	AC Restoration	\$ 204,000.00
2018	FIN	RW 6-24	6205	AAC	487,349	47	AC Restoration	\$ 3,679,000.00
2018	FIN	T-HANG	4305	PCC	8,395	46	PCC Restoration	\$ 100,000.00
2018	FIN	T-HANG	4310	AC	17,531	60	AC Restoration	\$ 123,000.00
2018	FIN	T-HANG	4315	AC	8,565	46	AC Restoration	\$ 66,000.00
2018	FIN	TW A	102	AAC	22,177	57	AC Restoration	\$ 156,000.00
2018	FIN	TW A	104	AAC	7,358	21	AC Reconstruction	\$ 67,000.00
2018	FIN	TW A	105	AC	184,752	32	AC Reconstruction	\$ 1,663,000.00
2018	FIN	TW A	110	AAC	17,576	22	AC Reconstruction	\$ 159,000.00
2018	FIN	TW B	205	AC	88,917	62	AC Restoration	\$ 623,000.00
2018	FIN	TW C	305	AAC	28,798	55	AC Restoration	\$ 202,000.00
2018	FIN	TW C	307	AC	11,213	28	AC Reconstruction	\$ 101,000.00
2018	FIN	TW E	520	AC	13,104	64	AC Restoration	\$ 92,000.00
2023	FIN	AP N	4405	PCC	30,077	63	PCC Restoration	\$ 301,000.00
2024	FIN	AP	4125	PCC	25,668	63	PCC Restoration	\$ 257,000.00
2025	FIN	AP GA	4510	PCC	17,338	64	PCC Restoration	\$ 174,000.00
2026	FIN	AP	4140	PCC	8,368	64	PCC Restoration	\$ 84,000.00


Appendix C

Technical Exhibits







CONSTRUCTION SINCE LAST INSPECTION & ANTICIPATED CONSTRUCTION ACTIVITY		
CONSTRUCTION YEAR	LOCATION	WORK TYPE / PAVEMENT SECTION
2015	AP RU 6	NEW CONSTRUCTION
2015	TW C	MILL AND OVERLAY
2015	TW C	NEW CONSTRUCTION
2015	TW E	MILL AND OVERLAY
2016	TW D	MILL AND OVERLAY
2016	TW H	NEW CONSTRUCTION
2018	RW 11-29	COMPLETE RECONSTRUCTION

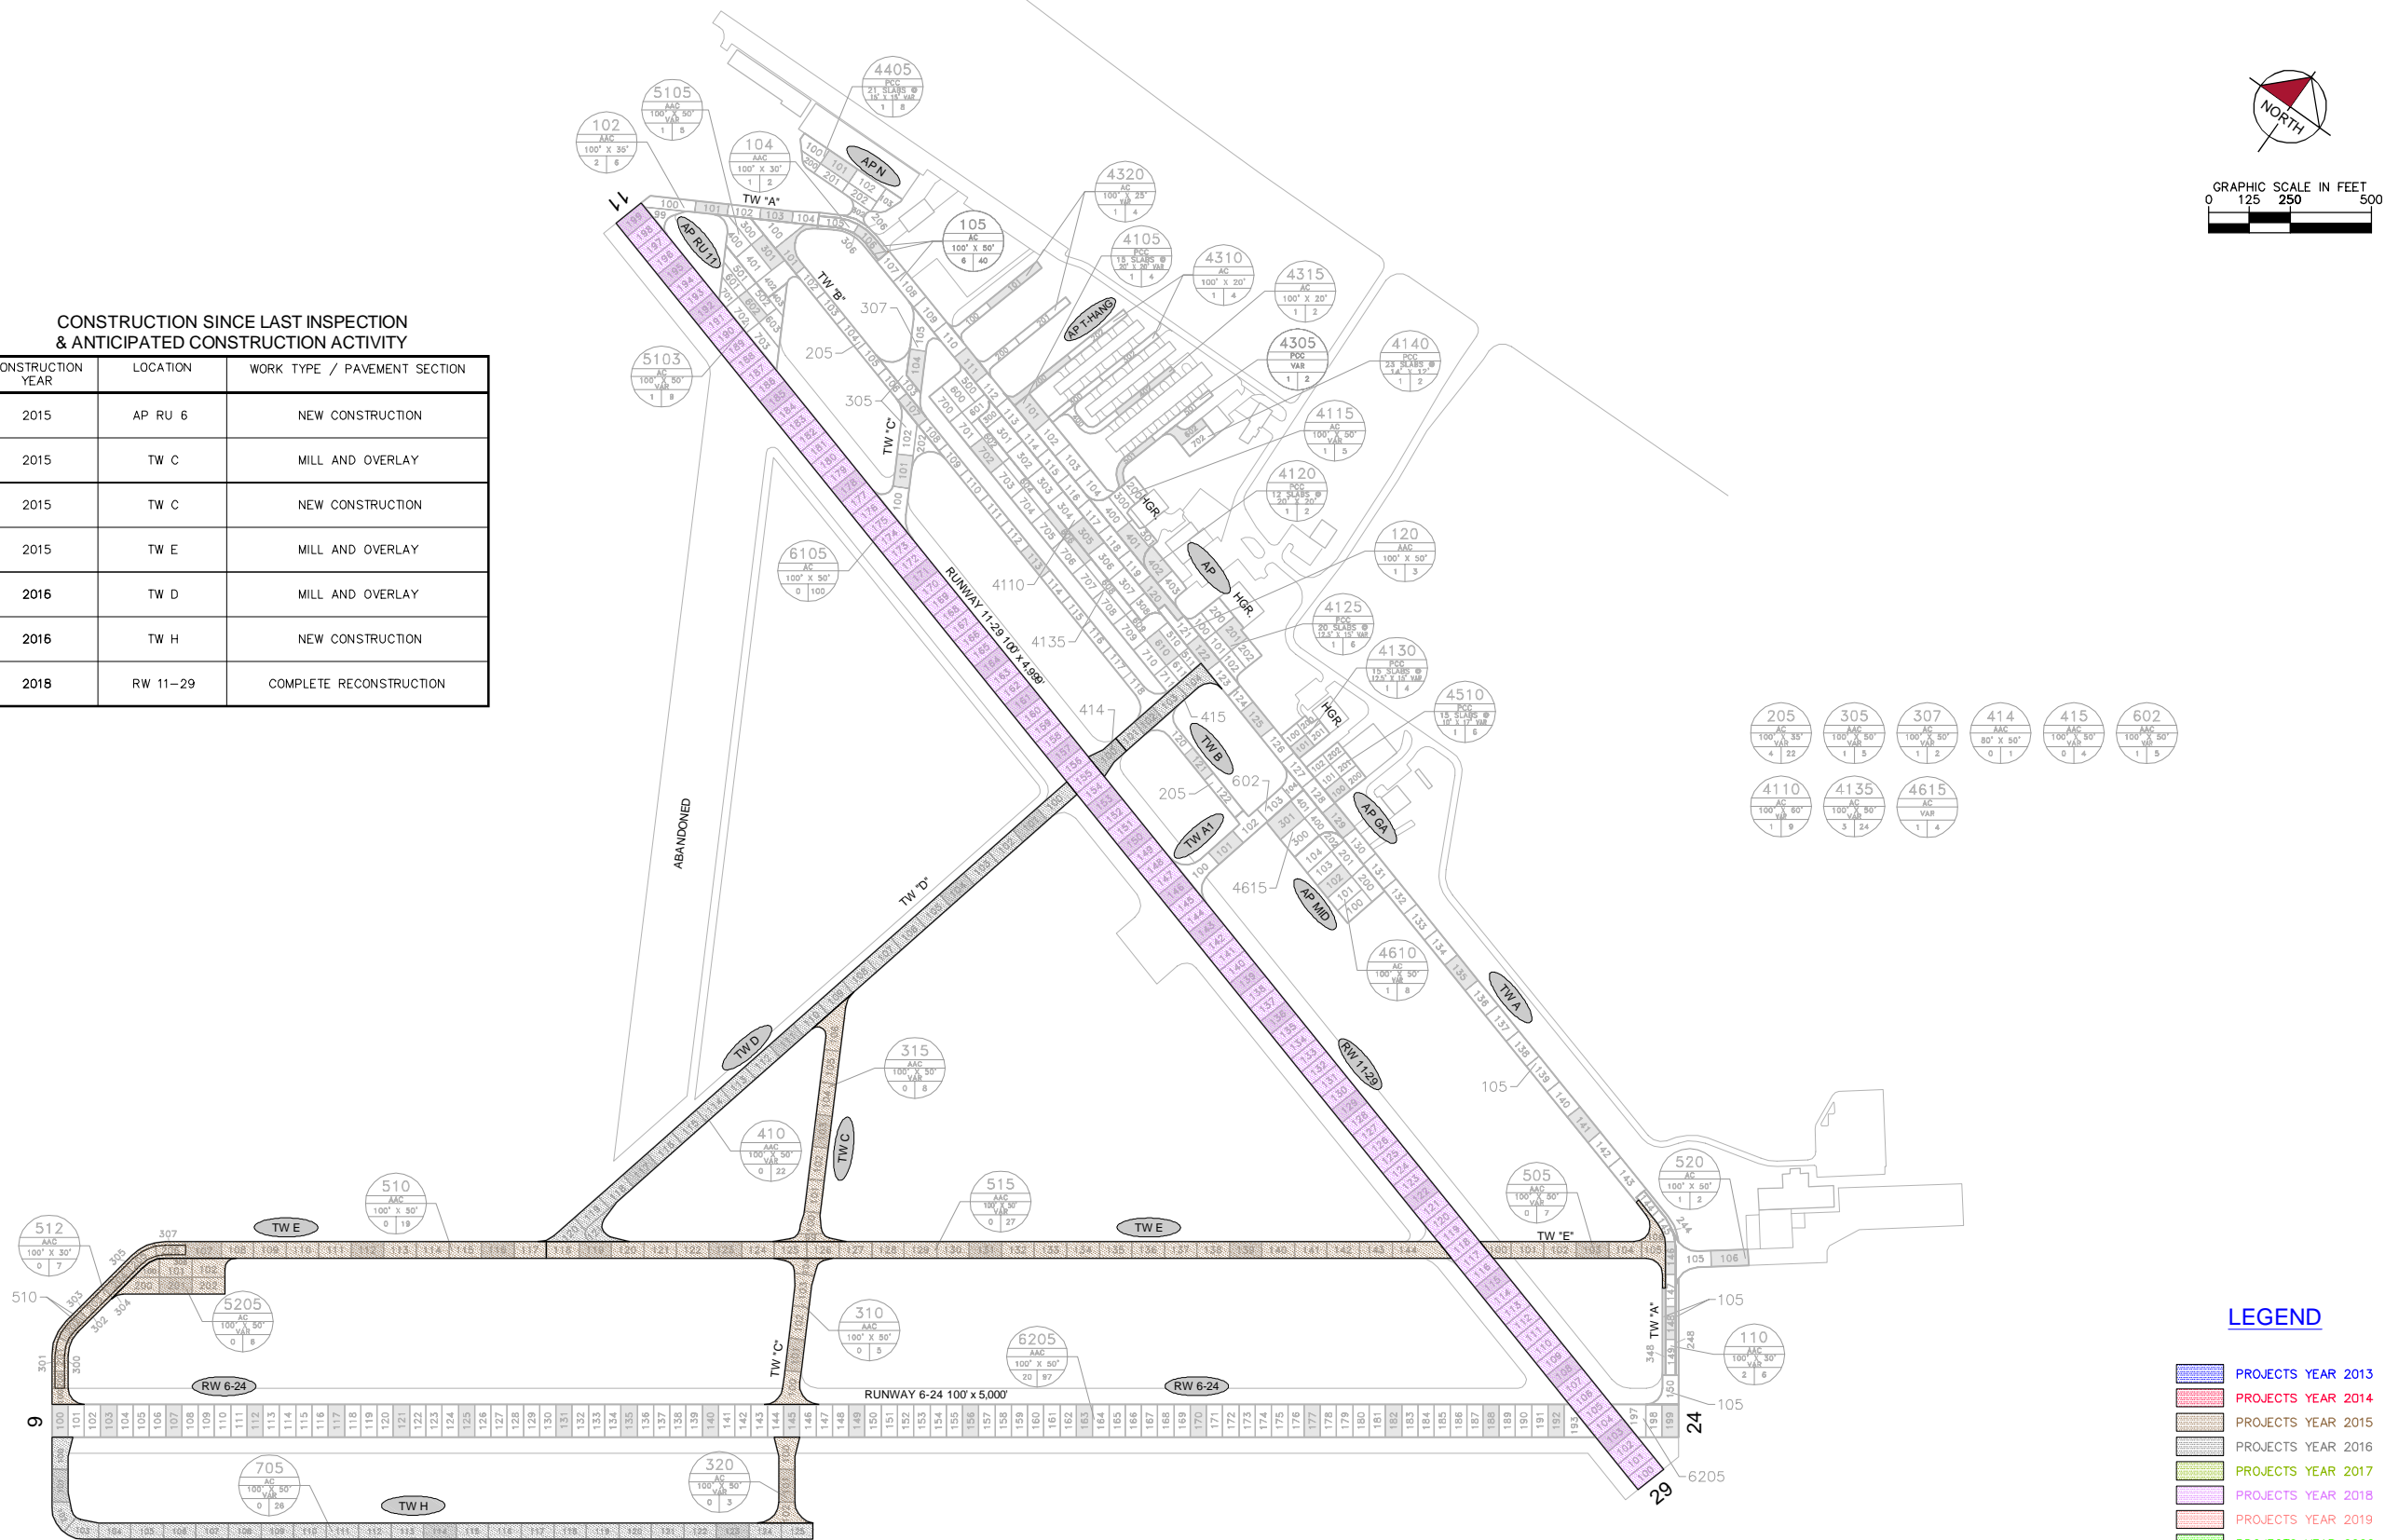

RUNWAY LENGTHS DEPICTED IN THIS DRAWING ARE FOR PAVEMENT MANAGEMENT PURPOSES ONLY AND MAY NOT MATCH PUBLISHED RUNWAY LENGTHS.




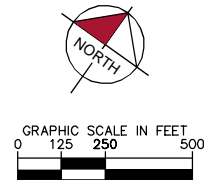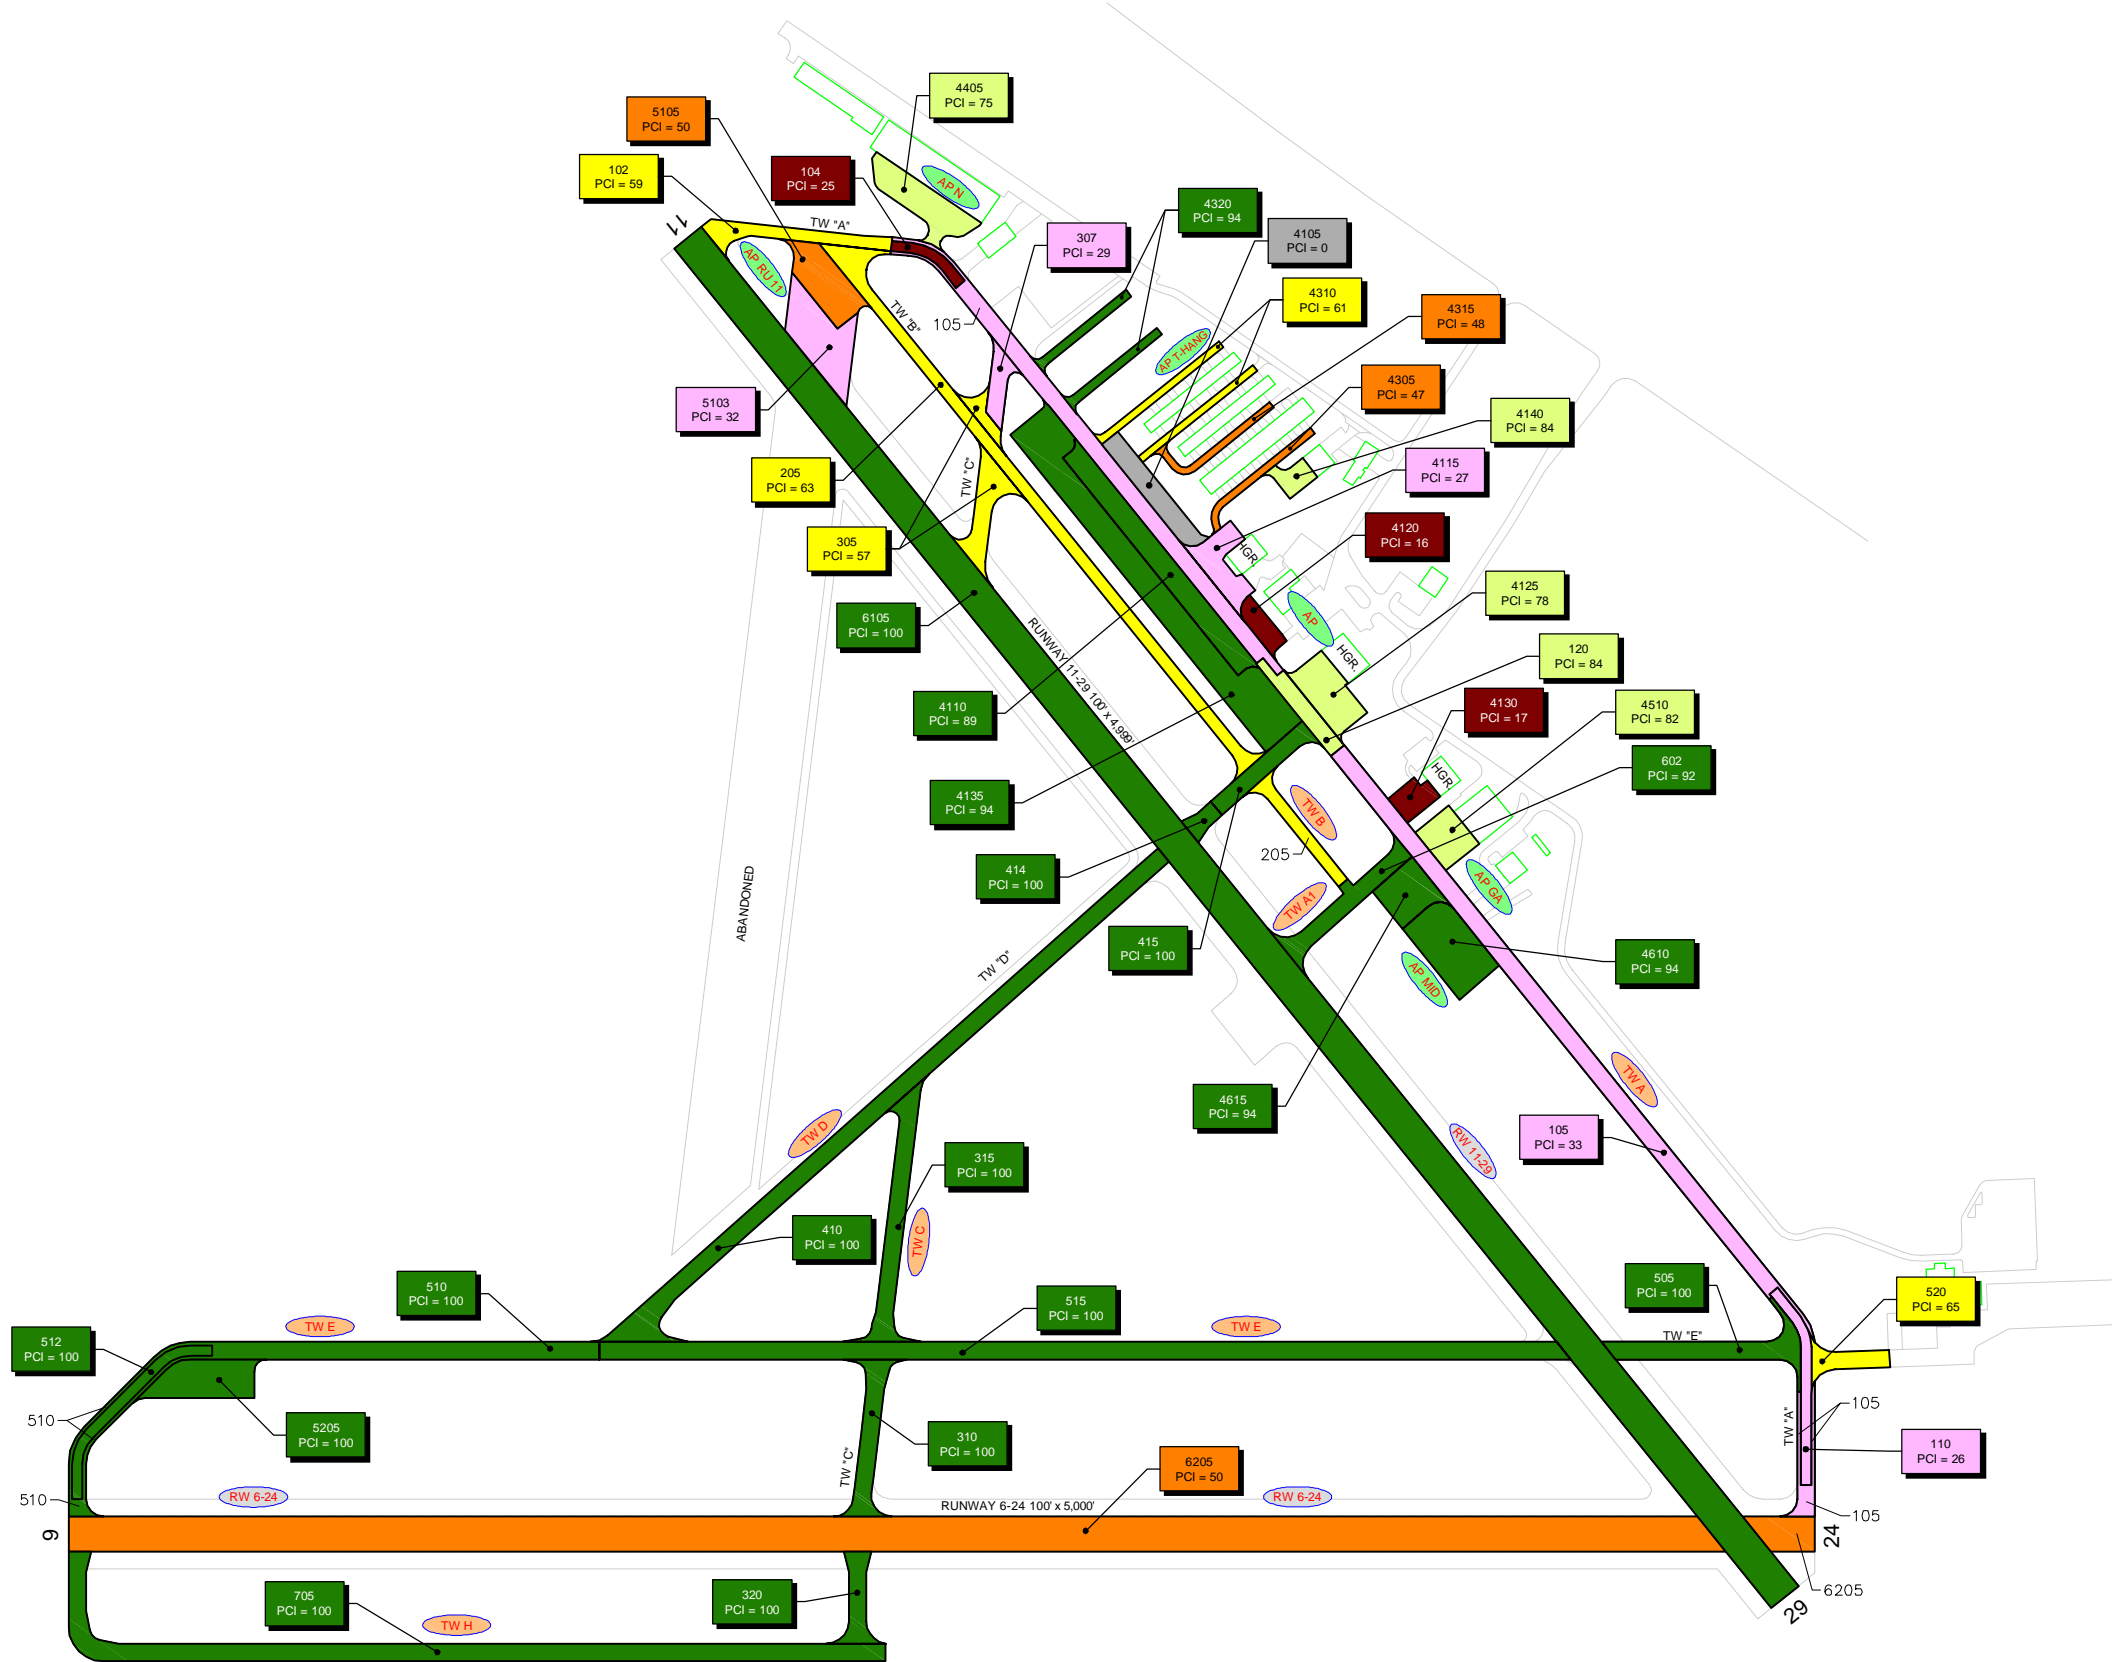

- LEGEND**
- RW 13-31 TYPICAL RUNWAY BRANCH ID
 - TW A TYPICAL TAXIWAY BRANCH ID
 - AP S TYPICAL APRON BRANCH ID
 - PCI 86-100 GOOD
 - PCI 71-85 SATISFACTORY
 - PCI 56-70 FAIR
 - PCI 41-55 POOR
 - PCI 26-40 VERY POOR
 - PCI 11-25 SERIOUS
 - PCI 0-10 FAILED

SECTION NO. 1
PCI NO. 1

RUNWAY LENGTHS DEPICTED IN THIS DRAWING ARE FOR PAVEMENT MANAGEMENT PURPOSES ONLY AND MAY NOT MATCH PUBLISHED RUNWAY LENGTHS.



Appendix D

Inspection Photograph Documentation



Runway 6-24, Section 6205, Sample Unit 117 – Low Severity (48) Longitudinal and Transverse Cracking, Low Severity (56) Swelling, Low Severity (52) Raveling



Runway 6-24, Section 6205, Sample Unit 107 - Low Severity (48) Longitudinal and Transverse Cracking, Medium Severity (48) Longitudinal and Transverse Cracking, Low Severity (52) Raveling, Medium Severity (52) Raveling



Runway 6-24, Section 6205, Sample Unit 149 - Low Severity (48) Longitudinal and Transverse Cracking, Medium Severity (48) Longitudinal and Transverse Cracking, Low Severity (52) Raveling, Medium Severity (52) Raveling



Taxiway A, Section 102, Sample Unit 101 - Low Severity (48) Longitudinal and Transverse Cracking, Low Severity (52) Raveling, Medium Severity (52) Raveling, Low Severity (56) Swelling



Taxiway A, Section 105, Sample Unit 141 - Low Severity (43) Block Cracking, Medium Severity (43) Block Cracking, Low Severity (52) Raveling, Low Severity (53) Rutting



Taxiway B, Section 205, Sample Unit 113 - Low Severity (48) Longitudinal and Transverse Cracking, Low Severity (52) Raveling, Medium Severity (52) Raveling, Low Severity (56) Swelling



Taxiway C, Section 307, Sample Unit 104 - Medium Severity (43) Block Cracking, Low Severity (52) Raveling



Apron, Section 4105, Sample Unit 101 – High Severity (72) Shattered Slab, High Severity (65) Joint Seal Damage



Apron, Section 4115, Sample Unit 401 – Medium Severity (41) Alligator Cracking, Medium Severity (48) Longitudinal and Transverse Cracking, Low Severity (52) Raveling



Apron, Section 4120, Sample Unit 402 – High Severity (65) Joint Seal Damage, Medium Severity (72) Shattered Slab



Apron, Section 4130, Sample Unit 101 – Medium Severity (63) Longitudinal, Transverse, and Diagonal Cracking, Medium Severity (62) Corner Break, High Severity (65) Joint Seal Damage



GA Apron, Section 4510, Sample Unit 100 – Low Severity (63) Longitudinal, Transverse, and Diagonal Cracking, High Severity (65) Joint Seal Damage



Apron Mid, Section 4610, Sample Unit 102 – Low Severity (57) Weathering



North Apron, Section 4405, Sample Unit 101 – High Severity (65) Joint Seal Damage



Run-Up Apron RW 11, Section 5103, Sample Unit 602 – Medium Severity (43) Block Cracking, Low Severity (52) Raveling

Appendix E

Inspection Distress Details

Re-Inspection Report

FDOT

Generated Date 7/18/2017

Page 1 of 45

Network:	FIN		Name:	FLAGLER EXECUTIVE AIRPORT		
Branch:	AP	Name:	APRON	Use:	APRON	Area: 260,262 SqFt
Section:	4105	of 8	From:	-	To:	-
Surface:	PCC	Family:	C9N59-GA-AP-PCC	Zone:	Category:	Rank: P
Area:	23,645 SqFt	Length:	220 Ft	Width:	60 Ft	
Slabs:	59	Slab Length:	20 Ft	Slab Width:	20 Ft	Joint Length: 1,040 Ft
Shoulder:		Street Type:		Grade:	0	Lanes: 0
Section Comments:						

Work Date: 1/1/1942	Work Type: BUILT	Code: IMPORTED	Is Major M&R: True
----------------------------	-------------------------	-----------------------	-------------------------------

Work Date: 1/1/1942	Work Type: OVERLAY	Code: IMPORTED	Is Major M&R: True
----------------------------	---------------------------	-----------------------	-------------------------------

Last Insp. Date: 1/24/2017	TotalSamples: 4	Surveyed: 1
-----------------------------------	------------------------	--------------------

Conditions: PCI:

Inspection Comments:

Sample Number: 101	Type: R	Area: 15.00 Slabs	PCI:
---------------------------	----------------	--------------------------	-------------

Sample Comments:

65	JT SEAL DMG	H	15.00	Slabs
72	SHAT. SLAB	M	10.00	Slabs
72	SHAT. SLAB	H	3.00	Slabs
72	SHAT. SLAB	L	1.00	Slabs
73	SHRINKAGE CR	N	2.00	Slabs
63	LINEAR CR	M	1.00	Slabs

Network:	FIN			Name:	FLAGLER EXECUTIVE AIRPORT										
Branch:	AP		Name:	APRON		Use:	APRON		Area:	260,262 SqFt					
Section:	4110		of	8		From:	-		To:	-		Last Const.:	1/1/2012		
Surface:	AC		Family:	C9N59-GA-AP-AC			Zone:				Category:	Rank: P			
Area:	50,015 SqFt			Length:	820 Ft			Width:	60 Ft						
Slabs:	124		Slab Length:	20 Ft		Slab Width:	20 Ft			Joint Length:	4,040 Ft				
Shoulder:				Street Type:				Grade:	0			Lanes:	0		
Section Comments:															
Work Date:	1/1/1942			Work Type:	OVERLAY				Code:	IMPORTED			Is Major M&R:	True	
Work Date:	1/1/1942			Work Type:	BUILT				Code:	IMPORTED			Is Major M&R:	True	
Work Date:	1/1/2012			Work Type:	Complete Reconstruction - AC				Code:	CR-AC			Is Major M&R:	True	
Last Insp. Date:	1/24/2017			TotalSamples:	9			Surveyed:	1						
Conditions:	PCI: 89														
Inspection Comments:															
Sample Number:	305		Type:	R		Area:	6200.00 SqFt			PCI:	89				
Sample Comments:															
48	L & T CR		L	50.00 Ft											
57	WEATHERING		L	6200.00 SqFt											

Network:	FIN		Name:	FLAGLER EXECUTIVE AIRPORT					
Branch:	AP	Name:	APRON	Use:	APRON	Area:	260,262 SqFt		
Section:	4115	of	8	From:	-	To:	-	Last Const.:	1/1/1950
Surface:	AC	Family:	C9N59-GA-AP-AC	Zone:		Category:		Rank:	P
Area:	20,847 SqFt	Length:	152 Ft	Width:	200 Ft				
Slabs:		Slab Length:	Ft	Slab Width:	Ft	Joint Length:	Ft		
Shoulder:		Street Type:		Grade:	0	Lanes:	0		
Section Comments:									
Work Date:	1/1/1950	Work Type:	OVERLAY	Code:	IMPORTED	Is Major M&R:	True		
Work Date:	1/1/1950	Work Type:	BUILT	Code:	IMPORTED	Is Major M&R:	True		
Last Insp. Date: 1/24/2017									
TotalSamples: 5									
Surveyed: 1									
Conditions: PCI: 27									
Inspection Comments:									
Sample Number:	401	Type:	R	Area:	5587.00 SqFt	PCI:	27		
Sample Comments:									
41	ALLIGATOR CR	M	40.00	SqFt					
41	ALLIGATOR CR	H	20.00	SqFt					
41	ALLIGATOR CR	L	16.00	SqFt					
45	DEPRESSION	L	91.00	SqFt					
43	BLOCK CR	M	5511.00	SqFt					
52	RAVELING	L	5587.00	SqFt					

Network:	FIN			Name:	FLAGLER EXECUTIVE AIRPORT						
Branch:	AP	Name:	APRON		Use:	APRON	Area:	260,262 SqFt			
Section:	4120	of 8	From:	-	To:	-	Last Const.:	1/1/1992			
Surface:	PCC	Family:	C9N59-GA-AP-PCC		Zone:		Category:	Rank: P			
Area:	9,798 SqFt		Length:	140 Ft		Width:	60 Ft				
Slabs:	24	Slab Length:	20 Ft		Slab Width:	20 Ft		Joint Length:	640 Ft		
Shoulder:		Street Type:		Grade:	0		Lanes:	0			
Section Comments:											
Work Date:	1/1/1992		Work Type:			BUILT		Code:	IMPORTED	Is Major M&R:	True
Last Insp. Date:	1/24/2017		TotalSamples:	2		Surveyed:	1				
Conditions:	PCI:	16									
Inspection Comments:											
Sample Number:	402	Type:	R		Area:	15.00 Slabs		PCI:	16		
Sample Comments:											
65	JT SEAL DMG		H	15.00		Slabs					
72	SHAT. SLAB		L	6.00		Slabs					
73	SHRINKAGE CR		N	11.00		Slabs					
63	LINEAR CR		M	2.00		Slabs					
75	CORNER SPALL		M	2.00		Slabs					
72	SHAT. SLAB		M	2.00		Slabs					
63	LINEAR CR		L	2.00		Slabs					

Network:	FIN			Name:	FLAGLER EXECUTIVE AIRPORT								
Branch:	AP		Name:	APRON		Use:	APRON	Area:	260,262 SqFt				
Section:	4125		of	8	From:	-		To:	-		Last Const.:	1/1/1992	
Surface:	PCC		Family:	C9N59-GA-AP-PCC		Zone:			Category:	Rank: P			
Area:	25,668 SqFt			Length:	220 Ft		Width:	110 Ft					
Slabs:	133		Slab Length:	13 Ft		Slab Width:	15 Ft		Joint Length:	3,219 Ft			
Shoulder:				Street Type:			Grade:	0		Lanes:	0		
Section Comments:													
Work Date:	1/1/1992			Work Type:	BUILT			Code:	IMPORTED		Is Major M&R:	True	
Last Insp. Date:	1/24/2017			TotalSamples:	6			Surveyed:	1				
Conditions:	PCI: 78												
Inspection Comments:													
Sample Number:	201		Type:	R		Area:	28.00 Slabs		PCI:	78			
Sample Comments:													
65	JT SEAL DMG			H	28.00		Slabs						
73	SHRINKAGE CR			N	7.00		Slabs						
74	JOINT SPALL			M	1.00		Slabs						
74	JOINT SPALL			L	3.00		Slabs						

Network:	FIN			Name:	FLAGLER EXECUTIVE AIRPORT									
Branch:	AP		Name:	APRON		Use:	APRON	Area:	260,262 SqFt					
Section:	4130		of	8	From:	-		To:	-		Last Const.:	1/1/1992		
Surface:	PCC		Family:	C9N59-GA-AP-PCC		Zone:			Category:			Rank:	P	
Area:	10,275 SqFt		Length:	90 Ft		Width:	110 Ft							
Slabs:	67		Slab Length:	10 Ft		Slab Width:	15 Ft		Joint Length:	1,450 Ft				
Shoulder:			Street Type:			Grade:	0		Lanes:	0				
Section Comments:														
Work Date:	1/1/1992			Work Type:	BUILT			Code:	IMPORTED		Is Major M&R:	True		
Last Insp. Date:	1/24/2017			TotalSamples:	4			Surveyed:	1					
Conditions:	PCI:		17											
Inspection Comments:														
Sample Number:	101		Type:	R		Area:	15.00 Slabs		PCI:	17				
Sample Comments:														
65	JT SEAL DMG		H	15.00		Slabs								
73	SHRINKAGE CR		N	9.00		Slabs								
62	CORNER BREAK		M	3.00		Slabs								
72	SHAT. SLAB		H	2.00		Slabs								
63	LINEAR CR		L	2.00		Slabs								
63	LINEAR CR		M	1.00		Slabs								
72	SHAT. SLAB		M	1.00		Slabs								
74	JOINT SPALL		L	4.00		Slabs								
74	JOINT SPALL		H	1.00		Slabs								
62	CORNER BREAK		H	1.00		Slabs								
75	CORNER SPALL		L	1.00		Slabs								

Network:	FIN		Name:	FLAGLER EXECUTIVE AIRPORT					
Branch:	AP	Name:	APRON	Use:	APRON	Area:	260,262 SqFt		
Section:	4135	of	8	From:	-	To:	-	Last Const.:	1/1/2012
Surface:	AC	Family:	C9N59-GA-AP-AC	Zone:		Category:		Rank:	P
Area:	111,646 SqFt	Length:	1,170 Ft	Width:	70 Ft				
Slabs:		Slab Length:	Ft	Slab Width:	Ft	Joint Length:	Ft		
Shoulder:		Street Type:		Grade:	0	Lanes:	0		
Section Comments:									
Work Date:	1/1/1992	Work Type:	BUILT	Code:	IMPORTED	Is Major M&R:	True		
Work Date:	1/1/2012	Work Type:	New Construction	Code:	HI-AG	Is Major M&R:	True		
Last Insp. Date: 1/24/2017									
TotalSamples: 24									
Surveyed: 3									
Conditions: PCI: 94									
Inspection Comments:									
Sample Number:	606	Type:	R	Area:	5400.00 SqFt	PCI:	94		
Sample Comments:									
57	WEATHERING	L	5400.00	SqFt					
Sample Number:	610	Type:	R	Area:	5000.00 SqFt	PCI:	94		
Sample Comments:									
57	WEATHERING	L	5000.00	SqFt					
Sample Number:	702	Type:	R	Area:	5000.00 SqFt	PCI:	94		
Sample Comments:									
57	WEATHERING	L	5000.00	SqFt					

Network:	FIN		Name:	FLAGLER EXECUTIVE AIRPORT								
Branch:	AP		Name:	APRON		Use:	APRON	Area:	260,262 SqFt			
Section:	4140		of	8	From:	-		To:	-		Last Const.:	1/1/2004
Surface:	PCC		Family:	C9N59-GA-AP-PCC		Zone:			Category:	Rank: S		
Area:	8,368 SqFt		Length:	100 Ft		Width:	84 Ft					
Slabs:	50		Slab Length:	14 Ft		Slab Width:	12 Ft		Joint Length:	1,116 Ft		
Shoulder:			Street Type:			Grade:	0		Lanes:	0		
Section Comments:												
Work Date:	1/1/2004		Work Type:	New Construction - Initial				Code:	NU-IN		Is Major M&R:	True
Last Insp. Date:	1/24/2017		TotalSamples:	2		Surveyed:	1					
Conditions:	PCI: 84											
Inspection Comments:												
Sample Number:	602		Type:	R		Area:	23.00 Slabs		PCI:	84		
Sample Comments:												
65	JT SEAL DMG		H	23.00 Slabs								
73	SHRINKAGE CR		N	7.00 Slabs								

Network:	FIN			Name:	FLAGLER EXECUTIVE AIRPORT				
Branch:	AP GA		Name:	APRON GA		Use:	APRON	Area:	17,338 SqFt
Section:	4510	of 1	From:	-			To:	-	Last Const.: 1/1/2005
Surface:	PCC	Family:	C9N59-GA-AP-PCC		Zone:	Category:		Rank:	P
Area:	17,338 SqFt		Length:	140 Ft		Width:	120 Ft		
Slabs:	99	Slab Length:	17 Ft		Slab Width:	10 Ft		Joint Length:	2,408 Ft
Shoulder:	Street Type:		Grade:		0		Lanes:	0	
Section Comments:									
Work Date:	1/1/2005		Work Type: New Construction - Initial			Code:	NU-IN		Is Major M&R: True
Last Insp. Date:	1/24/2017		TotalSamples:	6		Surveyed:	1		
Conditions:	PCI: 82								
Inspection Comments:									
Sample Number:	100	Type:	R	Area:	20.00 Slabs		PCI:	82	
Sample Comments:									
65	JT SEAL DMG		H	20.00 Slabs					
73	SHRINKAGE CR		N	1.00 Slabs					
63	LINEAR CR		L	2.00 Slabs					

Network:	FIN			Name:	FLAGLER EXECUTIVE AIRPORT							
Branch:	AP MID		Name:	APRON MID		Use:	APRON		Area:	60,249 SqFt		
Section:	4610		of	2	From:	-		To:	-		Last Const.:	12/1/2012
Surface:	AC		Family:	C9N59-GA-AP-AC		Zone:			Category:	Rank: P		
Area:	38,864 SqFt		Length:	260 Ft		Width:	150 Ft					
Slabs:			Slab Length:	Ft		Slab Width:	Ft		Joint Length:	Ft		
Shoulder:			Street Type:			Grade:	0		Lanes:	0		
Section Comments:												
Work Date:	12/1/2012		Work Type:	New Construction - Initial				Code:	NU-IN		Is Major M&R:	True
Last Insp. Date:	1/24/2017		TotalSamples:	8		Surveyed:	1					
Conditions:	PCI:	94										
Inspection Comments:												
Sample Number:	102		Type:	R		Area:	5000.00 SqFt		PCI:	94		
Sample Comments:												
57	WEATHERING		L	5000.00 SqFt								

Network:	FIN		Name:	FLAGLER EXECUTIVE AIRPORT							
Branch:	AP MID		Name:	APRON MID		Use:	APRON	Area:	60,249 SqFt		
Section:	4615	of 2	From:	-		To:	-		Last Const.:	1/1/2012	
Surface:	AC	Family:	C9N59-GA-AP-AC		Zone:			Category:	Rank: P		
Area:	21,385 SqFt	Length:	150 Ft		Width:	140 Ft					
Slabs:	Slab Length:		Ft		Slab Width:	Ft		Joint Length:	Ft		
Shoulder:	Street Type:		Grade:		0		Lanes:	0			
Section Comments:											
Work Date:	1/1/2012		Work Type:	New Construction - Initial			Code:	NU-IN		Is Major M&R:	True
Last Insp. Date:	1/24/2017		TotalSamples:	4		Surveyed:	1				
Conditions:	PCI:	94									
Inspection Comments:											
Sample Number:	301	Type:	R	Area:	6879.00 SqFt		PCI:	94			
Sample Comments:											
57	WEATHERING		L	6879.00 SqFt							

Network:	FIN			Name:	FLAGLER EXECUTIVE AIRPORT									
Branch:	AP N		Name:	NORTH APRON		Use:	APRON		Area:	30,077 SqFt				
Section:	4405		of	1		From:	-		To:	-		Last Const.:	1/1/2009	
Surface:	PCC		Family:	C9N59-GA-AP-PCC		Zone:			Category:			Rank:	S	
Area:	30,077 SqFt		Length:	350 Ft		Width:			85 Ft					
Slabs:	133		Slab Length:	15 Ft		Slab Width:			15 Ft		Joint Length:	3,532 Ft		
Shoulder:			Street Type:			Grade:	0		Lanes:	0				
Section Comments:														
Work Date:	1/1/2009		Work Type:	New Construction - Initial					Code:	NU-IN		Is Major M&R:	True	
Last Insp. Date:	1/24/2017		TotalSamples:	8		Surveyed:	1							
Conditions:	PCI: 75													
Inspection Comments:														
Sample Number:	101		Type:	R		Area:	21.00 Slabs		PCI:	75				
Sample Comments:														
65	JT SEAL DMG		H	21.00 Slabs										
63	LINEAR CR		L	7.00 Slabs										
73	SHRINKAGE CR		N	1.00 Slabs										

Network:	FIN		Name:	FLAGLER EXECUTIVE AIRPORT							
Branch:	AP RU 11		Name:	RUN-UP APRON AT RW 11		Use:	APRON	Area:	63,806 SqFt		
Section:	5103	of 2	From:	-			To:	-		Last Const.:	1/1/1942
Surface:	AC	Family:	C9N59-GA-AP-AC		Zone:		Category:		Rank:	P	
Area:	36,038 SqFt	Length:	280 Ft		Width:	120 Ft					
Slabs:		Slab Length:	Ft		Slab Width:	Ft		Joint Length:	Ft		
Shoulder:		Street Type:			Grade:	0		Lanes:	0		
Section Comments:											
Work Date:	1/1/1942		Work Type:	New Construction - Initial			Code:	NU-IN		Is Major M&R:	True
Last Insp. Date:	1/24/2017		TotalSamples:	9		Surveyed:	1				
Conditions:	PCI:	32									
Inspection Comments:											
Sample Number:	602	Type:	R	Area:	3300.00 SqFt		PCI:	32			
Sample Comments:											
45	DEPRESSION	L	105.00	SqFt							
43	BLOCK CR	M	3300.00	SqFt							
52	RAVELING	L	3250.00	SqFt							
52	RAVELING	M	50.00	SqFt							

Network:	FIN		Name:	FLAGLER EXECUTIVE AIRPORT						
Branch:	AP RU 11		Name:	RUN-UP APRON AT RW 11		Use:	APRON	Area:	63,806 SqFt	
Section:	5105	of 2	From:	-		To:	-		Last Const.:	1/1/1992
Surface:	AAC	Family:	C9N59-GA-AP-AAC-APC		Zone:			Category:	Rank: P	
Area:	27,768 SqFt		Length:	280 Ft		Width:	180 Ft			
Slabs:	Slab Length:		Ft		Slab Width:	Ft		Joint Length:	Ft	
Shoulder:	Street Type:		Grade:		0		Lanes:	0		
Section Comments:										
Work Date:	1/1/1992		Work Type:	BUILT		Code:	IMPORTED		Is Major M&R:	True
Last Insp. Date:	1/24/2017		TotalSamples:	5		Surveyed:	1			
Conditions:	PCI: 50									
Inspection Comments:										
Sample Number:	301	Type:	R	Area:	5000.00 SqFt		PCI:	50		
Sample Comments:										
48	L & T CR		L	120.00 Ft						
45	DEPRESSION		L	1386.00 SqFt						
52	RAVELING		L	5000.00 SqFt						

Network:	FIN			Name:	FLAGLER EXECUTIVE AIRPORT						
Branch:	RW 11-29		Name:	RUNWAY 11-29		Use:	RUNWAY		Area:	500,300 SqFt	
Section:	6105 of 1		From:	-			To:	-		Last Const.:	2/1/2018
Surface:	AC		Family:	C9N59-GA-RW-AC		Zone:			Category:	Rank: P	
Area:	500,300 SqFt		Length:	5,000 Ft		Width:	100 Ft				
Slabs:	Slab Length:		Ft		Slab Width:	Ft		Joint Length:	Ft		
Shoulder:	Street Type:				Grade:	0		Lanes:	0		
Section Comments:											
Work Date:	1/1/1942		Work Type: BUILT				Code:	IMPORTED		Is Major M&R:	True
Work Date:	1/1/1988		Work Type: OVERLAY				Code:	IMPORTED		Is Major M&R:	True
Work Date:	1/1/1988		Work Type: OVERLAY				Code:	IMPORTED		Is Major M&R:	True
Work Date:	2/1/2018		Work Type: Complete Reconstruction - AC				Code:	CR-AC		Is Major M&R:	True
Last Insp. Date:	7/9/2013		TotalSamples:	100		Surveyed:	20				
Conditions:	PCI: 50		NOTE: *** Pre-Construction PCI ***								
Inspection Comments:											
Sample Number:	103		Type:	R		Area:	5000.00 SqFt		PCI:	43	
Sample Comments:											
48	LONGITUDINAL/TRANSVERSE CRACKING		L	402.00 Ft							
48	LONGITUDINAL/TRANSVERSE CRACKING		M	300.00 Ft							
52	RAVELING		L	5000.00 SqFt							
57	WEATHERING		L	5000.00 SqFt							
56	SWELLING		L	150.00 SqFt							
56	SWELLING		M	84.00 SqFt							
Sample Number:	108		Type:	R		Area:	5000.00 SqFt		PCI:	47	
Sample Comments:											
48	LONGITUDINAL/TRANSVERSE CRACKING		M	300.00 Ft							
48	LONGITUDINAL/TRANSVERSE CRACKING		L	259.00 Ft							
52	RAVELING		L	5000.00 SqFt							
57	WEATHERING		L	5000.00 SqFt							
56	SWELLING		L	100.00 SqFt							
56	SWELLING		M	68.00 SqFt							
56	SWELLING		L	56.00 SqFt							
Sample Number:	115		Type:	R		Area:	5000.00 SqFt		PCI:	40	
Sample Comments:											
48	LONGITUDINAL/TRANSVERSE CRACKING		L	100.00 Ft							
48	LONGITUDINAL/TRANSVERSE CRACKING		M	250.00 Ft							
48	LONGITUDINAL/TRANSVERSE CRACKING		L	442.00 Ft							
52	RAVELING		L	5000.00 SqFt							
57	WEATHERING		L	5000.00 SqFt							
56	SWELLING		L	450.00 SqFt							
56	SWELLING		M	108.00 SqFt							
56	SWELLING		L	56.00 SqFt							
Sample Number:	122		Type:	R		Area:	5000.00 SqFt		PCI:	46	
Sample Comments:											
48	LONGITUDINAL/TRANSVERSE CRACKING		M	200.00 Ft							
48	LONGITUDINAL/TRANSVERSE CRACKING		L	418.00 Ft							
52	RAVELING		L	5000.00 SqFt							
57	WEATHERING		L	5000.00 SqFt							

E-15

56	SWELLING	L	195.00	SqFt		
56	SWELLING	M	8.00	SqFt		
56	SWELLING	L	150.00	SqFt		
56	SWELLING	L	14.00	SqFt		
<hr/>						
Sample Number:	129	Type:	R	Area:	5000.00 SqFt	PCI: 52
Sample Comments:						
48	LONGITUDINAL/TRANSVERSE CRACKING	L	156.00	Ft		
52	RAVELING	L	5000.00	SqFt		
57	WEATHERING	L	5000.00	SqFt		
48	LONGITUDINAL/TRANSVERSE CRACKING	L	100.00	Ft		
48	LONGITUDINAL/TRANSVERSE CRACKING	M	250.00	Ft		
56	SWELLING	L	150.00	SqFt		
56	SWELLING	L	16.00	SqFt		
<hr/>						
Sample Number:	136	Type:	R	Area:	5000.00 SqFt	PCI: 54
Sample Comments:						
56	SWELLING	L	165.00	SqFt		
48	LONGITUDINAL/TRANSVERSE CRACKING	L	199.00	Ft		
48	LONGITUDINAL/TRANSVERSE CRACKING	M	250.00	Ft		
52	RAVELING	L	5000.00	SqFt		
57	WEATHERING	L	5000.00	SqFt		
<hr/>						
Sample Number:	139	Type:	R	Area:	5000.00 SqFt	PCI: 53
Sample Comments:						
48	LONGITUDINAL/TRANSVERSE CRACKING	L	150.00	Ft		
48	LONGITUDINAL/TRANSVERSE CRACKING	M	300.00	Ft		
52	RAVELING	L	5000.00	SqFt		
57	WEATHERING	L	5000.00	SqFt		
56	SWELLING	L	57.00	SqFt		
<hr/>						
Sample Number:	143	Type:	R	Area:	5000.00 SqFt	PCI: 55
Sample Comments:						
48	LONGITUDINAL/TRANSVERSE CRACKING	L	55.00	Ft		
52	RAVELING	L	5000.00	SqFt		
57	WEATHERING	L	5000.00	SqFt		
48	LONGITUDINAL/TRANSVERSE CRACKING	M	250.00	Ft		
48	LONGITUDINAL/TRANSVERSE CRACKING	L	50.00	Ft		
56	SWELLING	L	54.00	SqFt		
56	SWELLING	L	20.00	SqFt		
<hr/>						
Sample Number:	146	Type:	R	Area:	5000.00 SqFt	PCI: 49
Sample Comments:						
56	SWELLING	M	50.00	SqFt		
48	LONGITUDINAL/TRANSVERSE CRACKING	L	138.00	Ft		
48	LONGITUDINAL/TRANSVERSE CRACKING	M	200.00	Ft		
48	LONGITUDINAL/TRANSVERSE CRACKING	L	150.00	Ft		
52	RAVELING	L	5000.00	SqFt		
57	WEATHERING	L	5000.00	SqFt		
56	SWELLING	L	146.00	SqFt		
<hr/>						
Sample Number:	150	Type:	R	Area:	5000.00 SqFt	PCI: 54
Sample Comments:						
48	LONGITUDINAL/TRANSVERSE CRACKING	L	61.00	Ft		
52	RAVELING	L	5000.00	SqFt		

57	WEATHERING	L	5000.00	SqFt
56	SWELLING	L	120.00	SqFt
48	LONGITUDINAL/TRANSVERSE CRACKING	M	150.00	Ft
48	LONGITUDINAL/TRANSVERSE CRACKING	L	54.00	Ft
<hr/>				
Sample Number: 153		Type: R	Area: 5000.00 SqFt	PCI: 54
Sample Comments:				
56	SWELLING	L	175.00	SqFt
48	LONGITUDINAL/TRANSVERSE CRACKING	L	120.00	Ft
48	LONGITUDINAL/TRANSVERSE CRACKING	M	160.00	Ft
48	LONGITUDINAL/TRANSVERSE CRACKING	L	190.00	Ft
52	RAVELING	L	5000.00	SqFt
57	WEATHERING	L	5000.00	SqFt
56	SWELLING	L	200.00	SqFt
<hr/>				
Sample Number: 157		Type: R	Area: 5000.00 SqFt	PCI: 53
Sample Comments:				
48	LONGITUDINAL/TRANSVERSE CRACKING	M	200.00	Ft
48	LONGITUDINAL/TRANSVERSE CRACKING	L	150.00	Ft
48	LONGITUDINAL/TRANSVERSE CRACKING	L	148.00	Ft
52	RAVELING	L	5000.00	SqFt
57	WEATHERING	L	5000.00	SqFt
56	SWELLING	L	156.00	SqFt
<hr/>				
Sample Number: 161		Type: R	Area: 5000.00 SqFt	PCI: 49
Sample Comments:				
57	WEATHERING	L	4850.00	SqFt
52	RAVELING	M	150.00	SqFt
56	SWELLING	L	164.00	SqFt
48	LONGITUDINAL/TRANSVERSE CRACKING	M	150.00	Ft
48	LONGITUDINAL/TRANSVERSE CRACKING	L	200.00	Ft
48	LONGITUDINAL/TRANSVERSE CRACKING	L	98.00	Ft
52	RAVELING	L	4850.00	SqFt
<hr/>				
Sample Number: 164		Type: R	Area: 5000.00 SqFt	PCI: 44
Sample Comments:				
48	LONGITUDINAL/TRANSVERSE CRACKING	M	200.00	Ft
48	LONGITUDINAL/TRANSVERSE CRACKING	L	150.00	Ft
48	LONGITUDINAL/TRANSVERSE CRACKING	L	75.00	Ft
52	RAVELING	L	4850.00	SqFt
57	WEATHERING	L	4850.00	SqFt
56	SWELLING	M	100.00	SqFt
52	RAVELING	M	150.00	SqFt
56	SWELLING	L	250.00	SqFt
<hr/>				
Sample Number: 171		Type: R	Area: 5000.00 SqFt	PCI: 54
Sample Comments:				
57	WEATHERING	L	5000.00	SqFt
56	SWELLING	L	96.00	SqFt
48	LONGITUDINAL/TRANSVERSE CRACKING	M	200.00	Ft
48	LONGITUDINAL/TRANSVERSE CRACKING	L	150.00	Ft
48	LONGITUDINAL/TRANSVERSE CRACKING	L	66.00	Ft
52	RAVELING	L	5000.00	SqFt

Sample Number: 178		Type:	R	Area:	5000.00 SqFt	PCI: 54
Sample Comments:						
48	LONGITUDINAL/TRANSVERSE CRACKING	M		150.00	Ft	
48	LONGITUDINAL/TRANSVERSE CRACKING	L		283.00	Ft	
52	RAVELING	L		4850.00	SqFt	
57	WEATHERING	L		4850.00	SqFt	
52	RAVELING	M		150.00	SqFt	
Sample Number: 185		Type:	R	Area:	5000.00 SqFt	PCI: 49
Sample Comments:						
48	LONGITUDINAL/TRANSVERSE CRACKING	M		200.00	Ft	
48	LONGITUDINAL/TRANSVERSE CRACKING	L		150.00	Ft	
48	LONGITUDINAL/TRANSVERSE CRACKING	L		179.00	Ft	
52	RAVELING	L		4850.00	SqFt	
57	WEATHERING	L		4850.00	SqFt	
52	RAVELING	M		150.00	SqFt	
56	SWELLING	L		168.00	SqFt	
56	SWELLING	L		100.00	SqFt	
Sample Number: 192		Type:	R	Area:	5000.00 SqFt	PCI: 50
Sample Comments:						
48	LONGITUDINAL/TRANSVERSE CRACKING	M		150.00	Ft	
48	LONGITUDINAL/TRANSVERSE CRACKING	L		325.00	Ft	
52	RAVELING	L		4900.00	SqFt	
52	RAVELING	M		100.00	SqFt	
57	WEATHERING	L		4900.00	SqFt	
56	SWELLING	L		74.00	SqFt	
Sample Number: 195		Type:	R	Area:	5000.00 SqFt	PCI: 53
Sample Comments:						
48	LONGITUDINAL/TRANSVERSE CRACKING	L		445.00	Ft	
52	RAVELING	L		5000.00	SqFt	
57	WEATHERING	L		5000.00	SqFt	
56	SWELLING	L		132.00	SqFt	
48	LONGITUDINAL/TRANSVERSE CRACKING	M		120.00	Ft	
Sample Number: 199		Type:	R	Area:	5000.00 SqFt	PCI: 54
Sample Comments:						
48	LONGITUDINAL/TRANSVERSE CRACKING	M		140.00	Ft	
48	LONGITUDINAL/TRANSVERSE CRACKING	L		443.00	Ft	
52	RAVELING	L		5000.00	SqFt	
56	SWELLING	L		46.00	SqFt	
57	WEATHERING	L		5000.00	SqFt	

Network:	FIN		Name:		FLAGLER EXECUTIVE AIRPORT					
Branch:	RW 6-24		Name:		RUNWAY 6-24		Use:	RUNWAY	Area:	487,349 SqFt
Section:	6205		of 1		From: -		To: -		Last Const.: 1/1/1995	
Surface:	AAC		Family:		C9N59-GA-RW-AAC-APC		Zone:		Category: Rank: P	
Area:	487,349 SqFt		Length:		4,850 Ft		Width:		100 Ft	
Slabs:			Slab Length:		Ft		Slab Width:		Ft Joint Length: Ft	
Shoulder:			Street Type:				Grade: 0		Lanes: 0	
Section Comments:										
Work Date:	1/1/1942		Work Type: BUILT				Code:	IMPORTED		Is Major M&R: True
Work Date:	1/1/1995		Work Type: OVERLAY				Code:	IMPORTED		Is Major M&R: True
Work Date:	1/1/1995		Work Type: OVERLAY				Code:	IMPORTED		Is Major M&R: True
Last Insp. Date:	1/24/2017		TotalSamples:		97		Surveyed: 20			
Conditions:	PCI: 50									
Inspection Comments:										
Sample Number:	100		Type:	R	Area:		5000.00 SqFt		PCI: 37	
Sample Comments:										
48	L & T CR		M	90.00 Ft						
48	L & T CR		L	300.00 Ft						
52	RAVELING		M	2573.00 SqFt						
52	RAVELING		L	2427.00 SqFt						
56	SWELLING		L	90.00 SqFt						
Sample Number:	103		Type:	R	Area:		5000.00 SqFt		PCI: 47	
Sample Comments:										
48	L & T CR		M	150.00 Ft						
48	L & T CR		L	440.00 Ft						
52	RAVELING		M	1408.00 SqFt						
52	RAVELING		L	3592.00 SqFt						
56	SWELLING		L	10.00 SqFt						
Sample Number:	107		Type:	R	Area:		5000.00 SqFt		PCI: 57	
Sample Comments:										
48	L & T CR		M	100.00 Ft						
48	L & T CR		L	332.00 Ft						
52	RAVELING		L	4900.00 SqFt						
52	RAVELING		M	100.00 SqFt						
56	SWELLING		L	33.00 SqFt						
Sample Number:	112		Type:	R	Area:		5000.00 SqFt		PCI: 57	
Sample Comments:										
48	L & T CR		L	364.00 Ft						
52	RAVELING		M	50.00 SqFt						
52	RAVELING		L	4950.00 SqFt						
56	SWELLING		L	12.00 SqFt						
48	L & T CR		M	50.00 Ft						
Sample Number:	117		Type:	R	Area:		5000.00 SqFt		PCI: 61	
Sample Comments:										
48	L & T CR		L	392.00 Ft						
52	RAVELING		L	4900.00 SqFt						
52	RAVELING		M	100.00 SqFt						
56	SWELLING		L	44.00 SqFt						
Sample Number:	121		Type:	R	Area:		5000.00 SqFt		PCI: 47	
Sample Comments:										
48	L & T CR		L	384.00 Ft						
52	RAVELING		M	1800.00 SqFt						
52	RAVELING		L	3200.00 SqFt						
48	L & T CR		M	50.00 Ft						

Sample Number: 125		Type:	R	Area:		5000.00 SqFt	PCI: 54
Sample Comments:							
48	L & T CR		M	150.00	Ft		
48	L & T CR		L	200.00	Ft		
52	RAVELING		M	100.00	SqFt		
52	RAVELING		L	4900.00	SqFt		
56	SWELLING		L	100.00	SqFt		
Sample Number: 131		Type:	R	Area:		5000.00 SqFt	PCI: 54
Sample Comments:							
48	L & T CR		M	100.00	Ft		
48	L & T CR		L	430.00	Ft		
52	RAVELING		L	4950.00	SqFt		
52	RAVELING		M	50.00	SqFt		
56	SWELLING		L	150.00	SqFt		
Sample Number: 135		Type:	R	Area:		5000.00 SqFt	PCI: 57
Sample Comments:							
48	L & T CR		M	100.00	Ft		
48	L & T CR		L	394.00	Ft		
52	RAVELING		L	4900.00	SqFt		
52	RAVELING		M	100.00	SqFt		
56	SWELLING		L	27.00	SqFt		
Sample Number: 140		Type:	R	Area:		5000.00 SqFt	PCI: 51
Sample Comments:							
48	L & T CR		M	200.00	Ft		
48	L & T CR		L	375.00	Ft		
52	RAVELING		M	100.00	SqFt		
52	RAVELING		L	4900.00	SqFt		
56	SWELLING		L	82.00	SqFt		
Sample Number: 145		Type:	R	Area:		5000.00 SqFt	PCI: 54
Sample Comments:							
48	L & T CR		M	206.00	Ft		
48	L & T CR		L	230.00	Ft		
52	RAVELING		M	250.00	SqFt		
52	RAVELING		L	4750.00	SqFt		
56	SWELLING		L	104.00	SqFt		
Sample Number: 149		Type:	R	Area:		5000.00 SqFt	PCI: 57
Sample Comments:							
48	L & T CR		M	100.00	Ft		
48	L & T CR		L	359.00	Ft		
52	RAVELING		M	150.00	SqFt		
52	RAVELING		L	4850.00	SqFt		
56	SWELLING		L	20.00	SqFt		
Sample Number: 156		Type:	R	Area:		5000.00 SqFt	PCI: 56
Sample Comments:							
48	L & T CR		M	50.00	Ft		
48	L & T CR		L	474.00	Ft		
56	SWELLING		L	38.00	SqFt		
52	RAVELING		M	250.00	SqFt		
52	RAVELING		L	4750.00	SqFt		
Sample Number: 163		Type:	R	Area:		5000.00 SqFt	PCI: 59
Sample Comments:							
48	L & T CR		M	100.00	Ft		
48	L & T CR		L	394.00	Ft		
52	RAVELING		M	250.00	SqFt		
52	RAVELING		L	4750.00	SqFt		
Sample Number: 170		Type:	R	Area:		5000.00 SqFt	PCI: 45
Sample Comments:							
48	L & T CR		M	100.00	Ft		

E-20

48	L & T CR	L	288.00	Ft
56	SWELLING	L	7.00	SqFt
52	RAVELING	M	2000.00	SqFt
52	RAVELING	L	3000.00	SqFt
<hr/>				
Sample Number: 177		Type: R	Area: 5000.00 SqFt	PCI: 47
Sample Comments:				
48	L & T CR	M	150.00	Ft
48	L & T CR	L	434.00	Ft
43	BLOCK CR	L	312.00	SqFt
52	RAVELING	M	500.00	SqFt
52	RAVELING	L	4500.00	SqFt
<hr/>				
Sample Number: 182		Type: R	Area: 5000.00 SqFt	PCI: 44
Sample Comments:				
48	L & T CR	M	250.00	Ft
48	L & T CR	L	582.00	Ft
56	SWELLING	L	109.00	SqFt
52	RAVELING	M	750.00	SqFt
52	RAVELING	L	4250.00	SqFt
<hr/>				
Sample Number: 188		Type: R	Area: 5000.00 SqFt	PCI: 42
Sample Comments:				
48	L & T CR	M	250.00	Ft
48	L & T CR	L	573.00	Ft
56	SWELLING	L	150.00	SqFt
52	RAVELING	L	4000.00	SqFt
52	RAVELING	M	1000.00	SqFt
<hr/>				
Sample Number: 192		Type: R	Area: 5000.00 SqFt	PCI: 37
Sample Comments:				
56	SWELLING	L	45.00	SqFt
48	L & T CR	L	565.00	Ft
48	L & T CR	M	150.00	Ft
43	BLOCK CR	L	150.00	SqFt
52	RAVELING	M	2240.00	SqFt
52	RAVELING	L	2760.00	SqFt
<hr/>				
Sample Number: 199		Type: R	Area: 5200.00 SqFt	PCI: 35
Sample Comments:				
48	L & T CR	M	54.00	Ft
48	L & T CR	L	200.00	Ft
43	BLOCK CR	M	520.00	SqFt
43	BLOCK CR	L	3377.00	SqFt
52	RAVELING	L	4680.00	SqFt
41	ALLIGATOR CR	L	5.00	SqFt
45	DEPRESSION	L	5.00	SqFt
52	RAVELING	M	520.00	SqFt

Network:	FIN		Name:	FLAGLER EXECUTIVE AIRPORT							
Branch:	T-HANG		Name:	T-HANGAR TAXILANE		Use:	TAXILANE	Area:	51,683 SqFt		
Section:	4305	of 4	From:	-		To:	-		Last Const.:	12/25/1999	
Surface:	PCC	Family:	C9N59-GA-RW-TW-PCC		Zone:			Category:	Rank: S		
Area:	8,395 SqFt	Length:	400 Ft		Width:	20 Ft					
Slabs:	29	Slab Length:	15 Ft		Slab Width:	20 Ft		Joint Length:	513 Ft		
Shoulder:	Street Type:		Grade:		0		Lanes:	0			
Section Comments:											
Work Date:	12/25/1999		Work Type:	New Construction - Initial			Code:	NU-IN		Is Major M&R:	True
Last Insp. Date:	1/24/2017		TotalSamples:	2		Surveyed:	1				
Conditions:	PCI:	47									
Inspection Comments:											
Sample Number:	501	Type:	R	Area:	14.00 Slabs		PCI:	47			
Sample Comments:											
65	JT SEAL DMG	H	14.00	Slabs							
73	SHRINKAGE CR	N	13.00	Slabs							
72	SHAT. SLAB	L	1.00	Slabs							
74	JOINT SPALL	M	1.00	Slabs							
63	LINEAR CR	L	2.00	Slabs							
72	SHAT. SLAB	M	1.00	Slabs							

Network:	FIN			Name:	FLAGLER EXECUTIVE AIRPORT							
Branch:	T-HANG		Name:	T-HANGAR TAXILANE		Use:	TAXILANE	Area:	51,683 SqFt			
Section:	4310 of 4		From:	-			To:	-		Last Const.:	12/25/1999	
Surface:	AC		Family:	C9N59-GA-TW-AC		Zone:			Category:	Rank: S		
Area:	17,531 SqFt		Length:	340 Ft		Width:	20 Ft					
Slabs:			Slab Length:	Ft		Slab Width:	Ft		Joint Length:	Ft		
Shoulder:			Street Type:			Grade:	0		Lanes:	0		
Section Comments:												
Work Date:	12/25/1999		Work Type:	New Construction - Initial				Code:	NU-IN		Is Major M&R:	True
Last Insp. Date:	1/24/2017		TotalSamples:	4		Surveyed:	1					
Conditions:	PCI: 61											
Inspection Comments:												
Sample Number:	201		Type:	R		Area:	4684.00 SqFt		PCI:	61		
Sample Comments:												
48	L & T CR		L	217.00 Ft								
52	RAVELING		L	3850.00 SqFt								
50	PATCHING		L	825.00 SqFt								
52	RAVELING		M	9.00 SqFt								

Network:	FIN		Name:	FLAGLER EXECUTIVE AIRPORT							
Branch:	T-HANG		Name:	T-HANGAR TAXILANE		Use:	TAXILANE	Area:	51,683 SqFt		
Section:	4315	of 4	From:	-			To:	-		Last Const.:	12/25/1999
Surface:	AC	Family:	C9N59-GA-TW-AC		Zone:		Category:		Rank:	S	
Area:	8,565 SqFt		Length:	1,330 Ft		Width:	20 Ft				
Slabs:	Slab Length:		Ft		Slab Width:	Ft		Joint Length:	Ft		
Shoulder:	Street Type:		Grade:		0		Lanes:	0			
Section Comments:											
Work Date:	12/25/1999		Work Type:	New Construction - Initial			Code:	NU-IN		Is Major M&R:	True
Last Insp. Date:	1/24/2017		TotalSamples:	2		Surveyed:	1				
Conditions:	PCI:	48									
Inspection Comments:											
Sample Number:	402	Type:	R	Area:	4360.00 SqFt		PCI:	48			
Sample Comments:											
48	L & T CR		L	164.00 Ft							
43	BLOCK CR		L	1659.00 SqFt							
45	DEPRESSION		L	21.00 SqFt							
52	RAVELING		L	3360.00 SqFt							
57	WEATHERING		L	1000.00 SqFt							
56	SWELLING		L	675.00 SqFt							

Network:	FIN			Name:	FLAGLER EXECUTIVE AIRPORT							
Branch:	T-HANG		Name:	T-HANGAR TAXILANE		Use:	TAXILANE		Area:	51,683 SqFt		
Section:	4320		of	4	From:	-		To:	-		Last Const.:	12/1/2012
Surface:	AC		Family:	C9N59-GA-TW-AC		Zone:			Category:	Rank: P		
Area:	17,192 SqFt		Length:	300 Ft		Width:	25 Ft					
Slabs:			Slab Length:	Ft		Slab Width:	Ft		Joint Length:	Ft		
Shoulder:			Street Type:			Grade:	0		Lanes:	0		
Section Comments:												
Work Date:	12/1/2012		Work Type:	New Construction - Initial				Code:	NU-IN		Is Major M&R:	True
Last Insp. Date:	1/24/2017		TotalSamples:	4		Surveyed:	1					
Conditions:	PCI:	94										
Inspection Comments:												
Sample Number:	101		Type:	R		Area:	5000.00 SqFt		PCI:	94		
Sample Comments:												
57	WEATHERING		L	5000.00 SqFt								

Network:	FIN			Name:	FLAGLER EXECUTIVE AIRPORT				
Branch:	TW A		Name:	TAXIWAY A		Use:	TAXIWAY	Area:	247,263 SqFt
Section:	102	of	5	From:	-		To:	-	Last Const.: 1/1/1992
Surface:	AAC	Family:	C9N59-GA-TW-AAC-APC		Zone:		Category:		Rank: P
Area:	22,177 SqFt		Length:	500 Ft		Width:	50 Ft		
Slabs:	Slab Length:		Ft		Slab Width:		Ft		Joint Length: Ft
Shoulder:	Street Type:				Grade:	0		Lanes:	0
Section Comments:									
Work Date:	1/1/1992		Work Type: BUILT				Code:	IMPORTED	
Is Major M&R:		True							
Last Insp. Date:	1/24/2017		TotalSamples:	6		Surveyed:	2		
Conditions:	PCI:	59							
Inspection Comments:									
Sample Number:	101	Type:	R	Area:	3500.00 SqFt		PCI:	61	
Sample Comments:									
48	L & T CR		L	85.00 Ft					
56	SWELLING		L	30.00 SqFt					
52	RAVELING		L	3490.00 SqFt					
52	RAVELING		M	10.00 SqFt					
Sample Number:	103	Type:	R	Area:	3500.00 SqFt		PCI:	58	
Sample Comments:									
48	L & T CR		L	102.00 Ft					
52	RAVELING		L	3450.00 SqFt					
56	SWELLING		L	13.00 SqFt					
45	DEPRESSION		L	23.00 SqFt					
52	RAVELING		M	50.00 SqFt					

Network:	FIN			Name:	FLAGLER EXECUTIVE AIRPORT						
Branch:	TW A		Name:	TAXIWAY A		Use:	TAXIWAY	Area:	247,263 SqFt		
Section:	104	of 5	From:	-			To:	-	Last Const.:	1/1/1982	
Surface:	AAC	Family:	C9N59-GA-TW-AAC-APC		Zone:		Category:		Rank:	P	
Area:	7,358 SqFt		Length:	250 Ft		Width:	30 Ft				
Slabs:		Slab Length:	Ft		Slab Width:	Ft		Joint Length:	Ft		
Shoulder:		Street Type:		Grade:	0		Lanes:	0			
Section Comments:											
Work Date:	1/1/1982		Work Type:	BUILT			Code:	IMPORTED		Is Major M&R:	True
Last Insp. Date:	1/24/2017		TotalSamples:	2		Surveyed:	1				
Conditions:	PCI:	25									
Inspection Comments:											
Sample Number:	106	Type:	R	Area:	3835.00 SqFt		PCI:	25			
Sample Comments:											
43	BLOCK CR	M	1368.00	SqFt							
43	BLOCK CR	L	2047.00	SqFt							
52	RAVELING	M	3419.00	SqFt							
50	PATCHING	L	420.00	SqFt							

Network:	FIN		Name:	FLAGLER EXECUTIVE AIRPORT										
Branch:	TW A		Name:	TAXIWAY A		Use:	TAXIWAY		Area:	247,263 SqFt				
Section:	105		of	5		From:	-		To:	-		Last Const.:	1/1/1942	
Surface:	AC		Family:	C9N59-GA-TW-AC		Zone:			Category:			Rank:	P	
Area:	184,752 SqFt		Length:	3,740 Ft		Width:	50 Ft							
Slabs:			Slab Length:	Ft		Slab Width:	Ft		Joint Length:	Ft				
Shoulder:			Street Type:			Grade:	0		Lanes:	0				
Section Comments:														
Work Date:	1/1/1942		Work Type:	BUILT				Code:	IMPORTED		Is Major M&R:	True		
Last Insp. Date:	1/24/2017		TotalSamples:	40		Surveyed:	6							
Conditions:	PCI: 33													
Inspection Comments:														
Sample Number:	111		Type:	R		Area:	4889.00 SqFt		PCI:	36				
Sample Comments:														
50	PATCHING		L	670.00 SqFt										
41	ALLIGATOR CR		L	12.00 SqFt										
43	BLOCK CR		M	2955.00 SqFt										
43	BLOCK CR		L	1252.00 SqFt										
52	RAVELING		L	4234.00 SqFt										
Sample Number:	120		Type:	R		Area:	6256.00 SqFt		PCI:	34				
Sample Comments:														
52	RAVELING		L	5872.00 SqFt										
48	L & T CR		L	348.00 Ft										
43	BLOCK CR		M	982.00 SqFt										
50	PATCHING		L	384.00 SqFt										
45	DEPRESSION		L	13.00 SqFt										
43	BLOCK CR		L	2015.00 SqFt										
41	ALLIGATOR CR		M	5.00 SqFt										
53	RUTTING		L	132.00 SqFt										
Sample Number:	125		Type:	R		Area:	5000.00 SqFt		PCI:	25				
Sample Comments:														
48	L & T CR		M	66.00 Ft										
48	L & T CR		L	200.00 Ft										
43	BLOCK CR		M	2906.00 SqFt										
50	PATCHING		M	3.00 SqFt										
41	ALLIGATOR CR		L	20.00 SqFt										
41	ALLIGATOR CR		M	74.00 SqFt										
53	RUTTING		L	24.00 SqFt										
52	RAVELING		L	4997.00 SqFt										
Sample Number:	129		Type:	R		Area:	5000.00 SqFt		PCI:	42				
Sample Comments:														
43	BLOCK CR		M	4000.00 SqFt										
43	BLOCK CR		L	1000.00 SqFt										
52	RAVELING		L	5000.00 SqFt										
Sample Number:	135		Type:	R		Area:	5000.00 SqFt		PCI:	31				
Sample Comments:														
41	ALLIGATOR CR		L	56.00 SqFt										
43	BLOCK CR		M	1000.00 SqFt										
43	BLOCK CR		L	3779.00 SqFt										
52	RAVELING		L	4835.00 SqFt										
50	PATCHING		M	15.00 SqFt										
50	PATCHING		L	150.00 SqFt										
53	RUTTING		L	100.00 SqFt										
Sample Number:	141		Type:	R		Area:	5000.00 SqFt		PCI:	32				
Sample Comments:														
41	ALLIGATOR CR		L	27.00 SqFt		E-28								
45	DEPRESSION		L	2.00 SqFt										

43	BLOCK CR	M	2487.00	SqFt
43	BLOCK CR	L	2486.00	SqFt
52	RAVELING	L	5000.00	SqFt
53	RUTTING	L	350.00	SqFt

Network:	FIN		Name:	FLAGLER EXECUTIVE AIRPORT										
Branch:	TW A		Name:	TAXIWAY A		Use:	TAXIWAY		Area:	247,263 SqFt				
Section:	110		of	5		From:	-		To:	-		Last Const.:	1/1/1982	
Surface:	AAC		Family:	C9N59-GA-TW-AAC-APC		Zone:			Category:			Rank:	P	
Area:	17,576 SqFt		Length:	587 Ft		Width:	30 Ft							
Slabs:			Slab Length:	Ft		Slab Width:	Ft		Joint Length:	Ft				
Shoulder:			Street Type:			Grade:	0		Lanes:	0				
Section Comments:														
Work Date:	1/1/1982		Work Type:	OVERLAY					Code:	IMPORTED		Is Major M&R:	True	
Work Date:	1/1/1982		Work Type:	BUILT					Code:	IMPORTED		Is Major M&R:	True	
Last Insp. Date:	1/24/2017		TotalSamples:	6		Surveyed:	2							
Conditions:	PCI: 26													
Inspection Comments:														
Sample Number:	146		Type:	R		Area:	3001.00 SqFt		PCI:	27				
Sample Comments:														
41	ALLIGATOR CR		L	281.00 SqFt										
43	BLOCK CR		M	2720.00 SqFt										
52	RAVELING		L	3001.00 SqFt										
Sample Number:	148		Type:	R		Area:	3000.00 SqFt		PCI:	26				
Sample Comments:														
41	ALLIGATOR CR		L	202.00 SqFt										
53	RUTTING		L	224.00 SqFt										
52	RAVELING		L	3000.00 SqFt										
43	BLOCK CR		M	2798.00 SqFt										

Network:	FIN			Name:	FLAGLER EXECUTIVE AIRPORT				
Branch:	TW A		Name:	TAXIWAY A		Use:	TAXIWAY	Area:	247,263 SqFt
Section:	120	of	5	From:	cc:-		To:	cc:-	Last Const.: 1/1/2012
Surface:	AAC	Family:	C9N59-GA-TW-AAC-APC		Zone:	Category:		Rank:	P
Area:	15,400 SqFt		Length:	290 Ft		Width:	50 Ft		
Slabs:	Slab Length:		Ft	Slab Width:		Ft	Joint Length:		Ft
Shoulder:	Street Type:		Grade:		0	Lanes:		0	
Section Comments:									
Work Date:	1/1/1942		Work Type: BUILT				Code:	IMPORTED	Is Major M&R: True
Work Date:	1/1/2012		Work Type: MILL and OVERLAY				Code:	ML-OV	Is Major M&R: True
Last Insp. Date:	1/24/2017		TotalSamples:	3		Surveyed: 1			
Conditions:	PCI:	84							
Inspection Comments:									
Sample Number:	122	Type:	R	Area:	5000.00 SqFt		PCI:	84	
Sample Comments:									
48	L & T CR		L	152.00 Ft					
56	SWELLING		L	5.00 SqFt					
57	WEATHERING		L	5000.00 SqFt					

Network:	FIN			Name:	FLAGLER EXECUTIVE AIRPORT							
Branch:	TW A1		Name:	TAXIWAY A1		Use:	TAXIWAY		Area:	25,816 SqFt		
Section:	602		of	1		From:	-		To:	-		
Surface:	AAC		Family:	C9N59-GA-TW-AAC-APC		Zone:			Category:			
Area:	25,816 SqFt		Length:	500 Ft		Width:	50 Ft					
Slabs:			Slab Length:	Ft		Slab Width:	Ft		Joint Length:	Ft		
Shoulder:			Street Type:			Grade:	0		Lanes:	0		
Section Comments:												
Work Date:	1/1/1942		Work Type:	New Construction - Initial				Code:	NU-IN		Is Major M&R:	True
Work Date:	12/1/2012		Work Type:	MILL and OVERLAY				Code:	ML-OV		Is Major M&R:	True
Last Insp. Date:	1/24/2017		TotalSamples:	5		Surveyed:	1					
Conditions:	PCI: 92											
Inspection Comments:												
Sample Number:	101		Type:	R		Area:	5000.00 SqFt		PCI:	92		
Sample Comments:												
48	L & T CR		L	2.00 Ft								
57	WEATHERING		L	5000.00 SqFt								

Network:	FIN			Name:	FLAGLER EXECUTIVE AIRPORT				
Branch:	TW B		Name:	TAXIWAY B		Use:	TAXIWAY	Area:	88,917 SqFt
Section:	205	of	1	From:	-	To:	-	Last Const.:	1/1/1992
Surface:	AC	Family:	C9N59-GA-TW-AC		Zone:		Category:		Rank: P
Area:	88,917 SqFt	Length:	2,450 Ft		Width:	35 Ft			
Slabs:		Slab Length:	Ft	Slab Width:		Ft	Joint Length:	Ft	
Shoulder:		Street Type:		Grade:	0		Lanes:	0	
Section Comments:									
Work Date:	1/1/1992		Work Type: BUILT			Code:	IMPORTED		Is Major M&R: True
Last Insp. Date:	1/24/2017		TotalSamples:	22		Surveyed:	4		
Conditions:	PCI: 63								
Inspection Comments:									
Sample Number:	101	Type:	R	Area:	5658.00 SqFt		PCI:	64	
Sample Comments:									
48	L & T CR	L	137.00 Ft						
52	RAVELING	M	24.00 SqFt						
52	RAVELING	L	5634.00 SqFt						
Sample Number:	107	Type:	R	Area:	3500.00 SqFt		PCI:	68	
Sample Comments:									
48	L & T CR	L	109.00 Ft						
52	RAVELING	L	2500.00 SqFt						
57	WEATHERING	L	1000.00 SqFt						
Sample Number:	113	Type:	R	Area:	3500.00 SqFt		PCI:	59	
Sample Comments:									
48	L & T CR	L	143.00 Ft						
56	SWELLING	L	65.00 SqFt						
52	RAVELING	L	3450.00 SqFt						
52	RAVELING	M	50.00 SqFt						
Sample Number:	121	Type:	R	Area:	3500.00 SqFt		PCI:	61	
Sample Comments:									
48	L & T CR	L	166.00 Ft						
52	RAVELING	L	3450.00 SqFt						
52	RAVELING	M	50.00 SqFt						
49	OIL SPILLAGE	N	15.00 SqFt						

Network:	FIN			Name:	FLAGLER EXECUTIVE AIRPORT							
Branch:	TW C		Name:	TAXIWAY C		Use:	TAXIWAY	Area:	122,213 SqFt			
Section:	305		of	5	From:	-		To:	-		Last Const.:	1/1/1992
Surface:	AAC		Family:	C9N59-GA-TW-AAC-APC		Zone:			Category:	Rank: P		
Area:	28,798 SqFt		Length:	410 Ft		Width:	50 Ft					
Slabs:			Slab Length:	Ft		Slab Width:	Ft		Joint Length:	Ft		
Shoulder:			Street Type:			Grade:	0		Lanes:	0		
Section Comments:												
Work Date:	1/1/1992		Work Type:	BUILT				Code:	IMPORTED		Is Major M&R:	True
Last Insp. Date:	1/24/2017		TotalSamples:	5		Surveyed:	1					
Conditions:	PCI: 57											
Inspection Comments:												
Sample Number:	101		Type:	R		Area:	5001.00 SqFt		PCI:	57		
Sample Comments:												
48	L & T CR		L	135.00 Ft								
52	RAVELING		L	4951.00 SqFt								
45	DEPRESSION		L	15.00 SqFt								
52	RAVELING		M	50.00 SqFt								
48	L & T CR		M	15.00 Ft								

Network:	FIN		Name:	FLAGLER EXECUTIVE AIRPORT							
Branch:	TW C		Name:	TAXIWAY C		Use:	TAXIWAY	Area:	122,213 SqFt		
Section:	307	of 5	From:	-			To:	-		Last Const.:	1/1/1942
Surface:	AC		Family:	C9N59-GA-TW-AC		Zone:			Category:	Rank: P	
Area:	11,213 SqFt		Length:	200 Ft		Width:	50 Ft				
Slabs:	Slab Length:		Ft		Slab Width:		Ft		Joint Length:		Ft
Shoulder:	Street Type:		Grade:		0		Lanes:		0		
Section Comments:											
Work Date:	1/1/1942		Work Type: BUILT				Code:	IMPORTED		Is Major M&R: True	
Last Insp. Date:	1/24/2017		TotalSamples:		2		Surveyed:		1		
Conditions:	PCI: 29										
Inspection Comments:											
Sample Number:	104		Type:	R		Area:	5271.00 SqFt		PCI: 29		
Sample Comments:											
41	ALLIGATOR CR		M	96.00 SqFt							
41	ALLIGATOR CR		L	6.00 SqFt							
45	DEPRESSION		L	6.00 SqFt							
52	RAVELING		L	5271.00 SqFt							
43	BLOCK CR		M	5169.00 SqFt							

Network:	FIN		Name:	FLAGLER EXECUTIVE AIRPORT							
Branch:	TW C		Name:	TAXIWAY C		Use:	TAXIWAY		Area:	122,213 SqFt	
Section:	310 of 5		From:	-		To:	-		Last Const.:	12/25/2015	
Surface:	AAC		Family:	C9N59-GA-TW-AAC-APC		Zone:			Category:	Rank: P	
Area:	26,271 SqFt		Length:	450 Ft		Width:	50 Ft				
Slabs:			Slab Length:	Ft		Slab Width:	Ft		Joint Length:	Ft	
Shoulder:			Street Type:			Grade:	0		Lanes:	0	
Section Comments:											
Work Date:	1/1/1942		Work Type: BUILT				Code:	IMPORTED		Is Major M&R:	True
Work Date:	12/25/2015		Work Type: MILL and OVERLAY				Code:	ML-OV		Is Major M&R:	True
Last Insp. Date:	7/9/2013		TotalSamples:	5		Surveyed:	1				
Conditions:	PCI: 49		NOTE: *** Pre-Construction PCI ***								
Inspection Comments:											
Sample Number:	101		Type:	R		Area:	5000.00 SqFt		PCI:	49	
Sample Comments:											
56	SWELLING		L	104.00 SqFt							
52	RAVELING		L	4800.00 SqFt							
50	PATCHING		M	200.00 SqFt							
43	BLOCK CRACKING		L	800.00 SqFt							
48	LONGITUDINAL/TRANSVERSE CRACKING		L	337.00 Ft							
48	LONGITUDINAL/TRANSVERSE CRACKING		L	61.00 Ft							
57	WEATHERING		L	4800.00 SqFt							

Network:	FIN		Name:	FLAGLER EXECUTIVE AIRPORT								
Branch:	TW C		Name:	TAXIWAY C		Use:	TAXIWAY		Area:	122,213 SqFt		
Section:	315 of 5		From:	-		To:	-		Last Const.:	12/25/2015		
Surface:	AAC		Family:	C9N59-GA-TW-AAC-APC		Zone:			Category:	Rank: P		
Area:	39,970 SqFt		Length:	650 Ft		Width:	50 Ft					
Slabs:			Slab Length:	Ft		Slab Width:	Ft		Joint Length:	Ft		
Shoulder:			Street Type:			Grade:	0		Lanes:	0		
Section Comments:												
Work Date:	1/1/1992		Work Type:	New Construction - Initial				Code:	NU-IN		Is Major M&R:	True
Work Date:	1/1/2007		Work Type:	New Construction - AC				Code:	NC-AC		Is Major M&R:	True
Work Date:	12/25/2015		Work Type:	MILL and OVERLAY				Code:	ML-OV		Is Major M&R:	True
Last Insp. Date:	7/9/2013		TotalSamples:	20		Surveyed:	3					
Conditions:	PCI:	43	NOTE: *** Pre-Construction PCI ***									
Inspection Comments:												
Sample Number:	103	Type:	R	Area:	5000.00 SqFt		PCI:	51				
Sample Comments:												
52	RAVELING		L	5000.00	SqFt							
43	BLOCK CRACKING		L	1000.00	SqFt							
57	WEATHERING		L	5000.00	SqFt							
48	LONGITUDINAL/TRANSVERSE CRACKING		M	82.00	Ft							
48	LONGITUDINAL/TRANSVERSE CRACKING		L	320.00	Ft							
48	LONGITUDINAL/TRANSVERSE CRACKING		L	92.00	Ft							
Sample Number:	111	Type:	R	Area:	5000.00 SqFt		PCI:	46				
Sample Comments:												
52	RAVELING		L	5000.00	SqFt							
56	SWELLING		L	86.00	SqFt							
43	BLOCK CRACKING		L	1000.00	SqFt							
48	LONGITUDINAL/TRANSVERSE CRACKING		L	300.00	Ft							
48	LONGITUDINAL/TRANSVERSE CRACKING		M	100.00	Ft							
48	LONGITUDINAL/TRANSVERSE CRACKING		L	227.00	Ft							
57	WEATHERING		L	5000.00	SqFt							
Sample Number:	116	Type:	R	Area:	5000.00 SqFt		PCI:	33				
Sample Comments:												
45	DEPRESSION		L	26.00	SqFt							
52	RAVELING		L	3850.00	SqFt							
50	PATCHING		M	1150.00	SqFt							
43	BLOCK CRACKING		L	2850.00	SqFt							
48	LONGITUDINAL/TRANSVERSE CRACKING		L	186.00	Ft							
57	WEATHERING		L	3850.00	SqFt							

Network:	FIN		Name:	FLAGLER EXECUTIVE AIRPORT							
Branch:	TW D		Name:	TAXIWAY D		Use:	TAXIWAY		Area:	134,524 SqFt	
Section:	410 of 3		From:	-		To:	-		Last Const.:	1/1/2016	
Surface:	AAC		Family:	C9N59-GA-TW-AAC-APC		Zone:			Category:	Rank: P	
Area:	110,706 SqFt		Length:	2,000 Ft		Width:	50 Ft				
Slabs:	Slab Length:		Ft		Slab Width:	Ft		Joint Length:	Ft		
Shoulder:	Street Type:				Grade:	0		Lanes:	0		
Section Comments:											
Work Date:	1/1/1942		Work Type: BUILT				Code:	IMPORTED		Is Major M&R: True	
Work Date:	1/1/2016		Work Type: MILL and OVERLAY				Code:	ML-OV		Is Major M&R: True	
Last Insp. Date: 7/9/2013											
TotalSamples:			21		Surveyed: 4						
Conditions:	PCI: 40		NOTE: *** Pre-Construction PCI ***								
Inspection Comments:											
Sample Number:	101		Type:	R		Area:	5000.00 SqFt		PCI:	53	
Sample Comments:											
52	RAVELING		L		4996.00	SqFt					
43	BLOCK CRACKING		L		520.00	SqFt					
48	LONGITUDINAL/TRANSVERSE CRACKING		L		618.00	Ft					
57	WEATHERING		L		4996.00	SqFt					
48	LONGITUDINAL/TRANSVERSE CRACKING		L		26.00	Ft					
Sample Number:	104		Type:	R		Area:	5000.00 SqFt		PCI:	47	
Sample Comments:											
52	RAVELING		L		5000.00	SqFt					
50	PATCHING		L		4.00	SqFt					
57	WEATHERING		L		5000.00	SqFt					
43	BLOCK CRACKING		L		1000.00	SqFt					
48	LONGITUDINAL/TRANSVERSE CRACKING		L		540.00	Ft					
48	LONGITUDINAL/TRANSVERSE CRACKING		L		17.00	Ft					
56	SWELLING		L		104.00	SqFt					
Sample Number:	111		Type:	R		Area:	5000.00 SqFt		PCI:	31	
Sample Comments:											
52	RAVELING		L		4500.00	SqFt					
50	PATCHING		M		500.00	SqFt					
43	BLOCK CRACKING		M		1000.00	SqFt					
43	BLOCK CRACKING		L		3500.00	SqFt					
53	RUTTING		L		144.00	SqFt					
57	WEATHERING		L		4500.00	SqFt					
Sample Number:	117		Type:	R		Area:	5000.00 SqFt		PCI:	31	
Sample Comments:											
43	BLOCK CRACKING		L		3500.00	SqFt					
43	BLOCK CRACKING		M		1500.00	SqFt					
57	WEATHERING		L		3200.00	SqFt					
52	RAVELING		L		3200.00	SqFt					
52	RAVELING		M		1800.00	SqFt					

Network:	FIN		Name:	FLAGLER EXECUTIVE AIRPORT							
Branch:	TW D		Name:	TAXIWAY D		Use:	TAXIWAY	Area:	134,524 SqFt		
Section:	414	of 3	From:	-		To:	-		Last Const.:	1/1/2016	
Surface:	AAC	Family:	C9N59-GA-TW-AAC-APC		Zone:			Category:	Rank: P		
Area:	5,779 SqFt		Length:	80 Ft		Width:	50 Ft				
Slabs:	Slab Length:		Ft		Slab Width:	Ft		Joint Length:	Ft		
Shoulder:	Street Type:				Grade:	0		Lanes:	0		
Section Comments:											
Work Date:	1/1/1942		Work Type: BUILT				Code:	IMPORTED		Is Major M&R:	True
Work Date:	1/1/2016		Work Type: MILL and OVERLAY				Code:	ML-OV		Is Major M&R:	True
Last Insp. Date:	7/9/2013		TotalSamples:	1		Surveyed:	1				
Conditions:	PCI: 65		NOTE: *** Pre-Construction PCI ***								
Inspection Comments:											
Sample Number:	100	Type:	R	Area:	4611.91 SqFt		PCI:	65			
Sample Comments:											
48	LONGITUDINAL/TRANSVERSE CRACKING		L	62.00 Ft							
41	ALLIGATOR CRACKING		L	30.00 SqFt							
53	RUTTING		L	81.00 SqFt							
53	RUTTING		L	36.00 SqFt							
57	WEATHERING		L	4611.91 SqFt							

Network:	FIN			Name:	FLAGLER EXECUTIVE AIRPORT					
Branch:	TW D		Name:	TAXIWAY D		Use:	TAXIWAY	Area:	134,524 SqFt	
Section:	415	of	3	From:	-		To:	-	Last Const.: 1/1/2016	
Surface:	AAC	Family:	C9N59-GA-TW-AAC-APC		Zone:			Category:	Rank: P	
Area:	18,039 SqFt		Length:	310 Ft		Width:	50 Ft			
Slabs:	Slab Length:		Ft		Slab Width:		Ft		Joint Length:	Ft
Shoulder:	Street Type:				Grade:	0		Lanes:	0	
Section Comments:										
Work Date:	1/1/1992		Work Type: BUILT				Code:	IMPORTED		Is Major M&R: True
Work Date:	1/1/2016		Work Type: MILL and OVERLAY				Code:	ML-OV		Is Major M&R: True
Last Insp. Date:	7/9/2013		TotalSamples:	4		Surveyed:	1			
Conditions:	PCI: 55		NOTE: *** Pre-Construction PCI ***							
Inspection Comments:										
Sample Number:	101	Type:	R	Area:	7672.00 SqFt		PCI:	55		
Sample Comments:										
48	LONGITUDINAL/TRANSVERSE CRACKING		L	39.00 Ft						
52	RAVELING		L	7504.00	SqFt					
57	WEATHERING		L	7504.00	SqFt					
52	RAVELING		M	168.00	SqFt					
45	DEPRESSION		L	64.00	SqFt					
45	DEPRESSION		L	54.00	SqFt					

Network:	FIN		Name:	FLAGLER EXECUTIVE AIRPORT							
Branch:	TW E		Name:	TAXIWAY E		Use:	TAXIWAY		Area:	274,370 SqFt	
Section:	505 of 5		From:	-		To:	-		Last Const.:	1/1/2015	
Surface:	AAC		Family:	DEFAULT		Zone:			Category:	Rank: P	
Area:	32,654 SqFt		Length:	550 Ft		Width:	35 Ft				
Slabs:	Slab Length:		Ft		Slab Width:	Ft		Joint Length:	Ft		
Shoulder:	Street Type:				Grade:	0		Lanes:	0		
Section Comments:											
Work Date:	1/1/1942		Work Type: OVERLAY				Code:	IMPORTED		Is Major M&R: True	
Work Date:	1/1/1942		Work Type: BUILT				Code:	IMPORTED		Is Major M&R: True	
Work Date:	1/1/2015		Work Type: MILL and OVERLAY				Code:	ML-OV		Is Major M&R: True	
Last Insp. Date:	3/12/2012		TotalSamples:	5		Surveyed:	2				
Conditions:	PCI: 43		NOTE: *** Pre-Construction PCI ***								
Inspection Comments:											
Sample Number:	102		Type:	R		Area:	3500.00 SqFt		PCI:	38	
Sample Comments:											
56	SWELLING		L	899.99 SqFt							
52	RAVELING		L	1899.98 SqFt							
52	RAVELING		M	1599.99 SqFt							
48	LONGITUDINAL/TRANSVERSE CRACKING		L	372.10 Ft							
50	PATCHING		L	.50 SqFt							
Sample Number:	103		Type:	R		Area:	3500.00 SqFt		PCI:	47	
Sample Comments:											
52	RAVELING		L	2099.98 SqFt							
52	RAVELING		M	899.99 SqFt							
48	LONGITUDINAL/TRANSVERSE CRACKING		L	310.08 Ft							
56	SWELLING		L	714.99 SqFt							

Network:	FIN			Name:	FLAGLER EXECUTIVE AIRPORT				
Branch:	TW E		Name:	TAXIWAY E		Use:	TAXIWAY	Area:	274,370 SqFt
Section:	510	of	5	From:	-		To:	-	
Surface:	AAC	Family:	DEFAULT		Zone:			Category:	Rank: P
Area:	71,339 SqFt		Length:	1,100 Ft		Width:	50 Ft		
Slabs:	Slab Length:		Ft	Slab Width:		Ft	Joint Length:		Ft
Shoulder:	Street Type:		Grade:		0		Lanes:		0
Section Comments:									
Work Date:	1/1/1942		Work Type: OVERLAY				Code:	IMPORTED	
Work Date:	1/1/1942		Work Type: BUILT				Code:	IMPORTED	
Work Date:	1/1/2015		Work Type: MILL and OVERLAY				Code:	ML-OV	
Last Insp. Date:	3/12/2012		TotalSamples:	16		Surveyed:	3		
Conditions:	PCI:	38	NOTE: *** Pre-Construction PCI ***						
Inspection Comments:									
Sample Number:	107	Type:	R	Area:	5000.00 SqFt		PCI:	28	
Sample Comments:									
43	BLOCK CRACKING	M	1399.99	SqFt					
50	PATCHING	L	300.00	SqFt					
56	SWELLING	L	410.00	SqFt					
45	DEPRESSION	L	30.00	SqFt					
48	LONGITUDINAL/TRANSVERSE CRACKING	L	219.06	Ft					
48	LONGITUDINAL/TRANSVERSE CRACKING	M	60.02	Ft					
41	ALLIGATOR CRACKING	L	55.00	SqFt					
52	RAVELING	L	2899.98	SqFt					
52	RAVELING	M	2099.98	SqFt					
Sample Number:	112	Type:	R	Area:	5000.00 SqFt		PCI:	41	
Sample Comments:									
43	BLOCK CRACKING	L	200.00	SqFt					
43	BLOCK CRACKING	M	999.99	SqFt					
56	SWELLING	L	110.00	SqFt					
48	LONGITUDINAL/TRANSVERSE CRACKING	L	490.13	Ft					
52	RAVELING	L	4619.96	SqFt					
52	RAVELING	M	380.00	SqFt					
45	DEPRESSION	L	25.00	SqFt					
Sample Number:	116	Type:	R	Area:	5000.00 SqFt		PCI:	44	
Sample Comments:									
43	BLOCK CRACKING	M	1299.99	SqFt					
48	LONGITUDINAL/TRANSVERSE CRACKING	L	92.02	Ft					
45	DEPRESSION	L	27.00	SqFt					
50	PATCHING	L	150.00	SqFt					
52	RAVELING	L	4799.96	SqFt					
52	RAVELING	M	200.96	SqFt					

Network:	FIN			Name:	FLAGLER EXECUTIVE AIRPORT				
Branch:	TW E		Name:	TAXIWAY E		Use:	TAXIWAY	Area:	274,370 SqFt
Section:	512	of	5	From:	-		To:	-	
Surface:	AAC		Family:	DEFAULT		Zone:	Category:		Rank:
Area:	19,204 SqFt		Length:	645 Ft		Width:	30 Ft		
Slabs:	Slab Length:		Ft	Slab Width:		Ft	Joint Length:		Ft
Shoulder:	Street Type:		Grade:		0	Lanes:		0	
Section Comments:									
Work Date:	1/1/1982		Work Type:				BUILT	Code:	IMPORTED
Work Date:	1/1/2015		Work Type:				MILL and OVERLAY	Code:	ML-OV
Last Insp. Date:	3/12/2012		TotalSamples:		7	Surveyed:		2	
Conditions:	PCI:	10	NOTE: *** Pre-Construction PCI ***						
Inspection Comments:									
Sample Number:	202	Type:	R	Area:		3000.00 SqFt	PCI: 6		
Sample Comments:									
43	BLOCK CRACKING		L	899.99	SqFt				
43	BLOCK CRACKING		M	2099.98	SqFt				
52	RAVELING		L	300.00	SqFt				
52	RAVELING		M	2699.98	SqFt				
56	SWELLING		L	1824.98	SqFt				
56	SWELLING		M	1149.99	SqFt				
Sample Number:	204	Type:	R	Area:		3000.00 SqFt	PCI: 14		
Sample Comments:									
41	ALLIGATOR CRACKING		L	120.00	SqFt				
43	BLOCK CRACKING		L	350.00	SqFt				
43	BLOCK CRACKING		M	1899.98	SqFt				
48	LONGITUDINAL/TRANSVERSE CRACKING		L	74.02	Ft				
52	RAVELING		L	500.00	SqFt				
52	RAVELING		M	2499.98	SqFt				
56	SWELLING		L	475.00	SqFt				

Network:	FIN		Name:	FLAGLER EXECUTIVE AIRPORT							
Branch:	TW E		Name:	TAXIWAY E		Use:	TAXIWAY		Area:	274,370 SqFt	
Section:	515 of 5		From:	-		To:	-		Last Const.:	1/1/2015	
Surface:	AAC		Family:	DEFAULT		Zone:			Category:	Rank: P	
Area:	138,069 SqFt		Length:	1,670 Ft		Width:	50 Ft				
Slabs:			Slab Length:	Ft		Slab Width:	Ft		Joint Length:	Ft	
Shoulder:			Street Type:			Grade:	0		Lanes:	0	
Section Comments:											
Work Date:	1/1/1942		Work Type: OVERLAY				Code:	IMPORTED		Is Major M&R: True	
Work Date:	1/1/1942		Work Type: BUILT				Code:	IMPORTED		Is Major M&R: True	
Work Date:	1/1/2015		Work Type: MILL and OVERLAY				Code:	ML-OV		Is Major M&R: True	
Last Insp. Date:	3/12/2012		TotalSamples:	27		Surveyed:	4				
Conditions:	PCI: 39		NOTE: *** Pre-Construction PCI ***								
Inspection Comments:											
Sample Number:	119		Type:	R		Area:	5000.00 SqFt		PCI:	31	
Sample Comments:											
43	BLOCK CRACKING		L	799.99 SqFt							
43	BLOCK CRACKING		M	1599.99 SqFt							
48	LONGITUDINAL/TRANSVERSE CRACKING		L	122.03 Ft							
48	LONGITUDINAL/TRANSVERSE CRACKING		M	90.02 Ft							
48	LONGITUDINAL/TRANSVERSE CRACKING		H	11.00 Ft							
52	RAVELING		L	3799.97 SqFt							
52	RAVELING		M	1199.99 SqFt							
56	SWELLING		L	30.00 SqFt							
Sample Number:	123		Type:	R		Area:	5000.00 SqFt		PCI:	31	
Sample Comments:											
50	PATCHING		M	350.00 SqFt							
45	DEPRESSION		L	28.00 SqFt							
48	LONGITUDINAL/TRANSVERSE CRACKING		L	379.10 Ft							
48	LONGITUDINAL/TRANSVERSE CRACKING		M	141.04 Ft							
43	BLOCK CRACKING		L	899.99 SqFt							
52	RAVELING		L	3199.97 SqFt							
52	RAVELING		M	1799.99 SqFt							
Sample Number:	131		Type:	R		Area:	5000.00 SqFt		PCI:	43	
Sample Comments:											
43	BLOCK CRACKING		L	4499.96 SqFt							
43	BLOCK CRACKING		M	500.00 SqFt							
52	RAVELING		L	4249.96 SqFt							
52	RAVELING		M	749.99 SqFt							
Sample Number:	139		Type:	R		Area:	5000.00 SqFt		PCI:	50	
Sample Comments:											
43	BLOCK CRACKING		L	4999.96 SqFt							
52	RAVELING		L	4599.96 SqFt							
52	RAVELING		M	400.00 SqFt							

Network:	FIN		Name:	FLAGLER EXECUTIVE AIRPORT							
Branch:	TW E		Name:	TAXIWAY E		Use:	TAXIWAY	Area:	274,370 SqFt		
Section:	520	of	5	From:	-			To:	-		
Surface:	AC	Family:	C9N59-GA-TW-AC		Zone:				Category:		
Area:	13,104 SqFt		Length:	465 Ft		Width:	50 Ft				
Slabs:	Slab Length:		Ft		Slab Width:	Ft		Joint Length:	Ft		
Shoulder:	Street Type:		Grade:		0		Lanes:	0			
Section Comments:											
Work Date:	1/1/2004		Work Type:	New Construction - Initial			Code:	NU-IN		Is Major M&R:	True
Last Insp. Date:	1/24/2017		TotalSamples:	2		Surveyed:	1				
Conditions:	PCI:	65									
Inspection Comments:											
Sample Number:	106	Type:	R	Area:	5750.00 SqFt		PCI:	65			
Sample Comments:											
56	SWELLING		L	775.00 SqFt							
57	WEATHERING		L	5175.00 SqFt							
52	RAVELING		L	575.00 SqFt							
48	L & T CR		L	185.00 Ft							