FLORIDA DEPARTMENT OF TRANSPORTATION

AVIATION AND SPACEPORTS OFFICE







Florida Department of Transportation

Statewide Airfield Pavement Management Program

Prepared by:

FDOT Aviation and Spaceports Office 605 Suwannee Street Tallahassee, Florida 32399-0450















OFFICE OF FREIGHT, LOGISTICS & PASSENGER OPERATIONS



Table of Contents

Executive Summary10
Program Background10
Summary of Results11Pavement Condition Index (Latest Inspection)11Forecasted Pavement Condition Index 2020-202912Major Rehabilitation Planning 2020-202912
Summary of Calhoun County Airport13
Chapter 1 – Introduction15
1.1 Background15
1.2 Statewide Airfield Pavement Management Program (SAPMP) Update 2018-201915
1.3 Organization171.3.1 Florida Department of Transportation Aviation and Spaceports Office Program Manager171.3.2 Participating Florida Public-Use and Publicly Owned Airports171.3.3 Florida Department of Transportation District Offices171.3.4 Consultant17
1.4 Purpose of Airport Pavement Evaluation Report19
1.5 History of the Program19
1.6 Federal Aviation Administration (FAA)21
1.7 FDOT SAPMP Objectives and Components211.7.1 Program Objectives211.7.2 Program Components21
1.8 References25
Chapter 2 – Methodology27
2.1 Airfield Pavement Database27
2.2 Airfield Pavement System Inventory 27 2.2.1 Pavement Management Program Network Definition Terminology 28
2.3 Airfield Pavement Structure
2.4 Airfield Pavement Work History
2.5 Airfield Pavement Traffic32
2.6 Airfield Pavement Condition Index (PCI) Survey322.6.1 PCI Survey Methodology322.6.2 Pavement Distress Types34



2.6.3 PCI Survey Inspection Procedures	
Chapter 3 – Airfield Pavement System Inventory	42
3.1 Airfield Pavement Network Information	
3.1.1 Previous and/or Anticipated Airfield Pavement Construction	
3.1.2 Estimated Pavement Age 3.1.3 Functional Use Classification	
3.1.4 Pavement Surface Type	
3.1.5 Pavement System Inventory Details	
Chapter 4 – Airfield Pavement Condition	52
4.1 Airfield Payament Condition Index (Latest Inspection)	52
4.1 Airfield Pavement Condition Index (Latest Inspection)	
4.1.2 Branch-Level Analysis	
4.1.3 Section-Level Analysis	
4.2 Summary of Pavement Condition Evaluation Results	56
4.2.1 Network-Level Observations	56
4.2.2 Branch-Level Observations	
4.3 Forecasted Pavement Conditions	
4.3.1 Performance Models and Prediction Curves	
4.3.2 Branch-Level Pavement Condition Forecast	
4.3.4 Forecasted PCI Considerations	
4.0.41 Globalcu 1 Gl Gollsidorations	
Chapter 5 – Localized Maintenance and Repair Planning	64
5.1 Localized Maintenance and Repair	
5.2 Localized Maintenance and Repair Policy	65
5.3 Localized Maintenance and Repair Analysis and Recommendations	69
Chapter 6 – Major Rehabilitation Planning	72
6.1 Major Rehabilitation	72
6.1.1 Critical PCI	
6.1.2 FDOT Recommended Minimum Service-Level PCI	
6.2 Major Rehabilitation Policy	75
6.2.1 Major Rehabilitation Pavement Section Development	
6.2.2 Major Rehabilitation Planning-Level Unit Costs	
6.3 Major Rehabilitation Needs	77
6.3.1 10-Year Unconstrained Budget Major Rehabilitation Needs	77
Chapter 7 – Conclusion	81
7.1 Recommendations	81
7.1.1 Continued PCI Survey Inspections	
7.1.2 Localized Maintenance and Repair	



7.1.3 Major Rehabilitation	81
7.1.4 Pavement Management System	81
7.2 Supporting Documents	
001 – Airfield Pavement Network Definition Exhibit	82
002 – Airfield Pavement System Inventory Exhibit	82
003 – Airfield Pavement Condition Index Exhibit	82
004 – Airfield Pavement Major Rehabilitation Exhibit	82
Inspection Photograph Documentation	82
7.2 Canalysian	0.0
7.3 Conclusion	83



Appendix A Airfield Pavement Analysis Tables

Appendix B Airfield Pavement Localized Maintenance and Repair and Major

Rehabilitation

Appendix C Technical Exhibits

Appendix D Inspection Photograph Documentation

Appendix E Inspection Distress Details



List of Figures

Figure E-4 Major Rehabilitation Planning Annual Budget 2020-202913
Figure 1.2 Florida Aviation System (Facilities with Pavement) and FDOT Districts16
Figure 1.7.2 (a) Typical Pavement Condition Life Cycle22
Figure 1.7.2 (b) General Pavement Treatments by Condition Range23
Figure 1.7.2 (c) Flexible Asphalt Concrete24
Figure 1.7.2 (d) Rigid Portland Cement Concrete24
Figure 3.1.1 (a) 2019 Airfield Pavement Network Definition Exhibit43
Figure 3.1.1 (b) 2019 Airfield Pavement System Inventory Exhibit44
Figure 3.1.2 Average Age of Pavements at Inspection45
Figure 3.1.3 Airfield Pavement Functional Classification Use by Area46
Figure 3.1.4 (a) Pavement Surface Type by Area (SF)47
Figure 3.1.4 (b) Pavement Surface Type by Area (%)48
Figure 4.1.1 Latest Condition – Overall Network52
Figure 4.1.2 (a) Latest Condition – Runway Pavements53
Figure 4.1.2 (b) Latest Condition – Taxiway Pavements53
Figure 4.1.2 (c) Latest Condition – Apron Pavements54
Figure 4.1.3 2019 Airfield Pavement Condition Index Exhibit56
Figure 4.2.2 Pavement Condition Summary by Facility Use57
Figure 4.3.2 (a) Forecasted Runway Pavement Performance58
Figure 4.3.2 (b) Forecasted Taxiway Pavement Performance59
Figure 4.3.2 (c) Forecasted Apron Pavement Performance59
Figure 6.1 (a) Major Rehabilitation Planning Decision Diagram, PCI ≤ Critical PCI72
Figure 6.1 (b) Major Rehabilitation Planning Decision Diagram, PCI > Critical PCI73
Figure 6.3.1 (a) 10-Year Major Rehabilitation Needs by Program Year79
Figure 6.3.1 (b) 10-Year Major Rehabilitation Needs by Program Year Exhibit79



List of Tables

Table E-1 Pavement Condition Index Summary (Last Inspection) – Section Level11
Table E-2 Pavement Condition Index Forecast 2020-202912
Table E-3 Major Rehabilitation Planning 2020-202912
Table 2.2.1 Airfield Pavement Database Network Definition Terminology29
Table 2.6.2 (a) Pavement Distress Types – Flexible Asphalt Concrete-Surfaced Airfields 34
Table 2.6.2 (b) Pavement Distresses Possible Causes – Flexible Asphalt Concrete- Surfaced Airfields35
Table 2.6.2 (c) Pavement Distresses Possible Effects – Flexible Asphalt Concrete- Surfaced Airfields
Table 2.6.2 (d) Pavement Distresses – Rigid Portland Cement Concrete-Surfaced Airfields
Table 2.6.2 (e) Pavement Distresses Possible Causes – Rigid Portland Cement Concrete- Surfaced Airfields
Table 2.6.2 (f) Pavement Distresses Possible Effects – Rigid Portland Cement Concrete- Surfaced Airfields
Table 2.6.3 (a) Recommended Sample Rate Schedule for Flexible Asphalt Concrete38
Table 2.6.3 (b) Recommended Sample Rate Schedule for Rigid Portland Cement Concrete
Table 2.6.4 Summary of Updates to ASTM D5340-1240
Table 3.1.1 Previous and/or Anticipated Airfield Pavement Construction42
Table 3.1.5 Pavement System Inventory Details
Table 4.1.3 Latest Pavement Condition Index Summary55
Table 4.3.3 Forecasted PCI 2020-202961
Table 5.2 (a) Localized Maintenance and Repair – Flexible Asphalt Concrete65
Table 5.2 (b) Localized Maintenance and Repair – Rigid Portland Cement Concrete66
Table 5.2 (c) Localized Repair Planning-Level Unit Costs – Flexible Asphalt Concrete68



Table 5.2 (d) Localized M&R Planning-Level Unit Costs – Rigid Portland Cement Concrete
Table 5.3 (a) Summary of Airport Localized M&R Planning Cost and Quantity at Network Level69
Table 5.3 (b) Summary of Airport Localized M&R Planning Cost and Quantity at Section Level70
Table 5.3 (c) Summary of Localized Maintenance70
Table 6.1.2 FDOT Recommended Minimum Service-Level PCI74
Table 6.2.1 (a) Conceptual Pavement Section for Major Rehabilitation – Flexible Asphalt Concrete
Table 6.2.1 (b) Conceptual Pavement Section for Major Rehabilitation – Rigid Portland Cement Concrete
Table 6.2.2 General Aviation Major Rehabilitation Planning-Level Unit Cost by Pavement Type77
Table 6.3.1 10-Year Major Rehabilitation Needs78



Executive Summary





Executive Summary

Program Background

Airport airfield pavement infrastructure facilities represent a large capital investment in the Florida Airport System. Timely and appropriate maintenance and strategic rehabilitation are essential as repair costs increase significantly in proportion to deterioration. Airport pavement distresses can also contribute to the development of loose debris and decreased ride quality, which can be a safety concern for aircraft operations.

In 2016, the Florida Department of Transportation (FDOT) Aviation and Spaceports Office (ASO) selected Kimley-Horn and Associates, Inc. with subconsultants Airfield Pavement Management Systems, LLC and AVCON, Inc. to provide professional services in support of FDOT in the continued efforts of performing a system update to the Statewide Airfield Pavement Management Program (SAPMP). This work is to be completed from fiscal year 2016 through fiscal year 2019. The SAPMP has 95 public use airport facilities throughout the seven FDOT Districts that participate in the system update. The results of this system update for this specific airport are presented in this report and can be utilized by FDOT and the Federal Aviation Administration (FAA) to identify, prioritize, and schedule pavement maintenance, repair, and major rehabilitation projects.

Pavement condition was assessed utilizing the pavement condition index (PCI) methodology as defined in the FAA Advisory Circular 150/5380-7B "Airport Pavement Management Program (PMP)" using the documented procedures set forth by ASTM D5340-12 "Standard Test Method for Airport Pavement Condition Index Surveys."

Pavement deterioration, in accordance with the ASTM D5340-12, was characterized in terms of distinct distress types, severity level of distress, and quantity of distress. This information is utilized to calculate a PCI numeric that represents the overall condition of the pavement in a numeric index that ranges from 0 (a condition category of FAILED) to 100 (GOOD). The PCI methodology analyzes an overall measure of the pavement condition and provides an indication of the degree of maintenance, repair, or rehabilitation efforts that will be required to sustain functional pavement.

The tasks required for the system update at each participating airport consist of the following:

- Obtain recent and anticipated airfield pavement construction work data.
- Update airport airfield pavement system inventory records (construction history, identification, geometry, and facility classification).
- Perform PCI Survey Inspections at each participating airport.
- Update the FDOT SAPMP PAVER™ database system.
- Update the FDOT SAPMP GIS Airfield Navigation GPS enabled Maps.
- Update airfield pavement performance models and pavement condition forecasting.
- Identification of planning-level maintenance, repair, and major rehabilitation to address pavement needs based on functional PCI analysis.
- Development of planning-level opinion of probable construction costs for pavement rehabilitation.





Summary of Results

Pavement Condition Index (Latest Inspection)

Table E-1 Pavement Condition Index Summary (Last Inspection) - Section Level

Network ID	Branch Name	Branch Use	Section ID	Area (SF)	PCI	Condition Rating
F95	RUNWAY 18-36	RUNWAY	6105	269,775	85	Satisfactory
F95	RUNWAY 18-36	RUNWAY	6110	9,975	100	Good
F95	TAXIWAY A	TAXIWAY	120	93,205	100	Good
F95	TAXIWAY A	TAXIWAY	125	60,539	100	Good
F95	TAXIWAY A2	TAXIWAY	110	18,034	100	Good
F95	T-HANG APRON	APRON	805	2,520	76	Satisfactory
F95	T-HANG APRON	APRON	806	2,820	76	Satisfactory
F95	T-HANG APRON	APRON	810	5,700	54	Poor
F95	T-HANG APRON	APRON	905	6,468	57	Fair
F95	T-HANG APRON	APRON	910	6,140	82	Satisfactory
F95	GA APRON	APRON	4105	78,381	76	Satisfactory
F95	GA APRON	APRON	4110	39,362	57	Fair
F95	GA APRON	APRON	4115	40,207	70	Fair
F95	GA APRON	APRON	4120	27,973	86	Good
F95	GA APRON	APRON	4150	9,900	100	Good
F95	GA APRON	APRON	4160	9,969	100	Good
F95	GA APRON	APRON	4205	10,930	65	Fair
F95	HELIPAD APRON	APRON	4305	4,850	89	Good





Forecasted Pavement Condition Index 2020-2029

Table E-2 Pavement Condition Index Forecast 2020-2029

Network	Daniel ID	Section	Last	Forecasted PCI									
ID	Branch ID	ID	PCI	2020	2021	2022	2023	2024	2025	2026	2027	2028	2029
F95	AP GA	4105	76	73	70	68	67	65	63	61	60	58	57
F95	AP GA	4110	57	54	53	51	50	48	46	45	43	42	40
F95	AP GA	4115	70	67	66	64	63	61	59	58	56	55	53
F95	AP GA	4120	86	82	79	77	75	72	70	68	66	65	63
F95	AP GA	4150	100	99	97	95	94	92	91	89	87	86	84
F95	AP GA	4160	100	94	92	91	89	87	86	84	83	81	80
F95	AP GA	4205	65	62	61	59	58	56	55	54	53	52	51
F95	AP HELIPAD	4305	89	85	82	80	77	75	73	70	68	67	65
F95	AP T-HANG	805	76	73	72	70	69	67	65	64	62	61	59
F95	AP T-HANG	806	76	73	72	70	69	67	65	64	62	61	59
F95	AP T-HANG	810	54	51	50	48	47	45	43	42	40	39	37
F95	AP T-HANG	905	57	54	53	51	50	48	46	45	43	42	40
F95	AP T-HANG	910	82	79	78	76	75	73	71	70	68	67	65
F95	RW 18-36	6105	85	81	79	76	74	72	69	68	66	64	63
F95	RW 18-36	6110	100	94	92	90	89	87	86	84	82	81	79
F95	TW A	120	100	91	89	86	84	81	79	77	75	74	72
F95	TW A	125	100	98	96	94	91	89	86	84	81	79	77
F95	TW A2	110	100	91	89	86	84	81	79	77	75	74	72

Major Rehabilitation Planning 2020-2029

Table E-3 Major Rehabilitation Planning 2020-2029

Program Year	Network ID	Branch ID	Section ID	Surface	Area (SF)	PCI Before	Rehabilitation Type	Pla	nning Cost
2020	F95	AP GA	4110	AC	39,362	54	AC Restoration	\$	276,000.00
2020	F95	AP GA	4205	PCC	10,930	62	PCC Restoration	\$	110,000.00
2020	F95	AP T-HANG	810	AC	5,700	51	AC Restoration	\$	40,000.00
2020	F95	AP T-HANG	905	AC	6,468	54	AC Restoration	\$	46,000.00
2022	F95	AP GA	4115	AC	40,207	64	AC Restoration	\$	282,000.00
2025	F95	AP GA	4105	PCC	78,381	63	PCC Restoration	\$	784,000.00
2026	F95	AP T-HANG	805	AC	2,520	64	AC Restoration	\$	18,000.00
2026	F95	AP T-HANG	806	AC	2,820	64	AC Restoration	\$	20,000.00
2028	F95	RW 18-36	6105	AAC	269,775	64	AC Restoration	\$	1,889,000.00
2029	F95	AP GA	4120	PCC	27,973	63	PCC Restoration	\$	280,000.00

^{*}All planning cost values have been rounded to the nearest thousand-dollar.



Figure E-4 Major Rehabilitation Planning Annual Budget 2020-2029



Summary of Calhoun County Airport

Calhoun County Airport was inspected in September 2018 – the overall weighted PCI value was 85, a condition rating of Satisfactory. The results of the maintenance, repair, and major rehabilitation analysis identified \$104,140 in localized M&R needs based on current conditions and a 10-Year major rehabilitation need of \$3,745,000 based on forecasted conditions. The current major rehabilitation needs based on the latest inspection consist of \$472,000 for pavements below critical condition.

Localized maintenance and repair identified within this report are categorized as preventive or stopgap; the FDOT SAPMP has defined maintenance policies based on FAA recommendations. Major rehabilitation is identified within the FDOT SAPMP as major construction activity that would result in an improvement or resetting of the pavement section's PCI to a value of 100. Such activities could include: mill and hot-mix asphalt overlay, rigid pavement repair and slab replacement, and full-depth reconstruction. It is recommended that the airport use this as a planning tool for future project development and prioritization – all localized maintenance and repair and major rehabilitation recommendations should be considered as planning-level only. All final localized maintenance, repair, and major rehabilitation is subject to change based on airport prioritization and further design-level evaluation.









Chapter 1 – Introduction

1.1 Background

The State of Florida has 128 public airports of which 100 public-use airports are recognized as part of the Federal Aviation Administration's (FAA) National Plan of Integrated Airport Systems (NPIAS) that are vital to the Florida economy as well as the economy of the United States. The Florida Aviation System (FAS) provides opportunities for the State to capitalize on an increasingly global marketplace. Florida's system of commercial service and general aviation (GA) airports are important to businesses throughout the entire State. Air travel is essential to tourism, Florida's number one industry.

There are millions of square feet of pavement infrastructure that consists of runways, taxiways, aprons, ramps, and other areas of airports that are vital to the support and safety of aircraft operations. Timely pavement maintenance, repair and major rehabilitation of these pavements will support the airport in operating safely, efficiently, economically and without excessive down time.

In general, adherence to the FAA Advisory Circulars are mandatory for all projects funded with federal grant monies through the Airport Improvement Program (AIP) and with revenue from the Passenger Facilities Charges (PFC) Program. Further information is detailed in FAA Grant Assurance No. 11 "Pavement Maintenance," No. 34 "Policies, Standards, and Specifications," and PFC Assurance No. 9 "Standards and Specifications." The Florida Department of Transportation (FDOT) performs the Statewide Airfield Pavement Management Program (SAPMP) System Updates for the benefit of participating public-use and publicly owned airports through the Aviation and Spaceports Office (ASO).


The SAPMP addresses the requirements of maintaining an effective pavement management program for the participating airports at the network level. Network-level management of pavement assets provides insight for short-term and long-term budget needs, understanding of the overall condition of the network (current and future), and pavement facilities that are subject for project consideration. A network-level evaluation can be supportive in the identification of maintenance, repair, and major rehabilitation needs and budgetary planning-level opinions of probable construction costs.

1.2 Statewide Airfield Pavement Management Program (SAPMP) Update 2018-2019

In 1992, the FDOT established the Statewide Airfield Pavement Management Program (SAPMP) to provide program managers, District Aviation and Spaceport Offices, and airport operators a system to proactively manage airport airfield pavement infrastructure within the Florida Aviation System. The SAPMP performs network-level Pavement Condition Index (PCI) survey inspections for airport facilities that are categorized as General Aviation (GA), Reliever (RL), and Commercial (PR). Currently, the program consists of 95 actively participating publicuse airports with pavement facilities and provides users with comprehensive data to better manage pavement assets.



Figure 1.2 Florida Aviation System (Facilities with Pavement) and FDOT Districts

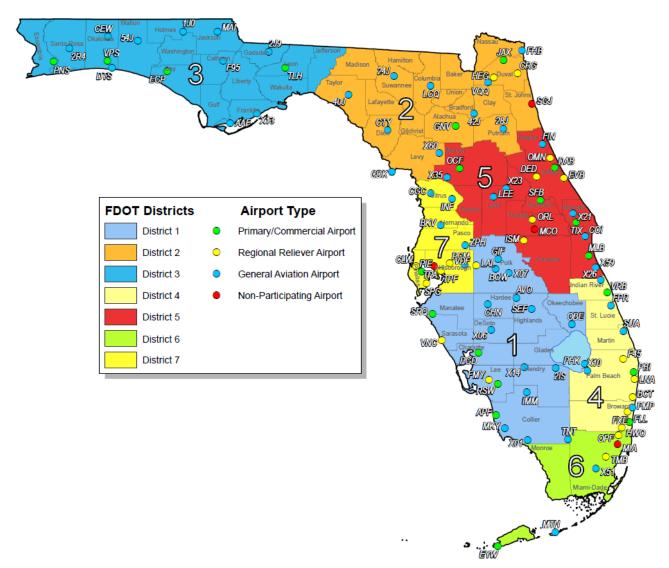

In 2016, the Florida Department of Transportation Aviation and Spaceports Office contracted Kimley-Horn and Associates, Inc. along with subconsultants Airfield Pavement Management Systems, LLC and AVCON, Inc. to provide professional services in support of FDOT in the continued efforts of performing a system update to the SAPMP. This work is to be completed from fiscal year 2016 through fiscal year 2019.





1.3 Organization

1.3.1 Florida Department of Transportation Aviation and Spaceports Office Program Manager

The FDOT Aviation and Spaceports Office (ASO) Aviation Engineering Manager serves as the Program Manager (ASO-PM) for the SAPMP. The ASO-PM monitors the work performed by the designated Consultant for the program. The ASO-PM has review and approval authority for each program task and manages the program's day-to-day details and pertinent updates.

The ASO-PM reports updates and milestones to the FDOT State Aviation and Spaceports Manager and Development Administrator.

1.3.2 Participating Florida Public-Use and Publicly Owned Airports

The airports are the end-user and beneficiary of the SAPMP. The SAPMP provides a specific Airport Pavement Evaluation Report that meets the requirements of the FAA Advisory Circular 150/5380-7B "Airport Pavement Management Program (PMP)." Individual participating airports will be provided a final Airport Pavement Evaluation Report by the designated Consultant that is specific to each airport's airfield pavement condition index survey. The ASO-PM has full authority and final approval of each report prior to finalization. In advance of each PCI survey and prior to completion of each Airport Pavement Evaluation Report, participating airports are asked to provide the necessary record documentation for the proper analysis efforts. Relevant record documentation artifacts may consist of but are not limited to: Airport Layout Plans (ALP), Construction Bid Tabulations, As-Built Construction Drawings, Engineer's Reports, and/or field pavement inspection reports.

1.3.3 Florida Department of Transportation District Offices

The seven (7) FDOT District Offices, specifically the Aviation representatives (currently the Freight and Logistics personnel), provide essential support to the SAPMP update and the ASO-PM. Each District supports the SAPMP's on-going efforts by providing local construction cost information throughout the State. The construction cost information, typically consisting of plans and bid tabulations, are used as the basis of the development maintenance, repair, and major rehabilitation opinions of probable construction costs for planning purposes. Each District Office receives copies of individual Airport Pavement Evaluation Reports for the participating airport facilities located within their respective Districts.

1.3.4 Consultant

The Consultant, Kimley-Horn and Associates, Inc., provides technical and administrative support to the ASO-PM for the SAPMP update. The support consists of airfield pavement system inventory updates, performance of PCI Surveys in accordance with ASTM D5340-12 "Standard Test Method for Airport Pavement Condition Index Surveys," evaluation and reporting of the pavement condition in accordance with the FAA Advisory Circular 150/5380-7B "Airport Pavement Management Program (PMP)."

The Consultant Team consists of Kimley-Horn, Airfield Pavement Management Systems, LLC., and AVCON, Inc.



A brief description of the general scope of work undertaken to update the SAPMP includes but is not limited to:

- Research and evaluation of existing record documentation was performed to identify construction projects that have taken place since the most recent major update of the SAPMP. This data is used to update the pavement inventory and network definition.
- An update to the existing Network Definition Map was made to reflect geometric changes, pavement composition updates, and section characterization. Furthermore, an update to the PCI Survey sample units were made to reflect the field investigation efforts.
- A functional pavement evaluation with PCI Survey inspections was completed on all airfield pavements maintained by the Airport. The PCI Survey procedure, as defined by ASTM D5340-12, was used as the basis of the functional pavement evaluation. For this specific evaluation, the sample units defined by prior studies were inspected as to better develop performance models for prediction curves. Pavement subject to construction or anticipated construction during scheduled PCI Survey inspection or within 2 years were omitted from inspection based on confirmation of airport personnel.
- Condition Analysis was performed based on the distress data observed, rated, measured, and recorded in accordance with the ASTM D5340-12 for the calculation of PCI values and ratings. The results of the current condition analysis were used in concert with the historic PCI Survey data and construction work history to develop performance models to forecast future PCI values for each section for a 10-year study duration.
- Maintenance, Repair, and Rehabilitation Planning was performed predicated on the results of the condition analysis with updated policies and planning-level unit costs. The policies, or M&R policies, have been updated to reflect standard practices for maintenance, repair, and major rehabilitation as defined by the FAA AC 150/5380-6C "Guidelines and Procedures for Maintenance of Airport Pavements." Planninglevel unit costs were developed based on representative construction bid tabulations provided by participating airports. The bid tabulations consisted of limited airfield pavement construction projects that took place between 2009 and 2015 at participating airports.





1.4 Purpose of Airport Pavement Evaluation Report

The individual airport airfield pavement evaluation report discusses the work performed, a summary of findings, condition analysis results, and recommendations for maintenance, repair, and major rehabilitation (M&R) planning associated with the SAPMP system update. It also briefly describes the procedures used to ensure that the appropriate engineering and scientific standards of care, quality, budget, schedules, and safety requirements were implemented during the performance of this work.

The purpose of this Airfield Pavement Evaluation Report is to achieve the following:

- Describe the goals, procedures, and purpose of the SAPMP
- Provide a brief technical explanation of the pavement management methodology, standard practices, and objectives
- Analyze pavement distresses data for the determination of pavement conditions and for identification of airfield pavement maintenance, repair, and major rehabilitation needs based on functional PCI trends

The identification of rehabilitation needs has been determined at the planning level. Design-level investigation is recommended prior to developing construction-level design documents and budgets.

In compliance with FAA Grant Assurances 11 and 19; the FDOT SAPMP provides airports with airfield pavement evaluation reports in accordance with FAA AC 150/5380-7B Airport Pavement Management Program (PMP) and AC 150/5380-6C Guidelines and Procedures for Maintenance of Airport Pavements. The application of the results of a PCI survey are for planning purposes and are limited to the visual observation of deteriorated pavements in limited sampling; design-level investigation is recommended in accordance with the FAA procedures defined in AC 5320-6F Airport Pavement Design and Evaluation and AC 150/5370-11B Use of Nondestructive Testing in the Evaluation of Airport Pavements. The aforementioned ACs provide the design-level material properties of in-situ pavement and subgrade layers for the determination of appropriate rehabilitation actions. The FDOT Statewide Airfield Pavement Management Program is organized to provide airports with planning-level data and does not intend to preclude the responsible engineer in performing the appropriate level of investigation and analysis in determining the appropriate design details of a pavement rehabilitation. It would not be advisable to solely base design-level rehabilitation without the appropriate level of investigation and determination of pavement deterioration beyond that of a visual functional condition assessment.

1.5 History of the Program

In 1992, the FDOT implemented the SAPMP to understand the pavement conditions at public airports in the FAS, systematically update pavement infrastructure information, and assist airport operators with recommendations of pavement maintenance, repair, and major rehabilitation needs. The 1992 SAPMP implementation provided the FDOT and the participating airports valuable information for establishing and performing timely and appropriate pavement rehabilitation.





During the 1992-1993 implementation and again during the 1998-1999 updates; the SAPMP performed the development with proprietary software for pavement management system analysis. This development allowed for the creation of pavement management database file system populated with airport attributes and condition data. The pavement management database was used to establish maintenance, repair, and rehabilitation policies; consider planning-level unit costs; and develop recommendations for performing pavement maintenance. This system, known as AIRPAV, was initially developed during the 1992-1993 SAPMP implementation for the analysis of distress data. The AIRPAV system was used again in the 1998-1999 SAPMP update.

In 2004, the SAPMP system update included the review of the AIRPAV software compared to other industry available non-proprietary software packages. As a result of this review, MicroPAVER[™] (currently known as PAVER[™]) was selected for implementation of the system update. MicroPAVER[™] was developed by the U.S. Army Corps of Engineers Construction Engineering Research Laboratory for pavement management. Data from the 1998-1999 FDOT SAPMP update, which was built upon the initial 1992-1993 implementation of AIRPAV, was reviewed and converted to be compatible with the MicroPAVER™ system. This data conversion included all documented pavement facilities, classifications, types, histories, geometries, PCI condition data and pertinent attributes gathered from airport feedback at the time. This information was used to develop the inventory of each participating airport's pavement facilities in a consistent format. This was the development of Airfield Pavement Network Definition Exhibits. These inventory exhibits visually depicted the branch, section, and sample units that were based upon the pavement construction history and composition information provided by each airport.

In the 2006-2008 system update, the SAPMP was updated again with continued use of the MicroPAVER™ system. Based on the distress data collected, a maintenance repair and major rehabilitation planning program was developed for each airport. As part of this SAPMP update, the procedures for the inspection and the collection of the pavement distress data were documented, and an interactive website (http://www.dot.state.fl.us/aviation/pavement.shtm) was established for input of data.

In the 2010-2012 system update, the SAPMP was updated using new global positioning system (GPS) integrated technology to digitally collect pavement distress data. Interactive geographic information system (GIS) map files were developed from updated Airfield Pavement Network Definition Exhibits to aid pavement condition inspectors in the collection of sample distress data. The data collected was utilized to develop pavement performance models to predict future pavement PCI values and make recommendations for major rehabilitation.

In the 2013-2015 system update, the SAPMP integrated PAVER™ and FieldInspector™ with the use of GPS and GIS capable field tablets. Furthermore, the update included continued adherence to the ASTM D5340-12 "Standard Test Method for Airport Pavement Condition Index Surveys." The ASTM update consisted of refinement of distress definition types and deduction values for select asphalt concrete and Portland Cement Concrete distresses.





1.6 Federal Aviation Administration (FAA)

Currently, airports participating in the Airport Improvement Program (AIP) Grant Program are required by the FAA to develop and implement a pavement maintenance program to be eligible for funding (FAA Advisory Circular 150/5380-6C "Guidelines and Procedures for Maintenance of Airport Pavements" and 150/5380-7B "Airport Pavement Management **Program (PMP)**"). This program requires detailed inspection of airfield pavement conditions by trained personnel. The inspections are required to be performed at least once a year using the PASER method or every three years if the pavement is inspected as defined by the PCI survey procedure in accordance with the ASTM D5340-12 "Standard Test Method for Airport Pavement Condition Index Surveys."

In general, adherence to the Advisory Circulars are mandatory for all projects funded with federal grant monies through the AIP program and with revenue from the Passenger Facilities Charges (PFC) Program. Further information is detailed in FAA Grant Assurance No. 11 "Pavement Maintenance," No. 34 "Policies, Standards, and Specifications," and PFC Assurance No. 9 "Standards and Specifications."

1.7 FDOT SAPMP Objectives and Components

The FDOT SAPMP is a program that provides the FAS support in implementing and/or maintaining a network-level Pavement Management Program in a consistent and regularly scheduled manner.

In accordance with FAA AC150/5380-7B "Airport Pavement Management Program (PMP)" an effective Pavement Management Program consists of a system that achieves specific objectives. The FDOT SAPMP objectives are as follows:

1.7.1 Program Objectives

- 1 A systematic means for collecting and storing information regarding existing pavement structure and condition.
- An objective and repeatable system for evaluating pavement condition.
- Procedures for predicting future pavement condition.
- Procedures for modeling both past and future pavement performance conditions.
- Procedures to determine the budget requirements to meet management objectives, such as the maintenance, repair, and major rehabilitation budget required to keep a pavement at a specified PCI level or the budget required to improve to target PCI level.
- 6 Procedures for formulating and prioritizing maintenance, repair, and major rehabilitation projects.

The objectives are accomplished by the following components:

1.7.2 Program Components

- A. Database
- B. Pavement Inventory
- C. Pavement Structure
- D. Pavement Work History
- E. Pavement Condition Data





- F. Pavement Performance Modeling for the Prediction/Forecast of PCI
- G. Maintenance, Repair, and Major Rehabilitation Policies and Budget Simulation

A well-maintained network-level pavement management program may provide airport staff a better understanding of the airfield pavement performance for developing and planning for specific maintenance, repair, and major rehabilitation projects. The understanding of specific distress types and severities will assist the airport in addressing pavement maintenance and repair with the appropriate treatments as defined by the FAA Advisory Circular 150/5380-6C "Guidelines and Procedures for Maintenance of Airport Pavements." The development of projects with an understanding of system inventory, deterioration details, and pavement condition forecasts may assist airport staff in developing practical rehabilitation actions and budgets. Furthermore, the understanding of pavements' past performance and forecasted condition may assist airport staff in addressing pavement rehabilitation in a timely and costeffective manner. Figure 1.7.2 (a) Typical Pavement Condition Life Cycle, which is based on the FAA Advisory Circular 150/5380-7B "Airport Pavement Management Program (PMP)." Figure 1.7.2 (a) Typical Pavement Condition Life Cycle, depicts a general duration of a pavement section and identifies the ideal condition to perform rehabilitative treatments at an optimal cost rather than allowing significant increase in rate of deterioration that would result in increased costs.

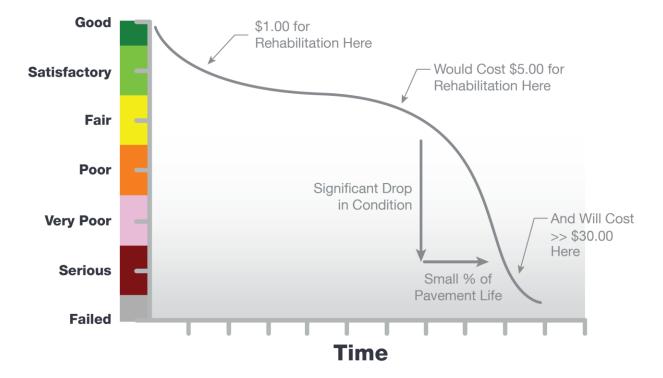


Figure 1.7.2 (a) Typical Pavement Condition Life Cycle


*Figure is for conceptual purposes only – unit costs are not specific to airfield pavements (AC vs PCC).

Figure 1.7.2 (b) General Pavement Treatments by Condition Range depicts generic flexible asphalt concrete (AC) pavement treatments that are effective at specific condition ranges. This graphic is a general concept and will vary based on pavement surface type and overall



composition. The intent is to convey various treatment types that would be effective based on the condition of the pavement along the deterioration model.

Figure 1.7.2 (b) General Pavement Treatments by Condition Range

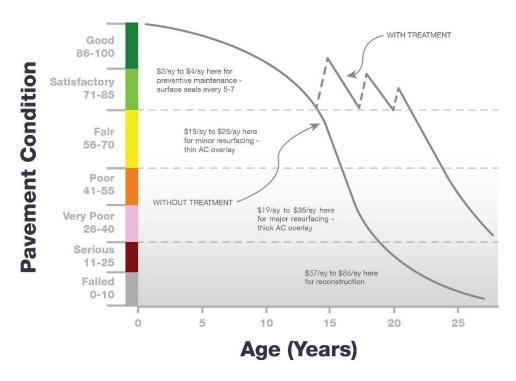

Pavement maintenance, repair, and major rehabilitation would be quite anticipatory if all pavements behaved as depicted in Figures 1.7.2 (a) and 1.7.2 (b), however pavement condition performance vary significantly based on several factors. Factors that contribute to a pavement section's condition and deterioration performance may include: functional design life, material type, material construction quality, climatic conditions, aircraft loading type and frequency, non-aircraft loading type and frequency, maintenance history, subgrade conditions, and other infrastructure in the vicinity. The list of factors is not all-inclusive of all factors that may contribute to a pavement's life cycle, it is intended to clarify that unique conditions certainly will affect a pavement's deterioration.

Figures 1.7.2 (c) and Figure 1.7.2 (d) depict visual conditions of pavement facilities, for both AC and PCC respectively, with approximated PCI ranges and corresponding repair and rehabilitation measures.



Figure 1.7.2 (c) Flexible Asphalt Concrete

	PCI Range	Representative PCI	Representative Pavement Surface	Rehabilitation Activities
Routine Maintenance	86-100	90		Pavements with PCI values above 85, or 'Good', may require periodic joint/crack sealing and local patching.
Pavement Preservation	65-85	70		Pavements with PCI conditions ranging from 'Fair' to 'Satisfactory' may require surface treatments (seal coat), thin overlays, and/or joint/crack sealing.
Major Rehabiliation	40-64	50	B	Pavements that have deteriorated below a PCI 65 (but above 39), or within the range of 'Very Poor' to 'Fair' conditions, may require major rehabilitation such as pavement mill and overlay or partial full-depth reconstruction.
Major Reconstruction	0-39	15		Pavements that have deteriorated below a PCI 40, or within the range of 'Failed' to 'Very Poor' conditions, may require major reconstruction.

Figure 1.7.2 (d) Rigid Portland Cement Concrete

	PCI Range	Representative PCI	Representative Pavement Surface	Rehabilitation Activities
Routine Maintenance	86-100	90		Pavements with PCI values above 85, or 'Good', may require periodic joint/crack sealing and local patching.
Pavement Preservation	65-85	70		Pavements with PCI conditions ranging from 'Fair' to 'Satisfactory' may require patches and/or joint/crack sealing.
Major Rehabiliation	40-64	50		Pavements that have deteriorated below a PCI 65 (but above 39), or within the range of 'Very Poor' to 'Fair' conditions may require major rehabilitation such as slab replacement and PCC restoration activity.
Major Reconstruction	0-39	15		Pavements that have deteriorated below a PCI 40, or within the range of 'Failed' to 'Very Poor' conditions, may require major reconstruction.

Airport Pavement Evaluation Report

2019

Calhoun County Airport (F95)





1.8 References

The following reference documents were referenced as specific guidelines and procedures for maintaining airport pavements; establishing an effective pavement maintenance program; and identifying specific pavement distresses, probable causes of distresses, inspection guidelines, and recommended methods of repair:

- ASTM D5340-12 "Standard Test Method for Airport Pavement Condition Index Surveys."
- FAA Advisory Circular 150/5380-7B "Airport Pavement Management Program."
- FAA Advisory Circular 150/5380-6C "Guidelines and Procedures for Maintenance of Airport Pavements."
- FAA Advisory Circular 150/5320-6F "Airport Pavement Design and Evaluation."
- Department of the Air Force, Air Force Civil Engineer Center "Engineering Technical Letter (ETL) 14-3: Preventive Maintenance Plan (PMP) for Airfield Pavements."
- Unified Facilities Criteria (UFC) 3-260-16FA 16 "Airfield Pavement Condition Survey Procedures Pavements."
- Unified Facilities Criteria (UFC) 3-260-03 "Airfield Pavement Evaluation."
- Pavement Management for Airports, Roads, and Parking Lots 2nd Edition, M.Y. Shahin.



Chapter 2





Chapter 2 – Methodology

An effective pavement management program incorporates the regular collection of pavement condition information and communication of information to appropriate sponsors. This chapter of the report defines the specific methods utilized as part of the SAPMP System Update to meet the requirements of an effective pavement management system as defined by the FAA Advisory Circular 150/5380-7B "Airport Pavement Management Program (PMP)."

2.1 Airfield Pavement Database

The SAPMP program has historically utilized PAVERTM (formerly MicroPAVERTM); the current update has maintained the use of the PAVER™ 7.0 version of the software. The PAVER™ software application was developed by the U.S. Army Construction Engineering Research Laboratory sponsored by the FAA, Federal Highway Administration, U.S. Army, U.S. Air Force, and the U.S. Navy to meet the objectives of an effective pavement management system. The SAPMP consists of a network-level database of the airport's airfield pavement facilities that are part of the program. PAVER[™] can achieve the following pavement management objectives: a manageable inventory system, the analysis of the current condition of pavements in accordance with the ASTM D5340, the development of pavement performance models to forecast conditions, and the development of maintenance, repair, and major rehabilitation recommendations based on budgetary scenarios.

PAVER™ inventory management is based on a tiered organizational structure that consists of networks, branches, and sections, with the section being the smallest unit of management. Critical elements of an effective pavement management program are maintained within the network-level PAVERTM database. These elements typically consist of pavement inventory characteristics, pavement structure, work history, historic condition records, and analytical customization.

The SAPMP System Update consisted of the conversion of the previous database from a PAVERTM version 6.5 to a version 7.0.

2.2 Airfield Pavement System Inventory

An airfield pavement system inventory typically maintains the location of all runways, taxiways, and aprons; geometric characteristics; type of pavement structure, year of construction and/or last major rehabilitation; and general composition details of the pavement.

The pavement inventory for an airport's airfield is an assembly of pavement infrastructure information that builds an inventory of branches and sections that codifies the airport's airfield pavement network. General geometry characteristics, estimated length, width, functional classification, pavement surface type, and operational function are among the characteristics identified at this initial phase in the pavement management process. The development of a pavement inventory that reasonably reflects the airport's airfield pavement facilities that are maintained by the airport provides a defined scope of the inspection and analysis efforts. As in the past, the SAPMP scope of work is specific to the airport-maintained airfield pavements as defined in the field network definition exhibits presented to current airport personnel.





A critical input to the pavement system inventory and network definition in the development of the SAPMP update is the date of last major rehabilitation/construction performed on the pavement assets that would set the asset at a PCI of 100 and a condition rating of Good. The airport provided a limited combination of record drawings, reports, and staff input that was pertinent information in developing the construction history of the airport's pavements from inception. Major rehabilitation/construction activities performed in the last 24-months or anticipated in the next 24-months are assumed to restore the PCI to 100. These activities include; pavement overlay, mill and replace, mill and overlay, new construction, and/or complete reconstruction.

Aerial imagery was obtained through the FDOT Surveying & Mapping Office's Aerial Photo Look Up System (APLUS). This spatially projected imagery was utilized with computer-aided drafting software (AutoCAD) in concert with geographical information system software (ArcGIS) to develop a planning-level representative model that reasonably reflects the pavement assets at the airport.

2.2.1 Pavement Management Program Network Definition Terminology

There are several terms that are common in the communication of the results of the SAPMP System Update, these terms are defined as follows:

Pavement Network

A pavement network is a logical unit for organizing pavements into a structure for pavement management. A network will typically consist of one or more pavement branches, which are typically comprised of one or many pavement sections. The network is the starting point of the hierarchy of pavement management organization. For example, a network can be all the pavements within an airport's airfield or all the pavements in a statewide program. For the FDOT SAPMP, a network represents an individual airport's airfield pavement facilities maintained by the airport.

The SAPMP System Update consists of research and evaluation of existing record documentation for the participating airports' airfield facilities. The pavement network is typically limited to the pavement facilities subject to aircraft use that is also maintained by the airport owner and eligible for public funding.

Pavement Branch

A pavement branch, also known as a facility, is a logical unit of generally identifiable pavement of a network with distinct functional classification. For example, within an airfield each runway, taxiway, or apron is considered a branch. A branch must consist of at least one section.

Pavement Section

A pavement section, also known as a feature, is the most specific management unit when considering the application and selection of maintenance, repair, and/or major rehabilitation treatments on an area of pavement within a branch. Each branch consists of at least one section, but may consist of more if pavement feature characteristics are distinct throughout the branch. Characteristics considered when subdividing branches into sections include, but are not limited to: pavement structure, type, age, condition, and function; traffic composition and frequency (current and future); geometric location; construction history; and other related





infrastructure features (e.g. drainage). A pavement section is defined as a subordinate of a pavement branch, which is a subordinate of a "parent" pavement network.

Pavement Sample Unit

A pavement sample unit is a subdivision of a pavement section that has a standard size range: twenty (20) continuous slabs (±8 slabs) for Portland Cement Concrete (PCC) pavement and 5,000 contiguous square feet (±2,000 ft²) for flexible asphalt concrete (AC) or porous friction course pavements.

Table 2.2.1 Airfield Pavement Database Network Definition Terminology

PMS Network Level	Common Definition	Airport Example
Network	Overall pavement assets maintained by the Airport	"Tallahassee International Airport – Airfield Pavements"
Branch Name	Commonly defined asset name as established by Airport and by use	"Runway 18-36"
Branch ID	Codified shorthand name for commonly defined asset established for database identification	"RW 18-36" RW, Branch Use, "Runway" 18-36, Runway Facility
Section ID	Codified identification for pavement asset that is distinct by the following: Pavement Composition Construction Work History Aircraft Traffic Condition Records	"6105"
Sample Unit	A numeric identification of an area of pavement (5,000±2,000 SF of AC or 20±8 slabs of PCC) that has been inspected in accordance with ASTM D5340-12.	"300"





2.3 Airfield Pavement Structure

2.3.1 Pavement Structure Types

Airport airfield pavements are constructed to provide adequate support for the loads imposed by aircraft and produce a firm, stable, smooth, all-year, all-weather surface free of debris or other particles that may be blown or dislocated by propeller wash or jet blast. Typical pavement planning and design requires coordination of factors that include but are not limited to; subgrade conditions, material layer types, aircraft fleet mix (type, frequency, and traffic growth), and functional use. A pavement structure is composed of constructed layers that consist of subgrade, subbase, base course, structural courses, and surfaces courses. For the FDOT SAPMP, two major pavement structure types are classified for evaluation and analysis: Flexible Asphalt Concrete Surface and Rigid Portland Cement Concrete Surface. Additionally, Composite Structures known as Whitetopping Pavements are also present at limited airports within the Florida Airports System; these unique pavement structures are evaluated separately.

Flexible Asphalt Concrete Surface

A pavement comprised of aggregate mixture with an asphalt cement binder. The FDOT SAPMP consists of three (3) asphalt concrete surface types: Asphalt Concrete (AC), Asphalt Concrete Overlaid on Asphalt Concrete (AAC), and Asphalt Concrete Overlaid on Portland Cement Concrete (APC).

Asphalt Concrete (AC)

A flexible pavement section consisting of aggregate mixture with asphalt cement binder layered on engineered base course material that is layered on subbase and subgrade soil material.

Asphalt Concrete Overlaid on Asphalt Concrete (AAC)

A flexible pavement section consisting of aggregate mixture with asphalt cement binder layered on an existing flexible AC pavement section. Flexible airfield pavement sections are AAC when a pavement rehabilitation consists of a pavement milling operation and a resurfacing of asphalt layers; or a direct overlay of asphalt concrete without surface preparation.

Asphalt Concrete Overlaid on Portland Cement Concrete (APC)

A flexible pavement section consisting of aggregate mixture with asphalt cement binder layered on an existing Rigid PCC pavement section. This unique pavement composition may result in distinct pavement distress manifestations known as reflective joint cracking.





Rigid Portland Cement Concrete Surface

A pavement comprised of aggregate mixture with a Portland Cement binder. The FDOT SAPMP recognizes Portland Cement Concrete (PCC) as the primary rigid pavement section.

Portland Cement Concrete (PCC)

A rigid pavement section composed of Portland cement concrete placed on a granular or treated base course that is supported on a compacted subgrade. The concrete surface must provide a texture of nonskid qualities, prevent the infiltration of surface water into the subgrade, and provide structural support to the airplanes. Rigid pavement construction requires the layout of appropriately designed joint spacing.

Composite Structure - Whitetopping Pavement

A composite pavement comprised of relatively thin Portland Cement Concrete overlaid on an existing flexible asphalt concrete pavement structure. There are three (3) types of Whitetopping Pavements: Conventional (WHT), Thin (TWT), and Ultra-Thin (UTW).

Conventional Whitetopping (WHT)

A composite pavement structure consisting of a modified PCC overlaid on an existing flexible AC pavement section area. The modified PCC layer is typically greater than 8 inches in thickness.

Thin Whitetopping (TWT)

A composite pavement structure consisting of a modified PCC overlaid on an existing flexible asphalt concrete pavement section. The modified PCC layer is typically between 4 and 8 inches in thickness.

Ultra-Thin Whitetopping (UTW)

A composite pavement structure consisting of a modified PCC overlaid on an existing flexible asphalt concrete pavement section. The Portland Cement Concrete layer is typically between 2 and 4 inches in thickness.





2.4 Airfield Pavement Work History

2.4.1 Airfield Pavement Record Keeping

It is strongly recommended that airports maintain records of all airfield construction and maintenance related to the pavement facilities. A history of all maintenance and repair performed and its associated costs (construction and soft costs) can provide valuable information on the effectiveness of various treatments on pavements. An airport should maintain detailed records of maintenance (routine, emergency, and proactive) activities. The records should consist of the following:

- 1. Location and Limits of Work.
- 2. Types and Severity of Distresses Repaired.
- 3. Type of Work.
- 4. Cost of Work.
- 5. Supporting Documents (contract documents, construction drawings, specifications, bid tabulations, repair product, photograph records, etc.).

2.5 Airfield Pavement Traffic

A pavement section is typically designed to meet the needs of the user (airlines, air cargo, general aviation, and/or military) in providing a safe, smooth, operational surface. Pavement deterioration generally occurs gradually through increased roughness and/or fatigue cracking caused by successive and heavy aircraft traffic.

This study does not consist of a study or analysis of each individual airport's airfield aircraft fleet mix or traffic operations. However, it is strongly recommended that airports incorporate the requirements of FAA Advisory Circular 150/5320-6F Airport Pavement Design and **Evaluation** when developing design-level rehabilitation activities. The AC provides guidance on incorporation of aircraft traffic fleet mix data.

2.6 Airfield Pavement Condition Index (PCI) Survey

2.6.1 PCI Survey Methodology

In adherence to the FAA Advisory Circular 150/5380-7B "Airport Pavement Management Program (PMP)," the FDOT SAPMP utilizes the PCI Survey Method of inspection to collect pavement distress data and analyze the condition. The PCI Survey Inspection procedure is a visual statistical sampling of pavements for recording primary distress types (e.g. cracking and deformation), associated severities, and quantities as defined by the ASTM D5340-12. This effort is the primary means of obtaining and recording pavement distress data. The survey inspection consists primarily of visual inspection of pavement surfaces for signs of distress and deterioration resulting from loading (aircraft) and environmental influences.

A visual pavement condition survey provides an indication of the cause and rate of deterioration of a pavement section from a functional point of view and can be an indicator of structural distress. The functional condition analysis assesses the rating of the operational surface. A visual PCI Survey Inspection does not predict the remaining structural life of a pavement section, or its ability to support loads. The functional condition determined by the PCI method

Airport Pavement Evaluation Report

2019 Calhoun County Airport (F95)





can provide a cost-effective means to plan for pavement rehabilitation projects. The timely application of pavement rehabilitation may lead to the extension of functional life of individual pavement sections. This method varies from structural evaluation; functional condition is limited to visually observed distresses and indicative modes of pavement deterioration. A formal structural evaluation analyzes subsurface conditions, material characteristics, and qualitative pavement structure attributes. A structural evaluation may consist of; subsurface geotechnical exploration, falling weight deflectometer testing, petrographic testing, material coring, and/or flexural testing.





2.6.2 Pavement Distress Types

For each section, the severity and quantity of defined distresses are recorded and then analyzed in accordance with the ASTM D5340-12 standard. The standard identifies 17 distinct flexible asphalt concrete distress types and 16 distinct rigid Portland Cement Concrete distress types.

Table 2.6.2 (a) Pavement Distress Types - Flexible Asphalt Concrete-Surfaced Airfields

Distress	Common Distress Mechanisms	
Alligator Cracking	Load / Fatigue	
Bleeding	Construction Quality/ Mix Design	
Block Cracking	Climate / Age	
Corrugation	Load / Construction Quality	
Depression	Load / Subsurface	
Jet Blast	Aircraft	
Joint Reflection - Cracking	Climate / Subsurface Pavement / Traffic Load	
Longitudinal/Transverse Cracking	Climate / Construction Quality	
Oil Spillage	Aircraft / Vehicle	
Patching	Utility / Pavement Repair / Age	
Polished Aggregate	Repeated Traffic Loading	
Raveling	Climate / Age	
Rutting	Load / Fatigue	
Shoving	PCC Pavement Growth / Movement	
Slippage Cracking	Load / Pavement Bond / Mix Design	
Swelling	Climate / Subsurface	
Weathering	Climate / Age	





Classification by Possible Causes					
Load	Climate / Durability	Moisture / Drainage	Others		
 Alligator Cracking Corrugation Depression Patching of Load-based distress Polished Aggregate Rutting Slippage Cracking 	 Bleeding Block Cracking Joint Reflection Cracking L/T Cracking Patching of climate / durability-caused distresses Shoving from PCC Raveling Weathering Swelling 	 Alligator Cracking Depression Patching of moisture / drainage caused distress Swelling Raveling Weathering 	Oil Spillage Jet Blast Erosion Polished Aggregate		

Table 2.6.2 (c) Pavement Distresses Possible Effects - Flexible Asphalt Concrete-Surfaced Air fields

Classification by Possible Effects				
Roughness	Skid / Hydroplaning Potential	FOD Potential	Rate of Deterioration and Maintenance Requirements	
 Corrugation Depression Rutting Shoving of asphalt pavement Swelling Raveling Weathering 	 Bleeding Depression Polished Aggregate Rutting 	Block Cracking Joint Reflection Cracking L/T Cracking Slippage Cracking	All Distresses	





Table 2.6.2 (d) Pavement Distresses - Rigid Portland Cement Concrete-Surfaced Airfields

Distress	Common Distress Mechanisms
Blowup	Climate / ASR
Corner Break	Load Repetition / Curling Stresses
Linear Cracking	Load Repetition / Curling Stresses / Shrinkage Stresses
Durability Cracking	Freeze-Thaw Cycling
Joint Seal Damage	Material Deterioration / Construction Quality / Age
Small Patch	Pavement Repair
Large Patch/Utility Cut	Utility / Pavement Repair
Popout	Freeze-Thaw Cycling / ASR / Material Quality
Pumping	Load Repetition / Poor Joint Sealant
Scaling	Construction Quality / Freeze-Thaw Cycling
Faulting	Subgrade Quality / ASR / Inadequate Load Transfer
Shattered Slab	Overloading
Shrinkage Cracking	Construction Quality / Climate
Joint Spalling	Load Repetition / Infiltration of Incompressible Material / Deterioration of Dowel (Load Transfer) Bars
Corner Spalling	Load Repetition / Infiltration of Incompressible Material / Deterioration of Dowel (Load Transfer) Bars
Alkali-Silica Reaction (ASR)	Construction Quality / Climate / Chemical Reaction





Table 2.6.2 (e) Pavement Distresses Possible Causes - Rigid Portland Cement Concrete-Surfaced Airfields

	Classification by Possible Causes										
Load	Load Climate / Durability		Others								
 Corner Break Shattered Slab L/T/D Cracking Pumping Patching of Load-associated distress Spalling 	Blowup "D" Cracking Joint Seal Damage Popouts Scaling Patch of Climate/Durability-associated distress Shrinkage Cracking Spalling L/T/D Cracking	 Corner Break Shattered Slab Pumping Patching of Moisture/Drainage- associated distress 	Settlement / Faulting								

Table 2.6.2 (f) Pavement Distresses Possible Effects - Rigid Portland Cement Concrete-Surfaced Airfields

	Classification by Possible Effects										
Roughness	Roughness Skid / Hydroplaning Potential		Rate of Deterioration and Maintenance Requirements								
 Blowup Corner Break L/T/D Cracking Shattered Slab Settlement / Faulting Spalling 	 Settlement / Faulting Spalling 	Corner Break L/T/D Cracking "D" Cracking Joint Seal Damage Shattered Slab Popouts Scaling	All distresses								





2.6.3 PCI Survey Inspection Procedures

Inspection Sampling Rate

The FDOT SAPMP performs PCI Survey Inspections on sample units defined in the previous update. The sample units are subject to change at the discretion of the inspection personnel and/or to major pavement rehabilitation treatments. Furthermore, access to the sample units based on accessibility or impacts to operations may affect the overall sampling rate effort at each airport. The following Tables 2.6.3 (a) and (b) define the sampling criteria used by the FDOT SAPMP. A higher sampling rate may be utilized to achieve a greater statistical confidence should the airport have the available resources to perform PCI Survey Inspections independent of the FDOT SAPMP.

Table 2.6.3 (a) Recommended Sample Rate Schedule for Flexible Asphalt Concrete

Number of Total	Sample Units to Inspect					
Sample Units in Section	Runways	Taxiways, Aprons, and Others				
1 - 4	1	1				
5 - 10	2	1				
11 - 15	3	2				
16 - 30	5	3				
31 - 40	7	4				
41 - 50	8	5				
51 or more	20% but ≤20	10% but ≤10				

Table 2.6.3 (b) Recommended Sample Rate Schedule for Rigid Portland Cement Concrete

Number of Total Sample Units in	Sample Units to Inspect					
Section	Runways	Taxiways, Aprons, and Others				
1 - 3	1	1				
4 - 6	2	1				
7 - 10	3	2				
11 - 15	4	2				
16 - 20	5	3				
21 - 30	7	3				
31 - 40	8	4				
41 - 50	10	5				
51 or more	20% but ≤20	10% but ≤10				





2.6.4 Updates to the ASTM D5340-12

Airfield pavement distresses and conditions were surveyed in accordance with the methods outlined in FAA Advisory Circular 150/5380-6C and ASTM D5340-12. These procedures define distress type, severity, and quantity for sampling areas within each defined pavement section area to analyze and determine the PCI value and condition rating. During the 2013-2015 System Update, the incorporation of the significant changes to the ASTM D5340 (version D5340-12) resulted in adjusted pavement condition indices on pavement sections subject to the distress types updated. Furthermore, the revision of the PCI deduction curves and the separation of distress types from the original, such as Weathering and Raveling, have in select cases increased the PCI value of the section without any rehabilitation performed.

Flexible Asphalt Concrete Pavement Distress Updates

The previous methodology which featured "(52) Weathering and Raveling" distress has been separated into two distresses "(52) Raveling" and "(57) Weathering." Previously, areas that were recorded as "Weathering and Raveling" were considered as one distress with a high deduction. Based on the updated methodology, in certain situations where "Weathering" only exists and does not meet the definition of "Raveling," the PCI deduction is not as high as the former "Weathering and Raveling." Therefore, areas identified only as "(57) Weathering" based on current ASTM standards, which were previously identified as "(52) Weathering and Raveling," may be subject to an improvement in PCI. In instances where pavement PCI has increased due to this update, it is not due to an improvement in actual condition, however indicative of the adjusted distress deterioration effects.

Rigid Portland Cement Concrete Pavement Distress Updates

The previous methodology defined "(70) Scaling" as a distress that consisted of surface deterioration caused by construction defects, material defects, and environmental factors. The distress included Alkali-Silica Reaction, also known as ASR. The current methodology has separated Alkali-Silica Reaction as a distress identified as "(76) Alkali-Silica Reaction / ASR." As a result, the previous "(70) Scaling" numerical deduction contribution to the PCI has been reduced. Previous inspections that recorded "(70) Scaling," and currently do not exhibit "(76) Alkali-Silica Reactivity / ASR" may potentially see an increase in PCI. Additionally, "(73) Shrinkage Cracks" has been redefined as "(73) Shrinkage Cracking". Shrinkage Cracking is characterized in two forms; drying shrinkage and plastic shrinkage. Drying shrinkage occurs over time as moisture leaves the pavement, it develops when hardened pavement continues to shrink as excess water not needed for cement hydration evaporates. It forms when subsurface resistance to the shrinkage is present and may extend through the entire depth of the slab. Plastic shrinkage can be caused by both atmospheric conditions and construction. Plastic shrinkage caused by atmospheric conditions develops when there is rapid loss of water in the surface of recently placed pavement. High winds or low humidity are contributing factors to evaporation. These shrinkage cracks can appear as a series of parallel cracks, usually 1 to 3 feet apart and do not extend very deep into the pavement's surface. Plastic shrinkage caused by construction can form from over finishing/overworking of the pavement during construction. These shrinkage cracks appear as a series of inter-connected hairline cracks, or pattern cracking, and are often observed throughout the majority of the slab surface. This condition is also referred to as map cracking or crazing.



Table 2.6.4 Summary of Updates to ASTM D5340-12

Use and	Updated Distress	Former Distress in Prior to	Deduction	Potential Effect
Surface Type		5340-10	Curve	
AC/AAC/ APC Airfield	(52) Raveling - Low	(52) Weathering and Raveling - Low	No Change	N/A
	(52) Raveling - Medium	(52) Weathering and Raveling - Medium	No Change	N/A
	(52) Raveling - High	(52) Weathering and Raveling - High	No Change	N/A
	(57) Weathering - Low	N/A – was part of 'Weathering and Raveling'	New	Increase in PCI with no maintenance
	(57) Weathering - Medium	N/A – was part of 'Weathering and Raveling'	New	Increase in PCI with no maintenance
	(57) Weathering - High	N/A – was part of 'Weathering and Raveling'	New	Increase in PCI with no maintenance
PCC Airfield	(70) Scaling - Low	(70) Scaling, Map Cracking, and Crazing - Low	New	Increase in PCI with no maintenance
	(70) Scaling - Medium	(70) Scaling, Map Cracking, and Crazing - Medium	New	Increase in PCI with no maintenance
	(70) Scaling - High	(70) Scaling, Map Cracking, and Crazing - High	New	Increase in PCI with no maintenance
	(76) Alkali Silica Reaction – Low	N/A – was part of 'Scaling, Map Cracking, and Crazing'	New	Increase in PCI with no maintenance
	(76) Alkali Silica Reaction – Medium	N/A – was part of 'Scaling, Map Cracking, and Crazing'	New	Increase in PCI with no maintenance
	(76) Alkali Silica Reaction – High	N/A – was part of 'Scaling, Map Cracking, and Crazing'	New	Increase in PCI with no maintenance
	(73) Shrinkage Cracking	(73) Shrinkage Cracking	No Change	Prior distress types identified as 'Scaling, Map Cracking, and Crazing' may now be identified as 'Shrinkage Cracking'



Chapter 3



Chapter 3 – Airfield Pavement System Inventory

A significant element of an effective airfield pavement management system is the appropriate record keeping of changes due to construction or operational use of the pavement facilities. This chapter discusses the inventory data collected from the airport and summarizes network-level characteristics of the airport's airfield pavements. At the start of each FDOT SAPMP System Update, all airports are asked to review the existing Airfield Pavement Network Definition exhibit for accuracy. Furthermore, participating airports are asked to provide documentation for any recent or anticipated construction related to their airfield pavements.

3.1 Airfield Pavement Network Information

3.1.1 Previous and/or Anticipated Airfield Pavement Construction

Based on information provided by the airport, the following Table 3.1.1 summarizes the airfield pavement construction projects that have been incorporated into the SAPMP database system since the 2013-2015 System Update. Figure 3.1.1 (a) and Figure 3.1.1 (b) provides an inset view of the 2019 Airfield Pavement Network Definition Exhibit and the 2019 Airfield Pavement System Inventory Exhibits that depict the updated network details for the airport reflected in the PAVER Database. Large format exhibits are referenced in Appendix C Technical Exhibits.

Table 3.1.1 Previous and/or Anticipated Airfield Pavement Construction


Year	General Work Description
2015	AP GA - New Construction - PCC
2016	AP GA CONN, RW 18-36, TW A - New Construction: 2" P-401, 10" P-209, P-152
2010	AP GA CONN, TW A2 - Reconstruction: 2" P-401, 10" P-209, P-152
2019	TW A, AP GA CONN - New Construction: 2" P-401, 10" P-209, P-152

The airport provided a limited combination of record drawings, reports, and staff input that was pertinent information in developing the construction history of the airport's pavements from inception. Major rehabilitation/construction activities performed in the last 24-months or anticipated in the next 24-months are assumed to restore the PCI to 100. These activities include: pavement overlay, mill and replace, mill and overlay, new construction, and/or complete reconstruction. These pavements were not formally subject to a PCI Survey and actual conditions may vary. Furthermore, any localized maintenance or repair performed that would improve the PCI will be considered in the condition analysis, if performed within inspection areas.






Figure 3.1.1 (a) 2019 Airfield Pavement Network Definition Exhibit

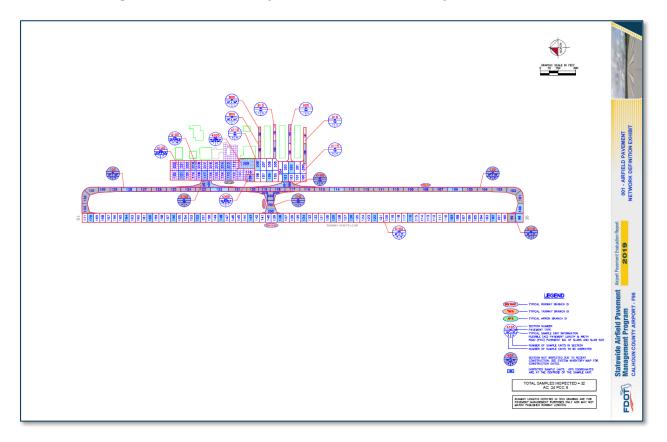

The Airfield Pavement Network Definition Exhibit provides details to the PCI Survey inspection efforts. The exhibit identifies the pavement facilities, surface type, section definition, and sample unit delineation.



Figure 3.1.1 (b) 2019 Airfield Pavement System Inventory Exhibit

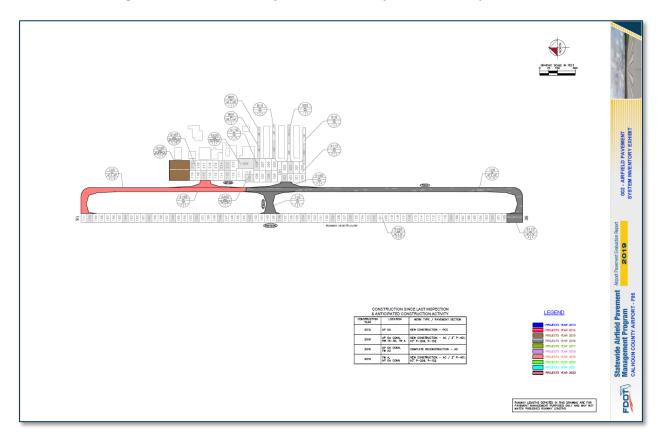

The Airfield Pavement System Inventory Exhibit provides details to the work history updates communicated by the Airport. The Exhibit provides the approximate limits of recent and/or anticipated construction on the airfield pavement facilities. The limits are based on documentation provided by the Airport and, if constructed, observed in the field.


3.1.2 Estimated Pavement Age

Standard pavement design practice considers a design life of a 20-year period. Design inputs typically require subgrade soil conditions, pavement section layer material characteristics, and anticipated loading (aircraft fleet mix) for the design-life period. Based on the review of the historic airfield pavement construction, Figure 3.1.2 summarizes the average age of the pavement sections at the time of the PCI survey inspection. Age is determined to be the number of years since any major construction activity has occurred. This is intended to be a rough estimate based on interpretation of the limited data available at the time of report.





Figure 3.1.2 Average Age of Pavements at Inspection

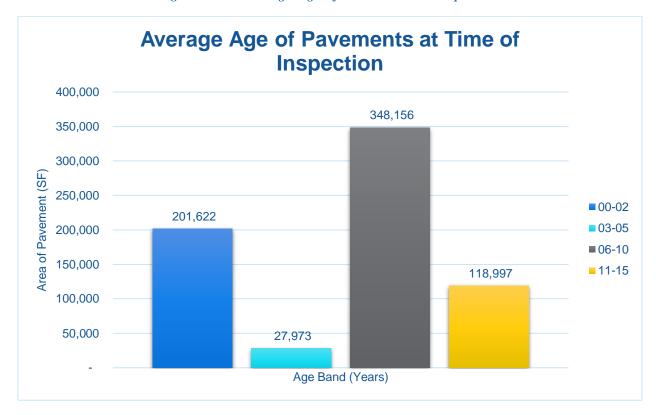

The estimation of the pavement age is based on information requested and provided by participating airports. Additionally, data collected in the prior system updates since 1992 have been relied upon.






3.1.3 Functional Use Classification

Pavements are subject to varying aircraft loading patterns based on utilization and overall operations. For this SAPMP Update, the following categories of airfield functional use have been identified and associated with the following possible pavement branch facilities: Apron, Runway, Taxiway, and Taxilane. Figure 3.1.3 summarizes the identified pavements' functional use by area in square feet. The pavement areas reviewed exclude shoulder pavement facilities.

Figure 3.1.3 Airfield Pavement Functional Classification Use by Area

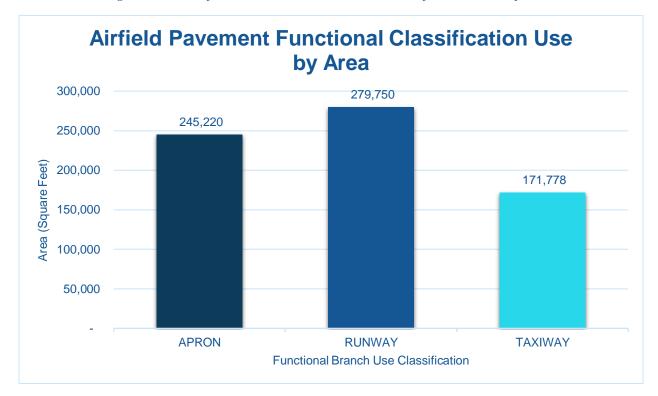





3.1.4 Pavement Surface Type

The airfield pavement facility surface types within the SAPMP include four common types of pavement: Portland cement concrete (PCC), asphalt concrete (AC), asphalt concrete overlaid on asphalt concrete (AAC), and asphalt concrete overlaid on Portland cement concrete (APC).

Based on the record documentation incorporated within the SAPMP database throughout the years, the pavement surface types have been assigned to the various pavement sections in accordance to its work history composition. The following Figures 3.1.4 (a) and (b) summarize the applicable pavement types observed at this specific airport's airfield.


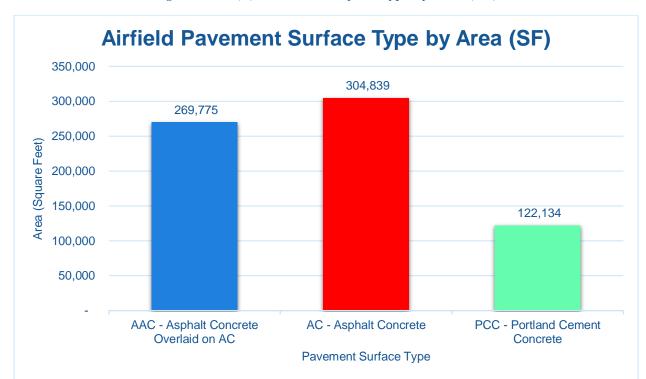


Figure 3.1.4 (a) Pavement Surface Type by Area (SF)



Figure 3.1.4 (b) Pavement Surface Type by Area (%)

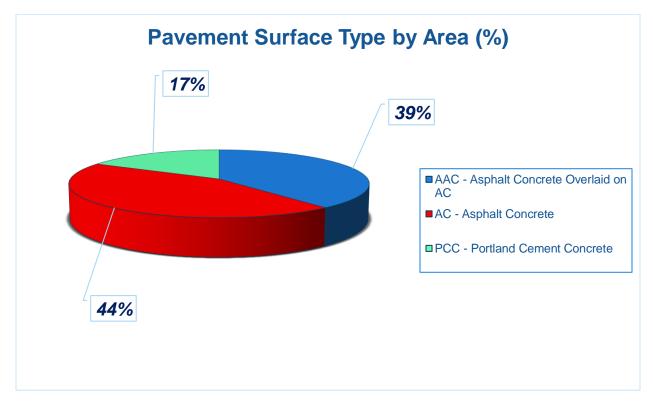

3.1.5 Pavement System Inventory Details

The following **Table 3.1.5** displays the section-level details assembled as part of this update. The section-level details are based on the record documentation provided by the airports to FDOT and from SAPMP System Updates. The details assembled rely on the accuracy and the adequacy of data provided; however, it should be noted that characteristics such as pavement areas may be based on aerial interpretation of spatially projected imagery. The accuracy of data is presented with the intention of a network planning-level document; should the airport elect to perform rehabilitation work, it is recommended that further investigation be performed at the project level for construction purposes.

In summary, the scope of the pavement inventory update resulted in the updating of select existing pavement geometry and the development of an AutoCAD model with spatial projection for use within GIS. Appendix A includes the Airfield Pavement Network Definition Exhibit and the Airfield Pavement System Inventory Exhibit which visually summarize the results of the Airfield Pavement System Inventory analysis and reporting.





Table 3.1.5 Pavement System Inventory Details

Network ID	Branch Name	Branch ID	Branch Use	Section ID	Length (FT)	Width (FT)	Area (SF)	Surface Type	Est. Last Construction Date
F95	GA APRON	AP GA	APRON	4105	545	167	78,381	PCC	1/1/2012
F95	GA APRON	AP GA	APRON	4110	210	200	39,362	AC	1/1/2003
F95	GA APRON	AP GA	APRON	4115	235	173	40,207	AC	1/1/2007
F95	GA APRON	AP GA	APRON	4120	168	167	27,973	PCC	1/1/2015
F95	GA APRON	AP GA	APRON	4150	96	60	9,900	AC	6/1/2019
F95	GA APRON	AP GA	APRON	4160	95	47	9,969	AC	6/1/2016
F95	GA APRON	AP GA	APRON	4205	150	250	10,930	PCC	1/1/2003
F95	HELIPAD APRON	AP HELIPAD	APRON	4305	75	65	4,850	PCC	1/1/2003
F95	T-HANG APRON	AP T-HANG	APRON	805	126	20	2,520	AC	1/1/2006
F95	T-HANG APRON	AP T-HANG	APRON	806	141	20	2,820	AC	1/1/2003
F95	T-HANG APRON	AP T-HANG	APRON	810	270	25	5,700	AC	1/1/2003
F95	T-HANG APRON	AP T-HANG	APRON	905	350	20	6,468	AC	1/1/2007
F95	T-HANG APRON	AP T-HANG	APRON	910	307	20	6,140	AC	1/1/2007
F95	RUNWAY 18-36	RW 18-36	RUNWAY	6105	3,597	75	269,775	AAC	1/1/2012
F95	RUNWAY 18-36	RW 18-36	RUNWAY	6110	133	75	9,975	AC	6/1/2016
F95	TAXIWAY A	TW A	TAXIWAY	120	2,450	35	93,205	AC	6/1/2016
F95	TAXIWAY A	TW A	TAXIWAY	125	1,575	35	60,539	AC	6/1/2019
F95	TAXIWAY A2	TW A2	TAXIWAY	110	185	74	18,034	AC	6/1/2016





PAGE INTENTIONALLY LEFT BLANK



Chapter 4





Chapter 4 – Airfield Pavement Condition

The examination of specific distress types (with causes attributed to load, climate, or other defined distress mechanism), determination of the severity of distress, and determination of the quantity of distress manifestation are required in the computation of a PCI value. The PCI provides valuable information that can be used to determine the existing condition of the pavement, possible cause of the pavement deterioration, and eventually aid in the planning of the rehabilitation of pavements. It should be noted that the PCI method of pavement condition evaluation is strictly a visual and functional evaluation. Further evaluation of the pavement condition may be necessary for design and/or project-level determination of pavement rehabilitation.

4.1 Airfield Pavement Condition Index (Latest Inspection)

4.1.1 Network-Level Analysis

The following Figure 4.1.1 summarizes the network-level pavement condition analysis based on the most recent PCI Survey inspection results.

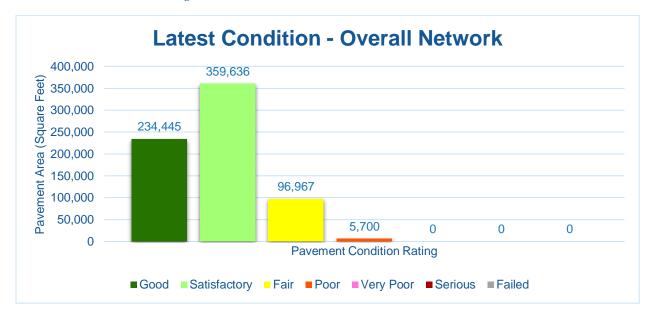


Figure 4.1.1 Latest Condition - Overall Network

4.1.2 Branch-Level Analysis

The following Figures 4.1.2 (a) through (c) summarize the branch-level pavement condition analysis based on the most recent PCI Survey inspection results; the following Figures provide overall branch-level conditions by branch use.



Figure 4.1.2 (a) Latest Condition - Runway Pavements

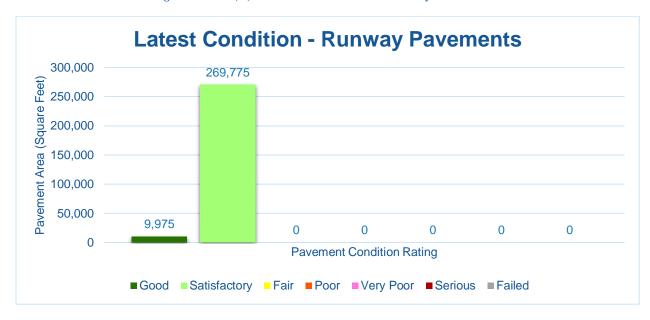



Figure 4.1.2 (b) Latest Condition - Taxiway Pavements







Figure 4.1.2 (c) Latest Condition - Apron Pavements

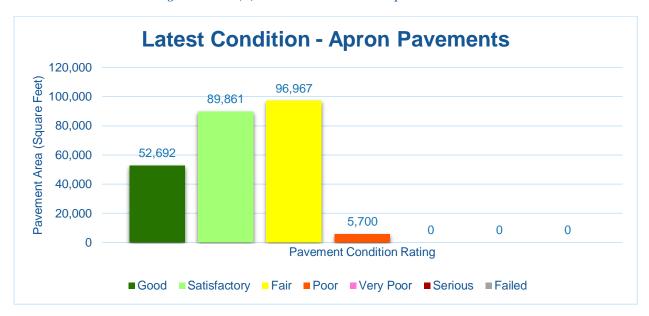

4.1.3 Section-Level Analysis

The following **Table 4.1.3** provides details for each pavement section of its area-weighted average PCI and the percent of distress which is related to load, climate, or other factors. The amount of distress attributed to the various causes provides insight into maintenance, repair, and rehabilitation needs. Load-related distress indicates that pavements are reaching the end of their structural design life, and for those pavements exhibiting a significant amount of these distress types, rehabilitation should be planned to strengthen or reconstruct the pavement. Appendix C Technical Exhibits provides a technical exhibit that graphically depicts the PCI values and ratings determined from this SAPMP System Update.

Any pavement facilities subject to pavement construction within the past 2 years or anticipated for construction within the next year may have been omitted from inspection. Pavement subject to major rehabilitation will be set to a PCI of 100.





Table 4.1.3 Latest Pavement Condition Index Summary

Network ID	Branch ID	Branch Name	Branch Use	Section ID	Area (SF)	Surface	PCI	PCI Rating	PCI % Climate	PCI % Load	PCI % Other	Sample Units Inspected	Total Sample Units in Section
F95	AP GA	GA APRON	APRON	4105	78,381	PCC	76	Satisfactory	26%	14%	60%	5	18
F95	AP GA	GA APRON	APRON	4110	39,362	AC	57	Fair	77%	0%	23%	2	8
F95	AP GA	GA APRON	APRON	4115	40,207	AC	70	Fair	36%	0%	64%	2	9
F95	AP GA	GA APRON	APRON	4120	27,973	PCC	86	Good	14%	0%	86%	1	6
F95	AP GA	GA APRON	APRON	4150	9,900	AC	100	Good	0%	0%	0%	0	2
F95	AP GA	GA APRON	APRON	4160	9,969	AC	100	Good	0%	0%	0%	0	2
F95	AP GA	GA APRON	APRON	4205	10,930	PCC	65	Fair	5%	13%	82%	1	1
F95	AP HELIPAD	HELIPAD APRON	APRON	4305	4,850	PCC	89	Good	66%	0%	34%	1	1
F95	AP T-HANG	T-HANG APRON	APRON	805	2,520	AC	76	Satisfactory	68%	0%	32%	1	1
F95	AP T-HANG	T-HANG APRON	APRON	806	2,820	AC	76	Satisfactory	55%	0%	45%	1	1
F95	AP T-HANG	T-HANG APRON	APRON	810	5,700	AC	54	Poor	66%	0%	34%	1	2
F95	AP T-HANG	T-HANG APRON	APRON	905	6,468	AC	57	Fair	25%	0%	75%	1	2
F95	AP T-HANG	T-HANG APRON	APRON	910	6,140	AC	82	Satisfactory	55%	0%	45%	1	2
F95	RW 18-36	RUNWAY 18-36	RUNWAY	6105	269,775	AAC	85	Satisfactory	100%	0%	0%	15	72
F95	RW 18-36	RUNWAY 18-36	RUNWAY	6110	9,975	AC	100	Good	0%	0%	0%	0	2
F95	TW A	TAXIWAY A	TAXIWAY	120	93,205	AC	100	Good	0%	0%	0%	0	21
F95	TW A	TAXIWAY A	TAXIWAY	125	60,539	AC	100	Good	0%	0%	0%	0	13
F95	TW A2	TAXIWAY A2	TAXIWAY	110	18,034	AC	100	Good	0%	0%	0%	0	5



Figure 4.1.3 is an inset view of the 2019 Airfield Pavement Condition Index Exhibit that visually represents the results of the latest PCI Survey inspection. A large format exhibit is located in **Appendix C Technical Exhibits.**

Figure 4.1.3 2019 Airfield Pavement Condition Index Exhibit

4.2 Summary of Pavement Condition Evaluation Results

4.2.1 Network-Level Observations

The field PCI Survey performed at Calhoun County Airport (F95) was completed in September of 2018. The resulting overall area-weighted average PCI value was 85 representing a condition rating of Satisfactory. Calhoun County Airport is serviced by a single runway; Runway 18-36 is 75-ft wide and 3,100-ft long. Taxiway A and associated connectors were not inspected due to recent construction. The PCI has been set to 100, a condition rating of Good.

Based on the FAA 5010 Report as of 07/18/2019 the Airport has reported 2,000 operations for 12 months ending 03/05/2018.





4.2.2 Branch-Level Observations

The following branch-level observations are intended to be an overall summary of select pavement facilities identified during the PCI Survey; further detail at the section and samplelevel may be referenced for all pavements assessed as part of this System Update. The branchlevel observations discussed are limited to select branches based on use and condition.

Runway 18-36

Runway 18-36 consists of 2 sections constructed of AC and AAC. The last construction years range from 2012 to 2016. The area-weighted average PCI for Runway 18-36 is 85 representing a Satisfactory condition rating. The pavement distresses observed were related to Climate distress classifications. Distresses observed on Runway 18-36 consist of Longitudinal & Transverse Cracking, Raveling, and Weathering.

T-Hang Apron

The T-Hang Apron consists of 5 sections constructed of AC. The last construction years range from 2003 to 2007. The area-weighted average PCI for the T-Hang Apron is 67 representing a Fair condition rating. The pavement distresses observed were related to Climate and Other distress classifications. Distresses observed on the T-Hang Apron consist of Depression, Longitudinal & Transverse Cracking, Patching, Raveling, and Weathering.

General Aviation (GA) Apron

The GA Apron consists of 7 sections constructed of AC and PCC. The last construction years range from 2003 to 2016. The area-weighted average PCI for the GA Apron is 74 representing a Satisfactory condition rating. The pavement distresses observed were related to Climate, Load, and Other distress classifications. Distresses observed on the GA Apron consist of Depression, Longitudinal & Transverse Cracking, Patching, Raveling, Weathering, Corner Break, Linear Cracking, Joint Seal Damage, Scaling, Faulting, Shrinkage Cracking, Joint Spall, and Corner Spall.

Figure 4.2.2 Pavement Condition Summary by Facility Use

Facility Use	Area-Weighted Average PCI	Condition Rating
Runway	85	Satisfactory
Taxiway	100	Good
Apron	73	Satisfactory





4.3 Forecasted Pavement Conditions

4.3.1 Performance Models and Prediction Curves

Pavement Performance Models are developed from the distress data and historic construction records collected for the SAPMP. This data is consolidated in a database and organized by inspection/construction date, pavement type, age, and pavement use. The pavement Performance Models are used to develop broad Prediction Curves, alternatively known as deterioration curves or family curves. These Prediction Curves are utilized to developed forecasted PCI values based on historic trends and statistical models.

4.3.2 Branch-Level Pavement Condition Forecast

The following Figures 4.3.2 (a) through (c) depict the branch-level pavement condition forecast by Branch Use (Runway, Taxiway, and/or Apron). The forecasted conditions are for a 10-year duration starting in January 2020 through January 2029.

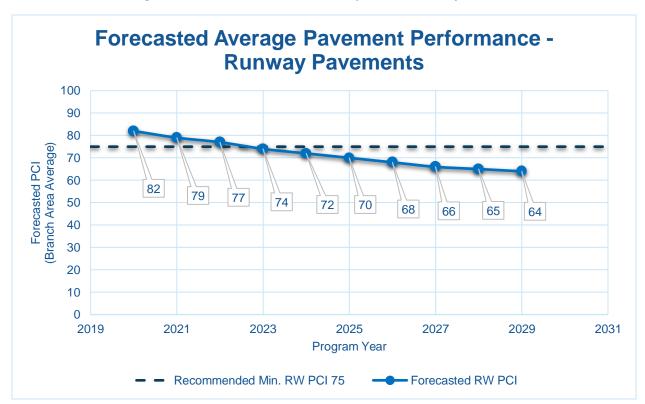


Figure 4.3.2 (a) Forecasted Runway Pavement Performance



Figure 4.3.2 (b) Forecasted Taxiway Pavement Performance


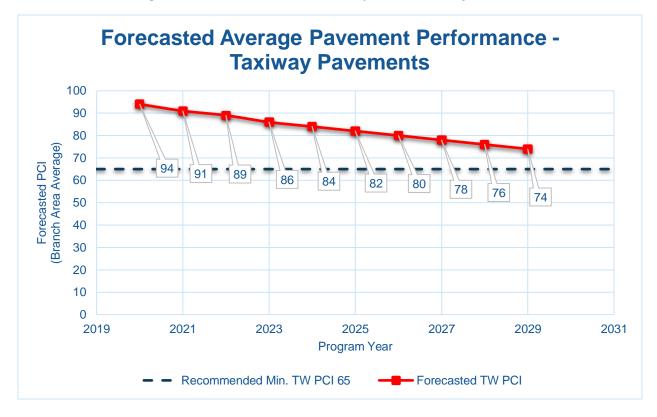


Figure 4.3.2 (c) Forecasted Apron Pavement Performance





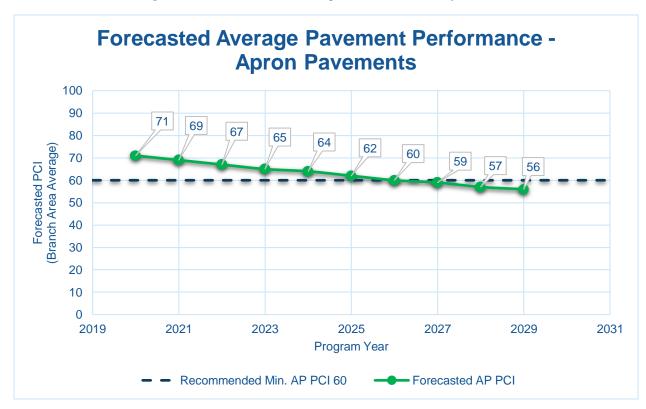

4.3.3 Section-Level Pavement Condition Forecast

The following **Table 4.3.3** provides detail to the forecasted PCI values for each section inspected. Please note the forecasted Branch- and Section-Level PCI's are for planning purposes and are subject to the sensitivities in changes in traffic and maintenance frequency. Airport staff should perform annual visual condition assessments to maintain recent understanding of pavement conditions.





Table 4.3.3 Forecasted PCI 2020-2029

Network	December 10	Section	Last DOL	Forecasted PCI									
ID	Branch ID	ID	Last PCI	2020	2021	2022	2023	2024	2025	2026	2027	2028	2029
F95	AP GA	4105	76	73	70	68	67	65	63	61	60	58	57
F95	AP GA	4110	57	54	53	51	50	48	46	45	43	42	40
F95	AP GA	4115	70	67	66	64	63	61	59	58	56	55	53
F95	AP GA	4120	86	82	79	77	75	72	70	68	66	65	63
F95	AP GA	4150	100	94	92	91	89	87	86	84	83	81	80
F95	AP GA	4160	100	94	92	91	89	87	86	84	83	81	80
F95	AP GA	4205	65	62	61	59	58	56	55	54	53	52	51
F95	AP HELIPAD	4305	89	85	82	80	77	75	73	70	68	67	65
F95	AP T-HANG	805	76	73	72	70	69	67	65	64	62	61	59
F95	AP T-HANG	806	76	73	72	70	69	67	65	64	62	61	59
F95	AP T-HANG	810	54	51	50	48	47	45	43	42	40	39	37
F95	AP T-HANG	905	57	54	53	51	50	48	46	45	43	42	40
F95	AP T-HANG	910	82	79	78	76	75	73	71	70	68	67	65
F95	RW 18-36	6105	85	81	79	76	74	72	69	68	66	64	63
F95	RW 18-36	6110	100	94	92	90	89	87	86	84	82	81	79
F95	TW A	120	100	91	89	86	84	81	79	77	75	74	72
F95	TW A	125	100	97	95	93	90	88	85	83	80	78	76
F95	TW A2	110	100	91	89	86	84	81	79	77	75	74	72





4.3.4 Forecasted PCI Considerations

As FDOT continues to update the SAPMP with future PCI Survey inspections and assembly of airfield pavement construction work history, the performance models will be further refined. With the refinement of additional PCI and work history data points, the forecasting of pavement conditions will continue to better reflect the performance trends of airfield pavements in the Florida Airports System. Forecasted or predicted pavement conditions for the airport are intended for planning purposes only. Design-level recommendations for pavement rehabilitation and/or reconstruction will require the appropriate application of the procedures defined in FAA AC 150/5320-6F Airport Pavement Design and Evaluation and AC 150/5370-11B Use of Nondestructive Testing in the Evaluation of Airport Pavements to determine structural and/or functional conditions at the time of project.







Chapter 5 - Localized Maintenance and **Repair Planning**

General Maintenance and Rehabilitation (M&R) methods are characterized under three broad categories: localized maintenance and repair, global treatments, and major rehabilitation.

- Localized Maintenance and Repair includes patching and crack sealing.
- > Global Treatments include surface seals and rejuvenators for flexible pavements.
- > Major Rehabilitation includes overlays, significant slab replacement, and reconstruction.

This chapter discusses the FDOT SAPMP Localized Maintenance and Repair Planning approach. Proactive localized maintenance and repair, specifically preservation, is highly recommended to the airports. However, it is certainly recognized that once pavements have deteriorated below a certain condition, the facility would benefit from a more substantial rehabilitation in lieu of localized efforts. Chapter 6 Major Rehabilitation Planning discusses the addressing of pavements through timely rehabilitation once it has deteriorated below a critical PCI where localized repairs may not be as cost effective.

5.1 Localized Maintenance and Repair

Localized maintenance and repair is best applied as a conservation measure and is oftentimes applied to slow the rate of deterioration of distressed pavements; however, may be applied as a temporary corrective measure in isolated areas. Localized maintenance and repair can be applied either as a safety ("stopgap") measure or preventive measure. Example distress types subject to localized preventive maintenance and repair may consist of low-severity longitudinal and transverse cracking and low-severity weathering. In many cases however, localized stopgap repair is applied as a safety measure to address high-severity distress manifestations when major rehabilitation is not funded for a given section with a PCI value below critical PCI. Some agencies may elect to define both types; preventative and stopgap, as localized maintenance.

Localized Stopgap/Safety Maintenance and Repair

Localized Stopgap or Safety Maintenance and Repair is defined as the localized distress repair needed to keep pavements operational in a safe condition. These activities are typically applied to high-severity distresses or distresses affecting operational activities. Typical pavement section PCIs will range from 0 to 65.

Localized Preventive Maintenance and Repair

Localized Preventive Maintenance and Repair is defined as distress maintenance activities performed with the primary objective of slowing the rate of deterioration. These activities typically include crack sealing and patching. Typical pavement section PCIs will be above 65.





5.2 Localized Maintenance and Repair Policy

The resulting Localized Maintenance and Repair recommendations are identified based on the policy defined in Table 5.2 (a) and Table 5.2 (b), for flexible asphalt concrete and rigid Portland cement concrete pavements, respectively. The activities identified were based on the research of practical pavement treatments in consideration of the FAA AC 150/5380-6C "Guidelines and Procedures for Maintenance of Airport Pavements" and the FDOT Airfield Pavement Distress Repair Manual. Additionally, the Engineering Technical Letter (ETL) 14-3: Preventive Maintenance Plan (PMP) for Airfield Pavements was referenced for conservative application of pavement treatments. The Localized Maintenance and Repair Policy and associated planning-level unit costs were developed in consideration of a network-level analysis – it is strictly intended to provide a glimpse of the condition of the airport pavements with a limited PCI survey effort.

The developed Localized Maintenance and Repair Policy and associated planning-level unit costs were based on a statewide consideration of pavement treatments and review of state construction costs for both Airfield Pavements and from the FDOT Historical Cost Information archives. Furthermore, a consideration of limited repair quantities was factored in the determination of conservative planning-level unit costs. The identified Localized maintenance activities for both preventive and stopgap activities are based on a statewide network approach; project-specific evaluation and maintenance quantities should be developed prior to any construction.

Table 5.2 (a) Localized Maintenance and Repair - Flexible Asphalt Concrete

Distress	Severity	Description	Code	Work Type	Work Unit
41	Low	ALLIGATOR CR	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
41	Medium	ALLIGATOR CR	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
41	High	ALLIGATOR CR	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
42	N/A	BLEEDING	FDOT-MO-PV	FDOT - MONITOR	N/A
43	Low	BLOCK CR	FDOT-MO-PV	FDOT - MONITOR	N/A
43	Medium	BLOCK CR	FDOT-CS-AC	FDOT - CRACK SEALING - AC	Ft
43	High	BLOCK CR	FDOT-PA-AP	FDOT - PATCHING - AC PARTIAL DEPTH	SqFt
44	Low	CORRUGATION	FDOT-ML-AC	FDOT - MILLING - AC	SqFt
44	Medium	CORRUGATION	FDOT-ML-AC	FDOT - MILLING - AC	SqFt
44	High	CORRUGATION	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
45	Low	DEPRESSION	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
45	Medium	DEPRESSION	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
45	High	DEPRESSION	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
46	N/A	JET BLAST	FDOT-PA-AP	FDOT - PATCHING - AC PARTIAL DEPTH	SqFt
47	Low	JT REF. CR	FDOT-MO-PV	FDOT - MONITOR	N/A
47	Medium	JT REF. CR	FDOT-CS-AC	FDOT - CRACK SEALING - AC	Ft
47	High	JT REF. CR	FDOT-CS-AC	FDOT - CRACK SEALING - AC	Ft





Distress	Severity	Description	Code	Work Type	Work Unit
48	Low	L&TCR	FDOT-MO-PV	FDOT - MONITOR	N/A
48	Medium	L&TCR	FDOT-CS-AC	FDOT - CRACK SEALING - AC	Ft
48	High	L&TCR	FDOT-CS-AC	FDOT - CRACK SEALING - AC	Ft
49	N/A	OIL SPILLAGE	FDOT-PA-AP	FDOT - PATCHING - AC PARTIAL DEPTH	SqFt
50	Low	PATCHING	FDOT-MO-PV	FDOT - MONITOR	N/A
50	Medium	PATCHING	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
50	High	PATCHING	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
51	N/A	POLISHED AG	FDOT-SS-LO	FDOT - SURFACE SEAL	SqFt
52	Low	RAVELING	FDOT-SS-LO	FDOT - SURFACE SEAL	SqFt
52	Medium	RAVELING	FDOT-PA-AP	FDOT - PATCHING - AC PARTIAL DEPTH	SqFt
52	High	RAVELING	FDOT-PA-AP	FDOT - PATCHING - AC PARTIAL DEPTH	SqFt
53	Low	RUTTING	FDOT-MO-PV	FDOT - MONITOR	N/A
53	Medium	RUTTING	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
53	High	RUTTING	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
54	Low	SHOVING	FDOT-MO-PV	FDOT - MONITOR	N/A
54	Medium	SHOVING	FDOT-ML-AC	FDOT - MILLING - AC	SqFt
54	High	SHOVING	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
55	N/A	SLIPPAGE CR	FDOT-PA-AP	FDOT - PATCHING - AC PARTIAL DEPTH	SqFt
56	Low	SWELLING	FDOT-MO-PV	FDOT - MONITOR	N/A
56	Medium	SWELLING	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
56	High	SWELLING	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
57	Low	WEATHERING	FDOT-MO-PV	FDOT - MONITOR	N/A
57	Medium	WEATHERING	FDOT-SS-LO	FDOT - SURFACE SEAL	SqFt
57	High	WEATHERING	FDOT-PA-AP	FDOT - PATCHING - AC PARTIAL DEPTH	SqFt

Table 5.2 (b) Localized Maintenance and Repair - Rigid Portland Cement Concrete

Distress	Severity	Description	Code	Work Type	Work Unit
61	Low	BLOW-UP	FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	SqFt
61	Medium	BLOW-UP	FDOT-PA-PF	FDOT - PATCHING - PCC FULL DEPTH	SqFt
61	High	BLOW-UP	FDOT-SL-PC	FDOT - SLAB REPLACEMENT - PCC	SqFt
62	Low	CORNER BREAK	FDOT-CS-PC	FDOT - CRACK SEALING - PCC	Ft
62	Medium	CORNER BREAK	FDOT-PA-PF	FDOT - PATCHING - PCC FULL DEPTH	SqFt
62	High	CORNER BREAK	FDOT-PA-PF	FDOT - PATCHING - PCC FULL DEPTH	SqFt
63	Low	LINEAR CR	FDOT-MO-PV	FDOT - MONITOR	N/A
63	Medium	LINEAR CR	FDOT-CS-PC	FDOT - CRACK SEALING - PCC	Ft
63	High	LINEAR CR	FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	SqFt





Distress	Severity	Description	Code	Work Type	Work Unit
64	Low	DURABIL. CR	FDOT-MO-PV	FDOT - MONITOR	N/A
64	Medium	DURABIL. CR	FDOT-PA-PF	FDOT - PATCHING - PCC FULL DEPTH	SqFt
64	High	DURABIL. CR	FDOT-SL-PC	FDOT - SLAB REPLACEMENT - PCC	SqFt
65	Low	JT SEAL DMG	FDOT-JS-PC	FDOT - JOINT SEAL - PCC	Ft
65	Medium	JT SEAL DMG	FDOT-JS-PC	FDOT - JOINT SEAL - PCC	Ft
65	High	JT SEAL DMG	FDOT-JS-PC	FDOT - JOINT SEAL - PCC	Ft
66	Low	SMALL PATCH	FDOT-MO-PV	FDOT - MONITOR	N/A
66	Medium	SMALL PATCH	FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	SqFt
66	High	SMALL PATCH	FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	SqFt
67	Low	LARGE PATCH	FDOT-MO-PV	FDOT - MONITOR	N/A
67	Medium	LARGE PATCH	FDOT-PA-PF	FDOT - PATCHING - PCC FULL DEPTH	SqFt
67	High	LARGE PATCH	FDOT-PA-PF	FDOT - PATCHING - PCC FULL DEPTH	SqFt
68	N/A	POPOUTS	FDOT-PO-FL	FDOT - POPOUT FILLER	SqFt
69	N/A	PUMPING	FDOT-SB-PC	FDOT – SLAB STABILIZATION - PCC	SqFt
70	Low	SCALING	FDOT-MO-PV	FDOT - MONITOR	N/A
70	Medium	SCALING	FDOT-PA-PP	-PP FDOT - PATCHING - PCC PARTIAL DEPTH	
70	High	SCALING	FDOT-SL-PC	FDOT - SLAB REPLACEMENT - PCC	SqFt
71	Low	FAULTING	FDOT-MO-PV	FDOT - MONITOR	N/A
71	Medium	FAULTING	FDOT-GR-PP	R-PP FDOT - GRINDING (LOCALIZED)	
71	High	FAULTING	FDOT-GR-PP	FDOT - GRINDING (LOCALIZED)	Ft
72	Low	SHAT. SLAB	FDOT-CS-PC	FDOT - CRACK SEALING - PCC	Ft
72	Medium	SHAT. SLAB	FDOT-SL-PC	FDOT - SLAB REPLACEMENT - PCC	SqFt
72	High	SHAT. SLAB	FDOT-SL-PC	FDOT - SLAB REPLACEMENT - PCC	SqFt
73	N/A	SHRINKAGE CR	FDOT-MO-PV	FDOT - MONITOR	N/A
74	Low	JOINT SPALL	FDOT-CS-PC	FDOT - CRACK SEALING - PCC	Ft
74	Medium	JOINT SPALL	FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	SqFt
74	High	JOINT SPALL	FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	SqFt
75	Low	CORNER SPALL	FDOT-CS-PC	FDOT - CRACK SEALING - PCC	Ft
75	Medium	CORNER SPALL	FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	SqFt
75	High	CORNER SPALL	FDOT-PA-PP	A-PP FDOT - PATCHING - PCC PARTIAL DEPTH	
76	Low	ASR	FDOT-MO-PV	FDOT - MONITOR	N/A
76	Medium	ASR	FDOT-PA-PF	FDOT - PATCHING - PCC FULL DEPTH	SqFt
76	High	ASR	FDOT-SL-PC	FDOT - SLAB REPLACEMENT - PCC	SqFt





Table 5.2 (c) Localized Repair Planning-Level Unit Costs - Flexible Asphalt Concrete

Code	Name	Cost	Units
FDOT-SS-LO	FDOT - SURFACE SEAL	\$0.55	SqFt
FDOT-ML-AC	FDOT - MILLING - AC	\$2.00	SqFt
FDOT-GR-PP	FDOT-GR-PP FDOT - GRINDING (LOCALIZED)		Ft
FDOT-CS-AC	FDOT-CS-AC FDOT - CRACK SEALING - AC		Ft
FDOT-MO-PV	FDOT-MO-PV FDOT - MONITOR		SqFt
FDOT-PA-AF	FDOT-PA-AF FDOT - PATCHING - AC FULL DEPTH		SqFt
FDOT-PA-AP	FDOT - PATCHING - AC PARTIAL DEPTH		SqFt

Table 5.2 (d) Localized M&R Planning-Level Unit Costs - Rigid Portland Cement Concrete

Code	Name	Cost	Units
FDOT-PA-PF	FDOT - PATCHING - PCC FULL DEPTH	\$100.00	SqFt
FDOT-SL-PC	FDOT - SLAB REPLACEMENT - PCC	\$30.00	SqFt
FDOT-SB-PC	FDOT - SLAB STABILIZATION - PCC	\$30.00	SqFt
FDOT-PA-PP	FDOT-PA-PP FDOT - PATCHING - PCC PARTIAL DEPTH		SqFt
FDOT-PO-FL	FDOT - POPOUT FILLER		SqFt
FDOT-GR-PP	FDOT-GR-PP FDOT - GRINDING (LOCALIZED)		Ft
FDOT-CS-PC	FDOT - CRACK SEALING - PCC	\$4.25	Ft
FDOT-MO-PV	FDOT-MO-PV FDOT - MONITOR		N/A
FDOT-JS-PC	FDOT-JS-PC FDOT - JOINT SEAL - PCC		Ft

^{*}PCC Patching (Full Depth and Partial Depth) consider high-early-strength and high-performing repair material.





5.3 Localized Maintenance and Repair Analysis and Recommendations

The SAPMP provides a planning-level estimation of Localized Maintenance and Repair based on the results of the latest PCI Survey Inspection performed at the airport. Based on the limited sample units inspected, a statistical extrapolation of distresses at the section level is used to estimate the quantities of recommended repair activities based on the policies defined in 5.2 Localized M&R Policy. The PCI Survey Inspections did not consist of 100% inspection of all sample units; therefore, the section-level distress quantities used to estimate the Localized Maintenance and Repair needs are for conceptual planning purposes. The accuracy of the extrapolated distresses, and therefore work quantities, is subject to the amount of sample units inspected and the concentration of distress types observed in sample units. Appendix B provides the estimated Localized Maintenance and Repair based on this SAPMP's PCI Survey Inspection efforts. Localized Preventive Maintenance and Repair is typically applied to pavements that are in a condition at or above the Critical PCI of 65. Localized Stopgap Maintenance and Repair is typically applied to pavements that are below the Critical PCI of 65. It is recommended that airport staff evaluate the application of Localized Maintenance and Repair in concert with the planning of Major Rehabilitation efforts identified in Chapter 6 Major Rehabilitation Planning. Pavements with Stopgap recommendations that are subject to nearterm Major Rehabilitation efforts may remove the need to perform localized maintenance efforts.

The following **Table 5.3 (a)** summarizes the anticipated Localized Maintenance and Repair efforts based on the PCI Survey Inspection efforts performed at this airport as part of this SAPMP System Update. The following table depicts planning-level costs rounded to the nearest ten dollars.

Table 5.3 (a) Summary of Airport Localized M&R Planning Cost and Quantity at Network Level

Work Description	Work Category	Rough Estimate of Work Quantity	Work Units	Planni	ng Material Cost
FDOT - JOINT SEAL - PCC	PREVENTIVE	13,610	Ft	\$	37,420.00
FDOT - CRACK SEALING - PCC	PREVENTIVE	95	Ft	\$	400.00
FDOT - SURFACE SEAL	PREVENTIVE	6,470	SqFt	\$	3,560.00
FDOT - PATCHING - AC FULL DEPTH	PREVENTIVE	3,005	SqFt	\$	18,020.00
FDOT - CRACK SEALING - AC	PREVENTIVE	240	Ft	\$	720.00
FDOT - PATCHING - PCC PARTIAL DEPTH	PREVENTIVE	60	SqFt	\$	4,260.00
FDOT - SURFACE SEAL	STOPGAP	13,900	SqFt	\$	7,650.00
FDOT - CRACK SEALING - AC	STOPGAP	995	Ft	\$	2,990.00
FDOT - PATCHING - AC FULL DEPTH	STOPGAP	3,360	SqFt	\$	20,150.00
FDOT - PATCHING - PCC PARTIAL DEPTH	STOPGAP	15	SqFt	\$	770.00
FDOT - CRACK SEALING - PCC	STOPGAP	5	Ft	\$	10.00
FDOT - JOINT SEAL - PCC	STOPGAP	2,975	Ft	\$	8,190.00





The following **Table 5.3 (b)** provides further breakdown of the anticipated planning-level cost at the section level for the pavements exhibiting distresses that would benefit from Localized M&R. The table shows the approximate improved "End Condition" of the section after the application of Localized M&R. The following table depicts planning-level costs rounded to the nearest ten dollars.

Table 5.3 (b) Summary of Airport Localized M&R Planning Cost and Quantity at Section Level

Network ID	Branch ID	Section ID	Area (SF)	Start Condition	End Condition	Cost
F95	AP GA	4105	78,381	76	81	\$ 32,880.00
F95	AP GA	4110	39,362	57	73	\$ 20,510.00
F95	AP GA	4115	40,207	70	81	\$ 16,510.00
F95	AP GA	4120	27,973	86	88	\$ 7,870.00
F95	AP GA	4150	9,900	100	100	\$ -
F95	AP GA	4160	9,969	100	100	\$ -
F95	AP GA	4205	10,930	65	74	\$ 8,970.00
F95	AP HELIPAD	4305	4,850	89	96	\$ 1,350.00
F95	AP T-HANG	805	2,520	76	85	\$ 550.00
F95	AP T-HANG	806	2,820	76	84	\$ 570.00
F95	AP T-HANG	810	5,700	54	62	\$ 3,100.00
F95	AP T-HANG	905	6,468	57	71	\$ 7,180.00
F95	AP T-HANG	910	6,140	82	85	\$ 760.00
F95	RW 18-36	6105	269,775	85	88	\$ 3,950.00
F95	RW 18-36	6110	9,975	100	100	\$ -
F95	TW A	120	93,205	100	100	\$ -
F95	TW A	125	60,539	100	100	\$ -
F95	TW A2	110	18,034	100	100	\$ -

The following Table 5.3 (c) provides a summary of the anticipated planning-level costs for Localized Preventive Maintenance and Repair and Localized Stopgap Maintenance and Repair. The following table depicts planning-level costs rounded to the nearest ten dollars.

Table 5.3 (c) Summary of Localized Maintenance

Work Category	Cost		
Preventive	\$	64,380.00	
Stopgap	\$	39,760.00	
Planning-Level Localized M&R Needs =	\$	104,140.00	









Chapter 6 – Major Rehabilitation **Planning**

6.1 Major Rehabilitation

Major rehabilitation is recommended to correct or improve structural deficiencies and/or functional deterioration for pavement sections within a network. Often, when pavements are subject to significant changes in the aircraft fleet mix (frequency and type), major rehabilitation is required to provide a pavement section to meet the traffic demand. Major rehabilitation is recommended when a pavement section falls below the Critical PCI value that is defined during the system customization or if a pavement section has a significant observation of load-related distress. Observation of any load-related distress potentially indicates that the section may be structurally deficient or that the aircraft loads being applied to the pavement section are different than what the section was designed for. Figures 6.1 (a) and 6.1 (b) depict the decision process for major rehabilitation project identification with the assumption of available funds. Should funding be unavailable for pavement sections in need of major rehabilitation, the airport may elect to apply the appropriate localized stopgap repair.

Figure 6.1 (a) Major Rehabilitation Planning Decision Diagram, PCI ≤ Critical PCI


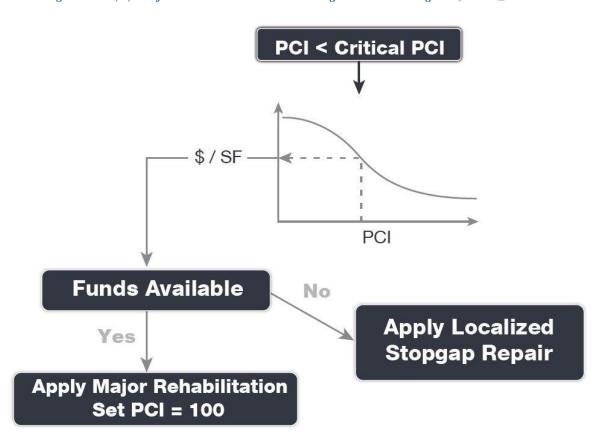




Figure 6.1 (b) Major Rehabilitation Planning Decision Diagram, PCI > Critical PCI



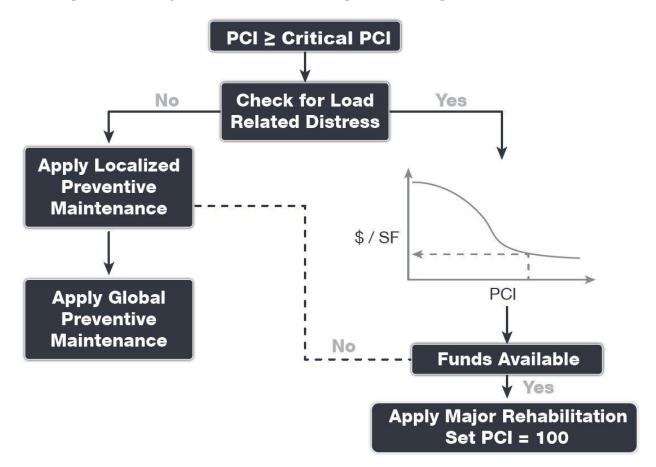

6.1.1 Critical PCI

For the FDOT SAPMP the development of a major rehabilitation program is based on the Critical PCI concept. The Critical PCI concept assumes that it is more cost-effective to maintain pavements above, rather than below their critical PCI. It is assumed that once a pavement section deteriorates to the Critical PCI value that it is more cost-effective to complete a major rehabilitation project rather than continuing to apply preventive maintenance. This method includes defining the Critical PCI and introducing major rehabilitation work types.

Identification of annual and long-range Major Rehabilitation work plans are typically based on the Critical PCI concept. The Critical PCI is defined as the PCI value at which the rate of loss (deterioration) increases with time, or the cost of applying localized maintenance and repair increases or is not effective. A Critical PCI is usually within a range of 55 and 70; the following procedure is standard approach in developing a specific Critical PCI:

- 1. Develop a pavement performance model and refine a prediction model for the pavements considered.
- 2. Select a localized maintenance and repair policy to be used in developing a work
- Apply the selected localized policy to the pavement sections for a range of PCI.
- 4. Compute the unit cost per area for each PCI range.
- 5. Plot the cost versus the PCI.
- 6. Determine the Critical PCI based on the point where the cost is insignificant.

The FDOT SAPMP defines the Critical PCI at 65 – this is based on the historic trends in pavement performance and Statewide planning efforts.

6.1.2 FDOT Recommended Minimum Service-Level PCI

The FDOT has recommended *Minimum Service-Level PCI* for airports' airfield pavements based on the following characteristics; airport type within FDOT SAPMP, branch use, and expected aircraft operations. For the purposes of Major Rehabilitation, the Critical PCI is typically the threshold condition that triggers major construction, however it is recommended that the airports maintain the Minimum Service-Level PCI with a combination of Localized Maintenance and Repair and timely Major Rehabilitation. Table 6.1.2 summarizes the FDOT Recommended Minimum Service-Level PCI.

Table 6.1.2 FDOT Recommended Minimum Service-Level PCI

Branch Use	FDOT Recommended PCI	Additional Consideration	
Runway	75	Aircraft Fleet Mix Changes Primary Runway	
Taxiway / Taxilane	65	Aircraft Fleet Mix Changes Expected Operations	
Aprons / Run-Ups / Ramps	60	Ground Service Equipment Non-Aircraft Operations (e.g. fueling)	





6.2 Major Rehabilitation Policy

6.2.1 Major Rehabilitation Pavement Section Development

The review of the existing as-built record documentation within the participating airports' archives was used as the basis of the conceptual pavement design sections. Refinement of the pavement section layers was performed in consideration of the FAA AC 150/5320-6F "Airport Pavement Design and Evaluation." It should be noted that no subsurface geotechnical investigation, ALTA/ACSM Survey, topographic survey, utilities survey, environmental, or site specific air traffic study(s) have been utilized in the development of the design criteria. No warranty or assurance is implied in this document for final design nor construction for any airfield pavements discussed within this report. The following Tables 6.2.1 (a) and (b) provide details on the conceptual pavement sections developed for this study.

Major rehabilitation is divided into two policy categories as part of this program: Full-Depth Reconstruction (Reconstruction) and Intermediate-Level Major Rehabilitation (Restoration). Based on the pavement type, the general categories are defined as AC Reconstruction and AC Restoration for AC, AAC, and APC flexible pavement types and PCC Reconstruction and PCC Restoration for PCC rigid pavement types. The pavement sections have been based on the average GA Airport Type requirements; no pavement design has been performed in accordance with AC 150/5320-6F for the determined conceptual sections.

Table 6.2.1 (a) Conceptual Pavement Section for Major Rehabilitation - Flexible Asphalt Concrete

Rehabilitation Type	General Aviation (GA) Airport
AC Restoration Combination of asphalt pavement milling and overlay with 25% of the areas subject to full-depth reconstruction. PCI = 41 to 65	P-101 AC Milling (2") P-603 Bituminous Tack P-401 (HMA) (2") 25% AC Reconstruction P-101 Pavement Removal P-152 Subgrade (12") P-211 Base (6") P-602 Bituminous Prime P-603 Bituminous Tack P-401 HMA (2") Excludes any paved shoulder features.
AC Reconstruction Full-depth asphalt pavement section reconstruction.	P-101 Pavement Removal P-152 Subgrade (12") P-211 Base (6") P-602 Bituminous Prime P-603 Bituminous Tack P-401 HMA (2")
PCI = 40 or less	Excludes any paved shoulder features.



Table 6.2.1 (b) Conceptual Pavement Section for Major Rehabilitation - Rigid Portland Cement Concrete

Rehabilitation Type	General Aviation (GA) Airport
PCC Restoration Restoration of PCC pavement with a combination of crack sealing, joint seal replacement, and replacement of 25% of slab panels.	P-101 Pavement Removal P-605 Joint Seal Repair P-152 Subgrade (6") P-211 Base (if needed, typical) (6") P-501 Rigid PCC (10")
PCI = 41 to 65	*Select Slabs (25%) **Crack Seal and Limited Patching
PCC Reconstruction Full-depth rigid pavement section reconstruction.	P-101 Pavement Removal P-605 Joint Seal Repair P-152 Subgrade (6") P-211 Base (6") P-501 Rigid PCC (10")
PCI = 40 or less	

The identification of rehabilitation needs and conceptual pavement sections have been determined at the planning level. Design-level investigation is recommended prior to developing construction-level design documents and budgets.

In compliance with FAA Grant Assurances 11 and 19, the FDOT SAPMP provides airports with airfield pavement evaluation reports in accordance with FAA AC 150/5380-7B Airport Pavement Management Program (PMP) and AC 150/5380-6C Guidelines and Procedures for Maintenance of Airport Pavements. The application of the results of a PCI survey are for planning purposes and are limited to the visual observation of deteriorated pavements in limited sampling; design-level investigation is recommended in accordance with the FAA procedures defined in AC 5320-6F Airport Pavement Design and Evaluation and AC 150/5370-11B Use of Nondestructive Testing in the Evaluation of Airport Pavements. The aforementioned ACs provide the design-level material properties of in-situ pavement and subgrade layers for the determination of appropriate rehabilitation actions. The FDOT SAPMP is organized to provide airports with planning-level data and does not intend to preclude the responsible engineer in performing the appropriate level of investigation and analysis in determining the appropriate design details of a pavement rehabilitation. It would not be advisable to solely base design-level rehabilitation without the appropriate level of investigation and determination of pavement deterioration beyond that of a visual functional condition assessment.

The recommendations identified in the Major Rehabilitation Needs consider the FAA AC 150/5370-10H Standard Specifications for Construction of Airports when determining the appropriate materials and methods implemented for construction projects, such as pavement rehabilitation, on airports. It should be noted that the AC 150/5370-10H Standard Specifications for Construction of Airports was updated in December of 2018. Design-level determination of project specific specifications based on the AC should be developed by the Airport when performing applicable construction projects.





6.2.2 Major Rehabilitation Planning-Level Unit Costs

Planning-level opinion of probable construction unit costs developed for this System Update was based on archived bid tabulations and records from airfield pavement projects provided by participating airports. A review of cost trends and cost factors have been incorporated to assist airports in planning for project budgets. Neither FDOT nor the Consultant Team has control over the cost of labor, materials, equipment, or over the Contractor's methods of determining prices or over competitive bidding or market conditions. Opinions of probable construction costs provided herein are based on the information known to FDOT at this time and represent only the Consultant Team's judgment as a design professional familiar with the construction industry. This report cannot and does not guarantee that proposals, bids, or actual construction costs will not vary from its opinions of probable construction costs.

Table 6.2.2 General Aviation Major Rehabilitation Planning-Level Unit Cost by Pavement Type

Rehabilitation Type	bilitation Type PCI Range		e Asphalt Cost Per SF	Rigid Portland Cement Concrete Cost per SF		
Restoration	41 to 65	\$	7.00	\$	10.00	
Reconstruction	0 to 40	\$	9.00	\$	15.00	

Planning-level opinion of probable construction unit costs consider factors for non-pavement improvements, QA/QC testing, and administrative costs.

6.3 Major Rehabilitation Needs

The objective of the major pavement rehabilitation needs analysis is to provide planning-level projects within an airport's airfield pavement network. Major rehabilitation activities are recommended when a payement section has deteriorated below the Critical PCI value, a point at which localized maintenance and repair activities may not be the most cost-effective solution. In addition, major rehabilitation is also recommended when the Section PCI is at or above the Critical PCI but the section has significant load-related PCI distresses. Identification of rehabilitation needs is done at the Airfield Pavement Network Definition's section level. This however does not limit the airport from further refining limits of project planning areas.

Major rehabilitation is identified within the FDOT SAPMP as major construction activity that would result in an improvement or resetting of the pavement section's PCI to a value of 100. Major rehabilitation recommendations (AC Restoration, AC Reconstruction, PCC Restoration, and PCC Reconstruction) should be considered as planning-level only. Additional design-level investigation in accordance to the FAA Advisory Circulars will be required. Recommendations identified within this planning document do not imply final design.

6.3.1 10-Year Unconstrained Budget Major Rehabilitation Needs

An unconstrained budget (unlimited budget) is performed for a 10-year duration to identify pavement rehabilitation needs based on current or forecasted PCI values deteriorating below the Critical PCI. FDOT recognizes airports are constrained by budgets and does not intend to convey an unrealistic approach of addressing pavement rehabilitation. The intent of the 10-Year Major Rehabilitation Needs analysis is to identify pavements that will warrant rehabilitation. It is highly recommended that airport staff utilize this information in support of the development of a practical Capital Improvement Program based on priorities, further design/project-level





investigation, and budgetary constraints. The following Table 6.3.1 summarizes all identified section-level major rehabilitation needs forecasted for the next 10-year period. It should be noted that the following table depicts planning-level costs and have been rounded for planning purposes.

Table 6.3.1 10-Year Major Rehabilitation Needs

Program Year	Network ID	Branch ID	Section ID	Surface	Area (SF)	PCI Before	Rehabilitation Type	Pla	Planning Cost	
2020	F95	AP GA	4110	AC	39,362	54	AC Restoration	\$	276,000.00	
2020	F95	AP GA	4205	PCC	10,930	62	PCC Restoration	\$	110,000.00	
2020	F95	AP T-HANG	810	AC	5,700	51	AC Restoration	\$	40,000.00	
2020	F95	AP T-HANG	905	AC	6,468	54	AC Restoration	\$	46,000.00	
2022	F95	AP GA	4115	AC	40,207	64	AC Restoration	\$	282,000.00	
2025	F95	AP GA	4105	PCC	78,381	63	PCC Restoration	\$	784,000.00	
2026	F95	AP T-HANG	805	AC	2,520	64	AC Restoration	\$	18,000.00	
2026	F95	AP T-HANG	806	AC	2,820	64	AC Restoration	\$	20,000.00	
2028	F95	RW 18-36	6105	AAC	269,775	64	AC Restoration	\$	1,889,000.00	
2029	F95	AP GA	4120	PCC	27,973	63	PCC Restoration	\$	280,000.00	

^{*}All values have been rounded to the nearest thousand-dollar.

The following Figure 6.3.1 (a) summarizes the section-level major rehabilitation needs for a 10year period between 2020 and 202*. Figure 6.3.1 (b) provides an inset view of Airfield Pavement Major Rehabilitation Exhibit, a large format exhibit is located in Appendix C Technical Exhibits. The exhibit graphically depicts the Major Rehabilitation Needs with rounded costs.

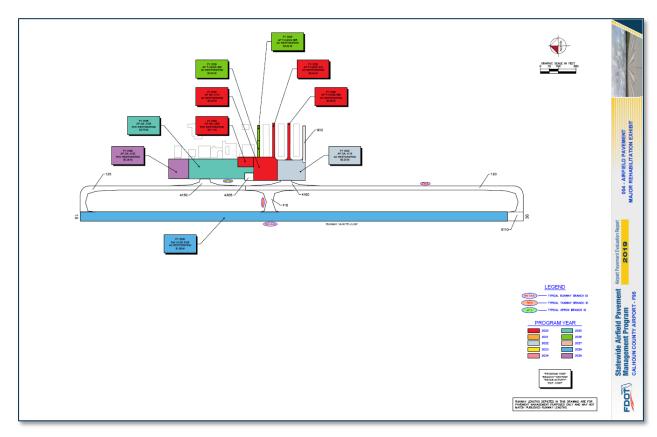




Figure 6.3.1 (a) 10-Year Major Rehabilitation Needs by Program Year



Figure 6.3.1 (b) 10-Year Major Rehabilitation Needs by Program Year Exhibit





Chapter 7





Chapter 7 – Conclusion

7.1 Recommendations

7.1.1 Continued PCI Survey Inspections

It is recommended that the airport continue to perform regularly scheduled PCI Survey inspections in accordance with the ASTM D5340-12 (or latest edition) to monitor the condition of the airfield pavement facilities.

A high priority should be considered for continuous maintenance record keeping and reinspection of all the airport's maintained pavement facilities to ensure continued safe aircraft operations. A series of scheduled periodic inspections must be carried out for an effective maintenance program. Re-inspection of pavements should be scheduled in a timely manner to ensure that all areas, particularly those that may not come under day-to-day observation, are thoroughly evaluated and reported.

7.1.2 Localized Maintenance and Repair

While deterioration of the pavements due to usage and exposure to the environment cannot be completely prevented, applying timely and effective maintenance efforts can slow the anticipated rate of deterioration. Lack of adequate and timely maintenance is the significant factor in pavement deterioration.

It is recommended that airport sponsors coordinate with their respective Airport Maintenance staff and Airport Engineer when developing project-level maintenance and repair efforts.

7.1.3 Major Rehabilitation

Chapter 6 – Major Rehabilitation Planning identified major pavement rehabilitation project needs from 2020-2029. The identification of the rehabilitation needs was performed at the section level for manageable project areas with the assumption of an unconstrained budget scenario. Given the uncertainty in the airport-specific budget information and prioritization goals, the unconstrained budget scenario was performed to evaluate the worst-case scenario and identify all the inspected pavements' needs in a 10-year period. Certainly, it is understood that most airports are faced with constrained budgets; further evaluation of projects based on prioritization, operational criticality, funding availability, and practicality is recommended.

7.1.4 Pavement Management System

The following recommendations are made to fully implement an effective pavement management program for the airport:

- Develop a detailed preventive maintenance program for the airport.
- Further refine and implement the identified 10-year major rehabilitation needs.
- Maintain detailed records on pavement maintenance, construction, and inspection.
- Maintain records on major pavement construction projects (year, scope, cost, and construction documents).





7.2 Supporting Documents

001 - Airfield Pavement Network Definition Exhibit

The Airfield Pavement Network Definition Exhibit is located in **Appendix C Technical Exhibits**. The exhibit depicts the airfield layout in a manner that defines the airfield pavement infrastructure as branches, sections, and sample units in accordance with the ASTM D5340-12. The exhibit is intended for planning purposes only – further detail on facilities can be found on the Airport's adopted Airport Layout Plan. Detailed characteristics are tabulated in Appendix A **Pavement Analysis Tables.**

002 - Airfield Pavement System Inventory Exhibit

The Airfield Pavement System Inventory Exhibit in is located in Appendix C Technical Exhibits. The exhibit depicts any recent and/or anticipated construction activity within the airfield pavement facilities reported by airport staff. The exhibit is intended to schematically identify the pavement limits of works and general work description. The information reported on the Airport Response Form provided by each participating airport was used as the basis of the changes; furthermore, changes are confirmed at the airport with airport staff during the in-brief and debrief meeting.

003 - Airfield Pavement Condition Index Exhibit

The Airfield Pavement Condition Index Exhibit is located in Appendix C Technical Exhibits. The exhibit is a visual summary of the latest conditions calculated from the results of the PCI Survey performed at the airport. The analysis of the distresses surveyed in accordance with the ASTM D5340-12 (referenced in Appendix E Inspection Distress Details) were analyzed using PAVER™ software to determine PCI values. The PCI values are identified in the exhibit and graphically represented using the standard ASTM D5340-12 colors for condition rating categories.

004 - Airfield Pavement Major Rehabilitation Exhibit

The Airfield Pavement Major Rehabilitation Exhibit is located in **Appendix C Technical Exhibits**. The exhibit has been prepared based on the section condition analysis, pavement condition forecasts, and major rehabilitation needs analysis. The exhibit graphically depicts the inventory with the associated rehabilitation type activity, program year, and the planning-level costs. The area limits, rehabilitation type, and planning-level costs should not be considered a design-level recommendation. A tabulation of the 10-Year Major Rehabilitation is located in Appendix B Airfield Pavement Localized Maintenance and Repair and Major Rehabilitation.

Inspection Photograph Documentation

Representative field conditions from the PCI Survey are documented with digital photographs located in Appendix D Inspection Photograph Documentation. Select photographs are provided with limited caption on the distresses observed – the Appendix does not contain photographs for every sample unit.

Statewide Airfield Pavement Management Program

Airport Pavement Evaluation Report

2019

Calhoun County Airport (F95)





7.3 Conclusion

The FDOT SAPMP Update Phase 2 2018-2019 was completed for the airport on behalf of the FDOT ASO in accordance with the Advisory Circulars 150/5380-7B "Airport Pavement Management Program (PMP)" and 150/5380-6C "Guidelines and Procedures for Maintenance of Airport Pavements." FDOT's implementation of the SAPMP has assisted public airports with this requirement in performing PCI survey inspections and analysis in accordance with the ASTM D5340-12 "Standard Test Method for Airport Pavement Condition Index Surveys."



Appendix A

Airfield Pavement Analysis Tables

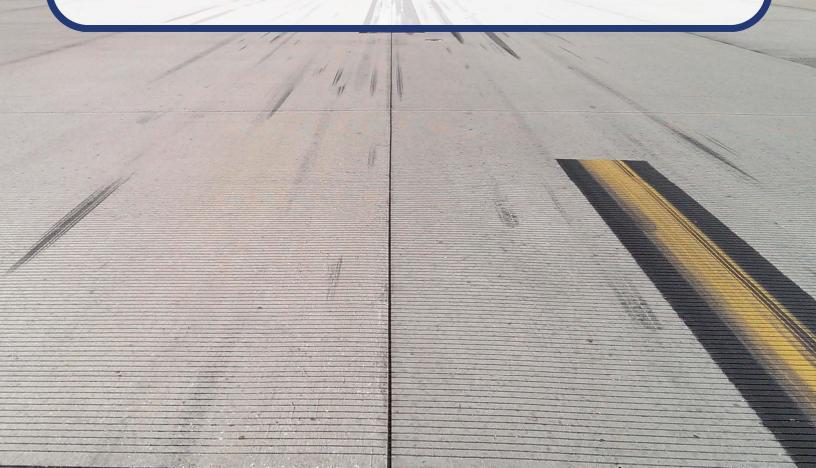






Table A-1 Pavement System Inventory Details

Network ID	Branch Name	Branch ID	Branch Use	Section ID	Length (FT)	Width (FT)	Area (SF)	Surface Type	Est. Last Construction Date
F95	GA APRON	AP GA	APRON	4105	545	167	78,381	PCC	1/1/2012
F95	GA APRON	AP GA	APRON	4110	210	200	39,362	AC	1/1/2003
F95	GA APRON	AP GA	APRON	4115	235	173	40,207	AC	1/1/2007
F95	GA APRON	AP GA	APRON	4120	168	167	27,973	PCC	1/1/2015
F95	GA APRON	AP GA	APRON	4150	96	60	9,900	AC	6/1/2019
F95	GA APRON	AP GA	APRON	4160	95	47	9,969	AC	6/1/2016
F95	GA APRON	AP GA	APRON	4205	150	250	10,930	PCC	1/1/2003
F95	HELIPAD APRON	AP HELIPAD	APRON	4305	75	65	4,850	PCC	1/1/2003
F95	T-HANG APRON	AP T-HANG	APRON	805	126	20	2,520	AC	1/1/2006
F95	T-HANG APRON	AP T-HANG	APRON	806	141	20	2,820	AC	1/1/2003
F95	T-HANG APRON	AP T-HANG	APRON	810	270	25	5,700	AC	1/1/2003
F95	T-HANG APRON	AP T-HANG	APRON	905	350	20	6,468	AC	1/1/2007
F95	T-HANG APRON	AP T-HANG	APRON	910	307	20	6,140	AC	1/1/2007
F95	RUNWAY 18-36	RW 18-36	RUNWAY	6105	3,597	75	269,775	AAC	1/1/2012
F95	RUNWAY 18-36	RW 18-36	RUNWAY	6110	133	75	9,975	AC	6/1/2016
F95	TAXIWAY A	TW A	TAXIWAY	120	2,450	35	93,205	AC	6/1/2016
F95	TAXIWAY A	TW A	TAXIWAY	125	1,575	35	60,539	AC	6/1/2019
F95	TAXIWAY A2	TW A2	TAXIWAY	110	185	74	18,034	AC	6/1/2016



Table A-2 Pavement Condition Index Summary (Last Inspection) - Section Level

Network ID	Branch Name	Branch Use	Section ID	Area (SF)	PCI	Condition Rating
F95	RUNWAY 18-36	RUNWAY	6105	269,775	85	Satisfactory
F95	RUNWAY 18-36	RUNWAY	6110	9,975	100	Good
F95	TAXIWAY A	TAXIWAY	120	93,205	100	Good
F95	TAXIWAY A	TAXIWAY	125	60,539	100	Good
F95	TAXIWAY A2	TAXIWAY	110	18,034	100	Good
F95	T-HANG APRON	APRON	805	2,520	76	Satisfactory
F95	T-HANG APRON	APRON	806	2,820	76	Satisfactory
F95	T-HANG APRON	APRON	810	5,700	54	Poor
F95	T-HANG APRON	APRON	905	6,468	57	Fair
F95	T-HANG APRON	APRON	910	6,140	82	Satisfactory
F95	GA APRON	APRON	4105	78,381	76	Satisfactory
F95	GA APRON	APRON	4110	39,362	57	Fair
F95	GA APRON	APRON	4115	40,207	70	Fair
F95	GA APRON	APRON	4120	27,973	86	Good
F95	GA APRON	APRON	4150	9,900	100	Good
F95	GA APRON	APRON	4160	9,969	100	Good
F95	GA APRON	APRON	4205	10,930	65	Fair
F95	HELIPAD APRON	APRON	4305	4,850	89	Good





Table A-3 Forecasted PCI 2020-2029

Network	Branch ID	Section	Last					Forecas	sted PCI				
ID	Branch ID	ID	PCI	2020	2021	2022	2023	2024	2025	2026	2027	2028	2029
F95	AP GA	4105	76	73	70	68	67	65	63	61	60	58	57
F95	AP GA	4110	57	54	53	51	50	48	46	45	43	42	40
F95	AP GA	4115	70	67	66	64	63	61	59	58	56	55	53
F95	AP GA	4120	86	82	79	77	75	72	70	68	66	65	63
F95	AP GA	4150	100	99	97	95	94	92	91	89	87	86	84
F95	AP GA	4160	100	94	92	91	89	87	86	84	83	81	80
F95	AP GA	4205	65	62	61	59	58	56	55	54	53	52	51
F95	AP HELIPAD	4305	89	85	82	80	77	75	73	70	68	67	65
F95	AP T-HANG	805	76	73	72	70	69	67	65	64	62	61	59
F95	AP T-HANG	806	76	73	72	70	69	67	65	64	62	61	59
F95	AP T-HANG	810	54	51	50	48	47	45	43	42	40	39	37
F95	AP T-HANG	905	57	54	53	51	50	48	46	45	43	42	40
F95	AP T-HANG	910	82	79	78	76	75	73	71	70	68	67	65
F95	RW 18-36	6105	85	81	79	76	74	72	69	68	66	64	63
F95	RW 18-36	6110	100	94	92	90	89	87	86	84	82	81	79
F95	TW A	120	100	91	89	86	84	81	79	77	75	74	72
F95	TW A	125	100	98	96	94	91	89	86	84	81	79	77
F95	TW A2	110	100	91	89	86	84	81	79	77	75	74	72

O	121	1/2	Λ1	0
ч.	/ Z.I	1/ Z	W 1	У

Page 1 of 4

Pavement Database: FDOT

Network:	CALHOU	N COUNT Branch: AP G	A GA Al	PRON	Section:	4105 Surface:PCC
L.C.D. 1/1/20	012 Us	se: APRON Rank: P	Length: 545	.00 (Ft) Wi	dth: 167.0	0 (Ft) True Area: 78381.00002 (SqFt
	Work			Thickness	Major	(24)
Work Date	Code	Work Description	Cost	(in)	M&R	Comments
1/1/2012	NU-IN	New Construction - Initial	0.00	0.00	V	2012 EST. PVMT SECTION UNKN
		1	•			
Network:	CALHOU	N COUNT Branch: AP G	A GA Al	PRON	Section:	4110 Surface:AC
L.C.D. 1/1/20	003 Us	se: APRON Rank: P	Length: 210	.00 (Ft) Wi	dth: 200.0	0 (Ft) True Area: 39362 (SqFt
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2003	NU-IN	New Construction - Initial	0.00	0.00	V	2003 EST. PVMT SECTION UNKN
Network:	CALHOU	N COUNT Branch: AP G	A GA Al	PRON	Section:	4115 Surface:AC
L.C.D. 1/1/20	007 Us	se: APRON Rank: P	Length: 235	.00 (Ft) Wi	dth: 173.0	0 (Ft) True Area: 40207.00001 (SqFt
Walb	Work			Thickness	Major	
Work Date	Code	Work Description	Cost	(in)	M&R	Comments
1/1/2007	NU-IN	New Construction - Initial	0.00	0.00		2007 EST. PVMT SECTION UNKN
Network:	CALHOU	N COUNT Branch: AP G	A GA Al	PRON	Section:	4120 Surface:PCC
L.C.D. 1/1/20	015 Us	se: APRON Rank: P	Length: 168	.00 (Ft) Wi	dth: 167.0	0 (Ft) True Area: 27973.00000 (SqFt
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2015	NC-PC	New Construction - PCC	0.00	0.00	V	UNKNOWN
		·	-			
Network: L.C.D. 6/1/20 Work Date	019 Us Work			Thickness	Major	4150 Surface:AC 0 (Ft) True Area: 9900.000003 (SqFt Comments
L.C.D. 6/1/20 Work Date	019 Us Work Code	se: APRON Rank: P Work Description	Length: 96 Cost	Thickness (in)	dth: 60.0 Major M&R	0 (Ft) True Area: 9900.000003 (SqFt Comments
L.C.D. 6/1/20 Work Date 6/1/2019	Work Code CR-AC	Work Description Complete Reconstruction - AC	Cost 49,500.00	Thickness (in)	Major M&R	0 (Ft) True Area: 9900.000003 (SqFt Comments 2" P-401, 10" P-209, P-152
L.C.D. 6/1/20 Work Date	019 Us Work Code	se: APRON Rank: P Work Description	Length: 96 Cost	Thickness (in)	dth: 60.0 Major M&R	0 (Ft) True Area: 9900.000003 (SqFt Comments
Work Date 6/1/2019 1/1/2007	Work Code CR-AC NU-IN	Work Description Complete Reconstruction - AC New Construction - Initial	Cost 49,500.00 0.00	.00 (Ft) Wi Thickness (in) 0.00 0.00	Major M&R	0 (Ft) True Area: 9900.000003 (SqFt Comments 2" P-401, 10" P-209, P-152 2007 EST. PVMT SECTION UNKN
L.C.D. 6/1/20 Work Date 6/1/2019 1/1/2007 Network:	Work Code CR-AC NU-IN	Work Description Complete Reconstruction - AC New Construction - Initial N COUNT Branch: AP G	Cost 49,500.00 0.00 A GA Al	Thickness (in) 0.00 0.00 0.00 PRON	Major M&R	0 (Ft) True Area: 9900.000003 (SqFt Comments 2" P-401, 10" P-209, P-152 2007 EST. PVMT SECTION UNKN 4160 Surface:AC
Work Date 6/1/2019 1/1/2007	Work Code CR-AC NU-IN CALHOU	Work Description Complete Reconstruction - AC New Construction - Initial N COUNT Branch: AP G	Cost 49,500.00 0.00 A GA Al Length: 95	0.00 (Ft) Wi Thickness (in) 0.00 0.00 0.00 PRON .00 (Ft) Wi	Major M&R V Section: dth: 47.0	0 (Ft) True Area: 9900.000003 (SqFt Comments 2" P-401, 10" P-209, P-152 2007 EST. PVMT SECTION UNKN
L.C.D. 6/1/20 Work Date 6/1/2019 1/1/2007 Network:	Work Code CR-AC NU-IN	Work Description Complete Reconstruction - AC New Construction - Initial N COUNT Branch: AP G	Cost 49,500.00 0.00 A GA Al Length: 95	Thickness (in) 0.00 0.00 0.00 PRON	Major M&R	0 (Ft) True Area: 9900.000003 (SqFt Comments 2" P-401, 10" P-209, P-152 2007 EST. PVMT SECTION UNKN 4160 Surface:AC
L.C.D. 6/1/20 Work Date 6/1/2019 1/1/2007 Network: L.C.D. 6/1/20	Work Code CR-AC NU-IN CALHOU 016 Us Work	Work Description Complete Reconstruction - AC New Construction - Initial N COUNT Branch: AP G se: APRON Rank: P	Cost 49,500.00 0.00 A GA Al Length: 95	Thickness (in) 0.00 0.00 0.00 PRON .00 (Ft) Wi Thickness	Major M&R V Section: dth: 47.0 Major	0 (Ft) True Area: 9900.000003 (SqFt Comments 2" P-401, 10" P-209, P-152 2007 EST. PVMT SECTION UNKN 4160 Surface:AC 0 (Ft) True Area: 9969.000003 (SqFt
L.C.D. 6/1/20 Work Date 6/1/2019 1/1/2007 Network: L.C.D. 6/1/20 Work Date	Work Code CR-AC NU-IN CALHOU 016 Us Work Code	Work Description Complete Reconstruction - AC New Construction - Initial N COUNT Branch: AP G se: APRON Rank: P Work Description	Cost 49,500.00 0.00 A GA Al Length: 95 Cost	Thickness (in) O.00 (Ft) Wi O.00 O.00 PRON O.00 (Ft) Wi Thickness (in)	Major M&R Section: dth: 47.0 Major M&R	0 (Ft) True Area: 9900.000003 (SqFt Comments 2" P-401, 10" P-209, P-152 2007 EST. PVMT SECTION UNKN 4160 Surface:AC 0 (Ft) True Area: 9969.000003 (SqFt Comments
L.C.D. 6/1/20 Work Date 6/1/2019 1/1/2007 Network: L.C.D. 6/1/20 Work Date	Work Code CR-AC NU-IN CALHOU 016 Us Work Code NC-AC	Work Description Complete Reconstruction - AC New Construction - Initial N COUNT Branch: AP G se: APRON Rank: P Work Description New Construction - AC	Cost 49,500.00 0.00 A GA Al Length: 95 Cost 0.00	Thickness (in)	Major M&R Section: dth: 47.0 Major M&R	Comments 2" P-401, 10" P-209, P-152 2007 EST. PVMT SECTION UNKN 4160 Surface: AC 0 (Ft) True Area: 9969.000003 (SqFt Comments 2" P-401, 10" P-209, P-152
L.C.D. 6/1/20 Work Date 6/1/2019 1/1/2007 Network: L.C.D. 6/1/20 Work Date 6/1/2016	Work Code CR-AC NU-IN CALHOU 016 Us Work Code NC-AC	Work Description Complete Reconstruction - AC New Construction - Initial N COUNT Branch: AP G See: APRON Rank: P Work Description New Construction - AC N COUNT Branch: AP G	Cost 49,500.00 0.00 A GA Al Length: 95 Cost 0.00 A GA Al GA Al Cost 0.00 Cost Cost	Thickness (in)	Major M&R Section: dth: 47.0 Major M&R V Section:	Comments 2" P-401, 10" P-209, P-152 2007 EST. PVMT SECTION UNKN 4160 Surface: AC 0 (Ft) True Area: 9969.000003 (SqFt Comments 2" P-401, 10" P-209, P-152
L.C.D. 6/1/20 Work Date 6/1/2019 1/1/2007 Network: L.C.D. 6/1/20 Work Date 6/1/2016 Network:	Work Code CR-AC NU-IN CALHOU 016 Us Work Code NC-AC	Work Description Complete Reconstruction - AC New Construction - Initial N COUNT Branch: AP G See: APRON Rank: P Work Description New Construction - AC N COUNT Branch: AP G	Cost 49,500.00 0.00 A GA Al Length: 95 Cost 0.00 A GA Al GA Al Cost 0.00 Cost Cost	Thickness (in)	Major M&R Section: dth: 47.0 Major M&R V Section:	Comments 2" P-401, 10" P-209, P-152 2007 EST. PVMT SECTION UNKN 4160 Surface:AC 0 (Ft) True Area: 9969.000003 (SqFt Comments 2" P-401, 10" P-209, P-152 4205 Surface:PCC
L.C.D. 6/1/20 Work Date 6/1/2019 1/1/2007 Network: L.C.D. 6/1/20 Work Date 6/1/2016 Network: L.C.D. 1/1/20	Work Code CR-AC NU-IN CALHOU 016 Us Work Code NC-AC CALHOU 003 Us Work	Work Description Complete Reconstruction - AC New Construction - Initial N COUNT Branch: AP G Se: APRON Rank: P Work Description New Construction - AC N COUNT Branch: AP G Se: APRON Rank: P	Cost 49,500.00 0.00 A GA Al Length: 95 Cost 0.00 A GA Al Length: 150	Thickness (in)	Major M&R Section: dth: 47.0 Major M&R V Section: dth: 250.0 Major	Comments 2" P-401, 10" P-209, P-152 2007 EST. PVMT SECTION UNKN 4160 Surface:AC 0 (Ft) True Area: 9969.000003 (SqFt Comments 2" P-401, 10" P-209, P-152 4205 Surface:PCC 0 (Ft) True Area: 10930 (SqFt
L.C.D. 6/1/20 Work Date 6/1/2019 1/1/2007 Network: L.C.D. 6/1/20 Work Date 6/1/2016 Network: L.C.D. 1/1/20 Work Date	Work Code CR-AC NU-IN CALHOU 016 Us Work Code NC-AC CALHOU 003 Us Work Code	Work Description Complete Reconstruction - AC New Construction - Initial N COUNT Branch: AP G See: APRON Rank: P Work Description New Construction - AC N COUNT Branch: AP G See: APRON Rank: P Work Description	Cost 49,500.00 0.00	PRON -0.00 (Ft) Wi Thickness (in) -0.00 -0.00 PRON -0.00 (Ft) Wi Thickness (in) -0.00 PRON -0.00 (Ft) Wi Thickness (in)	Section: dth: 47.0 Major M&R Section: dth: 47.0 Major M&R Section: dth: 250.0 Major M&R	Comments 2" P-401, 10" P-209, P-152 2007 EST. PVMT SECTION UNKN 4160 Surface: AC 0 (Ft) True Area: 9969.000003 (SqFt Comments 2" P-401, 10" P-209, P-152 4205 Surface: PCC 0 (Ft) True Area: 10930 (SqFt Comments
L.C.D. 6/1/20 Work Date 6/1/2019 1/1/2007 Network: L.C.D. 6/1/20 Work Date 6/1/2016 Network: L.C.D. 1/1/20 Work Date	Work Code CR-AC NU-IN CALHOU 016 Work Code NC-AC CALHOU 003 Work Code NU-IN	Work Description Complete Reconstruction - AC New Construction - Initial N COUNT Branch: AP G Se: APRON Rank: P Work Description New Construction - AC N COUNT Branch: AP G Se: APRON Rank: P Work Description New Construction - Initial	Cost 49,500.00 0.00	PRON -000 (Ft) Wi Thickness (in) -0.00 -0.00 PRON -0.00 (Ft) Wi Thickness (in) -0.00 PRON -0.00 (Ft) Wi Thickness (in) -0.00	Section: dth: 47.0 Major M&R Section: dth: 47.0 Major M&R Section: dth: 250.0 Major M&R	Comments 2" P-401, 10" P-209, P-152 2007 EST. PVMT SECTION UNKN 4160 Surface:AC 0 (Ft) True Area: 9969.000003 (SqFt Comments 2" P-401, 10" P-209, P-152 4205 Surface:PCC 0 (Ft) True Area: 10930 (SqFt Comments 2 Comments
L.C.D. 6/1/20 Work Date 6/1/2019 1/1/2007 Network: L.C.D. 6/1/20 Work Date 6/1/2016 Network: L.C.D. 1/1/20 Work Date 1/1/2003	Work Code CR-AC NU-IN CALHOU 016 Us Work Code NC-AC CALHOU 003 Us Work Code NU-IN	Work Description Complete Reconstruction - AC New Construction - Initial N COUNT Branch: AP G See: APRON Rank: P Work Description New Construction - AC N COUNT Branch: AP G See: APRON Rank: P Work Description New Construction - Initial N COUNT Branch: AP G See: APRON Rank: P	Cost 49,500.00 0.00 A GA Al Length: 95 Cost 0.00 A GA Al Length: 150 Cost 0.00 ELIPAD HELIF	PRON -0.00 (Ft) Wi Thickness (in) -0.00 -0.00 PRON -0.00 (Ft) Wi Thickness (in) -0.00 PRON -0.00 (Ft) Wi Thickness (in) -0.00	Section: dth: 250.0 Major M&R Section: dth: 47.0 Major M&R Section:	Comments 2" P-401, 10" P-209, P-152 2007 EST. PVMT SECTION UNKN 4160 Surface:AC 0 (Ft) True Area: 9969.000003 (SqFt Comments 2" P-401, 10" P-209, P-152 4205 Surface:PCC 0 (Ft) True Area: 10930 (SqFt Comments 2 Comments
L.C.D. 6/1/20 Work Date 6/1/2019 1/1/2007 Network: L.C.D. 6/1/20 Work Date 6/1/2016 Network: L.C.D. 1/1/20 Work Date 1/1/2003	Work Code CR-AC NU-IN CALHOU 016 Us Work Code NC-AC CALHOU 003 Us Work Code NU-IN CALHOU	Work Description Complete Reconstruction - AC New Construction - Initial N COUNT Branch: AP G See: APRON Rank: P Work Description New Construction - AC N COUNT Branch: AP G See: APRON Rank: P Work Description New Construction - Initial N COUNT Branch: AP G See: APRON Rank: P	Cost 49,500.00 0.00 A GA Al Length: 95 Cost 0.00 A GA Al Length: 150 Cost 0.00 ELIPAD HELIF	PRON -0.00 (Ft) Wi Thickness (in) -0.00 -0.00 PRON -0.00 (Ft) Wi Thickness (in) -0.00 PRON -0.00 (Ft) Wi Thickness (in) -0.00 PAD APRO -0.00 (Ft) Wi Thickness	section: dth: 250.0 Major M&R V Section: dth: 250.0 Major M&R V Section: dth: 65.0 Major	Comments 2" P-401, 10" P-209, P-152 2007 EST. PVMT SECTION UNKN 4160 Surface: AC 0 (Ft) True Area: 9969.000003 (SqFt Comments 2" P-401, 10" P-209, P-152 4205 Surface: PCC 0 (Ft) True Area: 10930 (SqFt Comments 2003 EST. PVMT SECTION UNKN
L.C.D. 6/1/20 Work Date 6/1/2019 1/1/2007 Network: L.C.D. 6/1/20 Work Date 6/1/2016 Network: L.C.D. 1/1/20 Work Date 1/1/2003 Network: L.C.D. 1/1/20	Work Code CR-AC NU-IN CALHOU 016 Us Work Code NC-AC CALHOU 003 Us Work Code NU-IN	Work Description Complete Reconstruction - AC New Construction - Initial N COUNT Branch: AP G See: APRON Rank: P Work Description New Construction - AC N COUNT Branch: AP G See: APRON Rank: P Work Description New Construction - Initial N COUNT Branch: AP G See: APRON Rank: P Work Description New Construction - Initial	Cost	Thickness (in)	Major M&R Section: dth: 47.0 Major M&R V Section: dth: 250.0 Major M&R V Section: dth: 65.0	Comments 2" P-401, 10" P-209, P-152 2007 EST. PVMT SECTION UNKN 4160 Surface:AC 0 (Ft) True Area: 9969.000003 (SqFt Comments 2" P-401, 10" P-209, P-152 4205 Surface:PCC 0 (Ft) True Area: 10930 (SqFt Comments 2003 EST. PVMT SECTION UNKN 4305 Surface:PCC 0 (Ft) True Area: 4850 (SqFt

o	12	Λ	12	Λ	1	(
7	L	.,	L	.,		-

Page 2 of 4

Pavement Database: FDOT

		1 arement Database.	1201				
Network:	CALHOU	N COUNT Branch: AP T-H	HANG T-HAI	NG APRON	Section:	805 Surface:AC	
L.C.D. 1/1/2	006 Us	se: APRON Rank: P L	ength: 126	.00 (Ft) Wi o	dth: 20.0	0 (Ft) True Area: 2520.000000 (SqFt	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments	
1/1/2006	NU-IN	New Construction - Initial	0.00	0.00	V	UNKNOWN	
37.4	Network: CALHOUN COUNT Branch: AP T-HANG T-HANG APRON Section: 806 Surface: AC						
Network: L.C.D. 1/1/2			HANG T-HAI Length: 141		Section:	806 Surface: AC 0 (Ft) True Area: 2820.000000 (SqFt	
Work Date	Work Code	Work Description	Cost	Thickness	Major M&R	Comments	
1/1/2003		New Construction - AC	0.00	(in) 0.00	Wak	2003 EST. PVMT SECTION UNKN	
Network:	CALHOU	N COUNT Branch: AP T-H	HANG T-HA	NG APRON	Section:	810 Surface: AC	
L.C.D. 1/1/2	003 Us	se: APRON Rank: P I	ength: 270	.00 (Ft) Wie	dth: 25.0	0 (Ft) True Area: 5700 (SqFt	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments	
1/1/2007	FDOT- PA-AP	FDOT - PATCHING - AC PARTIAL DEPTH	0.00	0.00			
1/1/2003	NU-IN	New Construction - Initial	0.00	0.00		2003 EST. PVMT SECTION UNKN	
	I.						
Network:	CALHOU	N COUNT Branch: AP T-F	HANG T-HA	NG APRON	Section:	905 Surface:AC	
L.C.D. 1/1/2		se: APRON Rank: P L	ength: 350	.00 (Ft) Wie		0 (Ft) True Area: 6468 (SqFt	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments	
1/1/2007	NU-IN	New Construction - Initial	0.00	0.00	V	2007 EST. PVMT SECTION UNKN	
N. d l.	CALHOLI	N COINT D L. ADTI	IANC THA	NG ADDON	G. A.	010	
Network: L.C.D. 1/1/2			ength: 307		Section:	910 Surface: AC 0 (Ft) True Area: 6140.000001 (SqFt	
	Work		Γ	Thickness	Major		
Work Date	Code	Work Description	Cost	(in)	M&R	Comments	
1/1/2007	NU-IN	New Construction - Initial	0.00	0.00	~	2007 EST. PVMT SECTION UNKN	
Network:	CALHOU	N COUNT Branch: RW 18	-36 RUNV	VAY 18-36	Section:	6105 Surface:AAC	
						0 (Ft) True Area: 269775.0000 (SqFt	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments	
1/1/2012	OL-MR	Overlay	0.00	0.00	V	EXTENSION AND WIDENING AN	
1/1/2007	NU-IN	New Construction - Initial	0.00	0.00		2" P-401, 6" P-211, 6" P-154, P-152	
N	0.1.1101	M COLDUT B 1 BW 10	ac Din	WAN 10 26	g	(110	
Network: L.C.D. 6/1/2				VAY 18-36 .00 (Ft) Wi o	Section: dth: 75.0	6110 Surface: AC 0 (Ft) True Area: 9975.000003 (SqFt	
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments	
6/1/2016	NC-AC	New Construction - AC	0.00	0.00	V	2" P-401, 10" P-209, P-152	

Page 3 of 4

Pavement Database: FDOT

Network: CALHOUN COUNT			Branch: TW A	TAXI	WAY A	Section:	120 Surface:AC	
L.C.D. 6/1/2016 Use: TAXIWAY			Rank: P L	ength: 2,450	.00 (Ft) W	idth: 35.0	0 (Ft) True Area: 93205.00002 (SqFt	
,	Work Date	Work Code	Work D	Description	Cost	Thickness (in)	Major M&R	Comments
6	5/1/2016	NC-AC	New Construction - AC		0.00	0.00	Y	2" P-401, 10" P-209, P-152

Network: CALHOUN COUNT Branch: TW A TAXIWAY A Section: 125 Surface: AC **L.C.D.** 6/1/2019 Use: TAXIWAY Rank: P **Length:** 1,575.00 (Ft) **Width:** 35.00 (Ft) True Area: 60539.00001 (SqFt Work Thickness Major **Work Date Work Description** Cost Comments Code (in) M&R 6/1/2019 2" P-401, 10" P-209, P-152 NC-AC New Construction - AC 0.00 0.00 **Y** NU-IN 1/1/2007 New Construction - Initial 0.00 0.00 **V** 2007 EST. PVMT SECTION UNKN

Network: L.C.D. 6/1/2	CALHOUI			WAY A2 .00 (Ft) Wi	Section:		
Work Date	Work Date Work Work I		Cost	Thickness (in)	Major M&R	Comments	
6/1/2016	CR-AC	Complete Reconstruction - AC	90,170.00	0.00	>	2" P-401, 10" P-209, P-152	
1/1/2007	HI-AG	New Construction	0.00	0.00	~	WIDEN AND GEOM. CHANGE. 2"	
1/1/2003	NU-IN	New Construction - Initial	0.00	0.00	~ :	2003 EST. PVMT SECTION UNKN	

Page 4 of 4

Pavement Database: FDOT

Summary:

Work Description	Section Count	Area Total (SqFt)	Thickness Avg (in)	Thickness STD (in)
Complete Reconstruction - AC	2	27,934.00	0.00	0.00
FDOT - PATCHING - AC PARTIAL DEPTH	1	5,700.00	0.00	0.00
New Construction	1	18,034.00	0.00	0.00
New Construction - AC	5	176,508.00	0.00	0.00
New Construction - Initial	13	552,806.00	0.00	0.00
New Construction - PCC	1	27,973.00	0.00	0.00
Overlay	1	269,775.00	0.00	0.00

9/20/2019	Branch Condition Report	Page 1 of 2
	Pavement Database: FDOT	

Branch ID	Number of Sections	Sum Section Length (Ft)	Avg Section Width (Ft)	True Area (SqFt)	Use	Average PCI	Standard Deviation PCI	Weighted Average PCI
AP GA	7	1,499.00	152.00	216,722.00	APRON	79.14	15.59	74.37
AP HELIPA	1	75.00	65.00	4,850.00	APRON	89.00	0.00	89.00
AP T-HANG	5	1,194.00	21.00	23,648.00	APRON	69.00	11.28	67.06
RW 18-36	2	3,730.00	75.00	279,750.00	RUNWAY	92.50	7.50	85.53
TW A	2	4,025.00	35.00	153,744.00	TAXIWAY	100.00	0.00	100.00
TW A2	1	185.00	74.00	18,034.00	TAXIWAY	100.00	0.00	100.00

9/20/2019	Branch Condition Report	Page 2 of 2
	Pavement Database: FDOT	

Use Category	Number of Sections	Total Area (SqFt)	Arithmetic Average PCI	Average STD PCI	Weighted Average PCI
APRON	13	245,220.00	76.00	14.73	73.96
RUNWAY	2	279,750.00	92.50	7.50	85.53
TAXIWAY	3	171,778.00	100.00	0.00	100.00
ALL	18	696,748.00	81.83	15.97	85.03

Pavement Database: FDOT

NetworkId: F95

Branch ID	Section ID	Last Const. Date	Surface	Use	Rank	Lanes	True Area (SqFt)	Last Inspection Date	Age At Inspec tion	PCI
AP GA	4105	1/1/2012	PCC	APRON	Р	0	78,381.00	9/6/2018	6	76
AP GA	4110	1/1/2003	AC	APRON	Р	0	39,362.00	9/6/2018	15	57
AP GA	4115	1/1/2007	AC	APRON	Р	0	40,207.00	9/6/2018	11	70
AP GA	4120	1/1/2015	PCC	APRON	Р	0	27,973.00	9/6/2018	3	86
AP GA	4150	6/1/2019	AC	APRON	Р	0	9,900.00	6/1/2019	0	100
AP GA	4160	6/1/2016	AC	APRON	Р	0	9,969.00	6/1/2016	0	100
AP GA	4205	1/1/2003	PCC	APRON	Р	0	10,930.00	9/6/2018	15	65
AP HELIPAD	4305	1/1/2003	PCC	APRON	Р	0	4,850.00	9/6/2018	15	89
AP T-HANG	805	1/1/2006	AC	APRON	Р	0	2,520.00	9/6/2018	12	76
AP T-HANG	806	1/1/2003	AC	APRON	Р	0	2,820.00	9/6/2018	15	76
AP T-HANG	810	1/1/2003	AC	APRON	Р	0	5,700.00	9/6/2018	15	54
AP T-HANG	905	1/1/2007	AC	APRON	Р	0	6,468.00	9/6/2018	11	57
AP T-HANG	910	1/1/2007	AC	APRON	Р	0	6,140.00	9/6/2018	11	82
RW 18-36	6105	1/1/2012	AAC	RUNWAY	Р	0	269,775.00	9/6/2018	6	85
RW 18-36	6110	6/1/2016	AC	RUNWAY	Р	0	9,975.00	6/1/2016	0	100
TW A	120	6/1/2016	AC	TAXIWAY	Р	0	93,205.00	6/1/2016	0	100
TW A	125	6/1/2019	AC	TAXIWAY	Р	0	60,539.00	6/1/2019	0	100
TW A2	110	6/1/2016	AC	TAXIWAY	Р	0	18,034.00	6/1/2016	0	100


Pavement Database: FDOT

Age Category	Average Age at Inspection	Total Area (SqFt)	Number of Sections	Arithmetic Average PCI	Standard Deviation PCI	Weighted Average PCI
00-02		201,622.00	6	100.00	0.00	100.00
03-05	3	27,973.00	1	86.00	0.00	86.00
06-10	6	348,156.00	2	80.50	4.50	82.97
11-15	13	118,997.00	9	69.56	11.52	65.43
ALL	8	696,748.00	18	81.83	15.97	85.03



Appendix B

Airfield Pavement Localized Maintenance and Repair and Major Rehabilitation

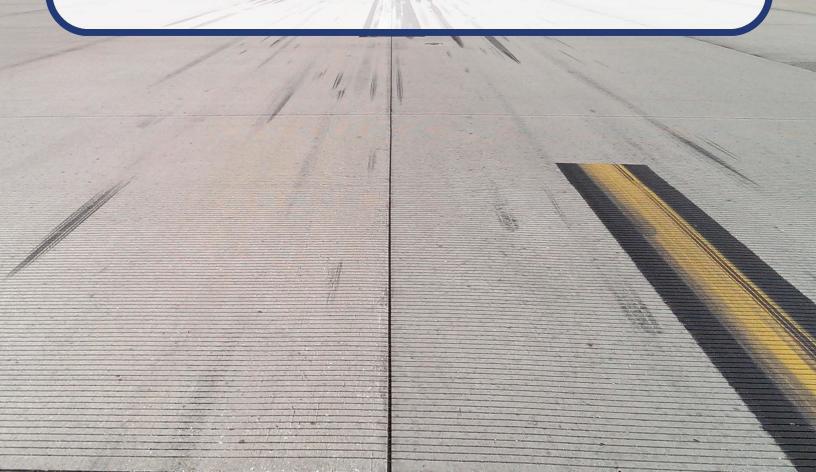

2019





Network ID	Branch ID	Section ID	Distress Code	Description	Severity	Distress Qty	Distress Unit	Percent Distress	Work Description	Work Qty	Work Unit	Unit Cost	Work Cost
F95	AP GA	4105	62	CORNER BREAK	Low	3.79	Slabs	1.3%	FDOT - CRACK SEALING - PCC	31.2	Ft	\$ 4.25	\$ 140.00
F95	AP GA	4105	65	JT SEAL DMG	Low	227.2	Slabs	80.0%	FDOT - JOINT SEAL - PCC	8203.4	Ft	\$ 2.75	\$ 22,560.00
F95	AP GA	4105	65	JT SEAL DMG	Medium	56.8	Slabs	20.0%	FDOT - JOINT SEAL - PCC	2050.9	Ft	\$ 2.75	\$ 5,640.00
F95	AP GA	4105	74	JOINT SPALL	Low	26.51	Slabs	9.3%	FDOT - CRACK SEALING - PCC	43.6	Ft	\$ 4.25	\$ 190.00
F95	AP GA	4105	74	JOINT SPALL	Medium	7.57	Slabs	2.7%	FDOT - PATCHING - PCC PARTIAL DEPTH	48.4	SqFt	\$ 72.00	\$ 3,530.00
F95	AP GA	4105	75	CORNER SPALL	Low	11.36	Slabs	4.0%	FDOT - CRACK SEALING - PCC	18.7	Ft	\$ 4.25	\$ 80.00
F95	AP GA	4105	75	CORNER SPALL	Medium	3.79	Slabs	1.3%	FDOT - PATCHING - PCC PARTIAL DEPTH	9.7	SqFt	\$ 72.00	\$ 740.00
F95	AP GA	4110	45	DEPRESSION	Low	1518.79	SqFt	3.9%	FDOT - PATCHING - AC FULL DEPTH	1679.2	SqFt	\$ 6.00	\$ 10,080.00
F95	AP GA	4110	48	L&TCR	Medium	994	Ft	2.5%	FDOT - CRACK SEALING - AC	994.1	Ft	\$ 3.00	\$ 2,990.00
F95	AP GA	4110	52	RAVELING	Low	13518.29	SqFt	34.3%	FDOT - SURFACE SEAL	13518.4	SqFt	\$ 0.55	\$ 7,440.00
F95	AP GA	4115	45	DEPRESSION	Low	2513.27	SqFt	6.3%	FDOT - PATCHING - AC FULL DEPTH	2719	SqFt	\$ 6.00	\$ 16,320.00
F95	AP GA	4115	52	RAVELING	Low	328.19	SqFt	0.8%	FDOT - SURFACE SEAL	328.3	SqFt	\$ 0.55	\$ 190.00
F95	AP GA	4120	65	JT SEAL DMG	Low	90	Slabs	100.0%	FDOT - JOINT SEAL - PCC	2861.6	Ft	\$ 2.75	\$ 7,870.00
F95	AP GA	4205	65	JT SEAL DMG	Low	22	Slabs	100.0%	FDOT - JOINT SEAL - PCC	2975.1	Ft	\$ 2.75	\$ 8,190.00
F95	AP GA	4205	74	JOINT SPALL	Low	1.16	Slabs	5.3%	FDOT - CRACK SEALING - PCC	2	Ft	\$ 4.25	\$ 10.00
F95	AP GA	4205	74	JOINT SPALL	Medium	1.16	Slabs	5.3%	FDOT - PATCHING - PCC PARTIAL DEPTH	7.5	SqFt	\$ 72.00	\$ 540.00
F95	AP GA	4205	75	CORNER SPALL	Medium	1.16	Slabs	5.3%	FDOT - PATCHING - PCC PARTIAL DEPTH	3.2	SqFt	\$ 72.00	\$ 230.00
F95	AP HELIPAD	4305	65	JT SEAL DMG	Medium	20	Slabs	100.0%	FDOT - JOINT SEAL - PCC	489.8	Ft	\$ 2.75	\$ 1,350.00
F95	AP T-HANG	805	45	DEPRESSION	Low	38	SqFt	1.5%	FDOT - PATCHING - AC FULL DEPTH	66.7	SqFt	\$ 6.00	\$ 410.00
F95	AP T-HANG	805	52	RAVELING	Low	251.98	SqFt	10.0%	FDOT - SURFACE SEAL	251.9	SqFt	\$ 0.55	\$ 140.00
F95	AP T-HANG	806	45	DEPRESSION	Low	57.05	SqFt	2.0%	FDOT - PATCHING - AC FULL DEPTH	91.5	SqFt	\$ 6.00	\$ 550.00
F95	AP T-HANG	806	52	RAVELING	Low	24.97	SqFt	0.9%	FDOT - SURFACE SEAL	24.8	SqFt	\$ 0.55	\$ 20.00
F95	AP T-HANG	810	45	DEPRESSION	Low	396.97	SqFt	7.0%	FDOT - PATCHING - AC FULL DEPTH	481.2	SqFt	\$ 6.00	\$ 2,890.00
F95	AP T-HANG	810	52	RAVELING	Low	379.86	SqFt	6.7%	FDOT - SURFACE SEAL	380	SqFt	\$ 0.55	\$ 210.00
F95	AP T-HANG	905	45	DEPRESSION	Low	1061.11	SqFt	16.4%	FDOT - PATCHING - AC FULL DEPTH	1195.9	SqFt	\$ 6.00	\$ 7,180.00
F95	AP T-HANG	910	45	DEPRESSION	Low	84.93	SqFt	1.4%	FDOT - PATCHING - AC FULL DEPTH	125.9	SqFt	\$ 6.00	\$ 760.00
F95	RW 18-36	6105	48	L&TCR	Medium	239.8	Ft	0.1%	FDOT - CRACK SEALING - AC	239.8	Ft	\$ 3.00	\$ 720.00
F95	RW 18-36	6105	52	RAVELING	Low	5860.73	SqFt	2.2%	FDOT - SURFACE SEAL	5861	SqFt	\$ 0.55	\$ 3,230.00






Table B-2 10-Year Major Rehabilitation Planning Needs at Section Level


Program Year	Network ID	Branch ID	Section ID	Surface	Area (SF)	PCI Before	Rehabilitation Type	Planning Cost	
2020	F95	AP GA	4110	AC	39,362	54	AC Restoration	\$ 276,000.00	
2020	F95	AP GA	4205	PCC	10,930	62	PCC Restoration	\$ 110,000.00	
2020	F95	AP T-HANG	810	AC	5,700	51	AC Restoration	\$ 40,000.00	
2020	F95	AP T-HANG	905	AC	6,468	54	AC Restoration	\$ 46,000.00	
2022	F95	AP GA	4115	AC	40,207	64	AC Restoration	\$ 282,000.00	
2025	F95	AP GA	4105	PCC	78,381	63	PCC Restoration	\$ 784,000.00	
2026	F95	AP T-HANG	805	AC	2,520	64	AC Restoration	\$ 18,000.00	
2026	F95	AP T-HANG	806	AC	2,820	64	AC Restoration	\$ 20,000.00	
2028	F95	RW 18-36	6105	AAC	269,775	64	AC Restoration	\$ 1,889,000.00	
2029	F95	AP GA	4120	PCC	27,973	63	PCC Restoration	\$ 280,000.00	



Appendix C

Technical Exhibits



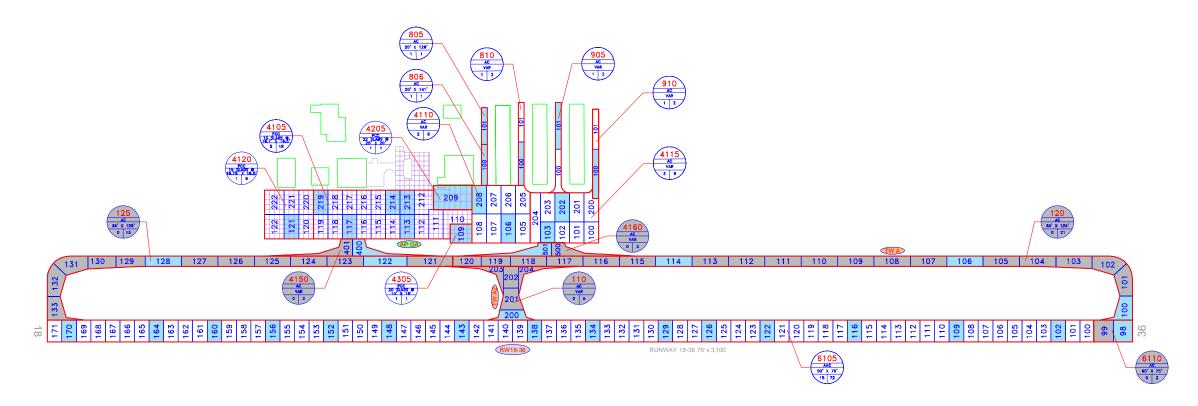

LEGEND












SECTION NOT INSPECTED DUE TO RECENT CONSTRUCTION. SEE SYSTEM INVENTORY MAP FOR CONSTRUCTION DATES.




TOTAL SAMPLES INSPECTED = 32 AC: 24 PCC: 8

RUNWAY LENGTHS DEPICTED IN THIS DRAWING ARE FOR PAVEMENT MANAGEMENT PURPOSES ONLY AND MAY NOT MATCH PUBLISHED RUNWAY LENGTHS.

FDOT



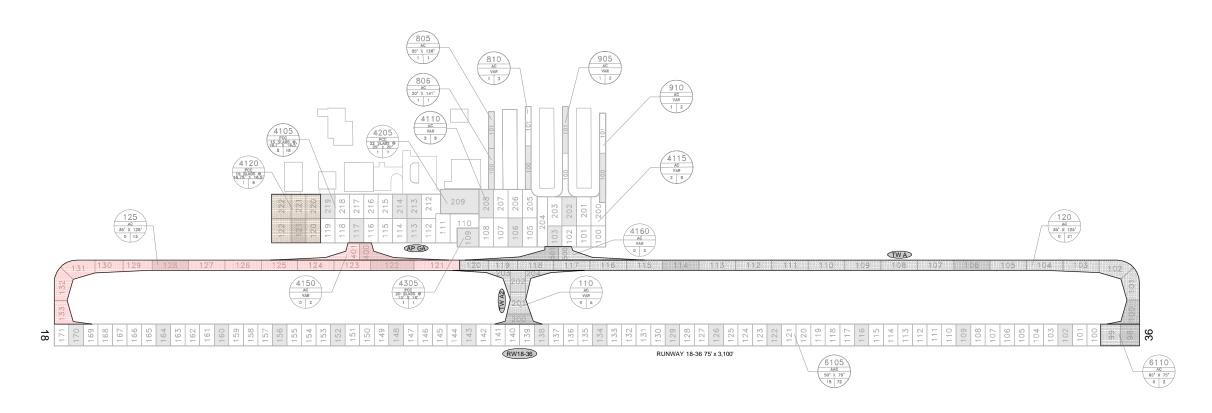


CONSTRUCTION SINCE LAST INSPECTION & ANTICIPATED CONSTRUCTION ACTIVITY


CONSTRUCTION YEAR	LOCATION	WORK TYPE / PAVEMENT SECTION
2015	AP GA	NEW CONSTRUCTION - PCC
2016	AP GA CONN, RW 18-36, TW A	NEW CONSTRUCTION - AC / 2" P-401, 10" P-209, P-152
2016	AP GA CONN, TW A2	COMPLETE RECONSTRUCTION - AC
2019	TW A, AP GA CONN	NEW CONSTRUCTION - AC / 2" P-401, 10" P-209, P-152

PROJECTS YEAR 2022


LEGEND

PROJECTS YEAR 2013 PROJECTS YEAR 2014 PROJECTS YEAR 2015 PROJECTS YEAR 2016 PROJECTS YEAR 2017 PROJECTS YEAR 2018 PROJECTS YEAR 2019 PROJECTS YEAR 2020



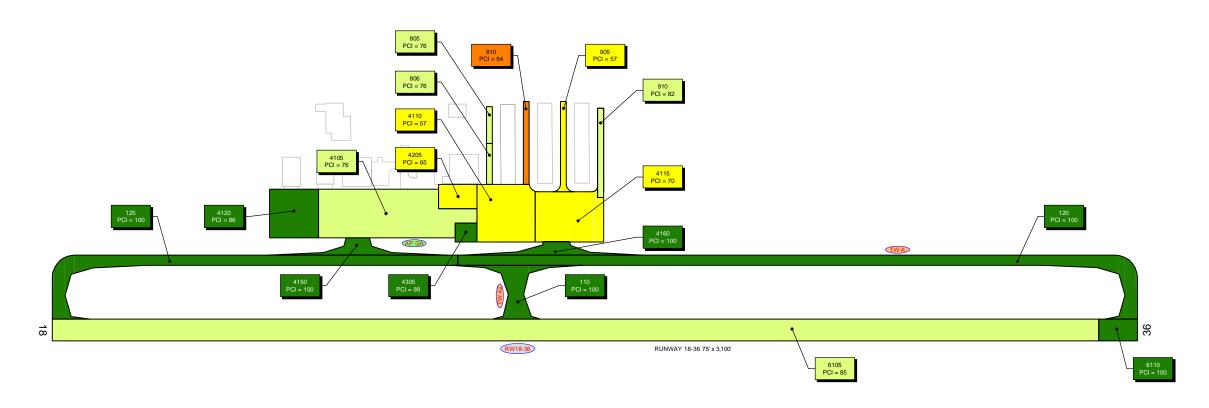


LEGEND

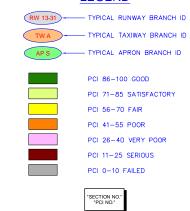



RUNWAY LENGTHS DEPICTED IN THIS DRAWING ARE FOR PAVEMENT MANAGEMENT PURPOSES ONLY AND MAY NOT MATCH PUBLISHED RUNWAY LENGTHS.

RUNWAY LENGTHS DEPICTED IN THIS DRAWING ARE FOR PAVEMENT MANAGEMENT PURPOSES ONLY AND MAY NOT MATCH PUBLISHED RUNWAY LENGTHS.

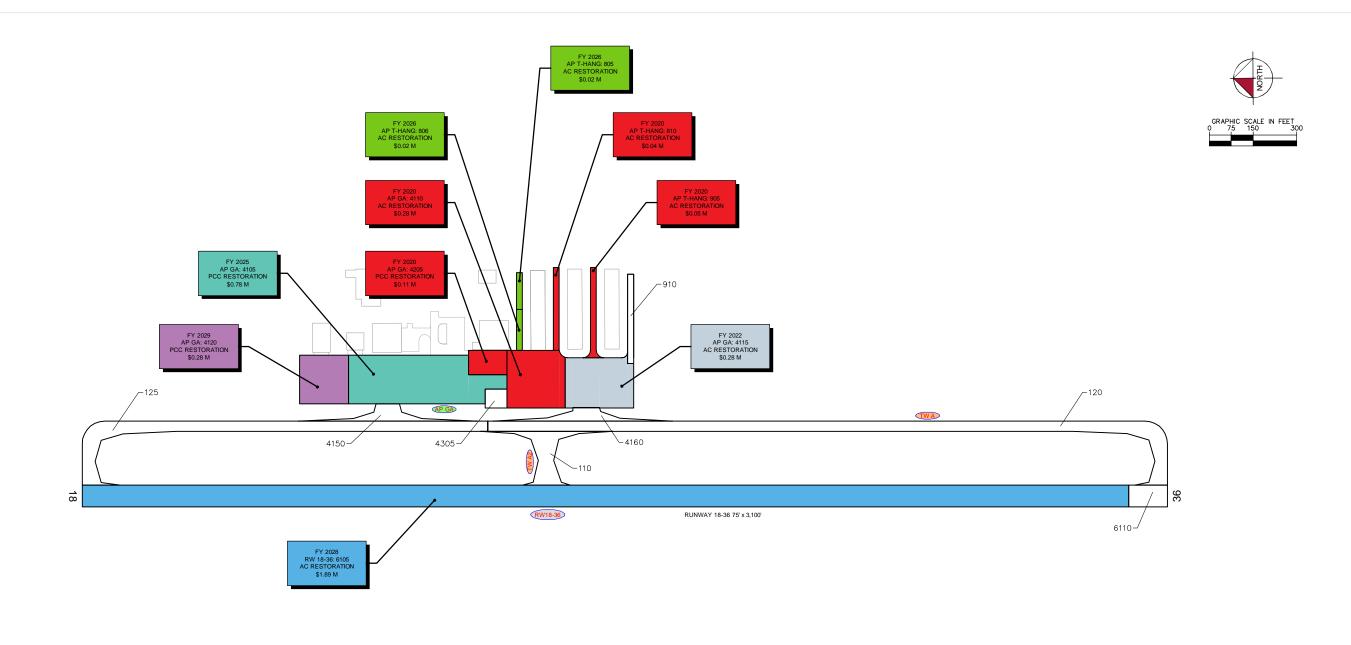

LEGEND






"PROGRAM YEAR"
"BRANCH": "SECTION"
"REHAB ACTIVITY"
"EST. COST"



Appendix D

Inspection Photograph Documentation

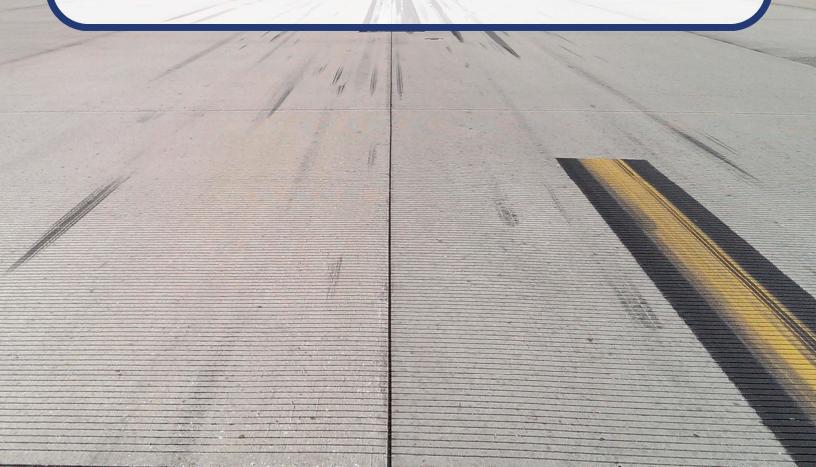







RW 18-36, Section 6105, Sample Unit 148 - Low Severity (48) Longitudinal & Transverse Cracking and Low Severity (57) Weathering



RW 18-36, Section 6105, Sample Unit 160 - Low Severity (48) Longitudinal & Transverse Cracking, Low Severity (52) Raveling, and Low Severity (57) Weathering







AP GA, Section 4105, Sample Unit 214 - Low Severity (65) Joint Seal Damage and Medium Severity (75) Corner Spall




AP T-HANG, Section 805, Sample Unit 101 - Low Severity (52) Raveling and Low Severity (57) Weathering



Appendix E

Inspection Distress Details

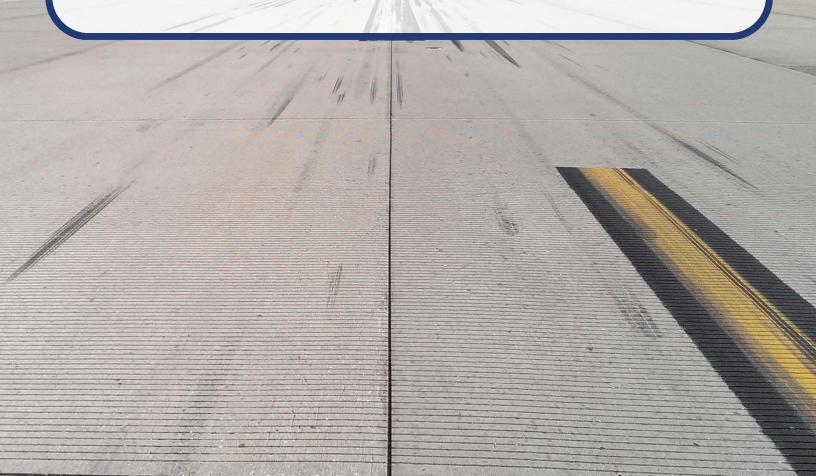

FDOT

Generated Date 9/20/2019 Page 1 of 16

Gene	rated Date	9/2	20/2019								rage 1 01 10
Netw	ork: F95				Name:	CALHOUN COU	NTY AIRPORT	Γ			
Bran	ch: AP GA		Name:	GA AP	RON	Use:	APRON	Area	: 2	16,722 SqFt	
Section	on: 4105	of 7		From: -			То: -			Last Const.:	1/1/2012
Surfa	ce: PCC	Family: C9	N59-GA-A	P-PCC	Zone:		Category:			Rank: P	
Area	78,381	l SqFt	Length:		545 Ft	Width:	167 F	t			
Slabs	: 284	Slab Length:		17 Ft	Sla	ab Width:	17 Ft		Joint Length:	10,254 Ft	
Shou	lder:	Street Type:			Gı	rade: 0			Lanes: 0		
Section	on Comments:										
Work	Date: 1/1/2012	Work '	Type: New	Construction	n - Initial	C	ode: NU-IN		Is Major N	1&R: True	
Last	Insp. Date: 9/6/2018		Totals	Samples: 1	8	Surveye	d: 5				
Cond	itions: PCI: 76										
Inspe	ction Comments:										
Samp	le Number: 113	Type:	R	A	rea:	15.00 Slabs	PCI:	72			
-	le Comments:	• •									
63	LINEAR CR		L	2.00	Slabs						
71	FAULTING		L	2.00							
73	SHRINKAGE CR		N	6.00							
75	CORNER SPALL		L		Slabs						
65	JT SEAL DMG		L	15.00	Slabs						
Samp	le Number: 117	Type:	R	A	rea:	15.00 Slabs	PCI:	83			
Samp	le Comments:										
65	JT SEAL DMG		L	15.00	Slabs						
62	CORNER BREAK		L	1.00							
73	SHRINKAGE CR		N	10.00	Slabs						
Samp	ole Number: 213	Type:	R	A	rea:	15.00 Slabs	PCI:	74			
Samp	le Comments:										
73	SHRINKAGE CR		N	12.00							
70	SCALING		L	1.00							
74	JOINT SPALL		L		Slabs						
75 65	CORNER SPALL JT SEAL DMG		L M	1.00 15.00							
			R			15.00 Slabs	PCI:	60			
_	ole Number: 214 ole Comments:	Type:	K	A	rea:	13.00 Slaos	rci:	09			
_	JOINT SPALL		M	2.00	Clabs						
74 75	CORNER SPALL		M M	1.00							
73 74	JOINT SPALL		L	1.00							
70	SCALING		L	3.00							
71	FAULTING		L	1.00							
63	LINEAR CR		L	1.00							
65	JT SEAL DMG		L	15.00							
_	le Number: 219	Type:	R	A	rea:	15.00 Slabs	PCI:	85			
Samp	le Comments:										
65	JT SEAL DMG		L	15.00							
71	FAULTING		L	1.00							
73	SHRINKAGE CR		N	8.00	Slabs						

Netv	work: F95		Name:	CALHOUN COU	INTY AIRPORT		
Brai	nch: AP GA	Name:	GA APRON	Use:	APRON	Area:	216,722 SqFt
Sect	ion: 4110	of 7	From: -		То: -		Last Const.: 1/1/2003
Surf	face: AC F	amily: C9N59-GA-A	P-AC Zone:		Category:		Rank: P
Area	a: 39,362	SqFt Length:	210 Ft	Width:	200 Ft		
Slab	os:	Slab Length:	Ft Slab V	Vidth:	Ft	Joint Length	ı: Ft
Shou	ulder:	Street Type:	Grade	: 0		Lanes: 0)
Sect	ion Comments:						
Wor	rk Date: 1/1/2003	Work Type: New	Construction - Initial	C	ode: NU-IN	Is Major	r M&R: True
Last	t Insp. Date: 9/6/2018	TotalS	amples: 8	Surveye	d: 2		
Con	ditions: PCI: 57						
Insp	ection Comments:						
Sam	ple Number: 106	Type: R	Area:	5000.00 SqFt	PCI: 59		
Sam	ple Comments:						
48	L & T CR	L	205.00 Ft				
57	WEATHERING	L	2000.00 SqFt				
52	RAVELING	L	3000.00 SqFt				
	L & T CR	M	150.00 Ft				
48							
48	DEPRESSION	L	67.00 SqFt				
48 45		Type: R	67.00 SqFt Area:	4900.00 SqFt	PCI: 56		
48 45 Sam	DEPRESSION			4900.00 SqFt	PCI: 56		
48 45 Sam Sam	DEPRESSION uple Number: 208			4900.00 SqFt	PCI: 56		
48 45 Sam	DEPRESSION uple Number: 208 uple Comments:	Type: R	Area:	4900.00 SqFt	PCI: 56		
48 45 Sam Sam 57	DEPRESSION uple Number: 208 uple Comments: WEATHERING	Type: R	Area: 4479.00 SqFt	4900.00 SqFt	PCI: 56		
48 45 Sam Sam 57 50	DEPRESSION uple Number: 208 uple Comments: WEATHERING PATCHING	Type: R L L	Area: 4479.00 SqFt 21.00 SqFt	4900.00 SqFt	PCI: 56		
48 45 Sam Sam 57 50 52	DEPRESSION uple Number: 208 uple Comments: WEATHERING PATCHING RAVELING	Type: R L L L	Area: 4479.00 SqFt 21.00 SqFt 400.00 SqFt	4900.00 SqFt	PCI: 56		

Network: F95			Name:	CALHOUN COU	INTY AIRPORT		
							21 (522 G F)
Branch: AP GA	<u> </u>	Name:	GA APRON	Use:	APRON	Area:	216,722 SqFt
Section: 4115	of	7 I	From: -		То: -		Last Const.: 1/1/2007
Surface: AC	Family:	C9N59-GA-AI	P-AC Zone:		Category:		Rank: P
Area:	40,207 SqFt	Length:	235 Ft	Width:	173 Ft		
Slabs:	Slab Leng	gth:	Ft Slal	Width:	Ft	Joint Length	: Ft
Shoulder:	Street Ty	pe:	Gra	ide: 0		Lanes: 0	
Section Comments:							
Work Date: 1/1/200	7 Wo	rk Type: New	Construction - Initial	C	ode: NU-IN	Is Major	M&R: True
Last Insp. Date: 9/0	5/2018	TotalS	amples: 9	Surveye	d: 2		
Conditions: PCI:			1	v			
Inspection Comment							
Sample Number: 1	03 Тур	e: R	Area:	3575.00 SqFt	PCI: 63		
Sample Comments:							
Sample Comments: 45 DEPRESSION	1	L	400.00 SqFt				
_	1	L L	400.00 SqFt 11.00 Ft				
45 DEPRESSION							
45 DEPRESSION 48 L & T CR	IG	L L	11.00 Ft	5000.00 SqFt	PCI: 74		
DEPRESSION L & T CR WEATHERIN	IG	L L	11.00 Ft 3575.00 SqFt	5000.00 SqFt	PCI: 74		
45 DEPRESSION 48 L & T CR 57 WEATHERIN Sample Number: 2	IG	L L	11.00 Ft 3575.00 SqFt Area:	5000.00 SqFt	PCI: 74		
45 DEPRESSION 48 L & T CR 57 WEATHERIN Sample Number: 2 Sample Comments:	IG 02 Type	L L E: R	11.00 Ft 3575.00 SqFt	5000.00 SqFt	PCI: 74		
45 DEPRESSION 48 L & T CR 57 WEATHERIN Sample Number: 2 Sample Comments: 52 RAVELING	IG Type	L L E: R	11.00 Ft 3575.00 SqFt Area: 70.00 SqFt	5000.00 SqFt	PCI: 74		

F95 CALHOUN COUNTY AIRPORT Network: Name: **Branch:** AP GA GA APRON Use: APRON Area: 216,722 SqFt Name: Section: 4120 of 7 To: -**Last Const.:** 1/1/2015 From: Surface: PCC Family: C9N59-GA-AP-PCC Zone: Category: Rank: P Area: 27,973 SqFt Length: 168 Ft Width: 167 Ft Slabs: 90 Slab Length: 19 Ft Slab Width: 16 Ft Joint Length: 2,862 Ft **Street Type:** Shoulder: Grade: Lanes: **Section Comments: Work Date:** 1/1/2015 Work Type: New Construction - PCC Code: NC-PC Is Major M&R: True **Last Insp. Date:** 9/6/2018 **TotalSamples:** 6 Surveyed: 1 **Conditions:** PCI: **Inspection Comments:** R **PCI:** 86 Sample Number: 121 Type: 15.00 Slabs Area: **Sample Comments:** 73 SHRINKAGE CR N 12.00 Slabs

L

15.00 Slabs

65

JT SEAL DMG

CALHOUN COUNTY AIRPORT Network: F95 Name: AP GA GA APRON Use: APRON 216,722 SqFt Branch: Name: Area: 4150 of 7 Section: From: To: -Last Const.: 6/1/2019 ACFamily: C9N59-GA-AP-AC Category: Rank: P Surface: Zone: Area: 9,900 SqFt Length: 96 Ft Width: 60 Ft Slab Width: Slab Length: Ft Ft Joint Length: Ft Slabs: Shoulder: **Street Type:** Grade: Lanes: **Section Comments:** Work Date: 1/1/2007 Work Type: New Construction - Initial Code: NU-IN Is Major M&R: True Work Date: 6/1/2019 Work Type: Complete Reconstruction - AC Code: CR-AC Is Major M&R: True **Last Insp. Date:** 9/29/2014 TotalSamples: 1 Surveyed: 1 NOTE: *** Pre-Construction PCI *** **Conditions: PCI:** 72 **Inspection Comments:** R **PCI:** 72 Sample Number: 200 Type: Area: 3746.00 SqFt **Sample Comments:** DEPRESSION L 21.00 SqFt 45 DEPRESSION L 45 15.00 SqFt 57 WEATHERING L 3646.00 SqFt DEPRESSION L 20.00 SqFt 45 LONGITUDINAL/TRANSVERSE L 48 31.00 Ft CRACKING RAVELING 100.00 SqFt 52 L

DEPRESSION

45

L

F95 CALHOUN COUNTY AIRPORT Network: Name: **Branch:** AP GA GA APRON Use: APRON 216,722 SqFt Name: Area: Section: 4205 of 7 **Last Const.:** 1/1/2003 From: To: -Surface: PCC Family: C9N59-GA-AP-PCC Zone: Category: Rank: P Area: 10,930 SqFt Length: 150 Ft Width: 250 Ft Slabs: Slab Length: 25 Ft Slab Width: 20 Ft Joint Length: 22 2,975 Ft Shoulder: **Street Type:** Grade: Lanes: **Section Comments:** Work Date: 1/1/2003 Work Type: New Construction - Initial Code: NU-IN Is Major M&R: True **Last Insp. Date:** 9/6/2018 TotalSamples: 1 Surveyed: 1 **Conditions:** PCI: **Inspection Comments: PCI:** 65 Sample Number: 209 Type: R 19.00 Slabs Area: **Sample Comments:** 63 LINEAR CR L 1.00 Slabs JOINT SPALL M 1.00 Slabs 74 JOINT SPALL 74 L 1.00 Slabs 75 CORNER SPALL Slabs M 1.00 71 **FAULTING** L 2.00 Slabs 73 SHRINKAGE CR N 17.00 Slabs

65

JT SEAL DMG

L

19.00 Slabs

F95 CALHOUN COUNTY AIRPORT Network: Name: **Branch:** AP HELIPAD HELIPAD APRON Use: APRON Area: 4,850 SqFt Name: **Section:** 4305 of 1 To: -**Last Const.:** 1/1/2003 From: Surface: PCC Family: C9N59-GA-AP-PCC Zone: Category: Rank: P Area: 4,850 SqFt Length: 75 Ft Width: 65 Ft Slabs: 20 Slab Length: 15 Ft Slab Width: 16 Ft Joint Length: 490 Ft **Street Type:** Shoulder: Grade: Lanes: **Section Comments:** Work Date: 1/1/2003 Work Type: New Construction - Initial Code: NU-IN Is Major M&R: True **Last Insp. Date:** 9/6/2018 TotalSamples: 1 Surveyed: 1 **Conditions:** PCI: **Inspection Comments: PCI:** 89 Sample Number: 109 Type: R 20.00 Slabs Area: **Sample Comments:**

65

73

JT SEAL DMG

SHRINKAGE CR

M

N

20.00 Slabs

5.00 Slabs

F95 CALHOUN COUNTY AIRPORT Network: Name: **Branch:** AP T-HANG T-HANG APRON Use: APRON Area: 23,648 SqFt Name: Section: 805 of 5 To: -**Last Const.:** 1/1/2006 From: Surface: ACFamily: C9N59-GA-AP-AC Zone: Category: Rank: P Area: 2,520 SqFt Length: 126 Ft Width: 20 Ft Slabs: Slab Length: Ft Slab Width: Ft Joint Length: Ft **Street Type:** Shoulder: Grade: Lanes: **Section Comments:** Work Date: 1/1/2006 Work Type: New Construction - Initial Code: NU-IN Is Major M&R: True **Last Insp. Date:** 9/6/2018 TotalSamples: 1 Surveyed: 1 **Conditions:** PCI: **Inspection Comments:** 2520.00 SqFt **PCI:** 76 Sample Number: 101 Type: R Area: **Sample Comments:** 45 DEPRESSION L 38.00 SqFt 52 RAVELING L 252.00 SqFt WEATHERING L 57 2268.00 SqFt

L & T CR

48

L

13.00 Ft

CALHOUN COUNTY AIRPORT Network: F95 Name: **Branch:** AP T-HANG T-HANG APRON Use: APRON Area: 23,648 SqFt Name: Section: 806 of 5 To: -**Last Const.:** 1/1/2003 From: Surface: ACFamily: C9N59-GA-AP-AC Zone: Category: Rank: P Area: 2,820 SqFt Length: 141 Ft Width: 20 Ft Slabs: Slab Length: Ft Slab Width: Ft Joint Length: Ft **Street Type:** Shoulder: Grade: Lanes: **Section Comments:** Work Date: 1/1/2003 Work Type: New Construction - AC Code: NC-AC Is Major M&R: True **Last Insp. Date:** 9/6/2018 **TotalSamples:** 1 Surveyed: 1 **Conditions:** PCI: **Inspection Comments:** 2820.00 SqFt **PCI:** 76 Sample Number: 100 Type: R Area: **Sample Comments:** 52 RAVELING L 25.00 SqFt 57 WEATHERING L 2795.00 SqFt L & T CR 48 L 37.00 Ft

DEPRESSION

45

L

CALHOUN COUNTY AIRPORT F95 Network: Name: AP T-HANG T-HANG APRON Use: APRON 23,648 SqFt **Branch:** Name: Area: 810 of 5 Section: From: To: -**Last Const.:** 1/1/2003 ACFamily: C9N59-GA-AP-AC Category: Rank: P Surface: Zone: Area: 5,700 SqFt Length: 270 Ft Width: 25 Ft Slab Length: Ft Slab Width: Ft Ft Slabs: Joint Length: Shoulder: **Street Type:** Grade: Lanes: **Section Comments:** Work Date: 1/1/2003 Work Type: New Construction - Initial Code: NU-IN Is Major M&R: True Work Date: 1/1/2007 Work Type: FDOT - PATCHING - AC PARTIAL Code: FDOT-PA-AP Is Major M&R: False **DEPTH Last Insp. Date:** 9/6/2018 **TotalSamples:** 2 Surveyed: 1 **Conditions: PCI:** 54 **Inspection Comments:** R 3001.00 SqFt **PCI:** 54 Sample Number: 100 Type: Area: **Sample Comments:** 57 WEATHERING L 1751.00 SqFt L 48 L & T CR 45.00 Ft 45 **DEPRESSION** L 209.00 SqFt 50 PATCHING L 1050.00 SqFt

52

RAVELING

L

F95 CALHOUN COUNTY AIRPORT Network: Name: **Branch:** AP T-HANG T-HANG APRON Use: APRON Area: 23,648 SqFt Name: **Section:** 905 of 5 To: -**Last Const.:** 1/1/2007 From: Surface: ACFamily: C9N59-GA-AP-AC Zone: Category: Rank: P Area: 6,468 SqFt Length: 350 Ft Width: 20 Ft Slabs: Slab Length: Ft Slab Width: Ft Joint Length: Ft **Street Type:** Shoulder: Grade: Lanes: **Section Comments:** Work Date: 1/1/2007 Work Type: New Construction - Initial Code: NU-IN Is Major M&R: True **Last Insp. Date:** 9/6/2018 **TotalSamples:** 2 Surveyed: 1 **Conditions:** PCI: **Inspection Comments:** 3200.00 SqFt **PCI:** 57 Sample Number: 101 Type: R Area: **Sample Comments:** 57 WEATHERING L 3200.00 SqFt 45 DEPRESSION L 525.00 SqFt

L & T CR

48

L

34.00 Ft

F95 CALHOUN COUNTY AIRPORT Network: Name: **Branch:** AP T-HANG T-HANG APRON Use: APRON Area: 23,648 SqFt Name: **Section:** 910 of 5 To: -**Last Const.:** 1/1/2007 From: Surface: ACFamily: C9N59-GA-AP-AC Zone: Category: Rank: P Area: 6,140 SqFt Length: 307 Ft Width: 20 Ft Slabs: Slab Length: Ft Slab Width: Ft Joint Length: Ft **Street Type:** Shoulder: Grade: Lanes: **Section Comments:** Work Date: 1/1/2007 Work Type: New Construction - Initial Code: NU-IN Is Major M&R: True **Last Insp. Date:** 9/6/2018 **TotalSamples:** 2 Surveyed: 1 **Conditions:** PCI: **Inspection Comments:** R 3400.00 SqFt **PCI:** 82 Sample Number: 100 Type: Area: **Sample Comments:** 45 DEPRESSION L 47.00 SqFt 57 WEATHERING L 3400.00 SqFt

L & T CR

48

L

26.00 Ft

Network: F95			Name:	CALHOUN COUN		
Branch: RW 18-36		Name:	RUNWAY 18-36	Use:		Area: 279,750 SqFt
ection: 6105	of 2		From: -		То: -	Last Const.: 1/1/2012
urface: AAC	Family: C9N APO		RW-AAC- Zone:		Category:	Rank: P
269,77	75 SqFt	Length		Width:	75 Ft	
Slabs:	Slab Length:		Ft Slab	Width:	Ft	Joint Length: Ft
Shoulder:	Street Type:		Grad	le: 0		Lanes: 0
Section Comments:						
Work Date: 1/1/2007			ew Construction - Initial		le: NU-IN	Is Major M&R: True
Work Date: 1/1/2012	Work T		-		le: OL-MR	Is Major M&R: True
Last Insp. Date: 9/6/2018		Tota	dSamples: 72	Surveyed	: 15	
Conditions: PCI: 85						
Inspection Comments:						
Sample Number: 102	Type:	R	Area:	3750.00 SqFt	PCI: 79	
Sample Comments:						
52 RAVELING	J	L	500.00 SqFt			
77 WEATHERING 18 L & T CR		L L	3250.00 SqFt 72.00 Ft			
Sample Number: 109	Type:	R	72.00 Ft Area:	3750.00 SqFt	PCI: 89	
Sample Number: 109	1 ype:	K	Alea:	3730.00 SqFt	1 (1; 69	
_						
77 WEATHERING 18 L & T CR		L L	3750.00 SqFt 48.00 Ft			
Sample Number: 116	Type:	R	Area:	3750.00 SqFt	PCI: 91	
Sample Comments:	1, pc.		. 11 vile	2,23.00 Sq1 t	101. 71	
48 L & T CR		Ĺ	9.00 Ft			
57 WEATHERING		L	3750.00 SqFt			
Sample Number: 122	Type:	R	Area:	3750.00 SqFt	PCI: 89	
Sample Comments:						
72 RAVELING		Ĺ	1.00 SqFt			
48 L & T CR 57 WEATHERING]	L L	25.00 Ft 3749.00 SqFt			
Sample Number: 126	Type:	R	Area:	3750.00 SqFt	PCI: 89	
Sample Comments:	- , pe.			2.23.00 2410	2 22. 07	
WEATHERING		Ĺ	3750.00 SqFt			
48 L&TCR		<u> </u>	36.00 Ft	2750 00 G E	DCI 00	
Sample Number: 129	Type:	R	Area:	3750.00 SqFt	PCI: 89	
Sample Comments:						
WEATHERING		L ·	3750.00 SqFt			
48 L&TCR		L R	53.00 Ft	3750.00 SqFt	PCI: 89	
Sample Number: 134 Sample Comments:	Type:	K	Area:	3730.00 sqrt	FCI; 89	
18 L & T CR		Ĺ	40.00 Ft			
57 WEATHERING]	L	3750.00 SqFt			
Sample Number: 138	Type:	R	Area:	3750.00 SqFt	PCI: 84	
Sample Comments:						
72 RAVELING		L	61.00 SqFt			
48 L & T CR 57 WEATHERING		L L	79.00 Ft 3689.00 SqFt			
Sample Number: 143	Type:	R	Area:	3750.00 SqFt	PCI: 84	
Sample Comments:	Type.	A	Alta.	STSOLOU SHIT	1 (1, 04	
-	1	L	98.00 Ft			
48 L & T CR	1	_	70.UU Ft			

57	WEATHERING	L		3720.00 SqFt			
52	RAVELING	L		30.00 SqFt			
Sam	ple Number: 148	Type:	R	Area:	3750.00 SqFt	PCI: 83	
Sam	ple Comments:						
52	RAVELING	L		75.00 SqFt			
48	L & T CR	L		84.00 Ft			
57	WEATHERING	L		3675.00 SqFt			
Sam	ple Number: 152	Type:	R	Area:	3750.00 SqFt	PCI: 86	
Sam	ple Comments:						
57	WEATHERING	L		3675.00 SqFt			
52	RAVELING	L		75.00 SqFt			
48	L & T CR	L		14.00 Ft			
Sam	ple Number: 156	Type:	R	Area:	3750.00 SqFt	PCI: 84	
Sam	ple Comments:						
48	L & T CR	L		65.00 Ft			
52	RAVELING	L		75.00 SqFt			
57	WEATHERING	L		3675.00 SqFt			
Sam	ple Number: 160	Type:	R	Area:	3750.00 SqFt	PCI: 76	
Sam	ple Comments:						
52	RAVELING	L		30.00 SqFt			
48	L & T CR	M	[50.00 Ft			
57	WEATHERING	L		3720.00 SqFt			
48	L & T CR	L		39.00 Ft			
Sam	ple Number: 164	Type:	R	Area:	3750.00 SqFt	PCI: 82	
Sam	ple Comments:						
48	L & T CR	L		96.00 Ft			
52	RAVELING	L		75.00 SqFt			
57	WEATHERING	L		3675.00 SqFt			
Sam	ple Number: 170	Type:	R	Area:	3750.00 SqFt	PCI: 81	
Sam	ple Comments:						
57	WEATHERING	L		3450.00 SqFt			
52	RAVELING	L		300.00 SqFt			
48	L & T CR	L		55.00 Ft			

F95 CALHOUN COUNTY AIRPORT Network: Name: **Branch:** TW A TAXIWAY A Use: TAXIWAY 153,744 SqFt Name: Area: 125 of 2 **Last Const.:** 6/1/2019 Section: From: To: Surface: ACFamily: C9N59-GA-TW-AC Zone: Category: Rank: P Area: 60,539 SqFt Length: 1,575 Ft Width: 35 Ft Slabs: Slab Length: Ft Slab Width: Ft Joint Length: Ft Shoulder: **Street Type:** Grade: Lanes: **Section Comments:** Work Date: 1/1/2007 Work Type: New Construction - Initial Code: NU-IN Is Major M&R: True Work Date: 6/1/2019 Work Type: New Construction - AC Code: NC-AC Is Major M&R: True **Last Insp. Date:** 9/29/2014 **TotalSamples:** 6 Surveyed: 1 NOTE: *** Pre-Construction PCI *** **Conditions:** PCI: **Inspection Comments:** R 3500.00 SqFt **PCI:** 94 Sample Number: 103 Type: Area: **Sample Comments:**

57

WEATHERING

L

Networ	k: F95			Name	: CALHOUN CO	UNTY AIRPORT			
Branch	: TW A2		Name:	TAXIWAY A2	Use:	TAXIWAY	Area:	18,034 SqFt	
Section	: 110	of	1 I	From: -		То: -		Last Const.: 6/1/2016	
Surface	: AC	Family: (C9N59-GA-TV	V-AC Zone:	:	Category:		Rank: P	
Area:	1	18,034 SqFt	Length:	185 Ft	Width:	74 Ft			
Slabs:		Slab Lengt	th:	Ft	Slab Width:	Ft	Joint Leng	th: Ft	
Shoulde	er:	Street Type	e:	•	Grade: 0		Lanes:	0	
Section	Comments:								
Work Date: 1/1/2003 Work Type: New Construction			Construction - Initia	1 (Code: NU-IN	Is Majo	or M&R: True		
Work Date: 1/1/2007 Work Type: New Construction			Construction	(Code: HI-AG	Is Majo	or M&R: True		
Work D	Date: 6/1/2016	Wor	k Type: Com	plete Reconstruction	- AC	Code: CR-AC	Is Major M&R: True		
Last Ins	sp. Date: 9/29/	/2014	TotalS	amples: 3	Survey	ed: 1			
Conditi	ons: PCI:	89		NOTE: ***	Pre-Construction PCI	**			
Inspect	ion Comments:								
Sample	Number: 101	Type:	: R	Area:	3500.00 SqFt	PCI: 8	39		
Sample	Comments:								
57 '	WEATHERING		L	3497.00 SqFt					
	PATCHING		L	3.00 SqFt					
	LONGITUDINA CRACKING	L/TRANSVERSE	L	5.00 Ft					