FLORIDA DEPARTMENT OF TRANSPORTATION AVIATION AND SPACEPORTS OFFICE

Statewide Airfield Pavement Management Program

Airport Pavement Evaluation Report November 2019



Clearwater Airpark (CLW) Reliever Airport District 7





121

Florida Department of Transportation

Statewide Airfield Pavement Management Program

Prepared by:

FDOT Aviation and Spaceports Office 605 Suwannee Street Tallahassee, Florida 32399-0450

OFFICE OF FREIGHT, LOGISTICS & PASSENGER OPERATIONS



Table of Contents

Executive Summary
Program Background10
Summary of Results11Pavement Condition Index (Latest Inspection)11Forecasted Pavement Condition Index 2020-202912Major Rehabilitation Planning 2020-202913
Summary of Clearwater Airpark14
Chapter 1 – Introduction
1.1 Background16
1.2 Statewide Airfield Pavement Management Program (SAPMP) Update 2018-201916
1.3 Organization 18 1.3.1 Florida Department of Transportation Aviation and Spaceports Office Program Manager 18 1.3.2 Participating Florida Public-Use and Publicly Owned Airports 18 1.3.3 Florida Department of Transportation District Offices 18 1.3.4 Consultant 18
1.4 Purpose of Airport Pavement Evaluation Report
1.5 History of the Program
1.6 Federal Aviation Administration (FAA)22
1.7 FDOT SAPMP Objectives and Components 22 1.7.1 Program Objectives 22 1.7.2 Program Components 22
1.8 References
Chapter 2 – Methodology
2.1 Airfield Pavement Database
2.2 Airfield Pavement System Inventory 28 2.2.1 Pavement Management Program Network Definition Terminology 29
2.3 Airfield Pavement Structure 31 2.3.1 Pavement Structure Types 31
2.4 Airfield Pavement Work History
2.5 Airfield Pavement Traffic
2.6 Airfield Pavement Condition Index (PCI) Survey



2.6.3 PCI Survey Inspection Procedures	
Chapter 3 – Airfield Pavement System Inventory	
3.1 Airfield Pavement Network Information	
3.1.1 Previous and/or Anticipated Airfield Pavement Construction	
3.1.3 Functional Use Classification	
3.1.4 Pavement Surface Type	
3.1.5 Pavement System Inventory Details	49
Chapter 4 – Airfield Pavement Condition	53
4.1 Airfield Pavement Condition Index (Latest Inspection)	53
4.1.1 Network-Level Analysis	
4.1.2 Branch-Level Analysis	
4.2 Summary of Pavement Condition Evaluation Results	
4.2.1 Network-Level Observations	
4.3 Forecasted Pavement Conditions	
4.3.1 Performance Models and Prediction Curves 4.3.2 Branch-Level Pavement Condition Forecast	
4.3.3 Section-Level Pavement Condition Forecast	
4.3.4 Forecasted PCI Considerations	
Chapter 5 – Localized Maintenance and Repair Planning	67
5.1 Localized Maintenance and Repair	
5.2 Localized Maintenance and Repair Policy	68
5.3 Localized Maintenance and Repair Analysis and Recommendations	72
Chapter 6 – Major Rehabilitation Planning	76
6.1 Major Rehabilitation	76
6.1.1 Critical PCI	
6.1.2 FDOT Recommended Minimum Service-Level PCI	
6.2 Major Rehabilitation Policy	
6.2.1 Major Rehabilitation Pavement Section Development	
6.2.2 Major Rehabilitation Planning-Level Unit Costs	
6.3 Major Rehabilitation Needs	
6.3.1 10-Year Unconstrained Budget Major Rehabilitation Needs	
Chapter 7 – Conclusion	85
7.1 Recommendations	85
7.1.1 Continued PCI Survey Inspections	
7.1.2 Localized Maintenance and Repair	



7.1.3 Major Rehabilitation	
7.1.4 Pavement Management System	
7.2 Supporting Documents	86
001 – Airfield Pavement Network Definition Exhibit	
002 – Airfield Pavement System Inventory Exhibit	
003 – Airfield Pavement Condition Index Exhibit	
004 – Airfield Pavement Major Rehabilitation Exhibit	
Inspection Photograph Documentation	
7.3 Conclusion	87



Appendix AAirfield Pavement Analysis TablesAppendix BAirfield Pavement Localized Maintenance and Repair and Major
RehabilitationAppendix CTechnical ExhibitsAppendix DInspection Photograph DocumentationAppendix EInspection Distress Details





List of Figures

Figure E-4 Major Rehabilitation Planning Annual Budget 2020-202914
Figure 1.2 Florida Aviation System (Facilities with Pavement) and FDOT Districts17
Figure 1.7.2 (a) Typical Pavement Condition Life Cycle23
Figure 1.7.2 (b) General Pavement Treatments by Condition Range
Figures 1.7.2 (c) Flexible Asphalt Concrete25
Figures 1.7.2 (d) Rigid Portland Cement Concrete25
Figure 3.1.1 (a) 2019 Airfield Pavement Network Definition Exhibit
Figure 3.1.1 (b) 2019 Airfield Pavement System Inventory Exhibit45
Figure 3.1.2 Average Age of Pavements at Inspection46
Figure 3.1.3 Airfield Pavement Functional Classification Use by Area
Figure 3.1.4 (a) Pavement Surface Type by Area (SF)48
Figure 3.1.4 (b) Pavement Surface Type by Area (%)49
Figure 4.1.1 Latest Condition – Overall Network
Figure 4.1.2 (a) Latest Condition – Runway Pavements
Figure 4.1.2 (b) Latest Condition – Taxiway Pavements54
Figure 4.1.2 (c) Latest Condition – Apron Pavements55
Figure 4.1.3 2019 Airfield Pavement Condition Index Exhibit
Figure 4.2.2 Pavement Condition Summary by Facility Use
Figure 4.3.2 (a) Forecasted Runway Pavement Performance
Figure 4.3.2 (b) Forecasted Taxiway Pavement Performance
Figure 4.3.2 (c) Forecasted Apron Pavement Performance
Figures 6.1 (a) Major Rehabilitation Planning Decision Diagram, PCI ≤ Critical PCI76
Figures 6.1 (b) Major Rehabilitation Planning Decision Diagram, PCI > Critical PCI77
Figure 6.3.1 (a) 10-Year Major Rehabilitation Needs by Program Year
Figure 6.3.1 (b) 10-Year Major Rehabilitation Needs by Program Year Exhibit



List of Tables

Table E-1 Pavement Condition Index Summary (Last Inspection) – Section Level11
Table E-2 Pavement Condition Index Forecast 2020-2029 12
Table E-3 Major Rehabilitation Planning 2020-2029 13
Table 2.2.1 Airfield Pavement Database Network Definition Terminology
Table 2.6.2 (a) Pavement Distress Types – Flexible Asphalt Concrete-Surfaced Airfields 35
Table 2.6.2 (b) Pavement Distresses Possible Causes – Flexible Asphalt Concrete- Surfaced Airfields
Table 2.6.2 (c) Pavement Distresses Possible Effects – Flexible Asphalt Concrete- Surfaced Airfields 36
Table 2.6.2 (d) Pavement Distresses – Rigid Portland Cement Concrete-Surfaced Airfields
Table 2.6.2 (e) Pavement Distresses Possible Causes – Rigid Portland Cement Concrete- Surfaced Airfields 38
Table 2.6.2 (f) Pavement Distresses Possible Effects – Rigid Portland Cement Concrete- Surfaced Airfields 38
Table 2.6.3 (a) Recommended Sample Rate Schedule for Flexible Asphalt Concrete39
Table 2.6.3 (b) Recommended Sample Rate Schedule for Rigid Portland Cement Concrete
Table 2.6.4 Summary of Updates to ASTM D5340-12 41
Table 3.1.1 Previous and/or Anticipated Airfield Pavement Construction 43
Table 3.1.5 Pavement System Inventory Details 50
Table 4.1.3 Latest Pavement Condition Index Summary 57
Table 4.3.3 Forecasted PCI 2020-2029
Table 5.2 (a) Localized Maintenance and Repair – Flexible Asphalt Concrete
Table 5.2 (b) Localized Maintenance and Repair – Rigid Portland Cement Concrete69
Table 5.2 (c) Localized Repair Planning-Level Unit Costs – Flexible Asphalt Concrete71



Table 5.2 (d) Localized M&R Planning-Level Unit Costs – Rigid Portland Cement Concrete
Table 5.3 (a) Summary of Airport Localized M&R Planning Cost and Quantity at Network Level
Table 5.3 (b) Summary of Airport Localized M&R Planning Cost and Quantity at Section Level
Table 5.3 (c) Summary of Localized Maintenance 74
Table 6.1.2 FDOT Recommended Minimum Service-Level PCI
Table 6.2.1 (a) Conceptual Pavement Section for Major Rehabilitation – Flexible Asphalt Concrete
Table 6.2.1 (b) Conceptual Pavement Section for Major Rehabilitation – Rigid PortlandCement Concrete
Table 6.2.2 Reliever (RL) Major Rehabilitation Planning-Level Unit Cost by PavementType
Table 6.3.1 10-Year Major Rehabilitation Needs 82



Executive Summary

Executive Summary

Program Background

Airport airfield pavement infrastructure facilities represent a large capital investment in the Florida Airport System. Timely and appropriate maintenance and strategic rehabilitation are essential as repair costs increase significantly in proportion to deterioration. Airport pavement distresses can also contribute to the development of loose debris and decreased ride quality, which can be a safety concern for aircraft operations.

In 2016, the Florida Department of Transportation (FDOT) Aviation and Spaceports Office (ASO) selected Kimley-Horn and Associates, Inc. with subconsultants Airfield Pavement Management Systems, LLC and AVCON, Inc. to provide professional services in support of FDOT in the continued efforts of performing a system update to the Statewide Airfield Pavement Management Program (SAPMP). This work is to be completed from fiscal year 2016 through fiscal year 2019. The SAPMP has 95 public use airport facilities throughout the seven FDOT Districts that participate in the system update. The results of this system update for this specific airport are presented in this report and can be utilized by FDOT and the Federal Aviation Administration (FAA) to identify, prioritize, and schedule pavement maintenance, repair, and major rehabilitation projects.

Pavement condition was assessed utilizing the pavement condition index (PCI) methodology as defined in the FAA Advisory Circular 150/5380-7B "Airport Pavement Management Program (PMP)" using the documented procedures set forth by ASTM D5340-12 "Standard Test Method for Airport Pavement Condition Index Surveys."

Pavement deterioration, in accordance with the ASTM D5340-12, was characterized in terms of distinct distress types, severity level of distress, and quantity of distress. This information is utilized to calculate a PCI numeric that represents the overall condition of the pavement in a numeric index that ranges from 0 (a condition category of FAILED) to 100 (GOOD). The PCI methodology analyzes an overall measure of the pavement condition and provides an indication of the degree of maintenance, repair, or rehabilitation efforts that will be required to sustain functional pavement.

The tasks required for the system update at each participating airport consist of the following:

- Obtain recent and anticipated airfield pavement construction work data.
- Update airport airfield pavement system inventory records (construction history, identification, geometry, and facility classification).
- Perform PCI Survey Inspections at each participating airport.
- Update the FDOT SAPMP PAVER[™] database system.
- Update the FDOT SAPMP GIS Airfield Navigation GPS enabled Maps.
- Update airfield pavement performance models and pavement condition forecasting.
- Identification of planning-level maintenance, repair, and major rehabilitation to address pavement needs based on functional PCI analysis.
- Development of planning-level opinion of probable construction costs for pavement rehabilitation.

Summary of Results

Pavement Condition Index (Latest Inspection)

Table E-1 Pavement Condition Index Summary (Last Inspection) – Section Level

Network ID	Branch Name	Branch Use	Section ID	Area (SF)	PCI	Condition Rating
CLW	RUNWAY 16-34	RUNWAY	6105	15,000	88	Good
CLW	RUNWAY 16-34	RUNWAY	6110	224,775	78	Satisfactory
CLW	RUNWAY 16-34	RUNWAY	6120	22,500	84	Satisfactory
CLW	RUNWAY 16-34	RUNWAY	6130	45,750	89	Good
CLW	ΤΑΧΙΨΑΥ Α	TAXIWAY	105	63,329	77	Satisfactory
CLW	ΤΑΧΙΨΑΥ Α	TAXIWAY	107	5,097	89	Good
CLW	ΤΑΧΙΨΑΥ Α	TAXIWAY	110	7,086	79	Satisfactory
CLW	ΤΑΧΙΨΑΥ Α	TAXIWAY	135	22,265	66	Fair
CLW	ΤΑΧΙΨΑΥ Α	TAXIWAY	140	12,540	80	Satisfactory
CLW	ΤΑΧΙΨΑΥ Α	TAXIWAY	145	23,716	88	Good
CLW	ΤΑΧΙΨΑΥ Α	TAXIWAY	150	15,000	90	Good
CLW	TAXIWAY A1	TAXIWAY	115	6,928	77	Satisfactory
CLW	TAXIWAY A2	TAXIWAY	120	6,567	72	Satisfactory
CLW	TAXIWAY A3	TAXIWAY	125	6,967	63	Fair
CLW	TAXIWAY CONNECTOR TO RUNWAY 34	TAXIWAY	5105	1,446	47	Poor
CLW	APRON AT T-HANGARS 2	APRON	4105	37,331	59	Fair
CLW	APRON AT T-HANGARS 3	APRON	4205	24,739	65	Fair
CLW	APRON AT T-HANGARS 1	APRON	4305	31,826	48	Poor
CLW	APRON AT T-HANGARS 1	APRON	4310	12,550	88	Good
CLW	CENTER APRON	APRON	4405	22,600	90	Good
CLW	CENTER APRON	APRON	4410	11,073	49	Poor
CLW	NORTH APRON	APRON	4505	19,396	42	Poor
CLW	NORTH APRON	APRON	4510	2,581	86	Good
CLW	T-HANGAR APRON	APRON	4605	14,273	48	Poor
CLW	T-HANGAR APRON	APRON	4610	13,025	92	Good



Forecasted Pavement Condition Index 2020-2029

Table E-2 Pavement Condition Index Forecast 2020-2029

Network	Branch ID	Section	Last	Forecasted PCI									
ID	Branchild	ID	PCI	2020	2021	2022	2023	2024	2025	2026	2027	2028	2029
CLW	AP CENTER	4405	90	87	85	83	81	79	76	74	72	70	68
CLW	AP CENTER	4410	49	48	47	46	45	43	42	41	40	39	38
CLW	AP N	4505	42	40	39	38	37	35	34	33	32	31	31
CLW	AP N	4510	86	83	81	79	77	75	73	71	70	68	67
CLW	AP T-HAN 1	4305	48	46	45	44	43	42	41	40	39	37	36
CLW	AP T-HAN 1	4310	88	85	83	81	79	77	74	72	70	68	66
CLW	AP T-HAN 2	4105	59	58	57	56	55	55	54	53	53	52	51
CLW	AP T-HAN 3	4205	65	63	62	61	60	59	58	58	57	56	55
CLW	AP T-HANG	4605	48	46	45	44	43	42	41	40	39	37	36
CLW	AP T-HANG	4610	92	89	87	85	83	81	78	76	74	72	70
CLW	RW 16-34	6105	88	85	83	81	80	78	77	75	74	72	71
CLW	RW 16-34	6110	78	76	74	73	72	71	70	69	68	67	66
CLW	RW 16-34	6120	84	82	80	78	77	75	74	72	71	70	69
CLW	RW 16-34	6130	89	86	84	82	80	78	77	75	74	72	71
CLW	TW A	105	77	75	74	72	71	70	69	68	67	66	65
CLW	TW A	107	89	86	85	83	81	80	78	77	75	74	73
CLW	TW A	110	79	77	76	74	73	72	71	69	68	67	66
CLW	TW A	135	66	65	64	63	62	61	60	59	59	58	57
CLW	TW A	140	80	78	76	75	74	72	71	70	69	68	67
CLW	TW A	145	88	86	84	83	81	80	78	77	76	74	73
CLW	TW A	150	90	87	85	84	82	80	79	77	76	74	73
CLW	TW A1	115	77	75	74	72	71	70	69	68	67	66	65
CLW	TW A2	120	72	70	69	68	67	66	65	64	63	63	62
CLW	TW A3	125	63	62	61	60	59	58	58	57	56	55	54
CLW	TW CONN 34	5105	47	46	45	44	44	43	42	42	41	40	40




Major Rehabilitation Planning 2020-2029

Table E-3 Major Rehabilitation Planning 2020-2029

Program Year	Network ID	Branch ID	Section ID	Surface	Area (SF)	PCI Before	Rehabilitation Type	Planning Cost
2020	CLW	AP CENTER	4410	AC	11,073	48	AC Restoration	\$ 112,000.00
2020	CLW	AP N	4505	AC	19,396	40	AC Restoration	\$ 239,000.00
2020	CLW	AP T-HAN 1	4305	AC	31,826	46	AC Restoration	\$ 332,000.00
2020	CLW	AP T-HAN 2	4105	AC	37,331	58	AC Restoration	\$ 355,000.00
2020	CLW	AP T-HAN 3	4205	AC	24,739	63	AC Restoration	\$ 236,000.00
2020	CLW	AP T-HANG	4605	AC	14,273	46	AC Restoration	\$ 149,000.00
2020	CLW	TW A3	125	AAC	6,967	62	AC Restoration	\$ 67,000.00
2020	CLW	TW CONN 34	5105	AC	1,446	46	AC Restoration	\$ 16,000.00
2021	CLW	TW A	135	AAC	22,265	64	AC Restoration	\$ 212,000.00
2026	CLW	TW A2	120	AAC	6,567	64	AC Restoration	\$ 63,000.00

*All planning cost values have been rounded to the nearest thousand-dollar.



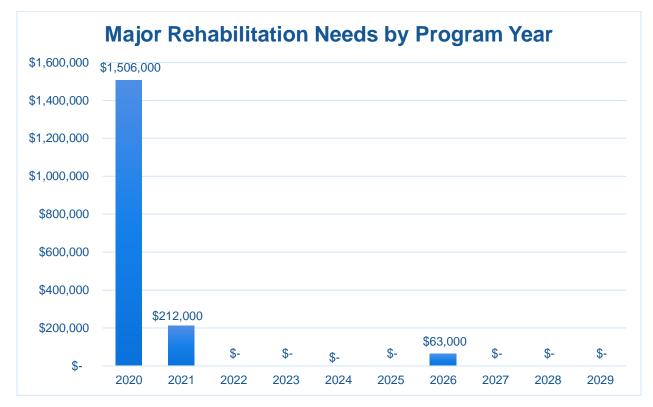

Summary of Clearwater Airpark

Clearwater Airpark was inspected in December of 2018 – the overall weighted PCI value was 74, a condition rating of Satisfactory. The results of the maintenance, repair, and major rehabilitation analysis identified \$128,460 in localized M&R needs based on current conditions and a 10-Year major rehabilitation need of \$1,781,000 based on forecasted conditions. The current major rehabilitation needs based on the latest inspection consist of \$1,506,000 for pavements below critical condition.

Localized maintenance and repair identified within this report are categorized as preventive or stopgap; the FDOT SAPMP has defined maintenance policies based on FAA recommendations. Major rehabilitation is identified within the FDOT SAPMP as major construction activity that would result in an improvement or resetting of the pavement section's PCI to a value of 100. Such activities could include: mill and hot-mix asphalt overlay, rigid pavement repair and slab replacement, and full-depth reconstruction. It is recommended that the airport use this as a planning tool for future project development and prioritization – all localized maintenance and repair and major rehabilitation recommendations should be considered as planning-level only. All final localized maintenance, repair, and major rehabilitation is subject to change based on airport prioritization and further design-level evaluation.



Chapter 1

Chapter 1 – Introduction

1.1 Background

The State of Florida has 128 public airports of which 100 public-use airports are recognized as part of the Federal Aviation Administration's (FAA) National Plan of Integrated Airport Systems (NPIAS) that are vital to the Florida economy as well as the economy of the United States. The Florida Aviation System (FAS) provides opportunities for the State to capitalize on an increasingly global marketplace. Florida's system of commercial service and general aviation (GA) airports are important to businesses throughout the entire State. Air travel is essential to tourism, Florida's number one industry.

There are millions of square feet of pavement infrastructure that consists of runways, taxiways, aprons, ramps, and other areas of airports that are vital to the support and safety of aircraft operations. Timely pavement maintenance, repair and major rehabilitation of these pavements will support the airport in operating safely, efficiently, economically and without excessive down time.

In general, adherence to the FAA Advisory Circulars are mandatory for all projects funded with federal grant monies through the Airport Improvement Program (AIP) and with revenue from the Passenger Facilities Charges (PFC) Program. Further information is detailed in FAA Grant Assurance No. 11 "Pavement Maintenance," No. 34 "Policies, Standards, and Specifications," and PFC Assurance No. 9 "Standards and Specifications." The Florida Department of Transportation (FDOT) performs the Statewide Airfield Pavement Management Program (SAPMP) System Updates for the benefit of participating public-use and publicly owned airports through the Aviation and Spaceports Office (ASO).

The SAPMP addresses the requirements of maintaining an effective pavement management program for the participating airports at the network level. Network-level management of pavement assets provides insight for short-term and long-term budget needs, understanding of the overall condition of the network (current and future), and pavement facilities that are subject for project consideration. A network-level evaluation can be supportive in the identification of maintenance, repair, and major rehabilitation needs and budgetary planning-level opinions of probable construction costs.

1.2 Statewide Airfield Pavement Management Program (SAPMP) Update 2018-2019

In 1992, the FDOT established the Statewide Airfield Pavement Management Program (SAPMP) to provide program managers, District Aviation and Spaceport Offices, and airport operators a system to proactively manage airport airfield pavement infrastructure within the Florida Aviation System. The SAPMP performs network-level Pavement Condition Index (PCI) survey inspections for airport facilities that are categorized as General Aviation (GA), Reliever (RL), and Commercial (PR). Currently, the program consists of 95 actively participating public-use airports with pavement facilities and provides users with comprehensive data to better manage pavement assets.



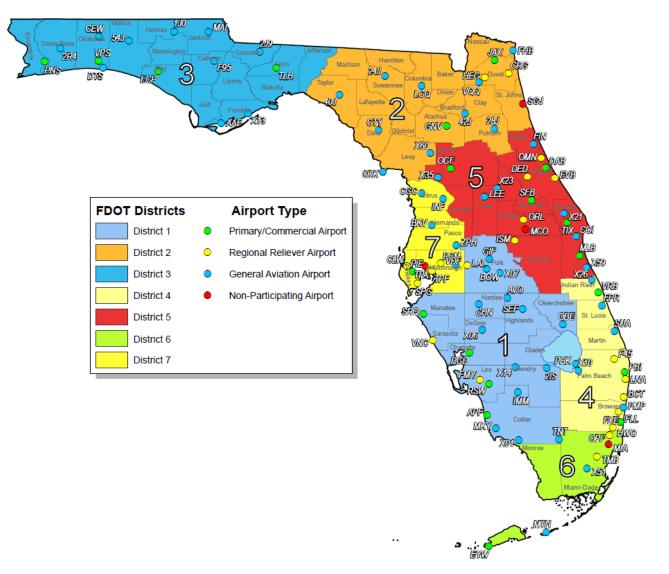


Figure 1.2 Florida Aviation System (Facilities with Pavement) and FDOT Districts

In 2016, the Florida Department of Transportation Aviation and Spaceports Office contracted Kimley-Horn and Associates, Inc. along with subconsultants Airfield Pavement Management Systems, LLC and AVCON, Inc. to provide professional services in support of FDOT in the continued efforts of performing a system update to the SAPMP. This work is to be completed from fiscal year 2016 through fiscal year 2019.

1.3 Organization

1.3.1 Florida Department of Transportation Aviation and Spaceports Office Program Manager

The FDOT Aviation and Spaceports Office (ASO) Aviation Engineering Manager serves as the Program Manager (ASO-PM) for the SAPMP. The ASO-PM monitors the work performed by the designated Consultant for the program. The ASO-PM has review and approval authority for each program task and manages the program's day-to-day details and pertinent updates.

The ASO-PM reports updates and milestones to the FDOT State Aviation and Spaceports Manager and Development Administrator.

1.3.2 Participating Florida Public-Use and Publicly Owned Airports

The airports are the end-user and beneficiary of the SAPMP. The SAPMP provides a specific Airport Pavement Evaluation Report that meets the requirements of the FAA Advisory Circular **150/5380-7B "Airport Pavement Management Program (PMP)."** Individual participating airports will be provided a final Airport Pavement Evaluation Report by the designated Consultant that is specific to each airport's airfield pavement condition index survey. The ASO-PM has full authority and final approval of each report prior to finalization. In advance of each PCI survey and prior to completion of each Airport Pavement Evaluation Report, participating airports are asked to provide the necessary record documentation for the proper analysis efforts. Relevant record documentation artifacts may consist of but are not limited to: Airport Layout Plans (ALP), Construction Bid Tabulations, As-Built Construction Drawings, Engineer's Reports, and/or field pavement inspection reports.


1.3.3 Florida Department of Transportation District Offices

The seven (7) FDOT District Offices, specifically the Aviation representatives (currently the Freight and Logistics personnel), provide essential support to the SAPMP update and the ASO-PM. Each District supports the SAPMP's on-going efforts by providing local construction cost information throughout the State. The construction cost information, typically consisting of plans and bid tabulations, are used as the basis of the development maintenance, repair, and major rehabilitation opinions of probable construction costs for planning purposes. Each District Office receives copies of individual Airport Pavement Evaluation Reports for the participating airport facilities located within their respective Districts.

1.3.4 Consultant

The Consultant, Kimley-Horn and Associates, Inc., provides technical and administrative support to the ASO-PM for the SAPMP update. The support consists of airfield pavement system inventory updates, performance of PCI Surveys in accordance with ASTM *D5340-12* "*Standard Test Method for Airport Pavement Condition Index Surveys,*" evaluation and reporting of the pavement condition in accordance with the FAA Advisory Circular *150/5380-7B* "*Airport Pavement Management Program (PMP).*"

The Consultant Team consists of Kimley-Horn, Airfield Pavement Management Systems, LLC., and AVCON, Inc.



- Research and evaluation of existing record documentation was performed to identify construction projects that have taken place since the most recent major update of the SAPMP. This data is used to update the pavement inventory and network definition.
- An update to the existing Network Definition Map was made to reflect geometric changes, pavement composition updates, and section characterization. Furthermore, an update to the PCI Survey sample units were made to reflect the field investigation efforts.
- A functional pavement evaluation with PCI Survey inspections was completed on all airfield pavements maintained by the Airport. The PCI Survey procedure, as defined by ASTM D5340-12, was used as the basis of the functional pavement evaluation. For this specific evaluation, the sample units defined by prior studies were inspected as to better develop performance models for prediction curves. Pavement subject to construction or anticipated construction during scheduled PCI Survey inspection or within 2 years were omitted from inspection based on confirmation of airport personnel.
- Condition Analysis was performed based on the distress data observed, rated, measured, and recorded in accordance with the ASTM D5340-12 for the calculation of PCI values and ratings. The results of the current condition analysis were used in concert with the historic PCI Survey data and construction work history to develop performance models to forecast future PCI values for each section for a 10-year study duration.
- Maintenance, Repair, and Rehabilitation Planning was performed predicated on the results of the condition analysis with updated policies and planning-level unit costs. The policies, or M&R policies, have been updated to reflect standard practices for maintenance, repair, and major rehabilitation as defined by the FAA AC 150/5380-6C "Guidelines and Procedures for Maintenance of Airport Pavements." Planning-level unit costs were developed based on representative construction bid tabulations provided by participating airports. The bid tabulations consisted of limited airfield pavement construction projects that took place between 2009 and 2015 at participating airports.



The individual airport airfield pavement evaluation report discusses the work performed, a summary of findings, condition analysis results, and recommendations for maintenance, repair, and major rehabilitation (M&R) planning associated with the SAPMP system update. It also briefly describes the procedures used to ensure that the appropriate engineering and scientific standards of care, quality, budget, schedules, and safety requirements were implemented during the performance of this work.

The purpose of this Airfield Pavement Evaluation Report is to achieve the following:

- Describe the goals, procedures, and purpose of the SAPMP
- Provide a brief technical explanation of the pavement management methodology, standard practices, and objectives
- Analyze pavement distresses data for the determination of pavement conditions and for identification of airfield pavement maintenance, repair, and major rehabilitation needs based on functional PCI trends

The identification of rehabilitation needs has been determined at the planning level. Design-level investigation is recommended prior to developing construction-level design documents and budgets.

In compliance with FAA Grant Assurances 11 and 19; the FDOT SAPMP provides airports with airfield pavement evaluation reports in accordance with FAA AC 150/5380-7B Airport Pavement Management Program (PMP) and AC 150/5380-6C Guidelines and Procedures for Maintenance of Airport Pavements. The application of the results of a PCI survey are for planning purposes and are limited to the visual observation of deteriorated pavements in limited sampling; design-level investigation is recommended in accordance with the FAA procedures defined in AC 5320-6F Airport Pavement Design and Evaluation and AC 150/5370-11B Use of Nondestructive Testing in the Evaluation of Airport Pavements. The aforementioned ACs provide the design-level material properties of in-situ pavement and subgrade layers for the determination of appropriate rehabilitation actions. The FDOT Statewide Airfield Pavement Management Program is organized to provide airports with planning-level data and does not intend to preclude the responsible engineer in performing the appropriate level of investigation and analysis in determining the appropriate design details of a pavement rehabilitation. It would not be advisable to solely base design-level rehabilitation without the appropriate level of investigation and determination of pavement deterioration beyond that of a visual functional condition assessment.

1.5 History of the Program

In 1992, the FDOT implemented the SAPMP to understand the pavement conditions at public airports in the FAS, systematically update pavement infrastructure information, and assist airport operators with recommendations of pavement maintenance, repair, and major rehabilitation needs. The 1992 SAPMP implementation provided the FDOT and the participating airports valuable information for establishing and performing timely and appropriate pavement rehabilitation.

2019

During the 1992-1993 implementation and again during the 1998-1999 updates; the SAPMP performed the development with proprietary software for pavement management system analysis. This development allowed for the creation of pavement management database file system populated with airport attributes and condition data. The pavement management database was used to establish maintenance, repair, and rehabilitation policies; consider planning-level unit costs; and develop recommendations for performing pavement maintenance. This system, known as AIRPAV, was initially developed during the 1992-1993 SAPMP implementation for the analysis of distress data. The AIRPAV system was used again in the 1998-1999 SAPMP update.

In 2004, the SAPMP system update included the review of the AIRPAV software compared to other industry available non-proprietary software packages. As a result of this review, MicroPAVER[™] (currently known as PAVER[™]) was selected for implementation of the system update. MicroPAVER[™] was developed by the U.S. Army Corps of Engineers Construction Engineering Research Laboratory for pavement management. Data from the 1998-1999 FDOT SAPMP update, which was built upon the initial 1992-1993 implementation of AIRPAV, was reviewed and converted to be compatible with the MicroPAVER[™] system. This data conversion included all documented pavement facilities, classifications, types, histories, geometries, PCI condition data and pertinent attributes gathered from airport feedback at the time. This information was used to develop the inventory of each participating airport's pavement facilities in a consistent format. This was the development of Airfield Pavement Network Definition Exhibits. These inventory exhibits visually depicted the branch, section, and sample units that were based upon the pavement construction history and composition information provided by each airport.

In the 2006-2008 system update, the SAPMP was updated again with continued use of the MicroPAVER[™] system. Based on the distress data collected, a maintenance repair and major rehabilitation planning program was developed for each airport. As part of this SAPMP update, the procedures for the inspection and the collection of the pavement distress data were documented, and an interactive website (http://www.dot.state.fl.us/aviation/pavement.shtm) was established for input of data.

In the 2010-2012 system update, the SAPMP was updated using new global positioning system (GPS) integrated technology to digitally collect pavement distress data. Interactive geographic information system (GIS) map files were developed from updated Airfield Pavement Network Definition Exhibits to aid pavement condition inspectors in the collection of sample distress data. The data collected was utilized to develop pavement performance models to predict future pavement PCI values and make recommendations for major rehabilitation.

In the 2013-2015 system update, the SAPMP integrated PAVER[™] and FieldInspector[™] with the use of GPS and GIS capable field tablets. Furthermore, the update included continued adherence to the ASTM D5340-12 "Standard Test Method for Airport Pavement Condition Index Surveys." The ASTM update consisted of refinement of distress definition types and deduction values for select asphalt concrete and Portland Cement Concrete distresses.



1.6 Federal Aviation Administration (FAA)

Currently, airports participating in the Airport Improvement Program (AIP) Grant Program are required by the FAA to develop and implement a pavement maintenance program to be eligible for funding (FAA Advisory Circular 150/5380-6C "Guidelines and Procedures for Maintenance of Airport Pavements" and 150/5380-7B "Airport Pavement Management Program (PMP)"). This program requires detailed inspection of airfield pavement conditions by trained personnel. The inspections are required to be performed at least once a year using the PASER method or every three years if the pavement is inspected as defined by the PCI survey procedure in accordance with the ASTM D5340-12 "Standard Test Method for Airport Pavement Condition Index Surveys."

In general, adherence to the Advisory Circulars are mandatory for all projects funded with federal grant monies through the AIP program and with revenue from the Passenger Facilities Charges (PFC) Program. Further information is detailed in FAA Grant Assurance No. 11 "Pavement Maintenance," No. 34 "Policies, Standards, and Specifications," and PFC Assurance No. 9 "Standards and Specifications."

1.7 FDOT SAPMP Objectives and Components

The FDOT SAPMP is a program that provides the FAS support in implementing and/or maintaining a network-level Pavement Management Program in a consistent and regularly scheduled manner.

In accordance with FAA AC150/5380-7B "Airport Pavement Management Program (PMP)" an effective Pavement Management Program consists of a system that achieves specific objectives. The FDOT SAPMP objectives are as follows:

1.7.1 Program Objectives

- 1 A systematic means for collecting and storing information regarding existing pavement structure and condition.
- 2 An objective and repeatable system for evaluating pavement condition.
- 3 Procedures for predicting future pavement condition.
- 4 Procedures for modeling both past and future pavement performance conditions.
- 5 Procedures to determine the budget requirements to meet management objectives, such as the maintenance, repair, and major rehabilitation budget required to keep a pavement at a specified PCI level or the budget required to improve to target PCI level.
- 6 Procedures for formulating and prioritizing maintenance, repair, and major rehabilitation projects.

The objectives are accomplished by the following components:


1.7.2 Program Components

- A. Database
- B. Pavement Inventory
- C. Pavement Structure
- D. Pavement Work History
- E. Pavement Condition Data



- F. Pavement Performance Modeling for the Prediction/Forecast of PCI
- G. Maintenance, Repair, and Major Rehabilitation Policies and Budget Simulation

A well-maintained network-level pavement management program may provide airport staff a better understanding of the airfield pavement performance for developing and planning for specific maintenance, repair, and major rehabilitation projects. The understanding of specific distress types and severities will assist the airport in addressing pavement maintenance and repair with the appropriate treatments as defined by the FAA Advisory Circular 150/5380-6C "Guidelines and Procedures for Maintenance of Airport Pavements." The development of projects with an understanding of system inventory, deterioration details, and pavement condition forecasts may assist airport staff in developing practical rehabilitation actions and budgets. Furthermore, the understanding of pavements' past performance and forecasted condition may assist airport staff in addressing pavement rehabilitation in a timely and costeffective manner. Figure 1.7.2 (a) Typical Pavement Condition Life Cycle, which is based on the FAA Advisory Circular 150/5380-7B "Airport Pavement Management Program (PMP)." Figure 1.7.2 (a) Typical Pavement Condition Life Cycle, depicts a general duration of a pavement section and identifies the ideal condition to perform rehabilitative treatments at an optimal cost rather than allowing significant increase in rate of deterioration that would result in increased costs.

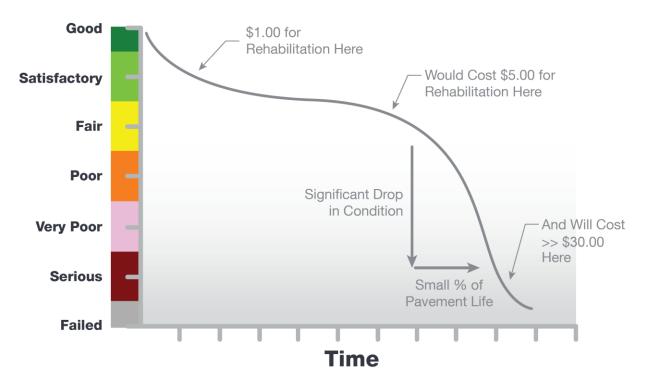




*Figure is for conceptual purposes only – unit costs are not specific to airfield pavements (AC vs PCC).

Figure 1.7.2 (b) General Pavement Treatments by Condition Range depicts generic flexible asphalt concrete (AC) pavement treatments that are effective at specific condition ranges. This graphic is a general concept and will vary based on pavement surface type and overall

FDOT

composition. The intent is to convey various treatment types that would be effective based on the condition of the pavement along the deterioration model.



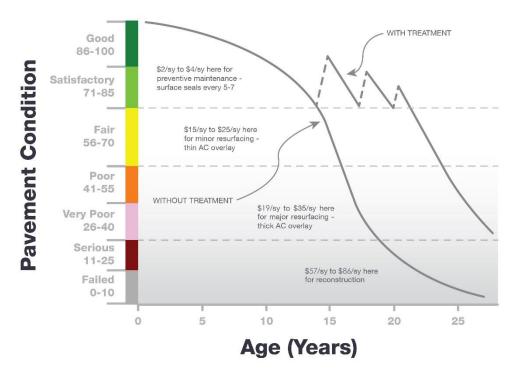

Pavement maintenance, repair, and major rehabilitation would be quite anticipatory if all pavements behaved as depicted in **Figures 1.7.2 (a) and 1.7.2 (b)**, however pavement condition performance vary significantly based on several factors. Factors that contribute to a pavement section's condition and deterioration performance may include: functional design life, material type, material construction quality, climatic conditions, aircraft loading type and frequency, non-aircraft loading type and frequency, maintenance history, subgrade conditions, and other infrastructure in the vicinity. The list of factors is not all-inclusive of all factors that may contribute to a pavement's life cycle, it is intended to clarify that unique conditions certainly will affect a pavement's deterioration.

Figures 1.7.2 (c) and 1.7.2 (d), depict visual conditions of pavement facilities, for both AC and PCC respectively, with approximated PCI ranges and corresponding repair and rehabilitation measures.


2019

Clearwater Airpark (CLW)



	PCI Range	Representative PCI	Representative Pavement Surface	Rehabilitation Activities
Routine Maintenance	86-100	90		Pavements with PCI values above 85, or 'Good', may require periodic joint/crack sealing and local patching.
Pavement Preservation	65-85	70		Pavements with PCI conditions ranging from 'Fair' to 'Satisfactory' may require surface treatments (seal coat), thin overlays, and/or joint/crack sealing.
Major Rehabiliation	40-64	50		Pavements that have deteriorated below a PCI 65 (but above 39), or within the range of 'Very Poor' to 'Fair' conditions, may require major rehabilitation such as pavement mill and overlay or partial full-depth reconstruction.
Major Reconstruction	0-39	15		Pavements that have deteriorated below a PCI 40, or within the range of 'Failed' to 'Very Poor' conditions, may require major reconstruction.

Figures 1.7.2 (c) Flexible Asphalt Concrete



	PCI Range	Representative PCI	Representative Pavement Surface	Rehabilitation Activities
Routine Maintenance	86-100	90		Pavements with PCI values above 85, or 'Good', may require periodic joint/crack sealing and local patching.
Pavement Preservation	65-85	70		Pavements with PCI conditions ranging from 'Fair' to 'Satisfactory' may require patches and/or joint/crack sealing.
Major Rehabiliation	40-64	50		Pavements that have deteriorated below a PCI 65 (but above 39), or within the range of 'Very Poor' to 'Fair' conditions may require major rehabilitation such as slab replacement and PCC restoration activity.
Major Reconstruction	0-39	15		Pavements that have deteriorated below a PCI 40, or within the range of 'Failed' to 'Very Poor' conditions, may require major reconstruction.



1.8 References

The following reference documents were referenced as specific guidelines and procedures for maintaining airport pavements; establishing an effective pavement maintenance program; and identifying specific pavement distresses, probable causes of distresses, inspection guidelines, and recommended methods of repair:

- ASTM D5340-12 "Standard Test Method for Airport Pavement Condition Index Surveys."
- FAA Advisory Circular 150/5380-7B "Airport Pavement Management Program." •
- FAA Advisory Circular 150/5380-6C "Guidelines and Procedures for Maintenance of • Airport Pavements."
- FAA Advisory Circular 150/5320-6F "Airport Pavement Design and Evaluation." •
- Department of the Air Force, Air Force Civil Engineer Center "Engineering Technical • Letter (ETL) 14-3: Preventive Maintenance Plan (PMP) for Airfield Pavements."
- Unified Facilities Criteria (UFC) 3-260-16FA 16 "Airfield Pavement Condition Survey • Procedures Pavements."
- Unified Facilities Criteria (UFC) 3-260-03 "Airfield Pavement Evaluation."
- Pavement Management for Airports, Roads, and Parking Lots 2nd Edition, M.Y. Shahin. •



Chapter 2

FDOT

Chapter 2 – Methodology

An effective pavement management program incorporates the regular collection of pavement condition information and communication of information to appropriate sponsors. This chapter of the report defines the specific methods utilized as part of the SAPMP System Update to meet the requirements of an effective pavement management system as defined by the FAA Advisory Circular **150/5380-7B** "Airport Pavement Management Program (PMP)."

2.1 Airfield Pavement Database

The SAPMP program has historically utilized PAVER[™] (formerly MicroPAVER[™]); the current update has maintained the use of the PAVER[™] 7.0 version of the software. The PAVER[™] software application was developed by the U.S. Army Construction Engineering Research Laboratory sponsored by the FAA, Federal Highway Administration, U.S. Army, U.S. Air Force, and the U.S. Navy to meet the objectives of an effective pavement management system. The SAPMP consists of a network-level database of the airport's airfield pavement facilities that are part of the program. PAVER[™] can achieve the following pavement management objectives: a manageable inventory system, the analysis of the current condition of pavements in accordance with the ASTM D5340, the development of pavement performance models to forecast conditions, and the development of maintenance, repair, and major rehabilitation recommendations based on budgetary scenarios.

PAVER[™] inventory management is based on a tiered organizational structure that consists of networks, branches, and sections, with the section being the smallest unit of management. Critical elements of an effective pavement management program are maintained within the network-level PAVER[™] database. These elements typically consist of pavement inventory characteristics, pavement structure, work history, historic condition records, and analytical customization.

The SAPMP System Update consisted of the conversion of the previous database from a PAVER[™] version 6.5 to a version 7.0.

2.2 Airfield Pavement System Inventory

An airfield pavement system inventory typically maintains the location of all runways, taxiways, and aprons; geometric characteristics; type of pavement structure, year of construction and/or last major rehabilitation; and general composition details of the pavement.

The pavement inventory for an airport's airfield is an assembly of pavement infrastructure information that builds an inventory of branches and sections that codifies the airport's airfield pavement network. General geometry characteristics, estimated length, width, functional classification, pavement surface type, and operational function are among the characteristics identified at this initial phase in the pavement management process. The development of a pavement inventory that reasonably reflects the airport's airfield pavement facilities that are maintained by the airport provides a defined scope of the inspection and analysis efforts. As in the past, the SAPMP scope of work is specific to the airport-maintained airfield pavements as defined in the field network definition exhibits presented to current airport personnel.



A critical input to the pavement system inventory and network definition in the development of the SAPMP update is the date of last major rehabilitation/construction performed on the pavement assets that would set the asset at a PCI of 100 and a condition rating of Good. The airport provided a limited combination of record drawings, reports, and staff input that was pertinent information in developing the construction history of the airport's pavements from inception. Major rehabilitation/construction activities performed in the last 24-months or anticipated in the next 24-months are assumed to restore the PCI to 100. These activities include; pavement overlay, mill and replace, mill and overlay, new construction, and/or complete reconstruction.

Aerial imagery was obtained through the FDOT Surveying & Mapping Office's Aerial Photo Look Up System (APLUS). This spatially projected imagery was utilized with computer-aided drafting software (AutoCAD) in concert with geographical information system software (ArcGIS) to develop a planning-level representative model that reasonably reflects the pavement assets at the airport.

2.2.1 Pavement Management Program Network Definition Terminology

There are several terms that are common in the communication of the results of the SAPMP System Update, these terms are defined as follows:

Pavement Network

A pavement network is a logical unit for organizing pavements into a structure for pavement management. A network will typically consist of one or more pavement branches, which are typically comprised of one or many pavement sections. The network is the starting point of the hierarchy of pavement management organization. For example, a network can be all the pavements within an airport's airfield or all the pavements in a statewide program. For the FDOT SAPMP, a network represents an individual airport's airfield pavement facilities maintained by the airport.

The SAPMP System Update consists of research and evaluation of existing record documentation for the participating airports' airfield facilities. The pavement network is typically limited to the pavement facilities subject to aircraft use that is also maintained by the airport owner and eligible for public funding.

Pavement Branch

A pavement branch, also known as a facility, is a logical unit of generally identifiable pavement of a network with distinct functional classification. For example, within an airfield each runway, taxiway, or apron is considered a branch. A branch must consist of at least one section.

Pavement Section

A pavement section, also known as a feature, is the most specific management unit when considering the application and selection of maintenance, repair, and/or major rehabilitation treatments on an area of pavement within a branch. Each branch consists of at least one section, but may consist of more if pavement feature characteristics are distinct throughout the branch. Characteristics considered when subdividing branches into sections include, but are not limited to: pavement structure, type, age, condition, and function; traffic composition and frequency (current and future); geometric location; construction history; and other related

infrastructure features (e.g. drainage). A pavement section is defined as a subordinate of a pavement branch, which is a subordinate of a "parent" pavement network.

Pavement Sample Unit

A pavement sample unit is a subdivision of a pavement section that has a standard size range: twenty (20) continuous slabs (± 8 slabs) for Portland Cement Concrete (PCC) pavement and 5,000 contiguous square feet ($\pm 2,000$ ft²) for flexible asphalt concrete (AC) or porous friction course pavements.

PMS Network Level	Common Definition	Airport Example
Network	Overall pavement assets maintained by the Airport	"Tallahassee International Airport – Airfield Pavements"
Branch Name	Commonly defined asset name as established by Airport and by use	"Runway 18-36"
Branch ID	Codified shorthand name for commonly defined asset established for database identification	"RW 18-36" RW, Branch Use, "Runway" 18-36, Runway Facility
Section ID	Codified identification for pavement asset that is distinct by the following: Pavement Composition Construction Work History Aircraft Traffic Condition Records	"6105"
Sample Unit	A numeric identification of an area of pavement (5,000±2,000 SF of AC or 20±8 slabs of PCC) that has been inspected in accordance with ASTM D5340-12.	"300"

Table 2.2.1 Airfield Pavement Database Network Definition Terminology



2.3 Airfield Pavement Structure

2.3.1 Pavement Structure Types

Airport airfield pavements are constructed to provide adequate support for the loads imposed by aircraft and produce a firm, stable, smooth, all-year, all-weather surface free of debris or other particles that may be blown or dislocated by propeller wash or jet blast. Typical pavement planning and design requires coordination of factors that include but are not limited to; subgrade conditions, material layer types, aircraft fleet mix (type, frequency, and traffic growth), and functional use. A pavement structure is composed of constructed layers that consist of subgrade, subbase, base course, structural courses, and surfaces courses. For the FDOT SAPMP, two major pavement structure types are classified for evaluation and analysis: Flexible Asphalt Concrete Surface and Rigid Portland Cement Concrete Surface. Additionally, Composite Structures known as Whitetopping Pavements are also present at limited airports within the Florida Airports System; these unique pavement structures are evaluated separately.

Flexible Asphalt Concrete Surface

A pavement comprised of aggregate mixture with an asphalt cement binder. The FDOT SAPMP consists of three (3) asphalt concrete surface types: Asphalt Concrete (AC), Asphalt Concrete Overlaid on Asphalt Concrete (AAC), and Asphalt Concrete Overlaid on Portland Cement Concrete (APC).

Asphalt Concrete (AC)

A flexible pavement section consisting of aggregate mixture with asphalt cement binder layered on engineered base course material that is layered on subbase and subgrade soil material.

Asphalt Concrete Overlaid on Asphalt Concrete (AAC)

A flexible pavement section consisting of aggregate mixture with asphalt cement binder layered on an existing flexible AC pavement section. Flexible airfield pavement sections are AAC when a pavement rehabilitation consists of a pavement milling operation and a resurfacing of asphalt layers; or a direct overlay of asphalt concrete without surface preparation.

Asphalt Concrete Overlaid on Portland Cement Concrete (APC)

A flexible pavement section consisting of aggregate mixture with asphalt cement binder layered on an existing Rigid PCC pavement section. This unique pavement composition may result in distinct pavement distress manifestations known as reflective joint cracking.



Rigid Portland Cement Concrete Surface

A pavement comprised of aggregate mixture with a Portland Cement binder. The FDOT SAPMP recognizes Portland Cement Concrete (PCC) as the primary rigid pavement section.

Portland Cement Concrete (PCC)

A rigid pavement section composed of Portland cement concrete placed on a granular or treated base course that is supported on a compacted subgrade. The concrete surface must provide a texture of nonskid qualities, prevent the infiltration of surface water into the subgrade, and provide structural support to the airplanes. Rigid pavement construction requires the layout of appropriately designed joint spacing.

Composite Structure – Whitetopping Pavement

A composite pavement comprised of relatively thin Portland Cement Concrete overlaid on an existing flexible asphalt concrete pavement structure. There are three (3) types of Whitetopping Pavements; Conventional (WHT), Thin (TWT), and Ultra-Thin (UTW).

Conventional Whitetopping (WHT)

A composite pavement structure consisting of a modified PCC overlaid on an existing flexible AC pavement section area. The modified PCC layer is typically greater than 8 inches in thickness.

Thin Whitetopping (TWT)

A composite pavement structure consisting of a modified PCC overlaid on an existing flexible asphalt concrete pavement section. The modified PCC layer is typically between 4 and 8 inches in thickness.

Ultra-Thin Whitetopping (UTW)

A composite pavement structure consisting of a modified PCC overlaid on an existing flexible asphalt concrete pavement section. The Portland Cement Concrete layer is typically between 2 and 4 inches in thickness.

2.4 Airfield Pavement Work History

2.4.1 Airfield Pavement Record Keeping

It is strongly recommended that airports maintain records of all airfield construction and maintenance related to the pavement facilities. A history of all maintenance and repair performed and its associated costs (construction and soft costs) can provide valuable information on the effectiveness of various treatments on pavements. An airport should maintain detailed records of maintenance (routine, emergency, and proactive) activities. The records should consist of the following:

- 1. Location and Limits of Work.
- 2. Types and Severity of Distresses Repaired.
- 3. Type of Work.
- 4. Cost of Work.
- 5. Supporting Documents (contract documents, construction drawings, specifications, bid tabulations, repair product, photograph records, etc.).

2.5 Airfield Pavement Traffic

A pavement section is typically designed to meet the needs of the user (airlines, air cargo, general aviation, and/or military) in providing a safe, smooth, operational surface. Pavement deterioration generally occurs gradually through increased roughness and/or fatigue cracking caused by successive and heavy aircraft traffic.

This study does not consist of a study or analysis of each individual airport's airfield aircraft fleet mix or traffic operations. However, it is strongly recommended that airports incorporate the requirements of FAA Advisory Circular **150/5320-6F Airport Pavement Design and Evaluation** when developing design-level rehabilitation activities. The AC provides guidance on incorporation of aircraft traffic fleet mix data.

2.6 Airfield Pavement Condition Index (PCI) Survey

2.6.1 PCI Survey Methodology

In adherence to the FAA Advisory Circular **150/5380-7B** "Airport Pavement Management **Program (PMP)**," the FDOT SAPMP utilizes the PCI Survey Method of inspection to collect pavement distress data and analyze the condition. The PCI Survey Inspection procedure is a visual statistical sampling of pavements for recording primary distress types (e.g. cracking and deformation), associated severities, and quantities as defined by the ASTM D5340-12. This effort is the primary means of obtaining and recording pavement distress data. The survey inspection consists primarily of visual inspection of pavement surfaces for signs of distress and deterioration resulting from loading (aircraft) and environmental influences.

A visual pavement condition survey provides an indication of the cause and rate of deterioration of a pavement section from a functional point of view and can be an indicator of structural distress. The functional condition analysis assesses the rating of the operational surface. A visual PCI Survey Inspection does not predict the remaining structural life of a pavement section, or its ability to support loads. The functional condition determined by the PCI method



can provide a cost-effective means to plan for pavement rehabilitation projects. The timely application of pavement rehabilitation may lead to the extension of functional life of individual pavement sections. This method varies from structural evaluation; functional condition is limited to visually observed distresses and indicative modes of pavement deterioration. A formal structural evaluation analyzes subsurface conditions, material characteristics, and qualitative pavement structure attributes. A structural evaluation may consist of; subsurface geotechnical exploration, falling weight deflectometer testing, petrographic testing, material coring, and/or flexural testing.



2.6.2 Pavement Distress Types

For each section, the severity and quantity of defined distresses are recorded and then analyzed in accordance with the ASTM D5340-12 standard. The standard identifies 17 distinct flexible asphalt concrete distress types and 16 distinct rigid Portland Cement Concrete distress types.

Table 2.6.2 (a) Pavement Distress Types – Flexible Asphalt Concrete-Surfaced Airfields

Distress	Common Distress Mechanisms
Alligator Cracking	Load / Fatigue
Bleeding	Construction Quality/ Mix Design
Block Cracking	Climate / Age
Corrugation	Load / Construction Quality
Depression	Load / Subsurface
Jet Blast	Aircraft
Joint Reflection - Cracking	Climate / Subsurface Pavement / Traffic Load
Longitudinal/Transverse Cracking	Climate / Construction Quality
Oil Spillage	Aircraft / Vehicle
Patching	Utility / Pavement Repair / Age
Polished Aggregate	Repeated Traffic Loading
Raveling	Climate / Age
Rutting	Load / Fatigue
Shoving	PCC Pavement Growth / Movement
Slippage Cracking	Load / Pavement Bond / Mix Design
Swelling	Climate / Subsurface
Weathering	Climate / Age



Table 2.6.2 (b) Pavement Distresses Possible Causes – Flexible Asphalt Concrete-SurfacedAirfields

	Classification by Possible Causes								
Load	Climate / Durability	Moisture / Drainage	Others						
 Alligator Cracking Corrugation Depression Patching of Load-based distress Polished Aggregate Rutting Slippage Cracking 	 Bleeding Block Cracking Joint Reflection Cracking L/T Cracking Patching of climate / durability-caused distresses Shoving from PCC Raveling Weathering Swelling 	 Alligator Cracking Depression Patching of moisture / drainage caused distress Swelling Raveling Weathering 	 Oil Spillage Jet Blast Erosion Polished Aggregate 						

Table 2.6.2 (c) Pavement Distresses Possible Effects – Flexible Asphalt Concrete-SurfacedAirfields

Classification by Possible Effects								
Roughness	Skid / Hydroplaning Potential	FOD Potential	Rate of Deterioration and Maintenance Requirements					
 Corrugation Depression Rutting Shoving of asphalt pavement Swelling Raveling Weathering 	 Bleeding Depression Polished Aggregate Rutting 	 Block Cracking Joint Reflection Cracking L/T Cracking Slippage Cracking 	All Distresses					



121

Table 2.6.2 (d) Pavement Distresses – Rigid Portland Cement Concrete-Surfaced Airfields

Distress	Common Distress Mechanisms				
Blowup	Climate / ASR				
Corner Break	Load Repetition / Curling Stresses				
Linear Cracking	Load Repetition / Curling Stresses / Shrinkage Stresses				
Durability Cracking	Freeze-Thaw Cycling				
Joint Seal Damage	Material Deterioration / Construction Quality / Age				
Small Patch	Pavement Repair				
Large Patch/Utility Cut	Utility / Pavement Repair				
Popout	Freeze-Thaw Cycling / ASR / Material Quality				
Pumping	Load Repetition / Poor Joint Sealant				
Scaling	Construction Quality / Freeze-Thaw Cycling				
Faulting	Subgrade Quality / ASR / Inadequate Load Transfer				
Shattered Slab	Overloading				
Shrinkage Cracking	Construction Quality / Climate				
Joint Spalling	Load Repetition / Infiltration of Incompressible Material / Deterioration of Dowel (Load Transfer) Bars				
Corner Spalling	Load Repetition / Infiltration of Incompressible Material / Deterioration of Dowel (Load Transfer) Bars				
Alkali-Silica Reaction (ASR)	Construction Quality / Climate / Chemical Reaction				



Table 2.6.2 (e) Pavement Distresses Possible Causes – Rigid Portland Cement Concrete-Surfaced Airfields

	Classification by Possible Causes								
Load	Climate / Durability	Moisture / Drainage	Others						
 Corner Break Shattered Slab L/T/D Cracking Pumping Patching of Load- associated distress Spalling 	 Blowup "D" Cracking Joint Seal Damage Popouts Scaling Patch of Climate/Durability- associated distress Shrinkage Cracking Spalling L/T/D Cracking 	 Corner Break Shattered Slab Pumping Patching of Moisture/Drainage- associated distress 	Settlement / Faulting						

Table 2.6.2 (f) Pavement Distresses Possible Effects – Rigid Portland Cement Concrete-Surfaced Airfields

	Classification by Possible Effects								
Roughness	Skid / Hydroplaning Potential	FOD Potential	Rate of Deterioration and Maintenance Requirements						
 Blowup Corner Break L/T/D Cracking Shattered Slab Settlement / Faulting Spalling 	 Settlement / Faulting Spalling 	 Corner Break L/T/D Cracking "D" Cracking Joint Seal Damage Shattered Slab Popouts Scaling 	All distresses						



2.6.3 PCI Survey Inspection Procedures

Inspection Sampling Rate

The FDOT SAPMP performs PCI Survey Inspections on sample units defined in the previous update. The sample units are subject to change at the discretion of the inspection personnel and/or to major pavement rehabilitation treatments. Furthermore, access to the sample units based on accessibility or impacts to operations may affect the overall sampling rate effort at each airport. The following **Tables 2.6.3 (a) and (b)** define the sampling criteria used by the FDOT SAPMP. A higher sampling rate may be utilized to achieve a greater statistical confidence should the airport have the available resources to perform PCI Survey Inspections independent of the FDOT SAPMP.

Table 2.6.3 (a) Recommended Sample Rate Schedule for Flexible Asphalt Concrete

Number of Total	Sample Units to Inspect							
Sample Units in Section	Runways	Taxiways, Aprons, and Others						
1 - 4	1	1						
5 - 10	2	1						
11 - 15	3	2						
16 - 30	5	3						
31 - 40	7	4						
41 - 50	8	5						
51 or more	20% but ≤20	10% but ≤10						

Table 2.6.3 (b) Recommended Sample Rate Schedule for Rigid Portland Cement Concrete

Number of Total	Sample Units to Inspect						
Sample Units in Section	Runways	Taxiways, Aprons, and Others					
1 - 3	1	1					
4 - 6	2	1					
7 - 10	3	2					
11 - 15	4	2					
16 - 20	5	3					
21 - 30	7	3					
31 - 40	8	4					
41 - 50	10	5					
51 or more	20% but ≤20	10% but ≤10					



Airfield pavement distresses and conditions were surveyed in accordance with the methods outlined in FAA Advisory Circular 150/5380-6C and ASTM D5340-12. These procedures define distress type, severity, and quantity for sampling areas within each defined pavement section area to analyze and determine the PCI value and condition rating. During the 2013-2015 System Update, the incorporation of the significant changes to the ASTM D5340 (version D5340-12) resulted in adjusted pavement condition indices on pavement sections subject to the distress types updated. Furthermore, the revision of the PCI deduction curves and the separation of distress types from the original, such as Weathering and Raveling, have in select cases increased the PCI value of the section without any rehabilitation performed.

Flexible Asphalt Concrete Pavement Distress Updates

The previous methodology which featured "(52) Weathering and Raveling" distress has been separated into two distresses "(52) Raveling" and "(57) Weathering." Previously, areas that were recorded as "Weathering and Raveling" were considered as one distress with a high deduction. Based on the updated methodology, in certain situations where "Weathering" only exists and does not meet the definition of "Raveling," the PCI deduction is not as high as the former "Weathering and Raveling." Therefore, areas identified only as "(57) Weathering" based on current ASTM standards, which were previously identified as "(52) Weathering and Raveling," may be subject to an improvement in PCI. In instances where pavement PCI has increased due to this update, it is not due to an improvement in actual condition, however indicative of the adjusted distress deterioration effects.

Rigid Portland Cement Concrete Pavement Distress Updates

The previous methodology defined "(70) Scaling" as a distress that consisted of surface deterioration caused by construction defects, material defects, and environmental factors. The distress included Alkali-Silica Reaction, also known as ASR. The current methodology has separated Alkali-Silica Reaction as a distress identified as "(76) Alkali-Silica Reaction / ASR." As a result, the previous "(70) Scaling" numerical deduction contribution to the PCI has been reduced. Previous inspections that recorded "(70) Scaling," and currently do not exhibit "(76) Alkali-Silica Reactivity / ASR" may potentially see an increase in PCI. Additionally, "(73) Shrinkage Cracks" has been redefined as "(73) Shrinkage Cracking". Shrinkage Cracking is characterized in two forms; drying shrinkage and plastic shrinkage. Drying shrinkage occurs over time as moisture leaves the pavement, it develops when hardened pavement continues to shrink as excess water not needed for cement hydration evaporates. It forms when subsurface resistance to the shrinkage is present and may extend through the entire depth of the slab. Plastic shrinkage can be caused by both atmospheric conditions and construction. Plastic shrinkage caused by atmospheric conditions develops when there is rapid loss of water in the surface of recently placed pavement. High winds or low humidity are contributing factors to evaporation. These shrinkage cracks can appear as a series of parallel cracks, usually 1 to 3 feet apart and do not extend very deep into the pavement's surface. Plastic shrinkage caused by construction can form from over finishing/overworking of the pavement during construction. These shrinkage cracks appear as a series of inter-connected hairline cracks, or pattern cracking, and are often observed throughout the majority of the slab surface. This condition is also referred to as map cracking or crazing.



Table 2.6.4 Summary of Updates to ASTM D5340-12

Use and Surface Type	Updated Distress	Former Distress in Prior to 5340-10	Deduction Curve	Potential Effect		
AC/AAC/ APC Airfield	(52) Raveling - Low	(52) Weathering and Raveling No Cha		N/A		
Airfield	(52) Raveling - Medium	(52) Weathering and Raveling - Medium	No Change	N/A		
	(52) Raveling - High	(52) Weathering and Raveling - High	No Change	N/A		
	(57) Weathering - Low	N/A – was part of 'Weathering and Raveling'	New	Increase in PCI with no maintenance		
	(57) Weathering - Medium	N/A – was part of 'Weathering and Raveling'	New	Increase in PCI with no maintenance		
	(57) Weathering - High	N/A – was part of 'Weathering and Raveling'	New	Increase in PCI with no maintenance		
PCC Airfield	(70) Scaling - Low	(70) Scaling, Map Cracking, and Crazing - Low	New	Increase in PCI with no maintenance		
	(70) Scaling - Medium	(70) Scaling, Map Cracking, and Crazing - Medium	New	Increase in PCI with no maintenance		
	(70) Scaling - High	(70) Scaling, Map Cracking, and Crazing - High	New	Increase in PCI with no maintenance		
	(76) Alkali Silica Reaction – Low	N/A – was part of 'Scaling, Map Cracking, and Crazing'	New	Increase in PCI with no maintenance		
	(76) Alkali Silica Reaction – Medium	N/A – was part of 'Scaling, Map Cracking, and Crazing'	New	Increase in PCI with no maintenance		
	(76) Alkali Silica Reaction – High	N/A – was part of 'Scaling, Map Cracking, and Crazing'	New	Increase in PCI with no maintenance		
	(73) Shrinkage Cracking	(73) Shrinkage Cracking	No Change	Prior distress types identified as 'Scaling, Map Cracking, and Crazing' may now be identified as 'Shrinkage Cracking'		

Statewide Airfield Pavement Management Program



Chapter 3

FDOT

Chapter 3 – Airfield Pavement System Inventory

A significant element of an effective airfield pavement management system is the appropriate record keeping of changes due to construction or operational use of the pavement facilities. This chapter discusses the inventory data collected from the airport and summarizes network-level characteristics of the airport's airfield pavements. At the start of each FDOT SAPMP System Update, all airports are asked to review the existing Airfield Pavement Network Definition exhibit for accuracy. Furthermore, participating airports are asked to provide documentation for any recent or anticipated construction related to their airfield pavements.

3.1 Airfield Pavement Network Information

3.1.1 Previous and/or Anticipated Airfield Pavement Construction

Based on information provided by the airport, the following **Table 3.1.1** summarizes the airfield pavement construction projects that have been incorporated into the SAPMP database system since the 2013-2015 System Update. **Figure 3.1.1 (a)** and **Figure 3.1.1 (b)** provides an inset view of the 2019 Airfield Pavement Network Definition Exhibit and the 2019 Airfield Pavement System Inventory Exhibits that depict the updated network details for the airport reflected in the PAVER Database. Large format exhibits are referenced in **Appendix C Technical Exhibits**.

Year	General Work Description
2012	RW 16-34, TW A - New Construction: 2" P-401, 5" P-219, 12" P-160
2013	TW A, TW A1, TW A2, TW A3 - Mill and Overlay: 0.5" Mill, 1.5" P-401 Overlay
2015	AP CENTER, AP T-HAN 1, AP T-HANG - Mill and Overlay

Table 3.1.1 Previous and/or Anticipated Airfield Pavement Construction

The airport provided a limited combination of record drawings, reports, and staff input that was pertinent information in developing the construction history of the airport's pavements from inception. Major rehabilitation/construction activities performed in the last 24-months or anticipated in the next 24-months are assumed to restore the PCI to 100. These activities include: pavement overlay, mill and replace, mill and overlay, new construction, and/or complete reconstruction. These pavements were not formally subject to a PCI Survey and actual conditions may vary. Furthermore, any localized maintenance or repair performed that would improve the PCI will be considered in the condition analysis, if performed within inspection areas.

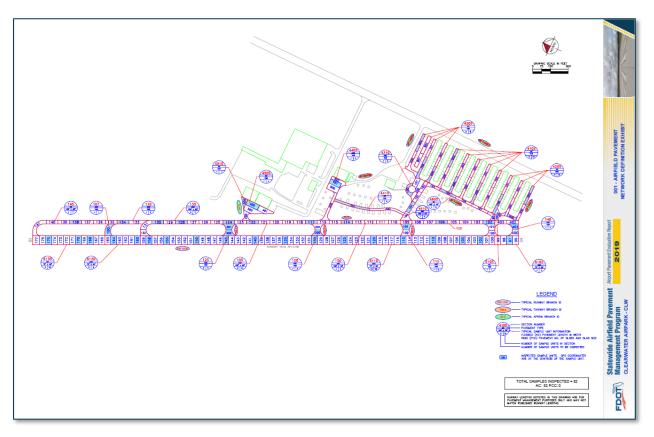


Figure 3.1.1 (a) 2019 Airfield Pavement Network Definition Exhibit

The Airfield Pavement Network Definition Exhibit provides details to the PCI Survey inspection efforts. The exhibit identifies the pavement facilities, surface type, section definition, and sample unit delineation.



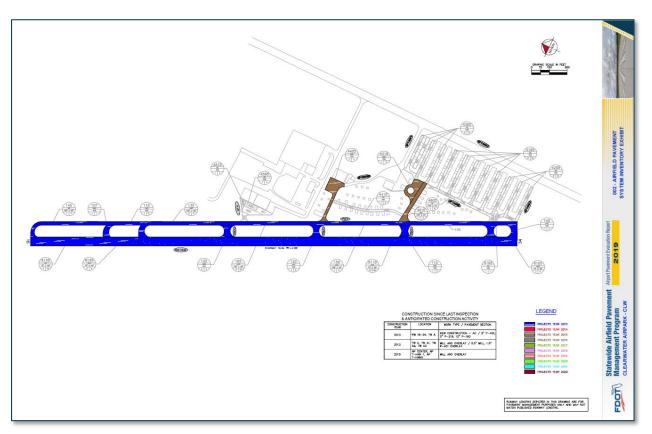


Figure 3.1.1 (b) 2019 Airfield Pavement System Inventory Exhibit


The Airfield Pavement System Inventory Exhibit provides details to the work history updates communicated by the Airport. The Exhibit provides the approximate limits of recent and/or anticipated construction on the airfield pavement facilities. The limits are based on documentation provided by the Airport and, if constructed, observed in the field.

3.1.2 Estimated Pavement Age

Standard pavement design practice considers a design life of a 20-year period. Design inputs typically require subgrade soil conditions, pavement section layer material characteristics, and anticipated loading (aircraft fleet mix) for the design-life period. Based on the review of the historic airfield pavement construction, **Figure 3.1.2** summarizes the average age of the pavement sections at the time of the PCI survey inspection. Age is determined to be the number of years since any major construction activity has occurred. This is intended to be a rough estimate based on interpretation of the limited data available at the time of report.





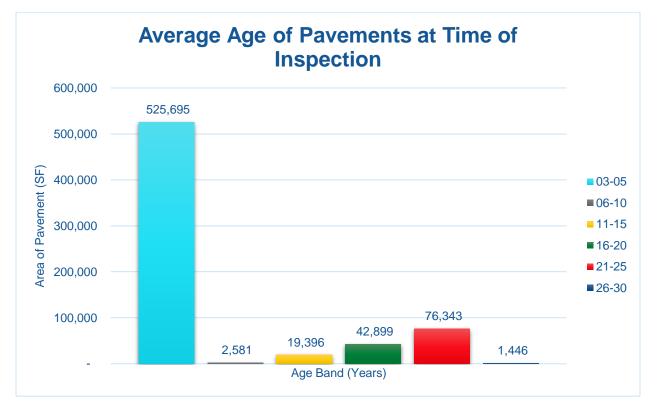

The estimation of the pavement age is based on information requested and provided by participating airports. Additionally, data collected in the prior system updates since 1992 have been relied upon.

Statewide Airfield Pavement
Management ProgramAirport Pavement
Evaluation Report2019



3.1.3 Functional Use Classification

Pavements are subject to varying aircraft loading patterns based on utilization and overall operations. For this SAPMP Update, the following categories of airfield functional use have been identified and associated with the following possible pavement branch facilities: Apron, Runway, Taxiway, and Taxilane. **Figure 3.1.3** summarizes the identified pavements' functional use by area in square feet. The pavement areas reviewed exclude shoulder pavement facilities.

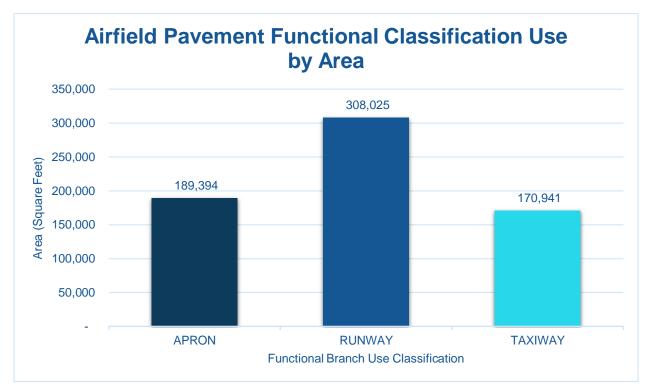


Figure 3.1.3 Airfield Pavement Functional Classification Use by Area

FDOT

3.1.4 Pavement Surface Type

The airfield pavement facility surface types within the SAPMP include four common types of pavement: Portland cement concrete (PCC), asphalt concrete (AC), asphalt concrete overlaid on asphalt concrete (AAC), and asphalt concrete overlaid on Portland cement concrete (APC).

Based on the record documentation incorporated within the SAPMP database throughout the years, the pavement surface types have been assigned to the various pavement sections in accordance to its work history composition. The following **Figures 3.1.4 (a) and (b)** summarize the applicable pavement types observed at this specific airport's airfield.


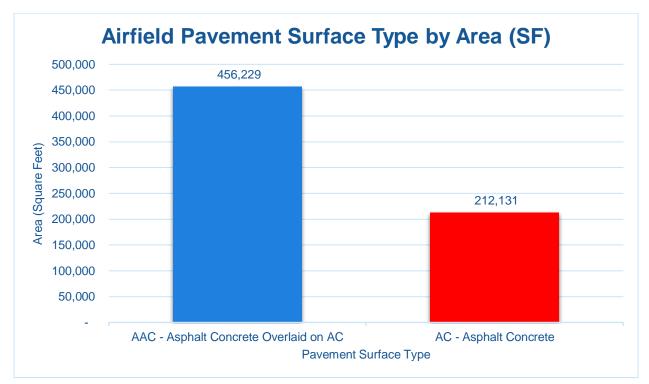


Figure 3.1.4 (a) Pavement Surface Type by Area (SF)



Figure 3.1.4 (b) Pavement Surface Type by Area (%)

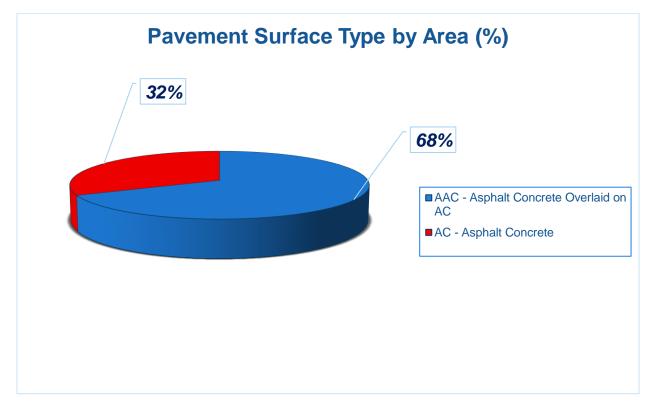

3.1.5 Pavement System Inventory Details

The following **Table 3.1.5** displays the section-level details assembled as part of this update. The section-level details are based on the record documentation provided by the airports to FDOT and from SAPMP System Updates. The details assembled rely on the accuracy and the adequacy of data provided; however, it should be noted that characteristics such as pavement areas may be based on aerial interpretation of spatially projected imagery. The accuracy of data is presented with the intention of a network planning-level document; should the airport elect to perform rehabilitation work, it is recommended that further investigation be performed at the project level for construction purposes.

In summary, the scope of the pavement inventory update resulted in the updating of select existing pavement geometry and the development of an AutoCAD model with spatial projection for use within GIS. **Appendix A** includes the Airfield Pavement Network Definition Exhibit and the Airfield Pavement System Inventory Exhibit which visually summarize the results of the Airfield Pavement System Inventory analysis and reporting.

Statewide Airfield Pavement Management Program Airport Pavement Evaluation Report

ment 2019



Table 3.1.5 Pavement System Inventory Details

Network ID	Branch Name	Branch ID	Branch Use	Section ID	Length (FT)	Width (FT)	Area (SF)	Surface Type	Est. Last Construction Date
CLW	CENTER APRON	AP CENTER	APRON	4405	575	25	22,600	AAC	1/1/2015
CLW	CENTER APRON	AP CENTER	APRON	4410	610	18	11,073	AC	12/15/1999
CLW	NORTH APRON	AP N	APRON	4505	200	100	19,396	AC	1/1/2003
CLW	NORTH APRON	AP N	APRON	4510	94	60	2,581	AC	1/1/2012
CLW	APRON AT T-HANGARS 1	AP T-HAN 1	APRON	4305	1,480	20	31,826	AC	12/25/1999
CLW	APRON AT T-HANGARS 1	AP T-HAN 1	APRON	4310	171	80	12,550	AAC	1/1/2015
CLW	APRON AT T-HANGARS 2	AP T-HAN 2	APRON	4105	1,800	20	37,331	AC	1/1/1996
CLW	APRON AT T-HANGARS 3	AP T-HAN 3	APRON	4205	1,200	20	24,739	AC	1/1/1996
CLW	T-HANGAR APRON	AP T-HANG	APRON	4605	660	20	14,273	AC	1/1/1996
CLW	T-HANGAR APRON	AP T-HANG	APRON	4610	386	30	13,025	AAC	1/1/2015
CLW	RUNWAY 16-34	RW 16-34	RUNWAY	6105	200	75	15,000	AAC	1/1/2013
CLW	RUNWAY 16-34	RW 16-34	RUNWAY	6110	2,997	75	224,775	AAC	1/1/2013
CLW	RUNWAY 16-34	RW 16-34	RUNWAY	6120	300	50	22,500	AAC	1/1/2013
CLW	RUNWAY 16-34	RW 16-34	RUNWAY	6130	600	100	45,750	AC	1/1/2013
CLW	ΤΑΧΙΨΑΥ Α	TW A	TAXIWAY	105	2,600	30	63,329	AAC	1/1/2013
CLW	ΤΑΧΙΨΑΥ Α	TW A	TAXIWAY	107	475	30	5,097	AAC	1/1/2013
CLW	ΤΑΧΙΨΑΥ Α	TW A	TAXIWAY	110	475	30	7,086	AAC	1/1/2013
CLW	ΤΑΧΙΨΑΥ Α	TW A	TAXIWAY	135	700	30	22,265	AAC	1/1/2013
CLW	ΤΑΧΙΨΑΥ Α	TW A	TAXIWAY	140	400	30	12,540	AAC	1/1/2013
CLW	ΤΑΧΙΨΑΥ Α	TW A	TAXIWAY	145	700	30	23,716	AC	1/1/2013
CLW	ΤΑΧΙΨΑΥ Α	TW A	TAXIWAY	150	2,600	30	15,000	AAC	1/1/2013
CLW	ΤΑΧΙΨΑΥ Α1	TW A1	TAXIWAY	115	100	50	6,928	AAC	1/1/2013
CLW	TAXIWAY A2	TW A2	TAXIWAY	120	100	50	6,567	AAC	1/1/2013
CLW	ΤΑΧΙΨΑΥ Α3	TW A3	TAXIWAY	125	100	50	6,967	AAC	1/1/2013
CLW	TAXIWAY CONNECTOR TO RUNWAY 34	TW CONN 34	TAXIWAY	5105	50	30	1,446	AC	1/1/1991



2019



PAGE INTENTIONALLY LEFT BLANK

Statewide Airfield Pavement Management Program



Chapter 4



Chapter 4 – Airfield Pavement Condition

The examination of specific distress types (with causes attributed to load, climate, or other defined distress mechanism), determination of the severity of distress, and determination of the quantity of distress manifestation are required in the computation of a PCI value. The PCI provides valuable information that can be used to determine the existing condition of the pavement, possible cause of the pavement deterioration, and eventually aid in the planning of the rehabilitation of pavements. It should be noted that the PCI method of pavement condition evaluation is strictly a visual and functional evaluation. Further evaluation of the pavement rehabilitation.

4.1 Airfield Pavement Condition Index (Latest Inspection)

4.1.1 Network-Level Analysis

The following **Figure 4.1.1** summarizes the network-level pavement condition analysis based on the most recent PCI Survey inspection results.

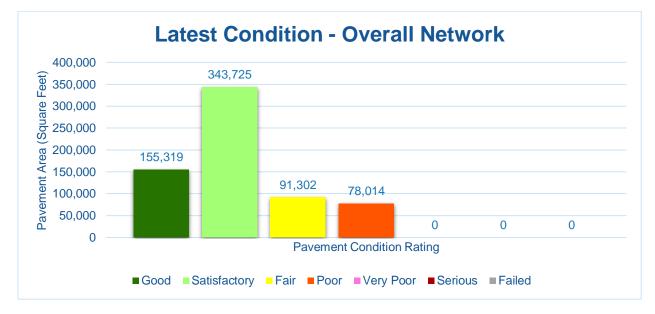


Figure 4.1.1 Latest Condition – Overall Network

4.1.2 Branch-Level Analysis

The following **Figures 4.1.2 (a) through (c)** summarize the branch-level pavement condition analysis based on the most recent PCI Survey inspection results; the following Figures provide overall branch-level conditions by branch use.







Figure 4.1.2 (b) Latest Condition – Taxiway Pavements







Figure 4.1.2 (c) Latest Condition – Apron Pavements

4.1.3 Section-Level Analysis

The following **Table 4.1.3** provides details for each pavement section of its area-weighted average PCI and the percent of distress which is related to load, climate, or other factors. The amount of distress attributed to the various causes provides insight into maintenance, repair, and rehabilitation needs. Load-related distress indicates that pavements are reaching the end of their structural design life, and for those pavements exhibiting a significant amount of these distress types, rehabilitation should be planned to strengthen or reconstruct the pavement. **Appendix C Technical Exhibits** provides a technical exhibit that graphically depicts the PCI values and ratings determined from this SAPMP System Update.

Any pavement facilities subject to pavement construction within the past 2 years or anticipated for construction within the next year may have been omitted from inspection. Pavement subject to major rehabilitation will be set to a PCI of 100.

Network ID	Branch ID	Branch Name	Branch Use	Section ID	Area (SF)	Surface	PCI	PCI Rating	PCI % Climate	PCI % Load	PCI % Other	Sample Units Inspected	Total Sample Units in Section
CLW	AP CENTER	CENTER APRON	APRON	4405	22,600	AAC	90	Good	100%	0%	0%	1	5
CLW	AP CENTER	CENTER APRON	APRON	4410	11,073	AC	49	Poor	88%	12%	0%	1	2
CLW	AP N	NORTH APRON	APRON	4505	19,396	AC	42	Poor	94%	0%	6%	1	4
CLW	AP N	NORTH APRON	APRON	4510	2,581	AC	86	Good	100%	0%	0%	1	1
CLW	AP T-HAN 1	APRON AT T-HANGARS 1	APRON	4305	31,826	AC	48	Poor	86%	0%	14%	3	8
CLW	AP T-HAN 1	APRON AT T-HANGARS 1	APRON	4310	12,550	AAC	88	Good	100%	0%	0%	1	3
CLW	AP T-HAN 2	APRON AT T-HANGARS 2	APRON	4105	37,331	AC	59	Fair	96%	0%	4%	3	10
CLW	AP T-HAN 3	APRON AT T-HANGARS 3	APRON	4205	24,739	AC	65	Fair	78%	14%	8%	3	8
CLW	AP T-HANG	T-HANGAR APRON	APRON	4605	14,273	AC	48	Poor	91%	9%	0%	1	5
CLW	AP T-HANG	T-HANGAR APRON	APRON	4610	13,025	AAC	92	Good	100%	0%	0%	1	4
CLW	RW 16-34	RUNWAY 16-34	RUNWAY	6105	15,000	AAC	88	Good	100%	0%	0%	1	4
CLW	RW 16-34	RUNWAY 16-34	RUNWAY	6110	224,775	AAC	78	Satisfactory	75%	0%	25%	13	60
CLW	RW 16-34	RUNWAY 16-34	RUNWAY	6120	22,500	AAC	84	Satisfactory	100%	0%	0%	2	6
CLW	RW 16-34	RUNWAY 16-34	RUNWAY	6130	45,750	AC	89	Good	100%	0%	0%	3	12
CLW	TW A	ΤΑΧΙΨΑΥ Α	TAXIWAY	105	63,329	AAC	77	Satisfactory	69%	0%	31%	5	21
CLW	TW A	ΤΑΧΙΨΑΥ Α	TAXIWAY	107	5,097	AAC	89	Good	100%	0%	0%	1	1
CLW	TW A	ΤΑΧΙΨΑΥ Α	TAXIWAY	110	7,086	AAC	79	Satisfactory	100%	0%	0%	1	2
CLW	TW A	ΤΑΧΙΨΑΥ Α	TAXIWAY	135	22,265	AAC	66	Fair	89%	0%	11%	2	7
CLW	TW A	ΤΑΧΙΨΑΥ Α	TAXIWAY	140	12,540	AAC	80	Satisfactory	59%	0%	41%	1	4
CLW	TW A	ΤΑΧΙΨΑΥ Α	TAXIWAY	145	23,716	AC	88	Good	100%	0%	0%	1	7
CLW	TW A	ΤΑΧΙΨΑΥ Α	TAXIWAY	150	15,000	AAC	90	Good	100%	0%	0%	1	5
CLW	TW A1	TAXIWAY A1	TAXIWAY	115	6,928	AAC	77	Satisfactory	50%	0%	50%	1	2
CLW	TW A2	TAXIWAY A2	TAXIWAY	120	6,567	AAC	72	Satisfactory	100%	0%	0%	1	2
CLW	TW A3	ΤΑΧΙΨΑΥ Α3	TAXIWAY	125	6,967	AAC	63	Fair	41%	0%	59%	2	2
CLW	TW CONN 34	TAXIWAY CONNECTOR TO RUNWAY 34	TAXIWAY	5105	1,446	AC	47	Poor	100%	0%	0%	1	1

Table 4.1.3 Latest Pavement Condition Index Summary




121

Clearwater Airpark (CLW)

FDOT

121

Figure 4.1.3 is an inset view of the 2019 Airfield Pavement Condition Index Exhibit that visually represents the results of the latest PCI Survey inspection. A large format exhibit is located in **Appendix C Technical Exhibits.**

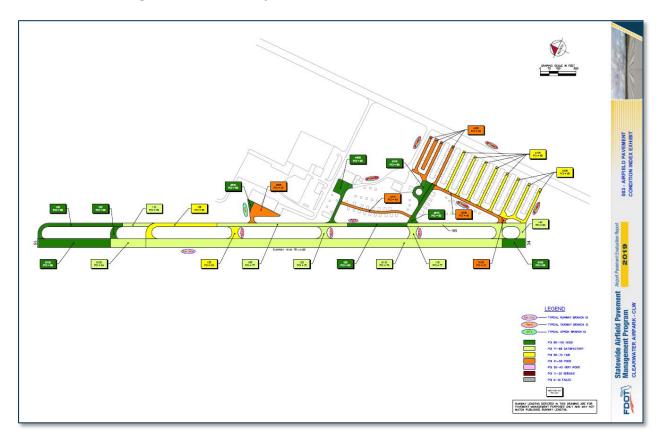





4.2 Summary of Pavement Condition Evaluation Results

4.2.1 Network-Level Observations

The field PCI Survey performed at Clearwater Air Park (CLW) completed in December of 2018. The resulting overall area-weighted average PCI value was 74 representing a condition rating of Satisfactory. Clearwater Air Park is serviced by one runway; Runway 16-34 is 75-ft wide and 4,108-ft long.

Based on the FAA 5010 Report as of 09/12/2019 the Airport has reported 50,590 operations for 12 months ending 12/14/2017.

4.2.2 Branch-Level Observations

The following branch-level observations are intended to be an overall summary of select pavement facilities identified during the PCI Survey; further detail at the section and sample-level may be referenced for all pavements assessed as part of this System Update. The branch-level observations discussed are limited to select branches based on use and condition.

Runway 16-34

Runway 16-34 consists of 4 sections constructed of AC and AAC. The last construction year for Runway 16-34 was 2013. The area-weighted average PCI for Runway 16-34 is 80 representing a Satisfactory condition rating. The pavement distresses observed were related to Climate and Other distress classifications. Distresses observed on Runway 16-34 consist of Depression, Longitudinal & Transverse Cracking, Swelling, and Weathering. Depressions were observed neat the RW34 side of the runway that appeared to be holding water. The runway's pavement joints were beginning to crack in the longitudinal direction with the appearance of random longitudinal and transverse cracks between the pavement joints.

Taxiway A

Taxiway A consists of 7 sections constructed of AC and AAC. The last construction year for Taxiway A was 2013. The area-weighted average PCI for Taxiway A is 79 representing a Satisfactory condition rating. The pavement distresses observed were related to Climate and Other distress classifications. Distresses observed on Taxiway A consist of Depression, Longitudinal & Transverse Cracking, Patching, Raveling, Swelling, and Weathering.

Taxiway A3

Taxiway A3 consists of 1 section constructed of AAC. The last construction year for Taxiway A3 was 2013. The area-weighted average PCI for Taxiway A3 is 63 representing a Fair condition rating. The pavement distresses observed were related to Climate and Other distress classifications. Distresses observed on Taxiway A3 consist of Depression, Longitudinal & Transverse Cracking, and Weathering. Large depressions were observed on Taxiway A3. The depressions were holding water at the time of inspection.

T-Hangar Apron

T-Hangar Apron consists of 2 sections constructed of AC and AAC. The last construction years range from 1996 to 2015. The area-weighted average PCI for T-Hangar Apron is 68 representing a Fair condition rating. The pavement distresses observed were related to Climate



and Load distress classifications. Distresses observed on T-Hangar Apron consist of Alligator Cracking, Block Cracking, Longitudinal & Transverse Cracking, Raveling, and Weathering.

Figure 4.2.2 Pavement Condition Summary by Facility Use

Facility Use	Area-Weighted Average PCI	Condition Rating
Runway	80	Satisfactory
Taxiway	77	Satisfactory
Apron	63	Fair



4.3 Forecasted Pavement Conditions

4.3.1 Performance Models and Prediction Curves

Pavement Performance Models are developed from the distress data and historic construction records collected for the SAPMP. This data is consolidated in a database and organized by inspection/construction date, pavement type, age, and pavement use. The pavement Performance Models are used to develop broad Prediction Curves, alternatively known as deterioration curves or family curves. These Prediction Curves are utilized to developed forecasted PCI values based on historic trends and statistical models.

4.3.2 Branch-Level Pavement Condition Forecast

The following **Figures 4.3.2 (a) through (c)** depict the branch-level pavement condition forecast by Branch Use (Runway, Taxiway, and/or Apron). The forecasted conditions are for a 10-year duration starting in January 2020 through January 2029.

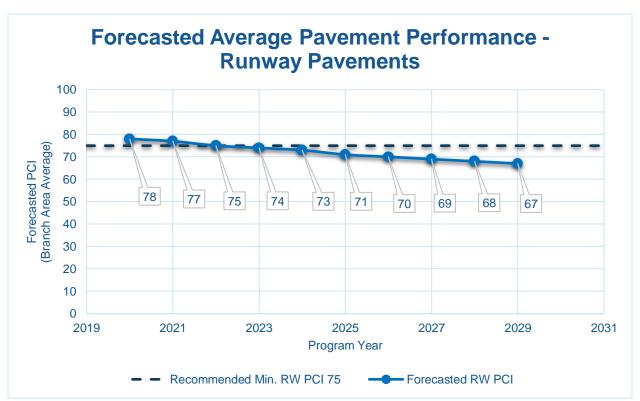


Figure 4.3.2 (a) Forecasted Runway Pavement Performance

FDOT

11




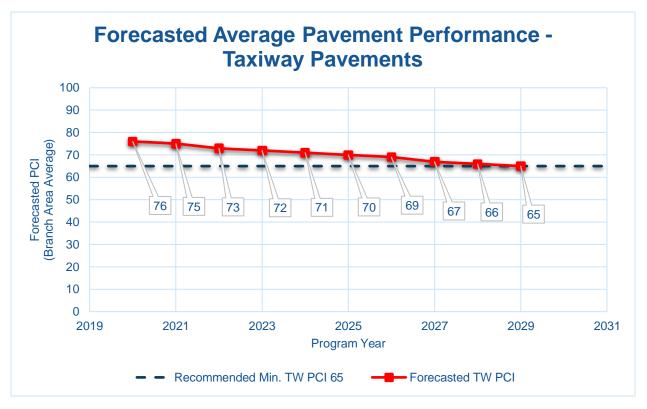


Figure 4.3.2 (c) Forecasted Apron Pavement Performance



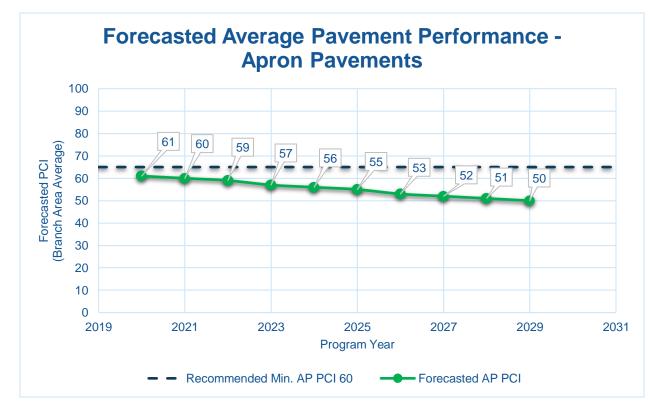

4.3.3 Section-Level Pavement Condition Forecast

The following **Table 4.3.3** provides detail to the forecasted PCI values for each section inspected. Please note the forecasted Branch- and Section-Level PCI's are for planning purposes and are subject to the sensitivities in changes in traffic and maintenance frequency. Airport staff should perform annual visual condition assessments to maintain recent understanding of pavement conditions.

Clearwater Airpark (CLW)

Statewide Airfield Pavement Management Program Airport Pavement Evaluation Report

ement 2019





Table 4.3.3 Forecasted PCI 2020-2029

Network	Branch ID	Section ID	Last PCI	Forecasted PCI									
ID	Branch ID			2020	2021	2022	2023	2024	2025	2026	2027	2028	2029
CLW	AP CENTER	4405	90	87	85	83	81	79	76	74	72	70	68
CLW	AP CENTER	4410	49	48	47	46	45	43	42	41	40	39	38
CLW	AP N	4505	42	40	39	38	37	35	34	33	32	31	31
CLW	AP N	4510	86	83	81	79	77	75	73	71	70	68	67
CLW	AP T-HAN 1	4305	48	46	45	44	43	42	41	40	39	37	36
CLW	AP T-HAN 1	4310	88	85	83	81	79	77	74	72	70	68	66
CLW	AP T-HAN 2	4105	59	58	57	56	55	55	54	53	53	52	51
CLW	AP T-HAN 3	4205	65	63	62	61	60	59	58	58	57	56	55
CLW	AP T-HANG	4605	48	46	45	44	43	42	41	40	39	37	36
CLW	AP T-HANG	4610	92	89	87	85	83	81	78	76	74	72	70
CLW	RW 16-34	6105	88	85	83	81	80	78	77	75	74	72	71
CLW	RW 16-34	6110	78	76	74	73	72	71	70	69	68	67	66
CLW	RW 16-34	6120	84	82	80	78	77	75	74	72	71	70	69
CLW	RW 16-34	6130	89	86	84	82	80	78	77	75	74	72	71
CLW	TW A	105	77	75	74	72	71	70	69	68	67	66	65
CLW	TW A	107	89	86	85	83	81	80	78	77	75	74	73
CLW	TW A	110	79	77	76	74	73	72	71	69	68	67	66
CLW	TW A	135	66	65	64	63	62	61	60	59	59	58	57
CLW	TW A	140	80	78	76	75	74	72	71	70	69	68	67
CLW	TW A	145	88	86	84	83	81	80	78	77	76	74	73
CLW	TW A	150	90	87	85	84	82	80	79	77	76	74	73
CLW	TW A1	115	77	75	74	72	71	70	69	68	67	66	65
CLW	TW A2	120	72	70	69	68	67	66	65	64	63	63	62
CLW	TW A3	125	63	62	61	60	59	58	58	57	56	55	54
CLW	TW CONN 34	5105	47	46	45	44	44	43	42	42	41	40	40

4.3.4 Forecasted PCI Considerations

As FDOT continues to update the SAPMP with future PCI Survey inspections and assembly of airfield pavement construction work history, the performance models will be further refined. With the refinement of additional PCI and work history data points, the forecasting of pavement conditions will continue to better reflect the performance trends of airfield pavements in the Florida Airports System. Forecasted or predicted pavement conditions for the airport are intended for planning purposes only. Design-level recommendations for pavement rehabilitation and/or reconstruction will require the appropriate application of the procedures defined in FAA *AC 150/5320-6F Airport Pavement Design and Evaluation* and *AC 150/5370-11B Use of Nondestructive Testing in the Evaluation of Airport Pavements* to determine structural and/or functional conditions at the time of project.

Statewide Airfield Pavement Management Program



Chapter 5

Chapter 5 – Localized Maintenance and Repair Planning

General Maintenance and Rehabilitation (M&R) methods are characterized under three broad categories: localized maintenance and repair, global treatments, and major rehabilitation.

- > Localized Maintenance and Repair includes patching and crack sealing.
- > Global Treatments include surface seals and rejuvenators for flexible pavements.
- Major Rehabilitation includes overlays, significant slab replacement, and reconstruction.

This chapter discusses the FDOT SAPMP Localized Maintenance and Repair Planning approach. Proactive localized maintenance and repair, specifically preservation, is highly recommended to the airports. However, it is certainly recognized that once pavements have deteriorated below a certain condition, the facility would benefit from a more substantial rehabilitation in lieu of localized efforts. Chapter 6 Major Rehabilitation Planning discusses the addressing of pavements through timely rehabilitation once it has deteriorated below a critical PCI where localized repairs may not be as cost effective.

5.1 Localized Maintenance and Repair

Localized maintenance and repair is best applied as a conservation measure and is oftentimes applied to slow the rate of deterioration of distressed pavements; however, may be applied as a temporary corrective measure in isolated areas. Localized maintenance and repair can be applied either as a safety ("stopgap") measure or preventive measure. Example distress types subject to localized preventive maintenance and repair may consist of low-severity longitudinal and transverse cracking and low-severity weathering. In many cases however, localized stopgap repair is applied as a safety measure to address high-severity distress manifestations when major rehabilitation is not funded for a given section with a PCI value below critical PCI. Some agencies may elect to define both types; preventative and stopgap, as localized maintenance.

Localized Stopgap/Safety Maintenance and Repair

Localized Stopgap or Safety Maintenance and Repair is defined as the localized distress repair needed to keep pavements operational in a safe condition. These activities are typically applied to high-severity distresses or distresses affecting operational activities. Typical pavement section PCIs will range from 0 to 65.

Localized Preventive Maintenance and Repair

Localized Preventive Maintenance and Repair is defined as distress maintenance activities performed with the primary objective of slowing the rate of deterioration. These activities typically include crack sealing and patching. Typical pavement section PCIs will be above 65.



5.2 Localized Maintenance and Repair Policy

The resulting Localized Maintenance and Repair recommendations are identified based on the policy defined in **Table 5.2 (a)** and **Table 5.2 (b)**, for flexible asphalt concrete and rigid Portland cement concrete pavements, respectively. The activities identified were based on the research of practical pavement treatments in consideration of the FAA *AC 150/5380-6C "Guidelines and Procedures for Maintenance of Airport Pavements"* and the *FDOT Airfield Pavement Distress Repair Manual*. Additionally, the *Engineering Technical Letter (ETL) 14-3: Preventive Maintenance Plan (PMP) for Airfield Pavements* was referenced for conservative application of pavement treatments. The Localized Maintenance and Repair Policy and associated planning-level unit costs were developed in consideration of a network-level analysis – it is strictly intended to provide a glimpse of the condition of the airport pavements with a limited PCI survey effort.

The developed Localized Maintenance and Repair Policy and associated planning-level unit costs were based on a statewide consideration of pavement treatments and review of state construction costs for both Airfield Pavements and from the FDOT Historical Cost Information archives. Furthermore, a consideration of limited repair quantities was factored in the determination of conservative planning-level unit costs. The identified Localized maintenance activities for both preventive and stopgap activities are based on a statewide network approach; project-specific evaluation and maintenance quantities should be developed prior to any construction.

Distress	Severity	Description	Code	Work Type	Work Unit
41	Low	ALLIGATOR CR	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
41	Medium	ALLIGATOR CR	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
41	High	ALLIGATOR CR	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
42	N/A	BLEEDING	FDOT-MO-PV	FDOT - MONITOR	N/A
43	Low	BLOCK CR	FDOT-MO-PV	FDOT - MONITOR	N/A
43	Medium	BLOCK CR	FDOT-CS-AC	FDOT - CRACK SEALING - AC	Ft
43	High	BLOCK CR	FDOT-PA-AP	FDOT - PATCHING - AC PARTIAL DEPTH	SqFt
44	Low	CORRUGATION	FDOT-ML-AC	FDOT - MILLING - AC	SqFt
44	Medium	CORRUGATION	FDOT-ML-AC	FDOT - MILLING - AC	SqFt
44	High	CORRUGATION	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
45	Low	DEPRESSION	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
45	Medium	DEPRESSION	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
45	High	DEPRESSION	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
46	N/A	JET BLAST	FDOT-PA-AP	FDOT - PATCHING - AC PARTIAL DEPTH	SqFt
47	Low	JT REF. CR	FDOT-MO-PV	FDOT - MONITOR	N/A
47	Medium	JT REF. CR	FDOT-CS-AC	FDOT - CRACK SEALING - AC	Ft
47	High	JT REF. CR	FDOT-CS-AC	FDOT - CRACK SEALING - AC	Ft

Table 5.2 (a) Localized Maintenance and Repair – Flexible Asphalt Concrete

Statewide Airfield Pavement Airport Pavement **Management Program**

2019 **Evaluation Report**

Clearwater Airpark (CLW)



Distress	Severity	Description	Code	Work Type	Work Unit
48	Low	L&TCR	FDOT-MO-PV	FDOT - MONITOR	N/A
48	Medium	L&TCR	FDOT-CS-AC	FDOT - CRACK SEALING - AC	Ft
48	High	L&TCR	FDOT-CS-AC	FDOT - CRACK SEALING - AC	Ft
49	N/A	OIL SPILLAGE	FDOT-PA-AP	FDOT - PATCHING - AC PARTIAL DEPTH	SqFt
50	Low	PATCHING	FDOT-MO-PV	FDOT - MONITOR	N/A
50	Medium	PATCHING	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
50	High	PATCHING	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
51	N/A	POLISHED AG	FDOT-SS-LO	FDOT - SURFACE SEAL	SqFt
52	Low	RAVELING	FDOT-SS-LO	FDOT - SURFACE SEAL	SqFt
52	Medium	RAVELING	FDOT-PA-AP	FDOT - PATCHING - AC PARTIAL DEPTH	SqFt
52	High	RAVELING	FDOT-PA-AP	FDOT - PATCHING - AC PARTIAL DEPTH	SqFt
53	Low	RUTTING	FDOT-MO-PV	FDOT - MONITOR	N/A
53	Medium	RUTTING	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
53	High	RUTTING	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
54	Low SHOVING FDOT-MO-PV FDOT - MONITOR		N/A		
54	Medium	SHOVING	FDOT-ML-AC	FDOT - MILLING - AC	SqFt
54	High	SHOVING	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
55	N/A	SLIPPAGE CR	FDOT-PA-AP	FDOT - PATCHING - AC PARTIAL DEPTH	SqFt
56	Low	SWELLING	FDOT-MO-PV	FDOT - MONITOR	N/A
56	Medium	SWELLING	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
56	High	SWELLING	FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	SqFt
57	Low	WEATHERING	FDOT-MO-PV	FDOT - MONITOR	N/A
57	Medium	WEATHERING	FDOT-SS-LO	FDOT - SURFACE SEAL	SqFt
57	High	WEATHERING	FDOT-PA-AP	FDOT - PATCHING - AC PARTIAL DEPTH	SqFt

Table 5.2 (b) Localized Maintenance and Repair – Rigid Portland Cement Concrete

Distress	Severity	Description	Code	Work Type	Work Unit
61	Low	BLOW-UP	FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	SqFt
61	Medium	BLOW-UP	FDOT-PA-PF	FDOT - PATCHING - PCC FULL DEPTH	SqFt
61	High	BLOW-UP	FDOT-SL-PC	FDOT - SLAB REPLACEMENT - PCC	SqFt
62	Low	CORNER BREAK	FDOT-CS-PC	FDOT - CRACK SEALING - PCC	Ft
62	Medium	CORNER BREAK	FDOT-PA-PF	FDOT - PATCHING - PCC FULL DEPTH	SqFt
62	High	CORNER BREAK	FDOT-PA-PF	FDOT - PATCHING - PCC FULL DEPTH	SqFt
63	Low	LINEAR CR	FDOT-MO-PV	FDOT - MONITOR	N/A
63	Medium	LINEAR CR	FDOT-CS-PC	FDOT - CRACK SEALING - PCC	Ft
63	High	LINEAR CR	FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	SqFt

Statewide Airfield Pavement Management Program Airport Pavement Evaluation Report

2019

Clearwater Airpark (CLW)



121

Distress	Severity	Description	Code	Work Type	Work Unit
64	Low	DURABIL. CR	FDOT-MO-PV	FDOT - MONITOR	N/A
64	Medium	DURABIL. CR	FDOT-PA-PF	FDOT - PATCHING - PCC FULL DEPTH	SqFt
64	High	DURABIL. CR	FDOT-SL-PC	FDOT - SLAB REPLACEMENT - PCC	SqFt
65	Low	JT SEAL DMG	FDOT-JS-PC	FDOT - JOINT SEAL - PCC	Ft
65	Medium	JT SEAL DMG	FDOT-JS-PC	FDOT - JOINT SEAL - PCC	Ft
65	High	JT SEAL DMG	FDOT-JS-PC	FDOT - JOINT SEAL - PCC	Ft
66	Low	SMALL PATCH	FDOT-MO-PV	FDOT - MONITOR	N/A
66	Medium	SMALL PATCH	FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	SqFt
66	High	SMALL PATCH	FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	SqFt
67	Low	LARGE PATCH	FDOT-MO-PV	FDOT - MONITOR	N/A
67	Medium	LARGE PATCH	FDOT-PA-PF	FDOT - PATCHING - PCC FULL DEPTH	SqFt
67	High	LARGE PATCH	FDOT-PA-PF	FDOT - PATCHING - PCC FULL DEPTH	SqFt
68	N/A	POPOUTS	FDOT-PO-FL	FDOT - POPOUT FILLER	SqFt
69	N/A	PUMPING	FDOT-SB-PC	FDOT – SLAB STABILIZATION - PCC	SqFt
70	Low	SCALING	FDOT-MO-PV	FDOT - MONITOR	N/A
70	Medium	SCALING	FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	SqFt
70	High	SCALING	FDOT-SL-PC	FDOT - SLAB REPLACEMENT - PCC	SqFt
71	Low	FAULTING	FDOT-MO-PV	FDOT - MONITOR	N/A
71	Medium	FAULTING	FDOT-GR-PP	FDOT - GRINDING (LOCALIZED)	Ft
71	High	FAULTING	FDOT-GR-PP	FDOT - GRINDING (LOCALIZED)	Ft
72	Low	SHAT. SLAB	FDOT-CS-PC	FDOT - CRACK SEALING - PCC	Ft
72	Medium	SHAT. SLAB	FDOT-SL-PC	FDOT - SLAB REPLACEMENT - PCC	SqFt
72	High	SHAT. SLAB	FDOT-SL-PC	FDOT - SLAB REPLACEMENT - PCC	SqFt
73	N/A	SHRINKAGE CR	FDOT-MO-PV	FDOT - MONITOR	N/A
74	Low	JOINT SPALL	FDOT-CS-PC	FDOT - CRACK SEALING - PCC	Ft
74	Medium	JOINT SPALL	FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	SqFt
74	High	JOINT SPALL	FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	SqFt
75	Low	CORNER SPALL	FDOT-CS-PC	FDOT - CRACK SEALING - PCC	Ft
75	Medium	CORNER SPALL	FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	SqFt
75	High	CORNER SPALL	FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	SqFt
76	Low	ASR	FDOT-MO-PV	FDOT - MONITOR	N/A
76	Medium	ASR	FDOT-PA-PF	FDOT - PATCHING - PCC FULL DEPTH	SqFt
76	High	ASR	FDOT-SL-PC	FDOT - SLAB REPLACEMENT - PCC	SqFt



Table 5.2 (c) Localized Repair Planning-Level Unit Costs – Flexible Asphalt Concrete

Code	Name	Cost	Units
FDOT-SS-LO	FDOT - SURFACE SEAL	\$0.55	SqFt
FDOT-ML-AC	FDOT - MILLING - AC	\$2.00	SqFt
FDOT-GR-PP	FDOT - GRINDING (LOCALIZED)	\$2.00	Ft
FDOT-CS-AC	FDOT - CRACK SEALING - AC	\$3.00	Ft
FDOT-MO-PV	FDOT - MONITOR	\$0.00	SqFt
FDOT-PA-AF	FDOT - PATCHING - AC FULL DEPTH	\$9.00	SqFt
FDOT-PA-AP	FDOT - PATCHING - AC PARTIAL DEPTH	\$4.00	SqFt

Table 5.2 (d) Localized M&R Planning-Level Unit Costs – Rigid Portland Cement Concrete

Code	Name	Cost	Units
FDOT-PA-PF	FDOT - PATCHING - PCC FULL DEPTH	\$150.00	SqFt
FDOT-SL-PC	FDOT - SLAB REPLACEMENT - PCC	\$30.00	SqFt
FDOT-SB-PC	FDOT - SLAB STABILIZATION - PCC	\$30.00	SqFt
FDOT-PA-PP	FDOT - PATCHING - PCC PARTIAL DEPTH	\$72.00	SqFt
FDOT-PO-FL	FDOT - POPOUT FILLER	\$0.05	SqFt
FDOT-GR-PP	FDOT - GRINDING (LOCALIZED)	\$2.00	Ft
FDOT-CS-PC	FDOT - CRACK SEALING - PCC	\$4.25	Ft
FDOT-MO-PV	FDOT - MONITOR	\$0.00	N/A
FDOT-JS-PC	FDOT - JOINT SEAL - PCC	\$2.75	Ft

*PCC Patching (Full Depth and Partial Depth) consider high-early-strength and high-performing repair material.

Statewide Airfield Pavement Airport Pavement Management Program Evaluation Report



5.3 Localized Maintenance and Repair Analysis and Recommendations

The SAPMP provides a planning-level estimation of Localized Maintenance and Repair based on the results of the latest PCI Survey Inspection performed at the airport. Based on the limited sample units inspected, a statistical extrapolation of distresses at the section level is used to estimate the quantities of recommended repair activities based on the policies defined in 5.2 Localized M&R Policy. The PCI Survey Inspections did not consist of 100% inspection of all sample units; therefore, the section-level distress quantities used to estimate the Localized Maintenance and Repair needs are for conceptual planning purposes. The accuracy of the extrapolated distresses, and therefore work quantities, is subject to the amount of sample units inspected and the concentration of distress types observed in sample units. Appendix B provides the estimated Localized Maintenance and Repair based on this SAPMP's PCI Survey Inspection efforts. Localized Preventive Maintenance and Repair is typically applied to pavements that are in a condition at or above the Critical PCI of 65. Localized Stopgap Maintenance and Repair is typically applied to pavements that are below the Critical PCI of 65. It is recommended that airport staff evaluate the application of Localized Maintenance and Repair in concert with the planning of Major Rehabilitation efforts identified in Chapter 6 Major Rehabilitation Planning. Pavements with Stopgap recommendations that are subject to nearterm Major Rehabilitation efforts may remove the need to perform localized maintenance efforts.

The following **Table 5.3 (a)** summarizes the anticipated Localized Maintenance and Repair efforts based on the PCI Survey Inspection efforts performed at this airport as part of this SAPMP System Update. The following table depicts planning-level costs rounded to the nearest ten dollars.

Work Description	Work Category	Rough Estimate of Work Quantity	Work Units	Plann	ning Material Cost
FDOT - SURFACE SEAL	PREVENTIVE	700	SqFt	\$	390.00
FDOT - CRACK SEALING - AC	PREVENTIVE	90	Ft	\$	260.00
FDOT - PATCHING - AC FULL DEPTH	PREVENTIVE	955	SqFt	\$	8,570.00
FDOT - SURFACE SEAL	STOPGAP	117,680	SqFt	\$	64,730.00
FDOT - PATCHING - AC FULL DEPTH	STOPGAP	2,355	SqFt	\$	21,190.00
FDOT - PATCHING - AC PARTIAL DEPTH	STOPGAP	7,765	SqFt	\$	31,060.00
FDOT - CRACK SEALING - AC	STOPGAP	755	Ft	\$	2,260.00

Table 5.3 (a) Summary of A	Airport Localized M&R Plannin	ng Cost and Quantity at Network Level
----------------------------	-------------------------------	---------------------------------------

Clearwater Airpark (CLW)

FDOT

121

The following Table 5.3 (b) provides further breakdown of the anticipated planning-level cost at the section level for the pavements exhibiting distresses that would benefit from Localized M&R. The table shows the approximate improved "End Condition" of the section after the application of Localized M&R. The following table depicts planning-level costs rounded to the nearest ten dollars.

Network ID	Branch ID	Section ID	Area (SF)	Start Condition	End Condition	Cost
CLW	AP CENTER	4405	22,600	90	90	\$ -
CLW	AP CENTER	4410	11,073	49	57	\$ 260.00
CLW	AP N	4505	19,396	42	65	\$ 37,950.00
CLW	AP N	4510	2,581	86	89	\$ 20.00
CLW	AP T-HAN 1	4305	31,826	48	67	\$ 26,110.00
CLW	AP T-HAN 1	4310	12,550	88	94	\$ 350.00
CLW	AP T-HAN 2	4105	37,331	59	75	\$ 23,240.00
CLW	AP T-HAN 3	4205	24,739	65	86	\$ 14,090.00
CLW	AP T-HANG	4605	14,273	48	62	\$ 8,710.00
CLW	AP T-HANG	4610	13,025	92	92	\$ -
CLW	RW 16-34	6105	15,000	88	88	\$ -
CLW	RW 16-34	6110	224,775	78	78	\$ 830.00
CLW	RW 16-34	6120	22,500	84	84	\$ -
CLW	RW 16-34	6130	45,750	89	89	\$ -
CLW	TW A	105	63,329	77	78	\$ 3,650.00
CLW	TW A	107	5,097	89	89	\$ -
CLW	TW A	110	7,086	79	79	\$ -
CLW	TW A	135	22,265	66	68	\$ 260.00
CLW	TW A	140	12,540	80	81	\$ 1,990.00
CLW	TW A	145	23,716	88	89	\$ 30.00
CLW	TW A	150	15,000	90	90	\$ -
CLW	TW A1	115	6,928	77	83	\$ 2,110.00
CLW	TW A2	120	6,567	72	72	\$ -
CLW	TW A3	125	6,967	63	72	\$ 8,070.00
CLW	TW CONN 34	5105	1,446	47	63	\$ 900.00

Table 5.3 (b) Summary of Airport Localized M&R Planning Cost and Quantity at Section Level

FDOT

141

The following **Table 5.3 (c)** provides a summary of the anticipated planning-level costs for Localized Preventive Maintenance and Repair and Localized Stopgap Maintenance and Repair. The following table depicts planning-level costs rounded to the nearest ten dollars.

Table 5.3 (c) Summary of Localized Maintenance

Work Category	Cost
Preventive	\$ 9,220.00
Stopgap	\$ 119,240.00
Planning-Level Localized M&R Needs =	\$ 128,460.00

Statewide Airfield Pavement Management Program



Chapter 6




Chapter 6 – Major Rehabilitation Planning


6.1 Major Rehabilitation

Major rehabilitation is recommended to correct or improve structural deficiencies and/or functional deterioration for pavement sections within a network. Often, when pavements are subject to significant changes in the aircraft fleet mix (frequency and type), major rehabilitation is required to provide a pavement section to meet the traffic demand. Major rehabilitation is recommended when a pavement section falls below the Critical PCI value that is defined during the system customization or if a pavement section has a significant observation of load-related distress. Observation of any load-related distress potentially indicates that the section may be structurally deficient or that the aircraft loads being applied to the pavement section are different than what the section was designed for. **Figures 6.1 (a) and 6.1 (b)** depict the decision process for major rehabilitation project identification with the assumption of available funds. Should funding be unavailable for pavement sections in need of major rehabilitation, the airport may elect to apply the appropriate localized stopgap repair.

Figures 6.1 (a) Major Rehabilitation Planning Decision Diagram, PCI ≤ Critical PCI

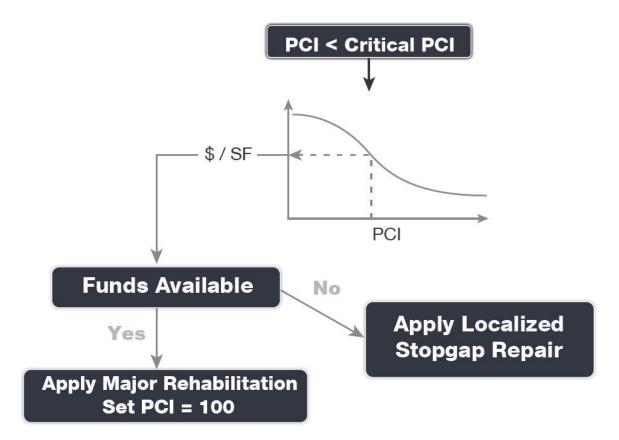

Figures 6.1 (b) Major Rehabilitation Planning Decision Diagram, PCI > Critical PCI

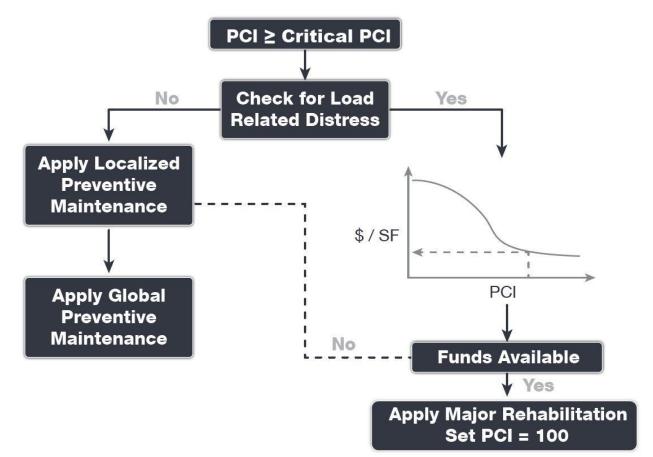



For the FDOT SAPMP the development of a major rehabilitation program is based on the Critical PCI concept. The *Critical PCI* concept assumes that it is more cost-effective to maintain pavements above, rather than below their critical PCI. It is assumed that once a pavement section deteriorates to the Critical PCI value that it is more cost-effective to complete a major rehabilitation project rather than continuing to apply preventive maintenance. This method includes defining the Critical PCI and introducing major rehabilitation work types.

Identification of annual and long-range Major Rehabilitation work plans are typically based on the Critical PCI concept. The Critical PCI is defined as the PCI value at which the rate of loss (deterioration) increases with time, or the cost of applying localized maintenance and repair increases or is not effective. A Critical PCI is usually within a range of 55 and 70; the following procedure is standard approach in developing a specific Critical PCI:

- 1. Develop a pavement performance model and refine a prediction model for the pavements considered.
- 2. Select a localized maintenance and repair policy to be used in developing a work plan.
- 3. Apply the selected localized policy to the pavement sections for a range of PCI.
- 4. Compute the unit cost per area for each PCI range.
- 5. Plot the cost versus the PCI.
- 6. Determine the Critical PCI based on the point where the cost is insignificant.

The FDOT SAPMP defines the Critical PCI at 65 – this is based on the historic trends in pavement performance and Statewide planning efforts.

6.1.2 FDOT Recommended Minimum Service-Level PCI

The FDOT has recommended *Minimum Service-Level PCI* for airports' airfield pavements based on the following characteristics; airport type within FDOT SAPMP, branch use, and expected aircraft operations. For the purposes of Major Rehabilitation, the Critical PCI is typically the threshold condition that triggers major construction, however it is recommended that the airports maintain the Minimum Service-Level PCI with a combination of Localized Maintenance and Repair and timely Major Rehabilitation. **Table 6.1.2** summarizes the FDOT Recommended Minimum Service-Level PCI.

Branch Use	FDOT Recommended PCI	Additional Consideration				
Runway	75	Aircraft Fleet Mix Changes Primary Runway				
Taxiway / Taxilane	65	Aircraft Fleet Mix Changes Expected Operations				
Aprons / Run-Ups / Ramps	65	Ground Service Equipment Non-Aircraft Operations (e.g. fueling)				

Table 6.1.2 FDOT Recommended Minimum Service-Level PCI

6.2 Major Rehabilitation Policy

6.2.1 Major Rehabilitation Pavement Section Development

The review of the existing as-built record documentation within the participating airports' archives was used as the basis of the conceptual pavement design sections. Refinement of the pavement section layers was performed in consideration of the FAA *AC 150/ 5320-6F "Airport Pavement Design and Evaluation."* It should be noted that no subsurface geotechnical investigation, ALTA/ACSM Survey, topographic survey, utilities survey, environmental, or site specific air traffic study(s) have been utilized in the development of the design criteria. No warranty or assurance is implied in this document for final design nor construction for any airfield pavements discussed within this report. The following **Tables 6.2.1 (a) and (b)** provide details on the conceptual pavement sections developed for this study.

Major rehabilitation is divided into two policy categories as part of this program: Full-Depth Reconstruction (Reconstruction) and Intermediate-Level Major Rehabilitation (Restoration). Based on the pavement type, the general categories are defined as AC Reconstruction and AC Restoration for AC, AAC, and APC flexible pavement types and PCC Reconstruction and PCC Restoration for PCC rigid pavement types. The pavement sections have been based on the average RL Airport Type requirements; no pavement design has been performed in accordance with AC 150/5320-6F for the determined conceptual sections.

Rehabilitation Type	Reliever (RL) Airport
AC Restoration	75% Mill and Overlay P-101 AC Milling (3")
Combination of asphalt pavement milling and overlay with 25% of the areas subject to full-depth reconstruction.	P-603 Bituminous Táck P-401 (HMA) (3")
PCI = 41 to 65	25% AC Reconstruction P-101 Pavement Removal P-152 Subgrade (12") P-211 Base (8") P-602 Bituminous Prime P-603 Bituminous Tack P-401 HMA (4") <i>Excludes any paved shoulder features.</i>
AC Reconstruction	P-101 Pavement Removal P-152 Subgrade (12") P-211 Base (8")
Full-depth asphalt pavement section reconstruction.	P-602 Bituminous Prime P-603 Bituminous Tack P-401 HMA (4") <i>Excludes any paved shoulder features.</i>
PCI = 40 or less	

Table 6.2.1 (a) Conceptual Pavement Section for Major Rehabilitation – Flexible AsphaltConcrete



Rehabilitation Type	Reliever (RL) Airport
 PCC Restoration Restoration of PCC pavement with a combination of crack sealing, joint seal replacement, and replacement of 25% of slab panels. PCI = 41 to 65 	P-101 Pavement Removal P-605 Joint Seal Repair P-152 Subgrade (12") P-211 Base (if needed, typical) (6") P-501 Rigid PCC (15") *Select Slabs (25%) **Crack Seal and Limited Patching
PCC Reconstruction Full-depth rigid pavement section reconstruction. PCI = 40 or less	P-101 Pavement Removal P-605 Joint Seal Repair P-152 Subgrade (12") P-211 Base (6") P-501 Rigid PCC (14")

The identification of rehabilitation needs and conceptual pavement sections have been determined at the planning level. Design-level investigation is recommended prior to developing construction-level design documents and budgets.

In compliance with FAA Grant Assurances 11 and 19, the FDOT SAPMP provides airports with airfield pavement evaluation reports in accordance with FAA AC 150/5380-7B Airport Pavement Management Program (PMP) and AC 150/5380-6C Guidelines and Procedures for Maintenance of Airport Pavements. The application of the results of a PCI survey are for planning purposes and are limited to the visual observation of deteriorated pavements in limited sampling; design-level investigation is recommended in accordance with the FAA procedures defined in AC 5320-6F Airport Pavement Design and Evaluation and AC 150/5370-11B Use of Nondestructive Testing in the Evaluation of Airport Pavements. The aforementioned ACs provide the design-level material properties of in-situ pavement and subgrade layers for the determination of appropriate rehabilitation actions. The FDOT SAPMP is organized to provide airports with planning-level data and does not intend to preclude the responsible engineer in performing the appropriate level of investigation and analysis in determining the appropriate design details of a pavement rehabilitation. It would not be advisable to solely base design-level rehabilitation without the appropriate level of investigation and determination of pavement deterioration beyond that of a visual functional condition assessment.

The recommendations identified in the Major Rehabilitation Needs consider the FAA AC 150/5370-10H Standard Specifications for Construction of Airports when determining the appropriate materials and methods implemented for construction projects, such as pavement rehabilitation, on airports. It should be noted that the AC 150/5370-10H Standard Specifications for Construction of Airports was updated in December of 2018. Design-level determination of project specific specifications based on the AC should be developed by the Airport when performing applicable construction projects.



6.2.2 Major Rehabilitation Planning-Level Unit Costs

Planning-level opinion of probable construction unit costs developed for this System Update was based on archived bid tabulations and records from airfield pavement projects provided by participating airports. A review of cost trends and cost factors have been incorporated to assist airports in planning for project budgets. Neither FDOT nor the Consultant Team has control over the cost of labor, materials, equipment, or over the Contractor's methods of determining prices or over competitive bidding or market conditions. Opinions of probable construction costs provided herein are based on the information known to FDOT at this time and represent only the Consultant Team's judgment as a design professional familiar with the construction industry. This report cannot and does not guarantee that proposals, bids, or actual construction costs will not vary from its opinions of probable construction costs.

Rehabilitation Type	PCI Range	Flexible Asphalt Concrete Cost Per SF		Rigid Portland Cement Concrete Cost per SF		
Restoration	41 to 65	\$	9.50	\$	13.50	
Reconstruction	0 to 40	\$	12.50	\$	20.00	

Table 6.2.2 Reliever (RL) Major Rehabilitation Planning-Level Unit Cost by Pavement Type

Planning-level opinion of probable construction unit costs consider factors for non-pavement improvements, QA/QC testing, and administrative costs.

6.3 Major Rehabilitation Needs

The objective of the major pavement rehabilitation needs analysis is to provide planning-level projects within an airport's airfield pavement network. Major rehabilitation activities are recommended when a pavement section has deteriorated below the Critical PCI value, a point at which localized maintenance and repair activities may not be the most cost-effective solution. In addition, major rehabilitation is also recommended when the Section PCI is at or above the Critical PCI but the section has significant load-related PCI distresses. Identification of rehabilitation needs is done at the Airfield Pavement Network Definition's section level. This however does not limit the airport from further refining limits of project planning areas.

Major rehabilitation is identified within the FDOT SAPMP as major construction activity that would result in an improvement or resetting of the pavement section's PCI to a value of 100. Major rehabilitation recommendations (AC Restoration, AC Reconstruction, PCC Restoration, and PCC Reconstruction) should be considered as planning-level only. Additional design-level investigation in accordance to the FAA Advisory Circulars will be required. Recommendations identified within this planning document do not imply final design.

6.3.1 10-Year Unconstrained Budget Major Rehabilitation Needs

An unconstrained budget (unlimited budget) is performed for a 10-year duration to identify pavement rehabilitation needs based on current or forecasted PCI values deteriorating below the Critical PCI. FDOT recognizes airports are constrained by budgets and does not intend to convey an unrealistic approach of addressing pavement rehabilitation. The intent of the 10-Year Major Rehabilitation Needs analysis is to identify pavements that will warrant rehabilitation. It is highly recommended that airport staff utilize this information in support of the development of a practical Capital Improvement Program based on priorities, further design/project-level investigation, and budgetary constraints. The following **Table 6.3.1** summarizes all identified section-level major rehabilitation needs forecasted for the next 10-year period. It should be noted that the following table depicts planning-level costs and have been rounded for planning purposes.

Program Year	Network ID	Branch ID	Section ID	Surface	Area (SF)	PCI Before	Rehabilitation Type	Planning Cost
2020	CLW	AP CENTER	4410	AC	11,073	48	AC Restoration	\$ 112,000.00
2020	CLW	AP N	4505	AC	19,396	40	AC Restoration	\$ 239,000.00
2020	CLW	AP T-HAN 1	4305	AC	31,826	46	AC Restoration	\$ 332,000.00
2020	CLW	AP T-HAN 2	4105	AC	37,331	58	AC Restoration	\$ 355,000.00
2020	CLW	AP T-HAN 3	4205	AC	24,739	63	AC Restoration	\$ 236,000.00
2020	CLW	AP T-HANG	4605	AC	14,273	46	AC Restoration	\$ 149,000.00
2020	CLW	TW A3	125	AAC	6,967	62	AC Restoration	\$ 67,000.00
2020	CLW	TW CONN 34	5105	AC	1,446	46	AC Restoration	\$ 16,000.00
2021	CLW	TW A	135	AAC	22,265	64	AC Restoration	\$ 212,000.00
2026	CLW	TW A2	120	AAC	6,567	64	AC Restoration	\$ 63,000.00

Table 6.3.1 10-Year Major Rehabilitation Needs

*All values have been rounded to the nearest thousand-dollar.

The following **Figure 6.3.1 (a)** summarizes the section-level major rehabilitation needs for a 10year period between 2020 and 2029. **Figure 6.3.1 (b)** provides an inset view of Airfield Pavement Major Rehabilitation Exhibit, a large format exhibit is located in **Appendix C Technical Exhibits**. The exhibit graphically depicts the Major Rehabilitation Needs with rounded costs.




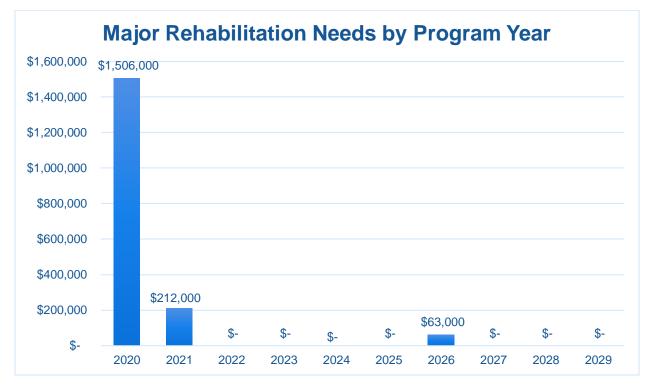


Figure 6.3.1 (b) 10-Year Major Rehabilitation Needs by Program Year Exhibit



Statewide Airfield Pavement Management Program

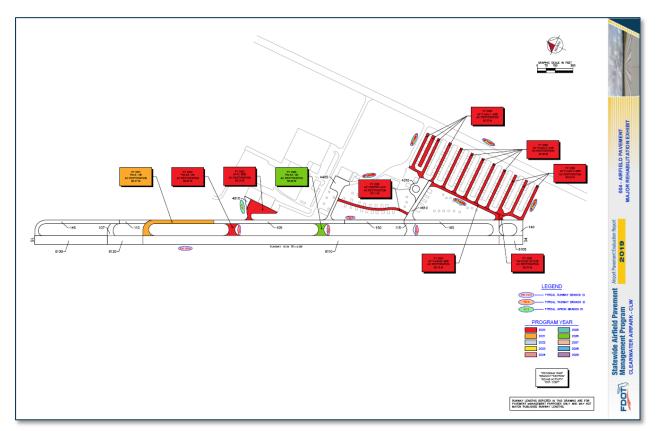

Chapter 7

Chapter 7 – Conclusion

7.1 Recommendations

7.1.1 Continued PCI Survey Inspections

It is recommended that the airport continue to perform regularly scheduled PCI Survey inspections in accordance with the ASTM D5340-12 (or latest edition) to monitor the condition of the airfield pavement facilities.

A high priority should be considered for continuous maintenance record keeping and reinspection of all the airport's maintained pavement facilities to ensure continued safe aircraft operations. A series of scheduled periodic inspections must be carried out for an effective maintenance program. Re-inspection of pavements should be scheduled in a timely manner to ensure that all areas, particularly those that may not come under day-to-day observation, are thoroughly evaluated and reported.

7.1.2 Localized Maintenance and Repair

While deterioration of the pavements due to usage and exposure to the environment cannot be completely prevented, applying timely and effective maintenance efforts can slow the anticipated rate of deterioration. Lack of adequate and timely maintenance is the significant factor in pavement deterioration.

It is recommended that airport sponsors coordinate with their respective Airport Maintenance staff and Airport Engineer when developing project-level maintenance and repair efforts.

7.1.3 Major Rehabilitation

Chapter 6 – Major Rehabilitation Planning identified major pavement rehabilitation project needs from 2020-2029. The identification of the rehabilitation needs was performed at the section level for manageable project areas with the assumption of an unconstrained budget scenario. Given the uncertainty in the airport-specific budget information and prioritization goals, the unconstrained budget scenario was performed to evaluate the worst-case scenario and identify all the inspected pavements' needs in a 10-year period. Certainly, it is understood that most airports are faced with constrained budgets; further evaluation of projects based on prioritization, operational criticality, funding availability, and practicality is recommended.

7.1.4 Pavement Management System

The following recommendations are made to fully implement an effective pavement management program for the airport:

- > Develop a detailed preventive maintenance program for the airport.
- Further refine and implement the identified 10-year major rehabilitation needs.
- Maintain detailed records on pavement maintenance, construction, and inspection.
- Maintain records on major pavement construction projects (year, scope, cost, and construction documents).

7.2 Supporting Documents

001 – Airfield Pavement Network Definition Exhibit

The Airfield Pavement Network Definition Exhibit is located in **Appendix C Technical Exhibits**. The exhibit depicts the airfield layout in a manner that defines the airfield pavement infrastructure as branches, sections, and sample units in accordance with the ASTM D5340-12. The exhibit is intended for planning purposes only – further detail on facilities can be found on the Airport's adopted Airport Layout Plan. Detailed characteristics are tabulated in **Appendix A Pavement Analysis Tables**.

002 – Airfield Pavement System Inventory Exhibit

The Airfield Pavement System Inventory Exhibit in is located in **Appendix C Technical Exhibits**. The exhibit depicts any recent and/or anticipated construction activity within the airfield pavement facilities reported by airport staff. The exhibit is intended to schematically identify the pavement limits of works and general work description. The information reported on the *Airport Response Form* provided by each participating airport was used as the basis of the changes; furthermore, changes are confirmed at the airport with airport staff during the in-brief and debrief meeting.

003 – Airfield Pavement Condition Index Exhibit

The Airfield Pavement Condition Index Exhibit is located in **Appendix C Technical Exhibits**. The exhibit is a visual summary of the latest conditions calculated from the results of the PCI Survey performed at the airport. The analysis of the distresses surveyed in accordance with the ASTM D5340-12 (referenced in **Appendix E Inspection Distress Details**) were analyzed using PAVER[™] software to determine PCI values. The PCI values are identified in the exhibit and graphically represented using the standard ASTM D5340-12 colors for condition rating categories.

004 – Airfield Pavement Major Rehabilitation Exhibit

The Airfield Pavement Major Rehabilitation Exhibit is located in **Appendix C Technical Exhibits**. The exhibit has been prepared based on the section condition analysis, pavement condition forecasts, and major rehabilitation needs analysis. The exhibit graphically depicts the inventory with the associated rehabilitation type activity, program year, and the planning-level costs. The area limits, rehabilitation type, and planning-level costs should not be considered a design-level recommendation. A tabulation of the 10-Year Major Rehabilitation is located in **Appendix B Airfield Pavement Localized Maintenance and Repair and Major Rehabilitation**.

Inspection Photograph Documentation

Representative field conditions from the PCI Survey are documented with digital photographs located in **Appendix D Inspection Photograph Documentation.** Select photographs are provided with limited caption on the distresses observed – the Appendix does not contain photographs for every sample unit.



7.3 Conclusion


The FDOT SAPMP Update Phase 2 2018-2019 was completed for the airport on behalf of the FDOT ASO in accordance with the Advisory Circulars **150/5380-7B** "Airport Pavement Management Program (PMP)" and **150/5380-6C** "Guidelines and Procedures for Maintenance of Airport Pavements." FDOT's implementation of the SAPMP has assisted public airports with this requirement in performing PCI survey inspections and analysis in accordance with the ASTM D5340-12 "Standard Test Method for Airport Pavement Condition Index Surveys."

Statewide Airfield Pavement Management Program



Appendix A

Airfield Pavement Analysis Tables

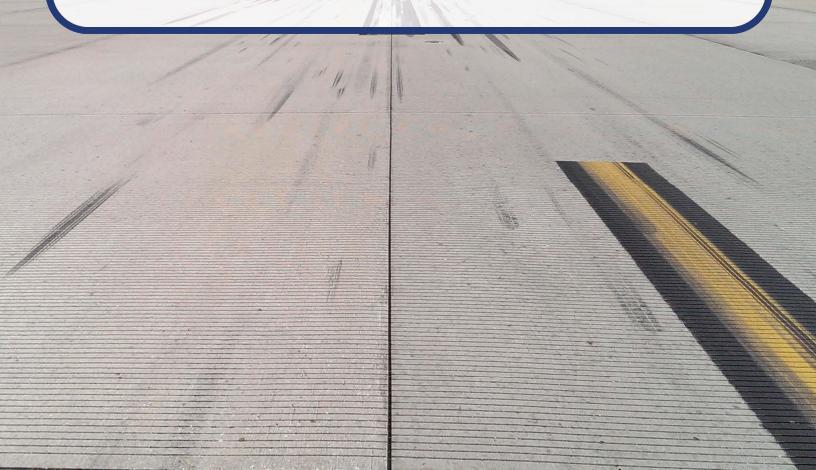

Clearwater Airpark (CLW)



Network ID	Branch Name	Branch ID	Branch Use	Section ID	Length (FT)	Width (FT)	Area (SF)	Surface Type	Est. Last Construction Date
CLW	CENTER APRON	AP CENTER	APRON	4405	575	25	22,600	AAC	1/1/2015
CLW	CENTER APRON	AP CENTER	APRON	4410	610	18	11,073	AC	12/15/1999
CLW	NORTH APRON	AP N	APRON	4505	200	100	19,396	AC	1/1/2003
CLW	NORTH APRON	AP N	APRON	4510	94	60	2,581	AC	1/1/2012
CLW	APRON AT T- HANGARS 1	AP T-HAN 1	APRON	4305	1,480	20	31,826	AC	12/25/1999
CLW	APRON AT T- HANGARS 1	AP T-HAN 1	APRON	4310	171	80	12,550	AAC	1/1/2015
CLW	APRON AT T- HANGARS 2	AP T-HAN 2	APRON	4105	1,800	20	37,331	AC	1/1/1996
CLW	APRON AT T- HANGARS 3	AP T-HAN 3	APRON	4205	1,200	20	24,739	AC	1/1/1996
CLW	T-HANGAR APRON	AP T-HANG	APRON	4605	660	20	14,273	AC	1/1/1996
CLW	T-HANGAR APRON	AP T-HANG	APRON	4610	386	30	13,025	AAC	1/1/2015
CLW	RUNWAY 16-34	RW 16-34	RUNWAY	6105	200	75	15,000	AAC	1/1/2013
CLW	RUNWAY 16-34	RW 16-34	RUNWAY	6110	2,997	75	224,775	AAC	1/1/2013
CLW	RUNWAY 16-34	RW 16-34	RUNWAY	6120	300	50	22,500	AAC	1/1/2013
CLW	RUNWAY 16-34	RW 16-34	RUNWAY	6130	600	100	45,750	AC	1/1/2013
CLW	TAXIWAY A	TW A	TAXIWAY	105	2,600	30	63,329	AAC	1/1/2013
CLW	TAXIWAY A	TW A	TAXIWAY	107	475	30	5,097	AAC	1/1/2013
CLW	TAXIWAY A	TW A	TAXIWAY	110	475	30	7,086	AAC	1/1/2013
CLW	TAXIWAY A	TW A	TAXIWAY	135	700	30	22,265	AAC	1/1/2013
CLW	TAXIWAY A	TW A	TAXIWAY	140	400	30	12,540	AAC	1/1/2013
CLW	TAXIWAY A	TW A	TAXIWAY	145	700	30	23,716	AC	1/1/2013
CLW	ΤΑΧΙΨΑΥ Α	TW A	TAXIWAY	150	2,600	30	15,000	AAC	1/1/2013
CLW	TAXIWAY A1	TW A1	TAXIWAY	115	100	50	6,928	AAC	1/1/2013
CLW	TAXIWAY A2	TW A2	TAXIWAY	120	100	50	6,567	AAC	1/1/2013
CLW	TAXIWAY A3	TW A3	TAXIWAY	125	100	50	6,967	AAC	1/1/2013
CLW	TAXIWAY CONNECTOR TO RUNWAY 34	TW CONN 34	TAXIWAY	5105	50	30	1,446	AC	1/1/1991

Table A-1 Pavement System Inventory Details



Table A-2 Pavement Condition Index Summary (Last Inspection) – Section Level

Network ID	Branch Name	Branch Use	Section ID	Area (SF)	PCI	Condition Rating
CLW	RUNWAY 16-34	RUNWAY	6105	15,000	88	Good
CLW	RUNWAY 16-34	RUNWAY	6110	224,775	78	Satisfactory
CLW	RUNWAY 16-34	RUNWAY	6120	22,500	84	Satisfactory
CLW	RUNWAY 16-34	RUNWAY	6130	45,750	89	Good
CLW	ΤΑΧΙΨΑΥ Α	TAXIWAY	105	63,329	77	Satisfactory
CLW	ΤΑΧΙΨΑΥ Α	TAXIWAY	107	5,097	89	Good
CLW	ΤΑΧΙΨΑΥ Α	TAXIWAY	110	7,086	79	Satisfactory
CLW	ΤΑΧΙΨΑΥ Α	TAXIWAY	135	22,265	66	Fair
CLW	ΤΑΧΙΨΑΥ Α	TAXIWAY	140	12,540	80	Satisfactory
CLW	ΤΑΧΙΨΑΥ Α	TAXIWAY	145	23,716	88	Good
CLW	ΤΑΧΙΨΑΥ Α	TAXIWAY	150	15,000	90	Good
CLW	TAXIWAY A1	TAXIWAY	115	6,928	77	Satisfactory
CLW	TAXIWAY A2	TAXIWAY	120	6,567	72	Satisfactory
CLW	TAXIWAY A3	TAXIWAY	125	6,967	63	Fair
CLW	TAXIWAY CONNECTOR TO RUNWAY 34	TAXIWAY	5105	1,446	47	Poor
CLW	APRON AT T-HANGARS 2	APRON	4105	37,331	59	Fair
CLW	APRON AT T-HANGARS 3	APRON	4205	24,739	65	Fair
CLW	APRON AT T-HANGARS 1	APRON	4305	31,826	48	Poor
CLW	APRON AT T-HANGARS 1	APRON	4310	12,550	88	Good
CLW	CENTER APRON	APRON	4405	22,600	90	Good
CLW	CENTER APRON	APRON	4410	11,073	49	Poor
CLW	NORTH APRON	APRON	4505	19,396	42	Poor
CLW	NORTH APRON	APRON	4510	2,581	86	Good
CLW	T-HANGAR APRON	APRON	4605	14,273	48	Poor
CLW	T-HANGAR APRON	APRON	4610	13,025	92	Good

Statewide Airfield Pavement Management Program Airport Pavement Evaluation Report

2019

Clearwater Airpark (CLW)



Table A-3 Forecasted PCI 2020-2029

Network	Branch ID	Section	Last					Forecas	sted PCI				
ID	Branch ID	ID	PCI	2020	2021	2022	2023	2024	2025	2026	2027	2028	2029
CLW	AP CENTER	4405	90	87	85	83	81	79	76	74	72	70	68
CLW	AP CENTER	4410	49	48	47	46	45	43	42	41	40	39	38
CLW	AP N	4505	42	40	39	38	37	35	34	33	32	31	31
CLW	AP N	4510	86	83	81	79	77	75	73	71	70	68	67
CLW	AP T-HAN 1	4305	48	46	45	44	43	42	41	40	39	37	36
CLW	AP T-HAN 1	4310	88	85	83	81	79	77	74	72	70	68	66
CLW	AP T-HAN 2	4105	59	58	57	56	55	55	54	53	53	52	51
CLW	AP T-HAN 3	4205	65	63	62	61	60	59	58	58	57	56	55
CLW	AP T-HANG	4605	48	46	45	44	43	42	41	40	39	37	36
CLW	AP T-HANG	4610	92	89	87	85	83	81	78	76	74	72	70
CLW	RW 16-34	6105	88	85	83	81	80	78	77	75	74	72	71
CLW	RW 16-34	6110	78	76	74	73	72	71	70	69	68	67	66
CLW	RW 16-34	6120	84	82	80	78	77	75	74	72	71	70	69
CLW	RW 16-34	6130	89	86	84	82	80	78	77	75	74	72	71
CLW	TW A	105	77	75	74	72	71	70	69	68	67	66	65
CLW	TW A	107	89	86	85	83	81	80	78	77	75	74	73
CLW	TW A	110	79	77	76	74	73	72	71	69	68	67	66
CLW	TW A	135	66	65	64	63	62	61	60	59	59	58	57
CLW	TW A	140	80	78	76	75	74	72	71	70	69	68	67
CLW	TW A	145	88	86	84	83	81	80	78	77	76	74	73
CLW	TW A	150	90	87	85	84	82	80	79	77	76	74	73
CLW	TW A1	115	77	75	74	72	71	70	69	68	67	66	65
CLW	TW A2	120	72	70	69	68	67	66	65	64	63	63	62
CLW	TW A3	125	63	62	61	60	59	58	58	57	56	55	54
CLW	TW CONN 34	5105	47	46	45	44	44	43	42	42	41	40	40

Work History Report

Pavement Database: FDOT Network: CLEARWATER AIR Branch: AP CENTER CENTER APRON Section: 4405 Surface: AAC L.C.D. 1/1/2015 Use: APRON Rank: P Length: 575.00 (Ft) Width: 25.00 (Ft) True Area: 22600.00000 (SqFt Work Thickness Major Work Date Work Description Cost Comments Code (in) M&R 1/1/2015 ML-OV MILL and OVERLAY 0.00 0.00 UNKNOWN \checkmark 1/1/2014 ST-SC Surface Treatment - Seal Coat 0.00 0.00 1/1/2003 SS-CT Surface Seal - Coal Tar Seal coated with GRIPFLEX 0.00 0.00 12/25/1999 NU-IN New Construction - Initial 0.00 0.00 \checkmark Branch: AP CENTER CENTER APRON Network: CLEARWATER AIR Section: 4410 Surface:AC L.C.D. 12/15/199 Use: APRON Rank: P Length: 610.00 (Ft) Width: 18.00 (Ft) True Area: 11073.00000 (SqFt Work Thickness Major Work Date Work Description Cost Comments Code (in) M&R 1/1/2014 ST-SC Surface Treatment - Seal Coat 0.00 0.00 1/1/2003 SS-CT 0.00 Seal coated with GRIPFLEX Surface Seal - Coal Tar 0.00 12/15/1999 NU-IN New Construction - Initial 0.00 0.00 \checkmark Section: 4505 Network: CLEARWATER AIR Branch: AP N NORTH APRON Surface:AC L.C.D. 1/1/2003 Use: APRON Rank: P Length: 200.00 (Ft) Width: 100.00 (Ft) True Area: 19396.00000 (SqFt Work Thickness Major Work Date Cost Comments Work Description Code (in) M&R 1/1/2014 Surface Treatment - Seal Coat ST-SC 0.00 0.00 1/1/2003 NU-IN New Construction - Initial 0.00 2.00 2"AC/6"Crushed PCC/9"Stab Subgrad \checkmark 1/1/2003 SS-CT Surface Seal - Coal Tar 0.00 0.00 Seal coated with GRIPFLEX Network: CLEARWATER AIR Section: 4510 Branch: AP N NORTH APRON Surface:AC **L.C.D.** 1/1/2012 Use: APRON Rank: P Length: 94.00 (Ft) Width: 60.00 (Ft) True Area: 2581.000000 (SqFt Work Thickness Major Work Date Work Description Cost Comments Code M&R (in) 1/1/2012 NU-IN New Construction - Initial 0.00 0.00 \checkmark Network: CLEARWATER AIR Branch: AP T-HAN 1 APRON AT T-HA Section: 4305 Surface:AC L.C.D. 12/25/199 Use: APRON Rank: P Length: 1,480.00 (Ft) Width: 20.00 (Ft) True Area: 31826.00000 (SqFt Work Thickness Major Work Date Work Description Cost Comments Code (in) M&R 1/1/2014 ST-SC Surface Treatment - Seal Coat 0.00 0.00 1/1/2003 SS-CT Surface Seal - Coal Tar 0.00 0.00 Seal coated with GRIPFLEX 12/25/1999 NU-IN New Construction - Initial 0.00 0.00 \checkmark Network: CLEARWATER AIR Branch: AP T-HAN 1 APRON AT T-HA Section: 4310 Surface:AAC L.C.D. 1/1/2015 171.00 (Ft) 80.00 (Ft) True Area: 12550.00000 (SqFt Use: APRON Rank: P Length: Width: Work Thickness Major Work Date Work Description Cost Comments Code (in) M&R 1/1/2015 ML-OV MILL and OVERLAY 0.00 0.00 \checkmark 1/1/2014 ST-SC Surface Treatment - Seal Coat 0.00 0.00 1/1/2003 SS-CT Surface Seal - Coal Tar 0.00 0.00 Seal coated with GRIPFLEX 12/25/1999 NU-IN New Construction - Initial 0.00 0.00 \checkmark

Work History Report

<u>.</u>						
Network:	CLEARW	ATER AIR Branch: AP T-H	HAN 2 APRO		Section:	
L.C.D. 1/1/1	996 Us	e: APRON Rank: P L	ength: 1,800	.00 (Ft) Wi	dth: 20.0	0 (Ft) True Area: 37331.00001 (SqFt
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2014	ST-SC	Surface Treatment - Seal Coat	0.00	0.00		
1/1/2003	SS-CT	Surface Seal - Coal Tar	0.00	0.00		Seal coated with GRIPFLEX
1/1/1996	IMPORT	BUILT	0.00	2.00		EST 1996: 2" FDOT P-331
	ED		•			
Network	CIFARW	ATER AIR Branch: AP T-H	IAN 3 APRO	Ν ΑΤ Τ-ΗΑ	Section:	4205 Surface:AC
L.C.D. 1/1/1			ength: 1,200			0 (Ft) True Area: 24739.00000 (SqFt
Work Date	Work	Work Description	Cost	Thickness	Major	Comments
	Code ST-SC	Surface Treatment - Seal Coat		(in)	M&R	
1/1/2014			0.00	0.00		Seel control with CDIDELEV
1/1/2003	SS-CT	Surface Seal - Coal Tar	0.00	0.00		Seal coated with GRIPFLEX
1/1/1996	IMPORT ED	DUILI	0.00	2.00		1996: 2" FDOT P-331
1/1/1996	IMPORT ED	OVERLAY	0.00	6.00		1996: 6" P-211 ON 9" P-160
Network:	CLEARW	ATER AIR Branch: AP T-H	IANG T-HAN	NGAR APR	Section:	4605 Surface:AC
L.C.D. 1/1/1	996 Us	e: APRON Rank: P L	ength: 660	.00 (Ft) Wi	dth: 20.0	0 (Ft) True Area: 14273.00000 (SqFt
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2014	ST-SC	Surface Treatment - Seal Coat	0.00	0.00		
1/1/2003	SS-CT	Surface Seal - Coal Tar	0.00	0.00		Seal coated with GRIPFLEX
1/1/1996	IMPORT	BUILT	0.00	2.00		1996: 2" P-331 ON 6" P-211 ON 9" P-
1/1/1996	ED IMPORT ED	OVERLAY	0.00	0.00		160 SOIL: SP
Network:	CLEARW	ATER AIR Branch: AP T-H	HANG T-HAN	NGAR APR	Section:	4610 Surface:AAC
L.C.D. 1/1/2	015 Us	e: APRON Rank: P L	ength: 386	.00 (Ft) Wi	dth: 30.0	0 (Ft) True Area: 13025.00000 (SqFt
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2015	ML-OV	MILL and OVERLAY	0.00	0.00		
1/1/2014	ST-SC	Surface Treatment - Seal Coat	0.00	0.00		
1/1/2003	SS-CT	Surface Seal - Coal Tar	0.00	0.00		Seal coated with GRIPFLEX
1/1/1996	IMPORT ED	BUILT	0.00	2.00		1996: 2" P-331 ON 6" P-211 ON 9" P- 160
1/1/1996		OVERLAY	0.00	0.00		SOIL: SP
Notrovilo		ATED AID Dramake DW 16	24 DININ	LAN 16 24	Seetier.	
Network: L.C.D. 1/1/2		ATER AIR Branch: RW 16 se: RUNWAY Rank: P L		VAY 16-34 .00 (Ft) Wie	Section: dth: 75.0	6105 Surface:AAC 0 (Ft) True Area: 15000.00000 (SqFt
Work Date	Work	Work Description	Cost	Thickness	Major	Comments
1/1/2013	Code ML-OV	MILL and OVERLAY	0.00	(in) 0.00	M&R ✓	0.5" MILL, 1.5" P-401 OVERLAY
1/1/2013	SS-CT	Surface Seal - Coal Tar	0.00	0.00		Seal coated with GRIPFLEX
1/1/2005				2.00		2"AC/6"Crushed PCC/9"Stab Subgrad
1/1/2002	NU-IN	New Construction - Initial	0.00			

Work History Report

Network:	CLEARW	ATER AIR Branch: RW 16	-34 RUNV	VAY 16-34	Section:	6110 Surface:AAC
L.C.D. 1/1/2	013 Us	se: RUNWAY Rank: P I	ength: 2,997	.00 (Ft) Wie	dth: 75.0	0 (Ft) True Area: 224775.0000 (SqF
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2013	ML-OV	MILL and OVERLAY	0.00	0.00		0.5" MILL, 1.5" P-401 OVERLAY
1/1/2003	SS-CT	Surface Seal - Coal Tar	0.00	0.00		Seal coated with GRIPFLEX
1/1/1991	IMPORT ED	OVERLAY	0.00	1.50		1991: 1.5" P-4O1
1/1/1991	IMPORT ED	OVERLAY	0.00	0.00		SOIL: SP
1/1/1970	IMPORT ED	BUILT	0.00	1.00		1970: 1" AC ON 6" LIMEROCK
Network:	CLEARW	ATER AIR Branch: RW 16	-34 RUNV	VAY 16-34	Section:	6120 Surface:AAC
L.C.D. 1/1/2						0 (Ft) True Area: 22500.00000 (SqF
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2013	ML-OV	MILL and OVERLAY	0.00	0.00		0.5" MILL, 1.5" P-401 OVERLAY
1/1/2003	SS-CT	Surface Seal - Coal Tar	0.00	0.00		Seal coated with GRIPFLEX
1/1/1992	IMPORT ED	BUILT	0.00	0.00		ASSUME 1992 AC RECONSTRUCTION
1/1/1992	IMPORT ED	OVERLAY	0.00	0.00		SOIL: SP
Network:	CLEARW	ATER AIR Branch: RW 16	5-34 RUNV	VAY 16-34	Section:	6130 Surface:AC
L.C.D. 1/1/2	013 Us	se: RUNWAY Rank: P I	.ength: 600	.00 (Ft) Wi	dth: 100.0	0 (Ft) True Area: 45750.00001 (SqF
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2013	NU-IN	New Construction - Initial	0.00	0.00		2" P-401, 6" P-219 RECYCLED CON
Network:	CLEARW	ATER AIR Branch: TW A	TAXI	WAY A	Section:	105 Surface:AAC
L.C.D. 1/1/2	013 Us	se: TAXIWAY Rank: P I	Length: 2,600	.00 (Ft) Wie	dth: 30.0	0 (Ft) True Area: 63329.00001 (SqF
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments
1/1/2013	ML-OV	MILL and OVERLAY	0.00	0.00		0.5" MILL, 1.5" P-401 OVERLAY
1/1/2003	SS-CT	Surface Seal - Coal Tar	0.00	0.00		Seal coated with GRIPFLEX
1/1/1991	ED	OVERLAY	0.00	1.50		1991: 1.5" P-401
1/1/1991	ED	OVERLAY	0.00	0.00		SOIL TYPE: SP
1/1/1970	IMPORT ED	BUILT	0.00	1.00		1970: 1" AC ON 6" LIMEROCK
				WAV A	Section:	107 Surface:AAC
Network	CLEARW	ATER AIR Branch TW A	TAXIN			
		ATER AIR Branch: TW A se: TAXIWAY Rank: P I	TAXIV Length: 475			
Network: L.C.D. 1/1/2 Work Date					dth: 30.0 Major	0 (Ft) True Area: 5097.000001 (SqF Comments
L.C.D. 1/1/2	013 Us Work	se: TAXIWAY Rank: P I	Length: 475	.00 (Ft) Wie Thickness	dth: 30.0	0 (Ft) True Area: 5097.000001 (SqF

Work History Report

Page 4 of 6

Network:	CLEARW.	ATER AIR	Branch: TW A	TAXI	WAY A	Section:	110 Surface:AAC
L.C.D. 1/1/20	013 Us	se: TAXIWAY	Rank: P	Length: 475	.00 (Ft) Wi	dth: 30.0	0 (Ft) True Area: 7086.000002 (SqFt
Work Date	Work Code	Work De	escription	Cost	Thickness (in)	Major M&R	Comments
1/1/2013	ML-OV	MILL and OVE	ERLAY	0.00	0.00		0.5" MILL, 1.5" P-401 OVERLAY
1/1/2003	SS-CT	Surface Seal - C	Coal Tar	0.00	0.00		Seal coated with GRIPFLEX
1/1/1992	IMPORT ED	BUILT		0.00	0.00		1992 AC PAVEMENT
1/1/1992	IMPORT ED	OVERLAY		0.00	0.00		SOIL: SP
1/1/1984	IMPORT ED	OVERLAY		0.00	0.00		ESTIMATE 1984 CEMENT STABILIZED LIMEROCK
Network:	CLEARW.	ATER AIR	Branch: TW A	1 TAXI	WAY A1	Section:	115 Surface:AAC
L.C.D. 1/1/20	013 Us	se: TAXIWAY	Rank: P	Length: 100	.00 (Ft) Wi	dth: 50.0	0 (Ft) True Area: 6928.000002 (SqFt
Work Date	Work Code	Work Do	escription	Cost	Thickness (in)	Major M&R	Comments
1/1/2013	ML-OV	MILL and OVE	ERLAY	0.00	0.00		0.5" MILL, 1.5" P-401 OVERLAY
1/1/2003	SS-CT	Surface Seal - C	Coal Tar	0.00	0.00		Seal coated with GRIPFLEX
1/1/1991	IMPORT ED	OVERLAY		0.00	0.00		1991: AC PAVEMENT
1/1/1991	IMPORT ED	OVERLAY		0.00	0.00		SOIL: SP
	ED				1.00		1970: 1" AC ON 6" LIMEROCK
	IMPORT ED	BUILT		0.00	1.00		1770. 1 AC ON O LIVILKOCK
1/1/1970	IMPORT ED CLEARW		Branch: TW A Rank: P l	TAXI	WAY A	Section:	
1/1/1970 Network:	IMPORT ED CLEARW	ATER AIR Se: TAXIWAY		TAXI	WAY A	Section:	135 Surface:AAC
1/1/1970 Network: 0 L.C.D. 1/1/20	IMPORT ED CLEARW 013 Us Work Code	ATER AIR Se: TAXIWAY	Rank: P I	TAXI Cength: 700	WAY A 1.00 (Ft) Wi Thickness (in)	Section: dth: 30.0 Major	135 Surface: AAC 0 (Ft) True Area: 22265.00000 (SqFt
1/1/1970 Network: 0 L.C.D. 1/1/20 Work Date	IMPORT ED CLEARW 013 Us Work Code	ATER AIR se: TAXIWAY Work Do	Rank: P I escription ERLAY	TAXIV Length: 700 Cost	WAY A 1.00 (Ft) Wi Thickness (in)	Section: dth: 30.0 Major M&R	135 Surface:AAC 0 (Ft) True Area: 22265.00000 (SqFt Comments
1/1/1970 Network: 0 L.C.D. 1/1/20 Work Date 1/1/2013 1/1/2003	IMPORT ED CLEARW. 013 Us Work Code ML-OV	ATER AIR se: TAXIWAY Work Do MILL and OVE Surface Seal - C	Rank: P I escription ERLAY	TAXI Length: 700 Cost 0.00	WAY A .00 (Ft) Wi Thickness (in) 0.00	Section: dth: 30.0 Major M&R	135 Surface: AAC 0 (Ft) True Area: 22265.00000 (SqFt Comments 0.5" MILL, 1.5" P-401 OVERLAY
1/1/1970 Network: 0 L.C.D. 1/1/20 Work Date 1/1/2013 1/1/2003 1/1/1998	IMPORT ED CLEARW 013 Us Work Code ML-OV SS-CT IMPORT ED	ATER AIR se: TAXIWAY Work Do MILL and OVE Surface Seal - C	Rank: P I escription ERLAY	TAXIV Length: 700 Cost 0.00 0.00	WAY A .00 (Ft) Wi Thickness (in) 0.00 0.00	Section: dth: 30.0 Major M&R	135 Surface:AAC 0 (Ft) True Area: 22265.00000 (SqFt Comments 0.5" MILL, 1.5" P-401 OVERLAY Seal coated with GRIPFLEX CONDITION/AGE FEATURE
1/1/1970 Network: 0 L.C.D. 1/1/20 Work Date 1/1/2013 1/1/2003 1/1/1998	IMPORT ED CLEARW 013 Us Work Code ML-OV SS-CT IMPORT ED IMPORT ED	ATER AIR se: TAXIWAY Work Do MILL and OVE Surface Seal - C BUILT OVERLAY	Rank: P I escription ERLAY	TAXIV Cength: 700 Cost 0.00 0.00 0.00	WAY A .00 (Ft) Wi Thickness (in) 0.00 0.00 0.00	Section: dth: 30.0 Major M&R	135 Surface:AAC 0 (Ft) True Area: 22265.00000 (SqFt Comments 0.5" MILL, 1.5" P-401 OVERLAY Seal coated with GRIPFLEX CONDITION/AGE FEATURE CHANGE FROM 1998 INSPECTION EST 1991 AC PAVEMENT
1/1/1970 Network: 0 L.C.D. 1/1/20 Work Date 1/1/2013 1/1/2003 1/1/1998 1/1/1991	IMPORT ED CLEARW 013 Us Work Code ML-OV SS-CT IMPORT ED IMPORT ED	ATER AIR se: TAXIWAY Work Do MILL and OVE Surface Seal - C BUILT OVERLAY	Rank: P I escription BRLAY Coal Tar Branch: TW A	TAXIV Length: 700 Cost 0.00 0.00 0.00 0.00 TAXIV	WAY A .00 (Ft) Wi Thickness (in) 0.00 0.00 0.00 0.00 WAY A	Section: dth: 30.0 Major M&R M&R Section:	135 Surface: AAC 0 (Ft) True Area: 22265.00000 (SqFt Comments 0.5" MILL, 1.5" P-401 OVERLAY Seal coated with GRIPFLEX CONDITION/AGE FEATURE CHANGE FROM 1998 INSPECTION EST 1991 AC PAVEMENT 140 Surface: AAC
1/1/1970 Network: 0 L.C.D. 1/1/20 Work Date 1/1/2013 1/1/2003 1/1/1998 1/1/1991 Network: 0	IMPORT ED CLEARW 013 Us Work Code ML-OV SS-CT IMPORT ED IMPORT ED	ATER AIR se: TAXIWAY Work Do MILL and OVE Surface Seal - C BUILT OVERLAY ATER AIR se: TAXIWAY	Rank: P I escription BRLAY Coal Tar Branch: TW A	TAXIV Length: 700 Cost 0.00 0.00 0.00 0.00 TAXIV	WAY A .00 (Ft) Wi Thickness (in) 0.00 0.00 0.00 0.00 WAY A	Section: dth: 30.0 Major M&R M&R Section:	135 Surface: AAC 0 (Ft) True Area: 22265.00000 (SqFt Comments 0.5" MILL, 1.5" P-401 OVERLAY Seal coated with GRIPFLEX CONDITION/AGE FEATURE CHANGE FROM 1998 INSPECTION EST 1991 AC PAVEMENT 140 Surface: AAC
1/1/1970 Network: 0 L.C.D. 1/1/20 Work Date 1/1/2013 1/1/2003 1/1/1998 1/1/1991 Network: 0 L.C.D. 1/1/20	IMPORT ED CLEARW. 013 Us Work Code ML-OV SS-CT IMPORT ED IMPORT ED CLEARW. 013 Us Work	ATER AIR se: TAXIWAY Work Do MILL and OVE Surface Seal - C BUILT OVERLAY ATER AIR se: TAXIWAY	Rank: P I escription ERLAY Coal Tar ERLAY Branch: TW A Rank: P Rank: P I escription	TAXI Cength: 700 Cost 0.00 0.00 0.00 1000 Cost 0.00	WAY A .00 (Ft) Wi Thickness (in) 0.00 0.00 0.00 0.00 0.00 WAY A .00 (Ft) Wi Thickness	Section: dth: 30.0 Major M&R Section: dth: 30.0 Major	135 Surface: AAC 0 (Ft) True Area: 22265.00000 (SqFt Comments 0.5" MILL, 1.5" P-401 OVERLAY Seal coated with GRIPFLEX CONDITION/AGE FEATURE CHANGE FROM 1998 INSPECTION EST 1991 AC PAVEMENT 140 Surface: AAC 0 (Ft) True Area: 12540.00000 (SqFt
1/1/1970 Network: 0 L.C.D. 1/1/20 Work Date 1/1/2013 1/1/2003 1/1/1998 1/1/1991 Network: 0 L.C.D. 1/1/20 Work Date	IMPORT ED CLEARW 013 Us Work Code ML-OV SS-CT IMPORT ED IMPORT ED CLEARW 013 Us Work Code	ATER AIR Se: TAXIWAY Work Do MILL and OVE Surface Seal - C BUILT OVERLAY ATER AIR Se: TAXIWAY Work Do	Rank: P I escription ERLAY Coal Tar ERLAY Branch: TW A Rank: P Rank: P I escription ERLAY	TAXIV Cength: 700 Cost 0.00 0.00 0.00 0.00 TAXIV Length: 400 Cost	WAY A .00 (Ft) Wi Thickness (in) 0.00 0.00 0.00 0.00 0.00 WAY A .00 (Ft) Wi Thickness (in)	Section: dth: 30.0 Major M&R Section: dth: 30.0 Major M&R	135 Surface:AAC 0 (Ft) True Area: 22265.00000 (SqFt Comments 0.5" MILL, 1.5" P-401 OVERLAY Seal coated with GRIPFLEX CONDITION/AGE FEATURE CHANGE FROM 1998 INSPECTION EST 1991 AC PAVEMENT 140 Surface:AAC 0 (Ft) True Area: 12540.00000 (SqFt Comments
1/1/1970 Network: L.C.D. 1/1/2 Work Date 1/1/2013 1/1/2003 1/1/1998 1/1/1991 Network: L.C.D. 1/1/2 Work Date 1/1/2013	IMPORT ED CLEARW. 013 Us Work Code ML-OV SS-CT IMPORT ED IMPORT ED IMPORT ED IMPORT ED IMPORT ED IMPORT ED IMPORT ED IMPORT ED	ATER AIR se: TAXIWAY Work Do MILL and OVE Surface Seal - C BUILT OVERLAY ATER AIR se: TAXIWAY Work Do MILL and OVE	Rank: P I escription I ERLAY I Coal Tar I Branch: TW A Rank: P I escription I I ERLAY I I Coal Tar I I Coal Tar I I ERLAY I I Coal Tar I I ERLAY I I Coal Tar I I	TAXI Cength: 700 Cost 0.00 0.00 0.00 0.00 TAXI Length: 400 Cost 0.00	WAY A .00 (Ft) Wi Thickness (in) 0.00 0.00 0.00 0.00 WAY A .00 (Ft) Wi Thickness (in) 0.00 0.00 0.00 0.00	Section: dth: 30.0 Major M&R Section: dth: 30.0 Major M&R	135 Surface: AAC 0 (Ft) True Area: 22265.00000 (SqFt Comments 0.5" MILL, 1.5" P-401 OVERLAY Seal coated with GRIPFLEX CONDITION/AGE FEATURE CHANGE FROM 1998 INSPECTION EST 1991 AC PAVEMENT 140 Surface: AAC 0 (Ft) True Area: 12540.00000 (SqFt Comments 0.5" MILL, 1.5" P-401 OVERLAY
1/1/1970 Network: L.C.D. 1/1/20 Work Date 1/1/2013 1/1/1998 1/1/1991 Network: L.C.D. 1/1/20 Work Date 1/1/2013 1/1/2013 1/1/2003	IMPORT ED CLEARW 013 Us Work Code ML-OV SS-CT IMPORT ED IMPORT ED IMPORT I	ATER AIR se: TAXIWAY Work Do MILL and OVE Surface Seal - C BUILT OVERLAY ATER AIR se: TAXIWAY Work Do MILL and OVE Surface Seal - C New Constructi	Rank: P I escription I ERLAY I Coal Tar I Branch: TW A Rank: P I escription I I ERLAY I I Coal Tar I I Coal Tar I I ERLAY I I Coal Tar I I ERLAY I I Coal Tar I I	TAXIV Cength: 700 Cost 0.00 0.00 0.00 0.00 Cost Cost 0.00 0.00 0.00	WAY A .00 (Ft) Wi Thickness (in) 0.00 0.00 0.00 0.00 WAY A .00 (Ft) Wi Thickness (in) 0.00 0.00 0.00 0.00	Section: dth: 30.0 Major M&R Section: dth: 30.0 Major M&R M&R	135 Surface: AAC 0 (Ft) True Area: 22265.00000 (SqFt Comments 0.5" MILL, 1.5" P-401 OVERLAY Seal coated with GRIPFLEX CONDITION/AGE FEATURE CHANGE FROM 1998 INSPECTION EST 1991 AC PAVEMENT 140 Surface: AAC 0 (Ft) True Area: 12540.00000 (SqFt Comments 0.5" MILL, 1.5" P-401 OVERLAY Seal coated with GRIPFLEX 2"AC/6"Crushed PCC/9"Stab Subgrad
1/1/1970 Network: L.C.D. 1/1/2 Work Date 1/1/2013 1/1/2003 1/1/1991 Network: L.C.D. 1/1/2 Work Date 1/1/2013 1/1/2003 1/1/2003 1/1/2003 1/1/2002	IMPORT ED CLEARW 013 Us Work Code ML-OV SS-CT IMPORT ED IMPORT ED CLEARW 013 Us Work Code ML-OV SS-CT NU-IN	ATER AIR se: TAXIWAY Work Do MILL and OVE Surface Seal - C BUILT OVERLAY ATER AIR se: TAXIWAY Work Do MILL and OVE Surface Seal - C New Constructi	Rank: P I escription I ERLAY I Coal Tar I Branch: TW A Rank: P I I escription I ERLAY I Coal Tar I Branch: P I Branch: TW A I Branch: TW A I	TAXIV Cength: 700 Cost 0.00 0.00 0.00 0.00 TAXIV Cost 0.00 0.00 0.00	WAY A .00 (Ft) Wi Thickness (in) 0.00 0.00 0.00 0.00 WAY A .00 (Ft) Wi Thickness (in) 0.00	Section: dth: 30.0 Major M&R Section: dth: 30.0 Major M&R Section: Section:	135 Surface: AAC 0 (Ft) True Area: 22265.00000 (SqFt Comments 0.5" MILL, 1.5" P-401 OVERLAY Seal coated with GRIPFLEX CONDITION/AGE FEATURE CHANGE FROM 1998 INSPECTION EST 1991 AC PAVEMENT 140 Surface: AAC 0 (Ft) True Area: 12540.00000 (SqFt Comments 0.5" MILL, 1.5" P-401 OVERLAY Seal coated with GRIPFLEX 2"AC/6"Crushed PCC/9"Stab Subgrad 145 Surface: AC
1/1/1970 Network: L.C.D. 1/1/20 Work Date 1/1/2013 1/1/2003 1/1/1991 Network: L.C.D. 1/1/20 Work Date 1/1/2013 1/1/200 1/1/200 1/1/200 1/1/200 1/1/200 1/1/200 1/1/200 1/1/200 1/1/200 1/1/200 1/1/200 1/1	IMPORT ED CLEARW 013 Us Work Code ML-OV SS-CT IMPORT ED IMPORT ED CLEARW 013 Us Work Code ML-OV SS-CT NU-IN	ATER AIR se: TAXIWAY Work Do MILL and OVE Surface Seal - C BUILT OVERLAY ATER AIR se: TAXIWAY MILL and OVE Surface Seal - C New Constructi ATER AIR se: TAXIWAY	Rank: P I escription I ERLAY I Coal Tar I Branch: TW A Rank: P I I escription I ERLAY I Coal Tar I Branch: P I Branch: TW A I Branch: TW A I	TAXIV Cength: 700 Cost 0.00 0.00 0.00 0.00 TAXIV Cost 0.00 0.00 0.00	WAY A .00 (Ft) Wi Thickness (in) 0.00 0.00 0.00 0.00 WAY A .00 (Ft) Wi Thickness (in) 0.00	Section: dth: 30.0 Major M&R Section: dth: 30.0 Major M&R Section: Section:	135 Surface: AAC 0 (Ft) True Area: 22265.00000 (SqFt Comments 0.5" MILL, 1.5" P-401 OVERLAY Seal coated with GRIPFLEX CONDITION/AGE FEATURE CHANGE FROM 1998 INSPECTION EST 1991 AC PAVEMENT 140 Surface: AAC 0 (Ft) True Area: 12540.00000 (SqFt Comments 0.5" MILL, 1.5" P-401 OVERLAY Seal coated with GRIPFLEX 2"AC/6"Crushed PCC/9"Stab Subgrad

Work History Report

Page 5 of 6

Network:	CLEARW	ATER AIR	Branch: TW A	TAXIV	WAY A	Section:	150 Surface:AAC
L.C.D. 1/1/2	013 Us	e: TAXIWAY	Rank: P I	ength: 2,600	.00 (Ft) Wi	dth: 30.0	0 (Ft) True Area: 15000.00000 (SqFt
Work Date	Work Code	Work D	escription	Cost	Thickness (in)	Major M&R	Comments
1/1/2013	ML-OV	MILL and OVI	ERLAY	0.00	0.00		REMOVE OR MILL EXISTING ASP
1/1/1991	OL-MR	Overlay		0.00	0.00		1991: 1.5" P-401
1/1/1970	NU-IN	New Construct	ion - Initial	0.00	0.00		1970: 1" AC ON 6" LIMEROCK
Network:	CLEARW.	ATER AIR	Branch: TW A2	2 TAXIV	WAY A2	Section:	120 Surface:AAC
L.C.D. 1/1/2	013 Us	e: TAXIWAY	Rank: P I	ength: 100	.00 (Ft) Wi	dth: 50.0	0 (Ft) True Area: 6567.000002 (SqFt
Work Date	Work Code	Work D	escription	Cost	Thickness (in)	Major M&R	Comments
1/1/2013	ML-OV	MILL and OVI	ERLAY	0.00	0.00		0.5" MILL, 1.5" P-401 OVERLAY
1/1/2003	SS-CT	Surface Seal - 0	Coal Tar	0.00	0.00		Seal coated with GRIPFLEX
1/1/1991	IMPORT ED	OVERLAY		0.00	0.00		1991: AC PAVEMENT
1/1/1991	IMPORT ED	OVERLAY		0.00	0.00		SOIL: SP
		DIULT		0.00	1.00		1970: 1" AC ON 6" LIMEROCK
1/1/1970	IMPORT ED	BUILI		0.00			
	ED		Daracha TWA	1	VAV AD	Quert's an	125
Network:	ED CLEARW	ATER AIR	Branch: TW A	B TAXIV	WAY A3	Section:	
	ED CLEARW 013 Us			B TAXIV	.00 (Ft) Wi	dth: 50.0	125 Surface: AAC 0 (Ft) True Area: 6967.000002 (SqFt
Network:	ED CLEARW	ATER AIR 6e: TAXIWAY		B TAXIV			
Network: L.C.D. 1/1/2	ED CLEARW 013 Us Work	ATER AIR 6e: TAXIWAY	Rank: P I	3 TAXIV ength: 100	.00 (Ft) Wi Thickness	dth: 50.0 Major	0 (Ft) True Area: 6967.000002 (SqFt
Network: L.C.D. 1/1/2 Work Date	ED CLEARW 013 Us Work Code	ATER AIR se: TAXIWAY Work D	Rank: P I escription ERLAY	3 TAXIV ength: 100 Cost	.00 (Ft) Wi Thickness (in)	dth: 50.0 Major M&R	0 (Ft) True Area: 6967.000002 (SqFt Comments
Network: L.C.D. 1/1/2 Work Date 1/1/2013	ED CLEARW. 013 Us Work Code ML-OV SS-CT IMPORT	ATER AIR se: TAXIWAY Work D MILL and OVI	Rank: P I escription ERLAY	3 TAXIV cength: 100 Cost 0.00	.00 (Ft) Wi Thickness (in) 0.00	dth: 50.0 Major M&R	0 (Ft) True Area: 6967.000002 (SqFt Comments 0.5" MILL, 1.5" P-401 OVERLAY
Network: L.C.D. 1/1/2 Work Date 1/1/2013 1/1/2003	ED CLEARW. 013 Us Work Code ML-OV SS-CT IMPORT ED IMPORT	ATER AIR e: TAXIWAY Work D MILL and OVI Surface Seal - 0	Rank: P I escription ERLAY	3 TAXIV ength: 100 Cost 0.00 0.00	.00 (Ft) Wi Thickness (in) 0.00 0.00	dth: 50.0 Major M&R ☑	0 (Ft) True Area: 6967.000002 (SqFt Comments 0.5" MILL, 1.5" P-401 OVERLAY Seal coated with GRIPFLEX
Network: L.C.D. 1/1/2 Work Date 1/1/2013 1/1/2003 1/1/1991	ED CLEARW. 013 Us Work Code ML-OV SS-CT IMPORT ED IMPORT ED IMPORT	ATER AIR Work D MILL and OVI Surface Seal - (OVERLAY OVERLAY	Rank: P I escription ERLAY	3 TAXIV ength: 100 Cost 0.00 0.00 0.00	.00 (Ft) Wi Thickness (in) 0.00 0.00 0.00	dth: 50.0 Major M&R ▼ ↓ ↓	0 (Ft) True Area: 6967.000002 (SqFt Comments 0.5" MILL, 1.5" P-401 OVERLAY Seal coated with GRIPFLEX 1991: AC PAVEMENT
Network: L.C.D. 1/1/2 Work Date 1/1/2013 1/1/2003 1/1/1991 1/1/1991	ED CLEARW. 013 Us Work Code ML-OV SS-CT IMPORT ED IMPORT ED	ATER AIR Work D MILL and OVI Surface Seal - (OVERLAY OVERLAY	Rank: P I escription ERLAY	3 TAXIV ength: 100 Cost 0.00 0.00 0.00	.00 (Ft) Wi Thickness (in) 0.00 0.00 0.00 0.00	dth: 50.0 Major M&R ♥ ♥ ♥	0 (Ft) True Area: 6967.000002 (SqFt Comments 0.5" MILL, 1.5" P-401 OVERLAY Seal coated with GRIPFLEX 1991: AC PAVEMENT SOIL: SP
Network: L.C.D. 1/1/2 Work Date 1/1/2013 1/1/2003 1/1/1991 1/1/1991 1/1/1970	ED CLEARW 013 Us Work Code ML-OV SS-CT IMPORT ED IMPORT ED	ATER AIR Work D MILL and OVI Surface Seal - (OVERLAY OVERLAY	Rank: P I escription ERLAY	B TAXIV cength: 100 Cost 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00	.00 (Ft) Wi Thickness (in) 0.00 0.00 0.00 0.00 1.00	dth: 50.0 Major M&R ♥ ♥ ♥	0 (Ft) True Area: 6967.000002 (SqFt Comments 0.5" MILL, 1.5" P-401 OVERLAY Seal coated with GRIPFLEX 1991: AC PAVEMENT SOIL: SP 1970: 1" AC ON 6" LIMEROCK
Network: L.C.D. 1/1/2 Work Date 1/1/2013 1/1/2003 1/1/1991 1/1/1991 1/1/1970	ED CLEARW. 013 Us Work Code ML-OV SS-CT IMPORT ED IMPORT ED IMPORT ED	ATER AIR we: TAXIWAY Work D MILL and OVI Surface Seal - (OVERLAY OVERLAY BUILT	Rank: P I rescription ERLAY Coal Tar Branch: TW CO	3 TAXIV cength: 100 Cost 0.00 0.00 0.00 0.00 0.00	.00 (Ft) Wi Thickness (in) 0.00 0.00 0.00 1.00 WAY CON	dth: 50.0 Major M&R	0 (Ft) True Area: 6967.000002 (SqFt Comments 0.5" MILL, 1.5" P-401 OVERLAY Seal coated with GRIPFLEX 1991: AC PAVEMENT SOIL: SP 1970: 1" AC ON 6" LIMEROCK
Network: L.C.D. 1/1/2 Work Date 1/1/2013 1/1/2003 1/1/1991 1/1/1991 1/1/1970 Network:	ED CLEARW. 013 Us Work Code ML-OV SS-CT IMPORT ED IMPORT ED IMPORT ED	ATER AIR e: TAXIWAY Work D MILL and OVI Surface Seal - (OVERLAY OVERLAY BUILT ATER AIR e: TAXIWAY	Rank: P I rescription ERLAY Coal Tar Branch: TW CO	3 TAXIV cength: 100 Cost 0.00 0.00 0.00 0.00 0.00	.00 (Ft) Wi Thickness (in) 0.00 0.00 0.00 1.00 WAY CON	dth: 50.0 Major M&R	0 (Ft) True Area: 6967.000002 (SqFt Comments 0.5" MILL, 1.5" P-401 OVERLAY Seal coated with GRIPFLEX 1991: AC PAVEMENT SOIL: SP 1970: 1" AC ON 6" LIMEROCK 5105 Surface: AC
Network: L.C.D. 1/1/2 Work Date 1/1/2013 1/1/2003 1/1/1991 1/1/1991 1/1/1970 Network: L.C.D. 1/1/1	ED CLEARW. 013 Us Work Code ML-OV SS-CT IMPORT ED IMPORT ED IMPORT ED IMPORT 991 Us Work	ATER AIR we: TAXIWAY Work D MILL and OVI Surface Seal - 0 OVERLAY OVERLAY BUILT ATER AIR we: TAXIWAY Work D	Rank: P I rescription I ERLAY I Coal Tar I Branch: TW CO Rank: P	TAXIV cength: 100 Cost 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00	.00 (Ft) Wi Thickness (in) 0.00 0.00 0.00 0.00 1.00 WAY CON .00 (Ft) Wi Thickness	dth: 50.0 Major M&R ♥ ♥ ♥ ♥ ♥ ♥ ♥ Section: dth: 30.0 Major	0 (Ft) True Area: 6967.000002 (SqFt Comments 0.5" MILL, 1.5" P-401 OVERLAY Seal coated with GRIPFLEX 1991: AC PAVEMENT SOIL: SP 1970: 1" AC ON 6" LIMEROCK 5105 Surface: AC 0 (Ft) True Area: 1446.000000 (SqFt
Network: L.C.D. 1/1/2 Work Date 1/1/2013 1/1/2003 1/1/1991 1/1/1991 1/1/1991 1/1/1970 Network: L.C.D. 1/1/1	ED CLEARW. 013 Us MC-OV SS-CT IMPORT ED IMPORT ED IMPORT ED IMPORT BD SCLEARW. 991 Us	ATER AIR we: TAXIWAY Work D MILL and OVI Surface Seal - 0 OVERLAY OVERLAY BUILT ATER AIR we: TAXIWAY Work D	Rank: P I escription I ERLAY I Coal Tar I Branch: TW CO Rank: P I escription I escription I ent - Seal Coat I	TAXIV ength: 100 Cost 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.	.00 (Ft) Wi Thickness (in) 0.00 0.00 0.00 0.00 1.00 WAY CON .00 (Ft) Wi Thickness (in)	dth: 50.0 Major M&R ♥ ♥ ♥ ♥ ♥ ♥ ♥ Section: dth: 30.0 Major	0 (Ft) True Area: 6967.000002 (SqFt Comments 0.5" MILL, 1.5" P-401 OVERLAY Seal coated with GRIPFLEX 1991: AC PAVEMENT SOIL: SP 1970: 1" AC ON 6" LIMEROCK 5105 Surface: AC 0 (Ft) True Area: 1446.000000 (SqFt
Network: L.C.D. 1/1/2 Work Date 1/1/2013 1/1/2003 1/1/1991 1/1/1991 1/1/1970 Network: L.C.D. 1/1/1 Work Date	ED CLEARW. 013 Us Work Code ML-OV SS-CT IMPORT ED IMPORT ED IMPORT ED IMPORT ED IMPORT ED IMPORT ED IMPORT ED IMPORT ED	ATER AIR we: TAXIWAY Work D MILL and OVI Surface Seal - (OVERLAY OVERLAY BUILT ATER AIR we: TAXIWAY Work D Surface Treatm Surface Seal - (Rank: P I escription I ERLAY I Coal Tar I Branch: TW CO Rank: P I escription I escription I ent - Seal Coat I	3 TAXIV cength: 100 Cost 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.00	.00 (Ft) Wi Thickness (in) 0.00 0.00 0.00 1.00 WAY CON .00 (Ft) Wi Thickness (in) 0.00	dth: 50.0 Major M&R ♥ ♥ ♥ ♥ ♥ ♥ ♥ Section: dth: 30.0 Major	0 (Ft) True Area: 6967.000002 (SqFt Comments 0.5" MILL, 1.5" P-401 OVERLAY Seal coated with GRIPFLEX 1991: AC PAVEMENT SOIL: SP 1970: 1" AC ON 6" LIMEROCK 5105 Surface: AC 0 (Ft) True Area: 1446.000000 (SqFt Comments

Work History Report

Pavement Database: FDOT

Summary:

Work Description	Section Count	Area Total (SqFt)	Thickness Avg (in)	Thickness STD (in)
BUILT	13	451,231.00	1.00	0.78
MILL and OVERLAY	15	456,229.00	0.00	0.00
New Construction - Initial	12	217,129.00	0.50	0.87
OVERLAY	18	743,106.00	0.50	1.41
Surface Seal - Coal Tar	20	576,216.00	0.00	0.00
Surface Treatment - Seal Coat	10	188,259.00	0.00	0.00

10/3/2019	Branch Condition ReportPage 1 ofPavement Database: FDOT							
Branch ID	Number of Sections	Sum Section Length (Ft)	Avg Section Width (Ft)	True Area (SqFt)	Use	Average PCI	Standard Deviation PCI	Weighted Average PCI
AP CENTE	2	1,185.00	21.50	33,673.00	APRON	69.50	20.50	76.52
AP N	2	294.00	80.00	21,977.00	APRON	64.00	22.00	47.17
AP T-HAN 1	2	1,651.00	50.00	44,376.00	APRON	68.00	20.00	59.31
AP T-HAN 2	1	1,800.00	20.00	37,331.00	APRON	59.00	0.00	59.00
AP T-HAN 3	1	1,200.00	20.00	24,739.00	APRON	65.00	0.00	65.00
AP T-HANG	2	1,046.00	25.00	27,298.00	APRON	70.00	22.00	68.99
RW 16-34	4	4,097.00	75.00	308,025.00	RUNWAY	84.75	4.32	80.56
TW A	7	7,950.00	30.00	149,033.00	TAXIWAY	81.29	7.92	79.17
TW A1	1	100.00	50.00	6,928.00	TAXIWAY	77.00	0.00	77.00
TW A2	1	100.00	50.00	6,567.00	TAXIWAY	72.00	0.00	72.00
TW A3	1	100.00	50.00	6,967.00	TAXIWAY	63.00	0.00	63.00
TW CONN	1	50.00	30.00	1,446.00	TAXIWAY	47.00	0.00	47.00

10/3/2019Branch Condition ReportPagPavement Database: FDOT								
Use Category	Number of Sections	Total Area (SqFt)	Arithmetic Average PCI	Average STD PCI	Weighted Average PCI			
APRON	10	189,394.00	66.70	19.22	63.04			
RUNWAY	4	308,025.00	84.75	4.32	80.56			
TAXIWAY	11	170,941.00	75.27	12.27	77.88			
ALL	25	74.91						

10/3/2019			Page 1	l of 2						
Pavement Dat	abase: FDOT				Netw	vorkId.	CLW			
Branch ID	Section ID	Last Const. Date	Surface	Use	Rank	Lanes	True Area (SqFt)	Last Inspection Date	Age At Inspec tion	PCI
AP CENTER	4405	1/1/2015	AAC	APRON	Р	0	22,600.00	12/10/201 8	3	90
AP CENTER	4410	12/15/1999	AC	APRON	Р	0	11,073.00	12/10/201 8	19	49
AP N	4505	1/1/2003	AC	APRON	Р	0	19,396.00	12/10/201 8	15	42
AP N	4510	1/1/2012	AC	APRON	Р	0	2,581.00	12/10/201 8	6	86
AP T-HAN 1	4305	12/25/1999	AC	APRON	Р	0	31,826.00	12/10/201 8	19	48
AP T-HAN 1	4310	1/1/2015	AAC	APRON	Р	0	12,550.00	12/10/201 8	3	88
AP T-HAN 2	4105	1/1/1996	AC	APRON	Р	0	37,331.00	12/10/201 8	22	59
AP T-HAN 3	4205	1/1/1996	AC	APRON	Р	0	24,739.00	12/10/201 8	22	65
AP T-HANG	4605	1/1/1996	AC	APRON	Р	0	14,273.00	12/10/201 8	22	48
AP T-HANG	4610	1/1/2015	AAC	APRON	Р	0	13,025.00	12/10/201 8	3	92
RW 16-34	6105	1/1/2013	AAC	RUNWAY	Р	0	15,000.00	12/10/201 8	5	88
RW 16-34	6110	1/1/2013	AAC	RUNWAY	Р	0	224,775.00	12/10/201 8	5	78
RW 16-34	6120	1/1/2013	AAC	RUNWAY	Р	0	22,500.00	12/10/201 8	5	84
RW 16-34	6130	1/1/2013	AC	RUNWAY	Р	0	45,750.00	12/10/201 8	5	89
TW A	105	1/1/2013	AAC	TAXIWAY	Р	0	63,329.00	12/10/201 8	5	77
TW A	107	1/1/2013	AAC	TAXIWAY	Р	0	5,097.00	12/10/201 8	5	89
TW A	110	1/1/2013	AAC	TAXIWAY	Р	0	7,086.00	12/10/201 8	5	79
TW A	135	1/1/2013	AAC	TAXIWAY	Р	0	22,265.00	0	5	66
TW A	140	1/1/2013	AAC	TAXIWAY	Р	0	12,540.00	8	5	80
TW A	145	1/1/2013	AC	TAXIWAY	Р	0	23,716.00	8	5	88
TW A	150	1/1/2013	AAC	TAXIWAY	Р	0	15,000.00	0	5	90
TW A1	115	1/1/2013	AAC	TAXIWAY	Р	0	6,928.00	12/10/201 8	5	77
TW A2	120	1/1/2013	AAC	TAXIWAY	Р	0	6,567.00	12/10/201 8	5	72
TW A3	125	1/1/2013	AAC	TAXIWAY	Р	0	6,967.00	12/10/201 8	5	63
TW CONN 34	5105	1/1/1991	AC	TAXIWAY	Р	0	1,446.00	12/10/201 8	27	47

Age Category	Average Age at Inspection	Total Area (SqFt)	Number of Sections	Arithmetic Average PCI	Standard Deviation PCI	Weighted Average PCI
03-05	5	525,695.00	17	81.76	8.52	80.65
06-10	6	2,581.00	1	86.00	0.00	86.00
11-15	15	19,396.00	1	42.00	0.00	42.00
16-20	19	42,899.00	2	48.50	0.50	48.26
21-25	22	76,343.00	3	57.33	7.04	58.89
26-30	27	1,446.00	1	47.00	0.00	47.00
ALL	9	668,360.00	25	73.36	16.03	74.91

Statewide Airfield Pavement Management Program



Appendix B

Airfield Pavement Localized Maintenance and Repair and Major Rehabilitation

Network ID	Branch ID	Section ID	Distress Code	Description	Severity	Distress Qty	Distress Unit	Percent Distress	Work Description	Work Qty	Work Unit	Uni	t Cost	w	/ork Cost
CLW	AP CENTER	4410	41	ALLIGATOR CR	Low	9.9	SqFt	0.1%	FDOT - PATCHING - AC FULL DEPTH	26.9	SqFt	\$	9.00	\$	240.00
CLW	AP CENTER	4410	43	BLOCK CR	Medium	19.7	SqFt	0.2%	FDOT - CRACK SEALING - AC	5.9	Ft	\$	3.00	\$	20.00
CLW	AP N	4505	45	DEPRESSION	Low	144.24	SqFt	0.7%	FDOT - PATCHING - AC FULL DEPTH	197	SqFt	\$	9.00	\$	1,770.00
CLW	AP N	4505	52	RAVELING	Low	9329.3	SqFt	48.1%	FDOT - SURFACE SEAL	9329.1	SqFt	\$	0.55	\$	5,140.00
CLW	AP N	4505	52	RAVELING	Medium	7758.41	SqFt	40.0%	FDOT - PATCHING - AC PARTIAL DEPTH	7758.6	SqFt	\$	4.00	\$	31,040.00
CLW	AP N	4510	52	RAVELING	Low	26.05	SqFt	1.0%	FDOT - SURFACE SEAL	25.8	SqFt	\$	0.55	\$	20.00
CLW	AP T-HAN 1	4305	45	DEPRESSION	Low	54.68	SqFt	0.2%	FDOT - PATCHING - AC FULL DEPTH	88.3	SqFt	\$	9.00	\$	800.00
CLW	AP T-HAN 1	4305	45	DEPRESSION	Medium	227.66	SqFt	0.7%	FDOT - PATCHING - AC FULL DEPTH	292.8	SqFt	\$	9.00	\$	2,640.00
CLW	AP T-HAN 1	4305	48	L & T CR	Medium	306.59	Ft	1.0%	FDOT - CRACK SEALING - AC	306.8	Ft	\$	3.00	\$	920.00
CLW	AP T-HAN 1	4305	50	PATCHING	Medium	424.96	SqFt	1.3%	FDOT - PATCHING - AC FULL DEPTH	512.4	SqFt	\$	9.00	\$	4,610.00
CLW	AP T-HAN 1	4305	52	RAVELING	Low	31161.2	SqFt	97.9%	FDOT - SURFACE SEAL	31161.5	SqFt	\$	0.55	\$	17,140.00
CLW	AP T-HAN 1	4310	52	RAVELING	Low	625.92	SqFt	5.0%	FDOT - SURFACE SEAL	625.4	SqFt	\$	0.55	\$	350.00
CLW	AP T-HAN 2	4105	45	DEPRESSION	Low	182.99	SqFt	0.5%	FDOT - PATCHING - AC FULL DEPTH	241.1	SqFt	\$	9.00	\$	2,180.00
CLW	AP T-HAN 2	4105	48	L & T CR	Medium	281.59	Ft	0.8%	FDOT - CRACK SEALING - AC	281.5	Ft	\$	3.00	\$	850.00
CLW	AP T-HAN 2	4105	52	RAVELING	Low	36732.6	SqFt	98.4%	FDOT - SURFACE SEAL	36732.9	SqFt	\$	0.55	\$	20,210.00
CLW	AP T-HAN 3	4205	41	ALLIGATOR CR	Low	27.45	SqFt	0.1%	FDOT - PATCHING - AC FULL DEPTH	52.7	SqFt	\$	9.00	\$	480.00
CLW	AP T-HAN 3	4205	52	RAVELING	Low	24739.02	SqFt	100.0%	FDOT - SURFACE SEAL	24738.7	SqFt	\$	0.55	\$	13,610.00
CLW	AP T-HANG	4605	41	ALLIGATOR CR	Low	23.79	SqFt	0.2%	FDOT - PATCHING - AC FULL DEPTH	47.4	SqFt	\$	9.00	\$	430.00
CLW	AP T-HANG	4605	43	BLOCK CR	Medium	451.98	SqFt	3.2%	FDOT - CRACK SEALING - AC	137.8	Ft	\$	3.00	\$	420.00
CLW	AP T-HANG	4605	52	RAVELING	Low	14273.05	SqFt	100.0%	FDOT - SURFACE SEAL	14273	SqFt	\$	0.55	\$	7,860.00
CLW	RW 16-34	6110	45	DEPRESSION	Low	57.48	SqFt	0.0%	FDOT - PATCHING - AC FULL DEPTH	91.5	SqFt	\$	9.00	\$	830.00
CLW	TW A	105	45	DEPRESSION	Low	97.09	SqFt	0.2%	FDOT - PATCHING - AC FULL DEPTH	141	SqFt	\$	9.00	\$	1,270.00
CLW	TW A	105	45	DEPRESSION	Medium	202.68	SqFt	0.3%	FDOT - PATCHING - AC FULL DEPTH	263.7	SqFt	\$	9.00	\$	2,380.00
CLW	TW A	135	48	L & T CR	Medium	85.33	Ft	0.4%	FDOT - CRACK SEALING - AC	85.3	Ft	\$	3.00	\$	260.00
CLW	TW A	140	45	DEPRESSION	Low	165.12	SqFt	1.3%	FDOT - PATCHING - AC FULL DEPTH	220.7	SqFt	\$	9.00	\$	1,990.00
CLW	TW A	145	52	RAVELING	Low	47.47	SqFt	0.2%	FDOT - SURFACE SEAL	47.4	SqFt	\$	0.55	\$	30.00
CLW	TW A1	115	45	DEPRESSION	Low	176.64	SqFt	2.6%	FDOT - PATCHING - AC FULL DEPTH	234.7	SqFt	\$	9.00	\$	2,110.00
CLW	TW A3	125	45	DEPRESSION	Low	779.95	SqFt	11.2%	FDOT - PATCHING - AC FULL DEPTH	896.6	SqFt	\$	9.00	\$	8,070.00
CLW	TW CONN 34	5105	43	BLOCK CR	Medium	69.97	SqFt	4.8%	FDOT - CRACK SEALING - AC	21.3	Ft	\$	3.00	\$	70.00
CLW	TW CONN 34	5105	52	RAVELING	Low	1440	SqFt	99.6%	FDOT - SURFACE SEAL	1440.2	SqFt	\$	0.55	\$	800.00
CLW	TW CONN 34	5105	52	RAVELING	Medium	6.03	SqFt	0.4%	FDOT - PATCHING - AC PARTIAL DEPTH	6.5	SqFt	\$	4.00	\$	30.00

Table B-1 Localized Maintenance and Repair Needs based on Current Condition

Clearwater Airpark (CLW)



121

2019



	1	2 2 10 100				8 1100000 0			
Program Year	Network ID	Branch ID	Section ID	Surface	Area (SF)	PCI Before	Rehabilitation Type	Pla	nning Cost
2020	CLW	AP CENTER	4410	AC	11,073	48	AC Restoration	\$	112,000.00
2020	CLW	AP N	4505	AC	19,396	40	AC Restoration	\$	239,000.00
2020	CLW	AP T-HAN 1	4305	AC	31,826	46	AC Restoration	\$	332,000.00
2020	CLW	AP T-HAN 2	4105	AC	37,331	58	AC Restoration	\$	355,000.00
2020	CLW	AP T-HAN 3	4205	AC	24,739	63	AC Restoration	\$	236,000.00
2020	CLW	AP T-HANG	4605	AC	14,273	46	AC Restoration	\$	149,000.00
2020	CLW	TW A3	125	AAC	6,967	62	AC Restoration	\$	67,000.00
2020	CLW	TW CONN 34	5105	AC	1,446	46	AC Restoration	\$	16,000.00
2021	CLW	TW A	135	AAC	22,265	64	AC Restoration	\$	212,000.00
2026	CLW	TW A2	120	AAC	6,567	64	AC Restoration	\$	63,000.00


Table B-2 10-Year Major Rehabilitation Planning Needs at Section Level


Statewide Airfield Pavement Management Program



Appendix C

Technical Exhibits

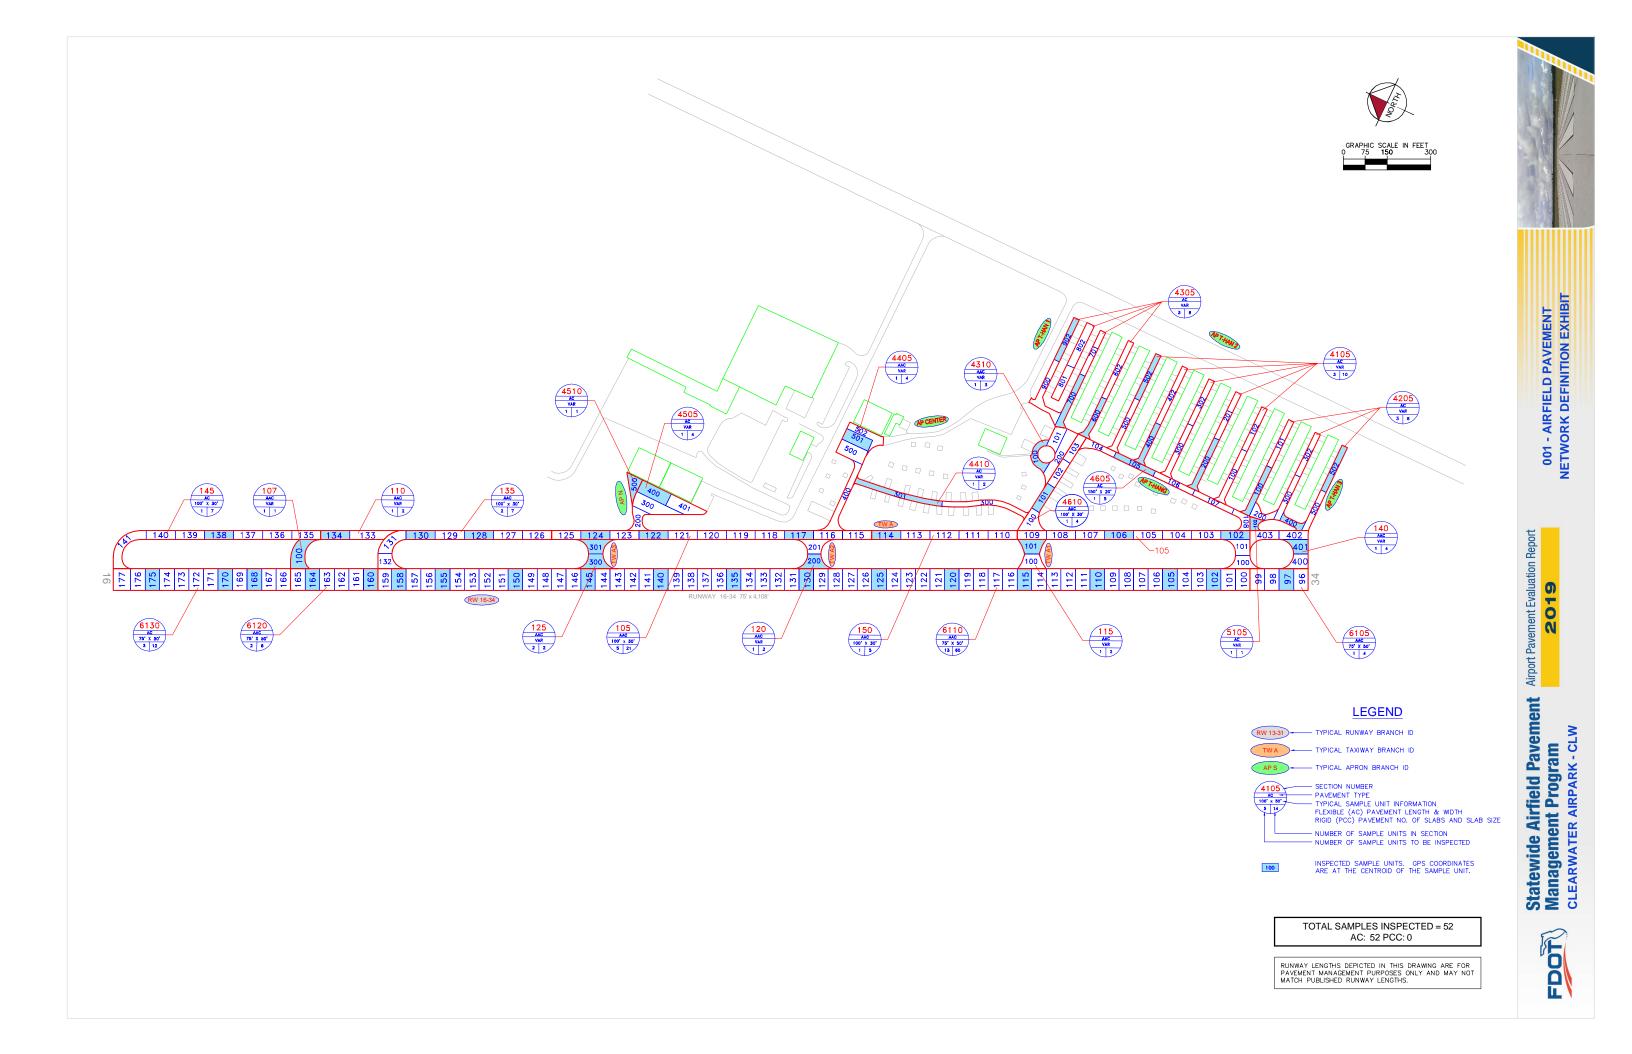

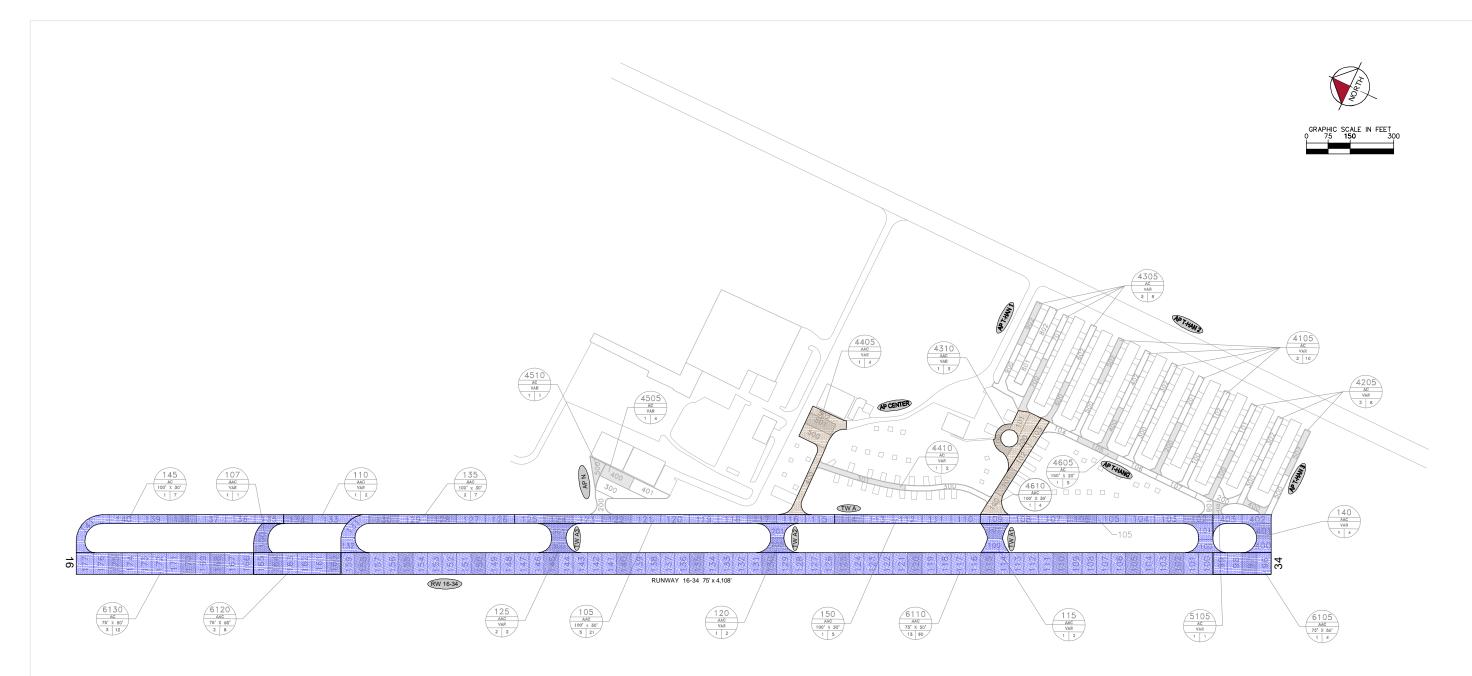


CONSTRUCTION SINCE LAST INSPECTION & ANTICIPATED CONSTRUCTION ACTIVITY

& AN	TICIFATED CON	ISTRUCTION ACTIV
CONSTRUCTION YEAR	LOCATION	WORK TYPE / PAVE
2013	RW 16-34, TW A	NEW CONSTRUCTION - 5" P-219, 12" P-160
2013	TW A, TW A1, TW A2, TW A3	MILL AND OVERLAY / 0 P-401 OVERLAY
2015	AP CENTER, AP T-HAN 1, AP T-HANG	MILL AND OVERLAY

RUNWAY LENGTHS DEPICTED IN THIS DRAWING ARE FOR PAVEMENT MANAGEMENT PURPOSES ONLY AND MAY NOT MATCH PUBLISHED RUNWAY LENGTHS.


PROJECTS	YEAR	2013
PROJECTS	YEAR	2014
PROJECTS	YEAR	2015
PROJECTS	YEAR	2016
PROJECTS	YEAR	2017
PROJECTS	YEAR	2018
PROJECTS	YEAR	2019
PROJECTS	YEAR	2020
PROJECTS	YEAR	2021
PROJECTS	YEAR	2022








002 - AIRFIELD PAVEMENT SYSTEM INVENTORY EXHIBIT

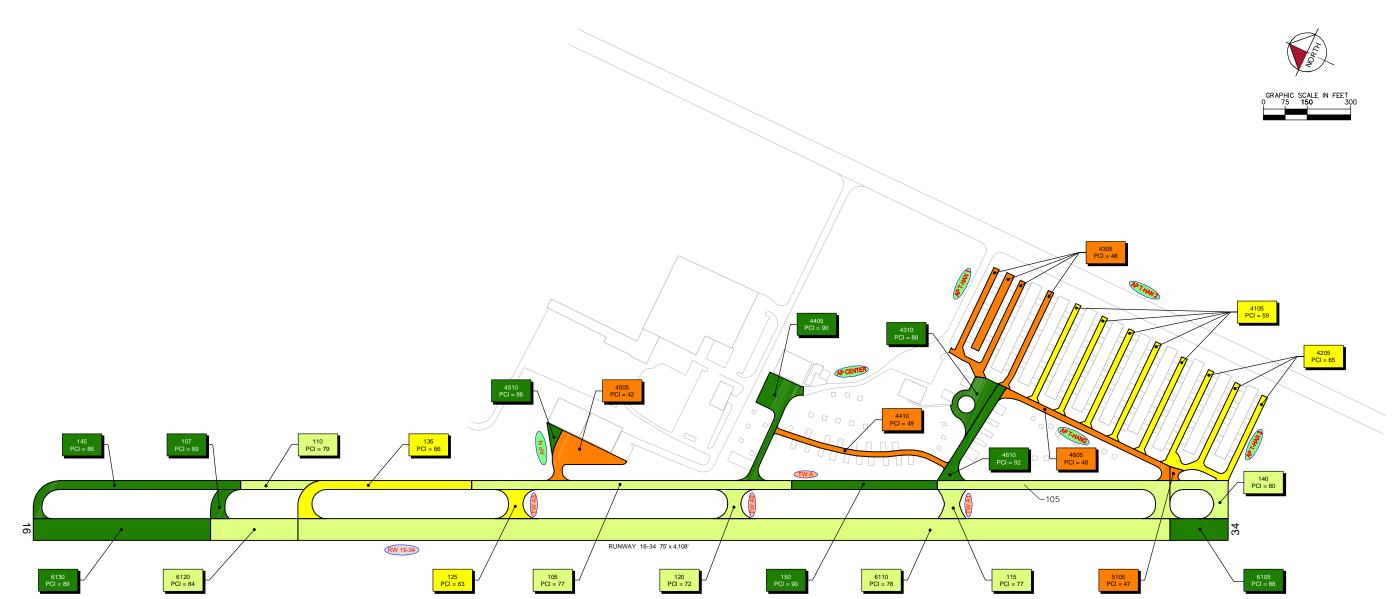







LEGEND

RW 13-31	- TYPICAL RUNWAY BRANCH ID
TWA	- TYPICAL TAXIWAY BRANCH ID
AP S	- TYPICAL APRON BRANCH ID
	PCI 86-100 GOOD
	PCI 71-85 SATISFACTORY
	PCI 56-70 FAIR
	PCI 41-55 POOR
	PCI 26-40 VERY POOR
	PCI 11-25 SERIOUS
	PCI 0-10 FAILED
	_

RUNWAY LENGTHS DEPICTED IN THIS DRAWING ARE FOR PAVEMENT MANAGEMENT PURPOSES ONLY AND MAY NOT MATCH PUBLISHED RUNWAY LENGTHS.

SECTION NO. "PCI NO."

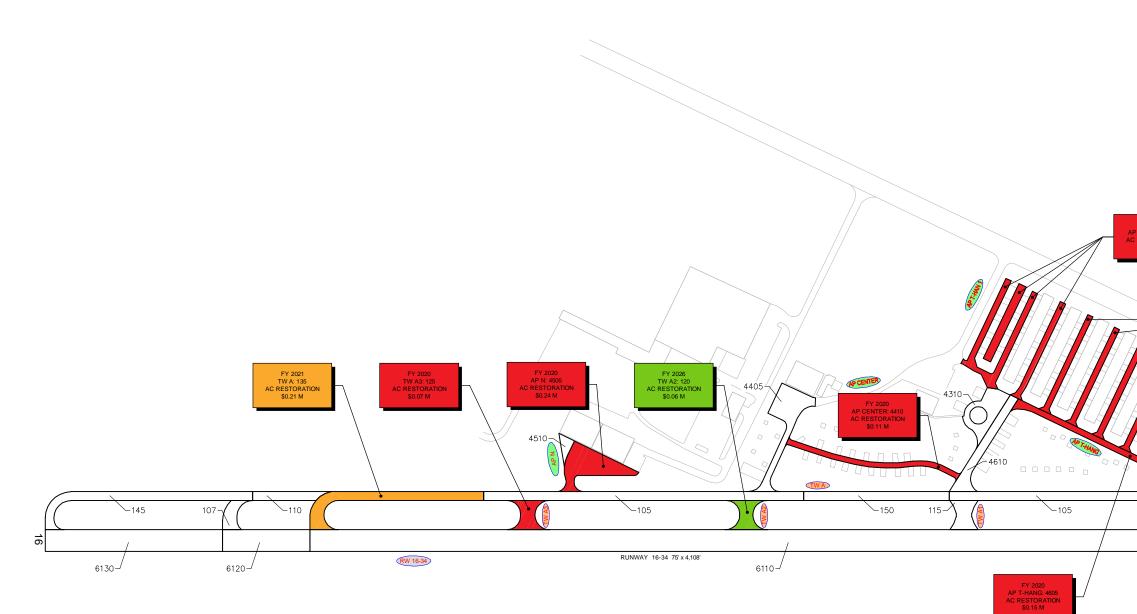

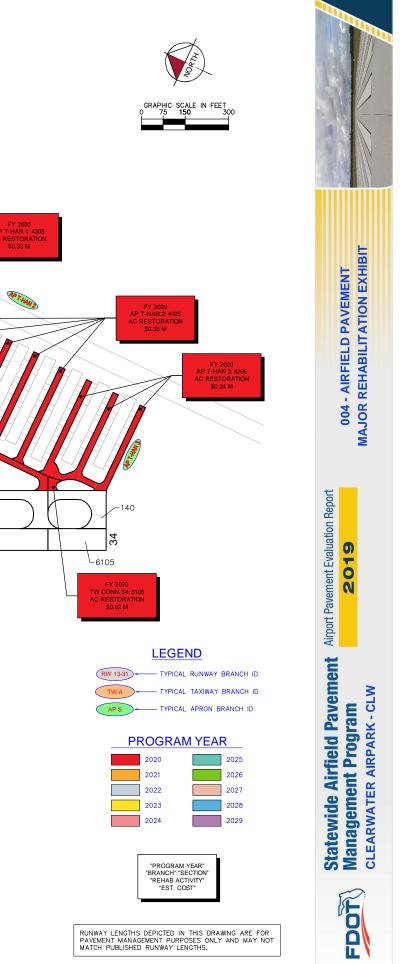


Statewide Airfield Pavement Management Program



Appendix D

Inspection Photograph Documentation

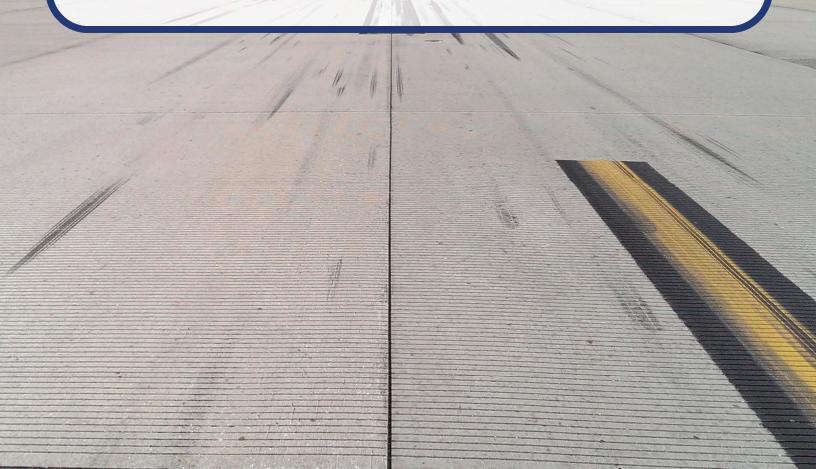





RW 16-34, Section 6110, Sample Unit 110 - Low Severity (48) Longitudinal & Transverse Cracking, Low Severity (56) Swelling, and Low Severity (57) Weathering



RW 16-34, Section 6110, Sample Unit 130 - Low Severity (48) Longitudinal & Transverse Cracking, Low Severity (56) Swelling, and Low Severity (57) Weathering

2019

Clearwater Airpark (CLW)





RW 16-34, Section 6110, Sample Unit 102 - Low Severity (45) Depression, Low Severity (48) Longitudinal & Transverse Cracking, Low Severity (56) Swelling, and Low Severity (57) Weathering



TW A, Section 105, Sample Unit 102 - Medium Severity (45) Depression, Low Severity (48) Longitudinal & Transverse Cracking, and Low Severity (57) Weathering







TW A, Section 135, Sample Unit 128 - Low Severity (48) Longitudinal & Transverse Cracking, Medium Severity (48) Longitudinal & Transverse Cracking, and Low Severity (57) Weathering



TW CONN 34, Section 5105, Sample Unit 102 - Low Severity (43) Block Cracking, Medium Severity (43) Block Cracking, Low Severity (48) Longitudinal & Transverse Cracking, and Low Severity (52) Raveling



121



AP CENTER, Section 4410, Sample Unit 301 - Low Severity (43) Block Cracking, Medium Severity (43) Block Cracking, and Low Severity (57) Weathering



AP T-HANG, Section 4605, Sample Unit 105 - Severity (43) Block Cracking, Medium Severity (43) Block Cracking, and Low Severity (52) Raveling






AP T-HAN 2, Section 4105, Sample Unit 400 - Low Severity (43) Block Cracking, Low Severity (45) Depression, Medium Severity (48) Longitudinal & Transverse Cracking, and Low Severity (52) Raveling

Statewide Airfield Pavement Management Program



Appendix E

Inspection Distress Details

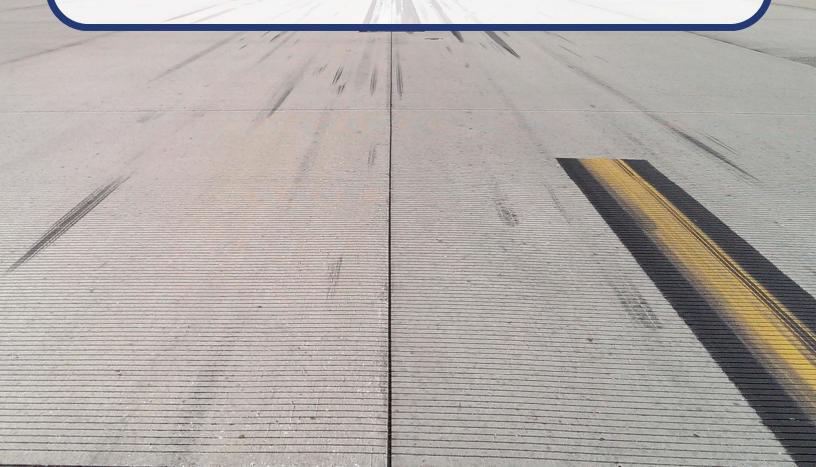

Re-Inspection Report

FDOT						
Generated Date	10/3/2019					Page 1 of 26
Network: CLW		Name:	CLEARWATER AI	RPARK		
Branch: AP CENTER	Name:	CENTER APRON	Use: A	APRON A	rea: 33,673 SqFt	
Section: 4405	of 2 Fr	om: -		То: -	Last Cons	st.: 1/1/2015
Surface: AAC Fai	mily: C9N59-RL-AP-A	AC-APC Zone:		Category:	Rank: P	
Area: 22,600 Sq	qFt Length:	575 Ft	Width:	25 Ft		
Slabs: Sla	ab Length:	Ft Slab W	idth:	Ft	Joint Length:	Ft
Shoulder: St	treet Type:	Grade:	0		Lanes: 0	
Section Comments:						
Work Date: 12/25/1999	Work Type: New C	onstruction - Initial	Code	: NU-IN	Is Major M&R: True	
Work Date: 1/1/2003	Work Type: Surface	e Seal - Coal Tar	Code	: SS-CT	Is Major M&R: False	;
Work Date: 1/1/2014	Work Type: Surface	e Treatment - Seal Coat	Code	: ST-SC	Is Major M&R: False	
Work Date: 1/1/2015	Work Type: MILL :	and OVERLAY	Code	: ML-OV	Is Major M&R: True	
Last Insp. Date: 12/10/2018	TotalSar	nples: 5	Surveyed:	1		
Conditions: PCI: 90						
Inspection Comments:						
Sample Number: 501	Type: R	Area:	3927.00 SqFt	PCI: 90		
Sample Comments:						
48 L & T CR57 WEATHERING	L L	12.00 Ft 3927.00 SqFt				

Network: CLW		Name:	CLEARWATER AIRPAR	K	
Branch: AP CENTER	Name:	CENTER APRON	Use: APRO	N Area:	33,673 SqFt
Section: 4410	of 2	From: -	To:	-	Last Const.: 12/15/1999
Surface: AC	Family: C9N59-RL-AF	P-AC Zone:	Cat	egory:	Rank: P
Area: 11,07	3 SqFt Length:	610 Ft	Width:	18 Ft	
Slabs:	Slab Length:	Ft Slab V	Vidth: Ft	Joir	nt Length: Ft
Shoulder:	Street Type:	Grade	e: 0	Lan	nes: 0
Section Comments:					
Work Date: 12/15/1999	Work Type: New	Construction - Initial	Code: NU	J-IN	Is Major M&R: True
Work Date: 1/1/2003	Work Type: Surfa	ce Seal - Coal Tar	Code: SS	-CT	Is Major M&R: False
Work Date: 1/1/2014	Work Type: Surfa	ce Treatment - Seal Coat	Code: ST	-SC	Is Major M&R: False
Last Insp. Date: 12/10/201	8 TotalS	amples: 2	Surveyed: 1		
Conditions: PCI: 49					
Inspection Comments:					
Sample Number: 301	Type: R	Area:	5621.00 SqFt	PCI: 49	
Sample Comments:					
43 BLOCK CR	L	5606.00 SqFt			
43 BLOCK CR	М	10.00 SqFt			
57 WEATHERING	L	5621.00 SqFt			
41 ALLIGATOR CR	L	5.00 SqFt			

Network:	CLW			Na	me: CL	EARWATER	AIRPARK			
Branch:	AP N		Name:	NORTH API	RON	Use:	APRON	Area:	21,977 SqF	t
Section:	4505	0	f 2	From: -			To: -		Last Con	st.: 1/1/2003
Surface:	AC	Family:	C9N59-RL-A	AP-AC Zo	ne:		Category:		Rank: H)
Area:		19,396 SqFt	Length	: 200	Ft	Width:	100 Ft			
Slabs:		Slab Len	gth:	Ft	Slab Width:		Ft	Joint L	ength:	Ft
Shoulder:		Street Ty	ype:		Grade: 0			Lanes:	0	
Section Co	omments:									
Work Date	e: 1/1/2003	W	ork Type: Ne	w Construction - In	tial	C	ode: NU-IN	Is N	Aajor M&R: True	2
Work Date	e: 1/1/2003	W	ork Type: Su	face Seal - Coal Ta	r	C	ode: SS-CT	Is N	lajor M&R: Fals	e
Work Date	e: 1/1/2014	W	ork Type: Su	face Treatment - Se	al Coat	C	ode: ST-SC	Is N	lajor M&R: Fals	e
-	Date: 12/1		Tota	Samples: 4		Surveye	d: 1			
Conditions										
Inspection	Comments	:								
Sample Nu	imber: 40	0 Typ	e: R	Area:	484	0.00 SqFt	PCI:	42		
Sample Co	omments:									
50 PA	TCHING		L	576.00 SqFt						
52 RA	VELING		М	1936.00 SqFt						
48 L&	t CR		L	101.00 Ft						
52 RA	VELING		L	2328.00 SqFt						
45 DE	PRESSION		L	36.00 SqFt						

Network:	CLW]	Name:	CLEARWATE	RAIRPARK		
Branch:	AP N		Name:	NORTH A	PRON	Use:	APRON	Area:	21,977 SqFt
Section:	4510	to	f 2 F	rom: -			To: -		Last Const.: 1/1/2012
Surface:	AC	Family:	C9N59-RL-AP	-AC	Zone:		Category:		Rank: P
Area:		2,581 SqFt	Length:	(94 Ft	Width:	60 Ft		
Slabs:		Slab Len	gth:	Ft	Slab Wid	lth:	Ft	Joint Lo	ength: Ft
Shoulder:		Street Ty	pe:		Grade:	0		Lanes:	0
Section Co	omments:								
Work Date	e: 1/1/2012	W	ork Type: New	Construction -	Initial	(Code: NU-IN	Is N	fajor M&R: True
Last Insp.	Date: 12/1	0/2018	TotalSa	amples: 1		Survey	ed: 1		
Conditions	s: PCI:	86							
Inspection	Comments:	:							
Sample Nu	umber: 500) Typ	e: R	Area	:	2581.00 SqFt	PCI:	86	
Sample Co	omments:								
52 RA	VELING		L	26.00 Sq	Ft				
48 L&	& T CR		L	26.00 Ft					
57 WE	EATHERING	j	L	2555.00 Sq	Ft				

Netwo	ork: CLW			Name	: CLE	ARWATER	AIRPARK				
Bran	h: AP T-HAN	1	Name:	APRON AT T-I	HANGARS 1	Use:	APRON	Area:	44,376	SqFt	
Sectio	n: 4305	of 2		From: -			То: -		Last	t Const.: 12/25/1	1999
Surfa	ce: AC	Family: C9	9N59-RL-AI	P-AC Zone:			Category:		Ran	k: P	
Area:	31	,826 SqFt	Length:	1,480 Ft		Width:	20 Ft				
Slabs		Slab Length	:	Ft S	Slab Width:		Ft	Join	t Length:	Ft	
Shoul	der:	Street Type:		(Grade: 0			Lan	es: 0		
Sectio	n Comments:										
Work	Date: 12/25/1999	Work	Type: New	Construction - Initia	1	C	ode: NU-IN		Is Major M&R:	True	
Work	Date: 1/1/2003	Work	Type: Surf	àce Seal - Coal Tar		C	ode: SS-CT		Is Major M&R:	False	
Work	Date: 1/1/2014	Work	Type: Surf	àce Treatment - Seal (Coat	C	ode: ST-SC		Is Major M&R:	False	
Last	nsp. Date: 12/10/2	2018	TotalS	Samples: 8		Survey	ed: 3				
Cond	itions: PCI: 4	8									
Inspe	ction Comments:										
Samp	le Number: 600	Type:	R	Area:	3160	.00 SqFt	PCI: 4	6			
Samp	le Comments:										
52	RAVELING		L	3020.00 SqFt							
48	L & T CR		М	12.00 Ft							
50	PATCHING		М	140.00 SqFt							
48	L & T CR		L	257.00 Ft							
45	DEPRESSION		L	18.00 SqFt							
43	BLOCK CR		L	820.00 SqFt							
56	SWELLING		L	15.00 SqFt							
-	le Number: 700	Type:	R	Area:	4124	.00 SqFt	PCI: 5	55			
Samp	le Comments:										
48	L & T CR		М	54.00 Ft							
43	BLOCK CR		L	60.00 SqFt							
50	PATCHING		L	39.00 SqFt							
48	L & T CR		L	238.00 Ft							
52	RAVELING		L	4085.00 SqFt							
Samp	le Number: 902	Туре:	R	Area:	3200	.00 SqFt	PCI: 4	1			
Samp	le Comments:										
43	BLOCK CR		L	1750.00 SqFt							
50	PATCHING		L	40.00 SqFt							
52	RAVELING		L	3160.00 SqFt							
48	L & T CR		L	153.00 Ft							
45	DEPRESSION		М	75.00 SqFt							
48	L & T CR		М	35.00 Ft							

Network:	CLW				Name: (CLEARWATE	R AIRPARK				
Branch:	AP T-HAN 1		Name:	APRON	AT T-HANGAR	Use:	APRON	А	rea:	44,376 SqFt	
Section: 4	4310	of	2	From: -			To:	-		Last Const.:	1/1/2015
Surface: A	AAC	Family:	C9N59-RL-A	P-AAC-APC	Zone:		Categ	gory:		Rank: P	
Area:	12,55	0 SqFt	Length:		171 Ft	Width:		80 Ft			
Slabs:		Slab Len	gth:	Ft	Slab Widt	th:	Ft		Joint Length:	Ft	
Shoulder:		Street Ty	pe:		Grade:	0			Lanes: 0		
Section Con	nments:										
Work Date:	12/25/1999	Wo	ork Type: New	Construction	- Initial	(Code: NU-	IN	Is Major	M&R: True	
Work Date:	1/1/2003	Wo	ork Type: Surf	ace Seal - Coa	l Tar	(Code: SS-C	CT	Is Major	M&R: False	
Work Date:	1/1/2014	Wo	ork Type: Surf	ace Treatment	- Seal Coat	(Code: ST-S	SC	Is Major	M&R: False	
Work Date:	1/1/2015	Wo	ork Type: MIL	L and OVERI	.AY	(Code: ML-	OV	Is Major	M&R: True	
Last Insp. D	Date: 12/10/201	.8	TotalS	amples: 3		Survey	ed: 1				
Conditions:	PCI: 88										
Inspection C	Comments:										
Sample Nun	nber: 100	Тур	e: R	Are	ea: 3	3168.00 SqFt		PCI: 88			
Sample Con	nments:										
52 RAV	ELING		L	158.00 S	qFt						
57 WEA	ATHERING		L	3010.00 S	1						

Network: CLW		Name:	CLEARWATE	R AIRPARK		
Branch: AP T-HAN 2	Name:	APRON AT T-HAN	GARS 2 Use:	APRON	Area: 3	7,331 SqFt
Section: 4105	of 1 F	rom: -		То: -		Last Const.: 1/1/1996
Surface: AC Fami	ily: C9N59-RL-AP	AC Zone:		Category:		Rank: P
Area: 37,331 SqF	t Length:	1,800 Ft	Width:	20 Ft		
Slabs: Slab	b Length:	Ft Slab	Width:	Ft	Joint Length:	Ft
Shoulder: Stre	eet Type:	Grad	e: 0		Lanes: 0	
Section Comments:						
Work Date: 1/1/1996	Work Type: BUIL	Т		Code: IMPORTED	Is Major M	&R: True
Work Date: 1/1/2003	Work Type: Surfac	ce Seal - Coal Tar		Code: SS-CT	Is Major M	&R: False
Work Date: 1/1/2014	Work Type: Surfac	ce Treatment - Seal Coat	(Code: ST-SC	Is Major M	&R: False
Last Insp. Date: 12/10/2018	TotalSa	mples: 10	Survey	ved: 3		
Conditions: PCI: 59						
Inspection Comments:						
Sample Number: 200	Type: R	Area:	4010.00 SqFt	PCI: 64		
Sample Comments:						
48 L & T CR	L	295.00 Ft				
52 RAVELING	L	4010.00 SqFt				
48 L & T CR	М	25.00 Ft				
Sample Number: 400	Type: R	Area:	3196.00 SqFt	PCI: 49		
Sample Comments:						
48 L & T CR	М	30.00 Ft				
43 BLOCK CR	L	112.00 SqFt				
50 PATCHING	L	170.00 SqFt				
48 L & T CR	L	222.00 Ft				
52 RAVELING	L	3026.00 SqFt				
45 DEPRESSION	L	52.00 SqFt				
Sample Number: 502	Type: R	Area:	3400.00 SqFt	PCI: 64		
Sample Comments:						
-	L	341.00 Ft				
-	L M	341.00 Ft 25.00 Ft				

Network: CLW		Name:	CLEARWATER	AIRPARK	
Branch: AP T-HAN 3	Name:	APRON AT T-HA	NGARS 3 Use:	APRON	Area: 24,739 SqFt
Section: 4205	of 1	From: -		То: -	Last Const.: 1/1/1996
Surface: AC Fa	amily: C9N59-RL-AF	P-AC Zone:		Category:	Rank: P
Area: 24,739 S	GqFt Length:	1,200 Ft	Width:	20 Ft	
Slabs: S	lab Length:	Ft Sla	b Width:	Ft	Joint Length: Ft
Shoulder: S	street Type:	Gr	ade: 0		Lanes: 0
Section Comments:					
Work Date: 1/1/1996	Work Type: BUII	LT	C	ode: IMPORTED	Is Major M&R: True
Work Date: 1/1/1996	Work Type: OVE	RLAY	C	ode: IMPORTED	Is Major M&R: True
Work Date: 1/1/2003	Work Type: Surfa	ace Seal - Coal Tar	C	Code: SS-CT	Is Major M&R: False
Work Date: 1/1/2014	Work Type: Surfa	ace Treatment - Seal Co	at C	Code: ST-SC	Is Major M&R: False
Last Insp. Date: 12/10/2018	TotalS	amples: 8	Survey	ed: 3	
Conditions: PCI: 65					
Inspection Comments:					
Sample Number: 100	Type: R	Area:	3738.00 SqFt	PCI: 64	
Sample Comments:					
56 SWELLING	L	125.00 SqFt			
52 RAVELING	L	3738.00 SqFt			
48 L & T CR	L	285.00 Ft			
Sample Number: 400	Type: R	Area:	1878.00 SqFt	PCI: 69	
Sample Comments:					
48 L & T CR	L	15.00 Ft			
52 RAVELING	L	1878.00 SqFt			
Sample Number: 502	Type: R	Area:	3400.00 SqFt	PCI: 64	
Sample Comments:					
52 RAVELING	L	3400.00 SqFt			
41 ALLIGATOR CR	L	10.00 SqFt			
48 L & T CR	L	22.00 Ft			

Network:	CLW				Name:	CLE	ARWATER	R AIRF	PARK				
Branch:	AP T-HA	NG	Name	: Т-НА	NGAR AP	RON	Use:	AP	RON	Area:	27,298	8 SqFt	
Section:	4605	0	of 2	From:	-				То: -		Las	t Const.:	1/1/1996
Surface:	AC	Family:	C9N59-RI	L-AP-AC	Zone:				Category:		Rai	nk: P	
Area:	1	4,273 SqFt	Leng	gth:	660 Ft		Width:		20 Ft				
Slabs:		Slab Lei	ngth:	Ft	S	lab Width:			Ft	Joint Leng	gth:	F	t
Shoulder:		Street T	ype:		G	Frade: 0				Lanes:	0		
Section Co	mments:												
Work Date	e: 1/1/1996	W	ork Type:]	BUILT			(Code:	IMPORTED	Is Ma	jor M&R:	True	
Work Date	e: 1/1/1996	W	ork Type: (OVERLAY			(Code:	IMPORTED	Is Ma	jor M&R:	True	
Work Date	e: 1/1/2003	W	ork Type: S	Surface Seal - C	Coal Tar		(Code:	SS-CT	Is Ma	jor M&R:	False	
Work Date	e: 1/1/2014	W	ork Type: S	Surface Treatme	ent - Seal C	Coat	(Code:	ST-SC	Is Ma	jor M&R:	False	
Last Insp. 1	Date: 12/10	0/2018	To	talSamples:	5		Survey	ed: 1					
Conditions	: PCI:	48											
Inspection	Comments:												
Sample Nu	mber: 105	Ty	pe: R	1	Area:	3000	0.00 SqFt		PCI: 48				
Sample Co	mments:												
52 RA	VELING		L	3000.00	SqFt								
43 BLO	OCK CR		М	95.00	SqFt								
41 ALI	LIGATOR C	R	L		SqFt								
43 BLO	OCK CR		L	2900.00	1								

Network:	CLW					Nam	e: CL	EARWAT	ER AIR	PARK				
Branch:	AP T-H	IANG	Ň	ame:	T-HAN	GAR A	PRON	Use	e: Al	PRON	Area:	27,298	3 SqFt	
Section:	4610		of 2	Fre	om: -					To: -		Las	t Const.:	1/1/2015
Surface:	AAC	Family	: C9N5	9-RL-AP-A	AC-APC	Zone	:			Category:		Rai	ık: P	
Area:		13,025 SqFt]	Length:		386 Ft	t	Width:		30 Ft				
Slabs:		Slab L	ength:		Ft		Slab Width:			Ft	Joint Le	ngth:	F	⁷ t
Shoulder:		Street	Туре:				Grade: 0)			Lanes:	0		
Section Co	omments:													
Work Date	e: 1/1/1996		Work Ty	pe: OVERI	LAY				Code:	IMPORTED	Is M	ajor M&R:	True	
Work Date	e: 1/1/1996		Work Ty	pe: BUILT					Code:	IMPORTED	Is M	ajor M&R:	True	
Work Date	e: 1/1/2003		Work Ty	pe: Surface	Seal - Co	al Tar			Code:	SS-CT	Is M	ajor M&R:	False	
Work Date	e: 1/1/2014		Work Ty	pe: Surface	Treatmen	ıt - Seal	Coat		Code:	ST-SC	Is M	ajor M&R:	False	
Work Date	e: 1/1/2015		Work Ty	pe: MILL a	and OVER	LAY			Code:	ML-OV	Is M	ajor M&R:	True	
Last Insp.	Date: 12/	10/2018		TotalSan	ples: 4			Surve	eyed:	1				
Conditions	s: PCI:	92												
Inspection	Comments	s:												
Sample Nu	umber: 10)1 1	ype:	R	Aı	rea:	300	04.00 SqFt		PCI: 92	2			
Sample Co	omments:													
57 WE	EATHERIN	G	L		3004.00	SqFt								
48 L&	t CR		L		3.00	Ft								

Network:	CLW				Name	CLE	EARWATER	AIRPARK			
Branch:	RW 16-3	34	Name:	RUNW	'AY 16-3	34	Use:	RUNWAY	Area:	308,025 Sc	qFt
Section:	6105	(of 4	From: -				То: -		Last C	onst.: 1/1/2013
Surface:	AAC	Family:	C9N59-RL-R APC	W-AAC-	Zone:			Category:		Rank:	Р
Area:		15,000 SqFt	Length:		200 Ft		Width:	75 Ft			
Slabs:		Slab Le	ngth:	Ft	5	Slab Width:		Ft	Joint L	ength:	Ft
Shoulder:		Street T	ype:		(Grade: 0			Lanes:	0	
Section Co	mments:										
Work Date	: 1/1/2002	W	Vork Type: New	Construction	n - Initia	1	С	ode: NU-IN	Is I	Major M&R: Ti	rue
Work Date	: 1/1/2003	W	Vork Type: Surf	ace Seal - Co	al Tar		С	ode: SS-CT	Is I	Major M&R: Fa	alse
Work Date	: 1/1/2013	W	Vork Type: MIL	L and OVER	RLAY		С	ode: ML-OV	Is I	Major M&R: Ti	rue
Last Insp. 1	Date: 12/1	0/2018	Totals	amples: 4	ł		Surveye	ed: 1			
Conditions Inspection	: PCI: Comments:	88									
Sample Nu	mber: 09'	7 Ty	pe: R	A	rea:	3750).00 SqFt	PCI: 8	38		
Sample Co	mments:										
57 WE	ATHERING	j	L	3750.00	SqFt						
48 L&	T CR		L	69.00	Ft						

Network: CLW		Name: 0	CLEARWATER AIRPA	ARK	
Branch: RW 16-34	Name:	RUNWAY 16-34		NWAY Area:	308,025 SqFt
		rom: -		Го: -	Last Const.: 1/1/2013
	mily: C9N59-RL-RW				Rank: P
Surface: AAC Fa	APC	-AAC- Zolle:	(Category:	канк: г
Area: 224,775 Sc	qFt Length:	2,997 Ft	Width:	75 Ft	
Slabs: Sl	lab Length:	Ft Slab Widt	th: F	rt Jo	bint Length: Ft
Shoulder: St	treet Type:	Grade:	0	L	anes: 0
Section Comments:					
Work Date: 1/1/1970	Work Type: BUIL	Г	Code:	IMPORTED	Is Major M&R: True
Work Date: 1/1/1991	Work Type: OVEF	RLAY	Code:	IMPORTED	Is Major M&R: True
Work Date: 1/1/1991	Work Type: OVEF	RLAY	Code:	IMPORTED	Is Major M&R: True
Work Date: 1/1/2003	Work Type: Surfac	e Seal - Coal Tar	Code:	SS-CT	Is Major M&R: False
Work Date: 1/1/2013	Work Type: MILL	and OVERLAY	Code:	ML-OV	Is Major M&R: True
Last Insp. Date: 12/10/2018	TotalSa	mples: 60	Surveyed: 13	3	
Conditions: PCI: 78					
Inspection Comments:					
Sample Number: 102	Type: A	Area: 3	3750.00 SqFt	PCI: 75	
Sample Comments:					
56 SWELLING	L	35.00 SqFt			
57 WEATHERING	L	3750.00 SqFt			
45 DEPRESSION48 L & T CR	L L	28.00 SqFt 139.00 Ft			
Sample Number: 105	Type: R		3750.00 SqFt	PCI: 75	
Sample Comments:	Type. K	Aita. 5	750.00 Sqrt	i ci. 75	
-	-	.			
56 SWELLING 48 L & T CR	L L	300.00 SqFt 189.00 Ft			
45 DEPRESSION	L	4.00 SqFt			
57 WEATHERING	L	3750.00 SqFt			
Sample Number: 110	Type: R	Area: 3	3750.00 SqFt	PCI: 70	
Sample Comments:					
56 SWELLING	L	330.00 SqFt			
45 DEPRESSION48 L & T CR	L L	2.00 SqFt 295.00 Ft			
57 WEATHERING	L	3750.00 SqFt			
Sample Number: 115	Type: R		3750.00 SqFt	PCI: 74	
Sample Comments:					
48 L & T CR	L	228.00 Ft			
56 SWELLING	L	50.00 SqFt			
57 WEATHERING	L	3750.00 SqFt			
Sample Number: 120	Type: R	Area: 3	3750.00 SqFt	PCI: 78	
Sample Comments:					
57 WEATHERING	L	3750.00 SqFt			
56 SWELLING 48 L & T CR	L L	160.00 SqFt 141.00 Ft			
Sample Number: 125	Type: R		3750.00 SqFt	PCI: 91	
Sample Comments:	- JPC 10			/1	
-	Ŧ	0.00 E			
48 L & T CR57 WEATHERING	L L	8.00 Ft 3750.00 SqFt			
Sample Number: 130	Type: R		3750.00 SqFt	PCI: 66	
Sample Comments:	••				

57	WEATHERING		L	3750.00 SqFt			
56	SWELLING		L	110.00 SqFt			
48	L & T CR		L	405.00 Ft			
Samp	ole Number: 135	Type:	R	Area:	3750.00 SqFt	PCI: 87	
Samp	ole Comments:						
57	WEATHERING		L	3750.00 SqFt			
56	SWELLING		L	10.00 SqFt			
48	L & T CR		L	40.00 Ft			
Samp	ole Number: 140	Type:	R	Area:	3750.00 SqFt	PCI: 76	
Samp	ole Comments:				-		
56	SWELLING		т	65.00 SqFt			
56 48	L & T CR		L L	184.00 Ft			
40 57	WEATHERING		L				
				3750.00 SqFt			
Samp	ole Number: 145	Type:	R	Area:	3750.00 SqFt	PCI: 77	
Samp	ole Comments:						
57	WEATHERING		L	3750.00 SqFt			
56	SWELLING		L	60.00 SqFt			
48	L & T CR		L	169.00 Ft			
Samp	ole Number: 150	Type:	R	Area:	3750.00 SqFt	PCI: 90	
Samp	ole Comments:						
57	WEATHERING		L	3750.00 SqFt			
48	L & T CR		L	18.00 Ft			
	ble Number: 155	Type:	R	Area:	3750.00 SqFt	PCI: 75	
-		r yper	К	in cu.	5750.00 5410		
Samp	ole Comments:						
57	WEATHERING		L	3750.00 SqFt			
48	L & T CR		L	232.00 Ft			
56	SWELLING		L	40.00 SqFt			
Samp	ole Number: 158	Туре:	R	Area:	3750.00 SqFt	PCI: 77	
Samp	ole Comments:						
48	L & T CR		L	203.00 Ft			
56	SWELLING		L	20.00 SqFt			
57	WEATHERING		L	3750.00 SqFt			
51			-	2720.00 Sqrt			

Network:	CLW				Name:	CLE	ARWATER	AIR	PARK				
Branch:	RW 16-34		Name:	RUNW	VAY 16-34		Use:	RU	JNWAY	Area:		308,025 SqFt	
Section:	6120	of	f 4	From:	-				To: -			Last Const.:	1/1/2013
Surface:	AAC	Family:	C9N59-RL- APC	-RW-AAC-	Zone:				Category:			Rank: P	
Area:	22,	500 SqFt	Lengt	h:	300 Ft		Width:		50 Ft				
Slabs:		Slab Len	gth:	Ft	Sl	ab Width:			Ft	J	oint Length:	F	ťt
Shoulder:		Street Ty	ype:		G	rade: 0				I	anes: 0		
Section Co	omments:												
Work Dat	e: 1/1/1992	We	ork Type: B	UILT			C	ode:	IMPORTED	1	Is Major	M&R: True	
Work Dat	e: 1/1/1992	We	ork Type: O	VERLAY			С	ode:	IMPORTED	1	Is Major	M&R: True	
Work Dat	e: 1/1/2003	We	ork Type: Si	urface Seal - C	oal Tar		С	ode:	SS-CT		Is Major	M&R: False	
Work Dat	e: 1/1/2013	We	ork Type: M	ILL and OVE	RLAY		С	ode:	ML-OV		Is Major	M&R: True	
Last Insp.	Date: 12/10/2	018	Tot	alSamples:	6		Surveye	ed: 2	2				
Condition	s: PCI: 84	ļ											
Inspection	Comments:												
Sample Nu	umber: 160	Тур	e: R	A	rea:	3750	0.00 SqFt		PCI: 8	32			
Sample Co	omments:												
57 WE	EATHERING		L	3750.00	SqFt								
48 L&	& T CR		L	157.00	-								
Sample Nu	umber: 164	Тур	e: R	A	rea:	3750	.00 SqFt		PCI: 8	36			
Sample Co	omments:												
48 L&	& T CR		L	103.00	Ft								
57 WE	EATHERING		L	3750.00	SqFt								

Network:	CLW			Name:	CLEARWATER	AIRPARK		
Branch:	RW 16-34		Name:	RUNWAY 16-34	Use:	RUNWAY	Area:	308,025 SqFt
Section:	6130	of 4		From: -		То: -		Last Const.: 1/1/2013
Surface:	AC	Family: C9	N59-RL-I	RW-AC Zone:		Category:		Rank: P
Area:	45,75	0 SqFt	Length	: 600 Ft	Width:	100 Ft		
Slabs:		Slab Length	:	Ft Sla	ab Width:	Ft	Joint L	ength: Ft
Shoulder:		Street Type:		Gi	rade: 0		Lanes:	0
Section Co	omments:							
Work Date	e: 1/1/2013	Work	Type: Ne	w Construction - Initial	C	ode: NU-IN	Is I	Major M&R: True
Last Insp.	Date: 12/10/201	8	Tota	Samples: 12	Surveye	d: 3		
Conditions	s: PCI: 89							
Inspection	Comments:							
Sample Nu	umber: 168	Туре:	R	Area:	3750.00 SqFt	PCI:	88	
Sample Co	omments:							
57 WE	EATHERING		L	3750.00 SqFt				
48 L&	τ CR		L	66.00 Ft				
Sample Nu	umber: 170	Type:	R	Area:	3750.00 SqFt	PCI:	89	
Sample Co	omments:							
57 WE	EATHERING		L	3750.00 SqFt				
48 L&	τ CR		L	42.00 Ft				
Sample Nu	umber: 175	Type:	R	Area:	3750.00 SqFt	PCI:	90	
Sample Co	omments:							
48 L&	t CR		L	24.00 Ft				
57 WE	EATHERING		L	3750.00 SqFt				

Network: CLW		Nam	ne: CLEARWATEF	₹ AIRPARK		
Branch: TW A	Name:	TAXIWAY A	Use:	TAXIWAY	Area: 149,033 SqFt	
Section: 105	of 7	From: -		To: -	Last Const.:	1/1/2013
Surface: AAC	Family: C9N59-RL- APC	-TW-AAC- Zone	e:	Category:	Rank: P	
	53,329 SqFt Lengt			30 Ft		
Slabs:	Slab Length:	Ft	Slab Width:	Ft	Joint Length: Ft	
Shoulder:	Street Type:		Grade: 0		Lanes: 0	
Section Comments:						
Work Date: 1/1/1970	Work Type: B	UILT	(Code: IMPORTED	Is Major M&R: True	
Work Date: 1/1/1991	Work Type: O	VERLAY	(Code: IMPORTED	Is Major M&R: True	
Work Date: 1/1/1991	Work Type: O	VERLAY	(Code: IMPORTED	Is Major M&R: True	
Work Date: 1/1/2003	Work Type: Si	urface Seal - Coal Tar	(Code: SS-CT	Is Major M&R: False	
Work Date: 1/1/2013	Work Type: M	IILL and OVERLAY	(Code: ML-OV	Is Major M&R: True	
Last Insp. Date: 12/10)/2018 Tot	alSamples: 21	Survey	ed: 5		
Conditions: PCI:	77					
Inspection Comments:						
Sample Number: 102	Type: R	Area:	3000.00 SqFt	PCI: 70		
Sample Comments:						
45 DEPRESSION	М	48.00 SqFt				
57 WEATHERING		3000.00 SqFt				
48 L & T CR	L	115.00 Ft				
Sample Number: 106	Type: R	Area:	3000.00 SqFt	PCI: 86		
Sample Comments:						
48 L & T CR	L	83.00 Ft				
57 WEATHERING		3000.00 SqFt				
Sample Number: 117	Type: R	Area:	3000.00 SqFt	PCI: 84		
Sample Comments:						
48 L & T CR	L	104.00 Ft				
57 WEATHERING		3000.00 SqFt				
Sample Number: 122	Type: R	Area:	3000.00 SqFt	PCI: 65		
Sample Comments:						
48 L & T CR	L	296.00 Ft				
57 WEATHERING		3000.00 SqFt				
45 DEPRESSION	L	23.00 SqFt				
56 SWELLING	L	15.00 SqFt				
Sample Number: 124	Type: R	Area:	3000.00 SqFt	PCI: 78		
Sample Comments:						
57 WEATHERING		3000.00 SqFt				
48 L & T CR	L	184.00 Ft				

Network:	CLW			Ν	ame: CL	EARWATER	AIRPARK		
Branch:	TW A		Name:	TAXIWAY	A	Use:	TAXIWAY	Area:	149,033 SqFt
Section:	107	0	of 7 I	From: -			To: -		Last Const.: 1/1/2013
Surface:	AAC	Family:	C9N59-RL-TV APC	V-AAC- Z	one:		Category:		Rank: P
Area:		5,097 SqFt	Length:	475	5 Ft	Width:	30 Ft		
Slabs:		Slab Lei	ngth:	Ft	Slab Width:	:	Ft	Joint Lei	ngth: Ft
Shoulder:		Street T	уре:		Grade: ()		Lanes:	0
Section Co	mments:								
Work Date	: 1/1/1992	W	ork Type: New	Construction - In	nitial	С	ode: NU-IN	Is M	ajor M&R: True
Work Date	: 1/1/2013	W	ork Type: MIL	and OVERLA	Y	C	ode: ML-OV	Is M	ajor M&R: True
Last Insp. l	Date: 12/1	0/2018	TotalS	amples: 1		Surveye	d: 1		
Conditions	: PCI:	89							
Inspection	Comments	:							
Sample Nu	mber: 100	0 Ty]	pe: R	Area:	509	97.00 SqFt	PCI: 8	9	
Sample Co	mments:								
57 WE.	ATHERING	Ĵ	L	5097.00 SqF	t				
48 L&	T CR		L	61.00 Ft					

Network:	CLW				Nam	ne: CL	EARWATE	R AIR	PARK				
Branch:	TW A		Name	: TAX	IWAY A		Use:	TA	XIWAY	Area:	149,03	3 SqFt	
Section:	110	C	of 7	From:	-				То: -		Las	t Const.:	1/1/2013
Surface:	AAC	Family:	C9N59-RI APC	L-TW-AAC-	Zon	e:			Category:		Rai	nk: P	
Area:		7,086 SqFt	Leng	gth:	475 F	t	Width:		30 Ft				
Slabs:		Slab Le	ngth:	F	t	Slab Width:			Ft	Joint Le	ength:	F	-
Shoulder:		Street T	ype:			Grade: 0				Lanes:	0		
Section Co	mments:												
Work Date	: 1/1/1984	W	ork Type: (OVERLAY				Code:	IMPORTED	Is N	lajor M&R	True	
Work Date	: 1/1/1992	W	ork Type: (OVERLAY				Code:	IMPORTED	Is N	lajor M&R:	True	
Work Date	: 1/1/1992	W	ork Type: 1	BUILT				Code:	IMPORTED	Is N	lajor M&R	True	
Work Date	: 1/1/2003	W	ork Type: S	Surface Seal -	Coal Tar			Code:	SS-CT	Is N	lajor M&R	False	
Work Date	: 1/1/2013	W	ork Type: 1	MILL and OV	ERLAY			Code:	ML-OV	Is N	lajor M&R	True	
Last Insp.]	Date: 12/10)/2018	To	talSamples:	2		Surve	ved:	1				
Conditions	: PCI:	79											
Inspection	Comments:												
Sample Nu	mber: 134	Ту	pe: R		Area:	300	0.00 SqFt		PCI: 79				
Sample Co	mments:												
48 L&	T CR		L	134.00) Ft								
57 WE.	ATHERING		L	2985.00) SqFt								
50 PAT	TCHING		L	15.00) SqFt								

Network:	CLW					Nam	e: (CLEARWAT	ER AIF	RPARK					
Branch:	TW A		1	Name:	TAXIV	WAY A		Us	se: T	AXIWAY	Ar	ea:	149,	033 SqFt	
Section:	135	C	of 7	F	rom:	-				То: -			1	Last Const.:	1/1/2013
Surface:	AAC	Family:	C9N APC	59-RL-TW	-AAC-	Zone	:			Category:			1	Rank: P	
Area:		22,265 SqFt		Length:		700 Ft		Width:		30 F	t				
Slabs:		Slab Le	ngth:		Ft		Slab Widt	h:		Ft		Joint Len	gth:	F	t
Shoulder:		Street T	ype:				Grade:	0				Lanes:	0		
Section Co	mments:														
Work Date	e: 1/1/1991	W	ork Ty	pe: OVEF	RLAY				Code:	IMPORT	ED	Is Ma	jor M&	R: True	
Work Date	e: 1/1/1998	i W	ork Ty	pe: BUIL	Т				Code:	IMPORTE	ED	Is Ma	jor M&	R: True	
Work Date	e: 1/1/2003	W	ork Ty	pe: Surfac	e Seal - Co	oal Tar			Code:	SS-CT		Is Ma	jor M&	R: False	
Work Date	e: 1/1/2013	w w	ork Ty	pe: MILL	and OVEI	RLAY			Code:	ML-OV		Is Ma	jor M&	R: True	
Last Insp.]	Date: 12/	10/2018		TotalSa	mples:	7		Surv	veyed:	2					
Conditions	: PCI:	66													
Inspection	Comments	5:													
Sample Nu	mber: 12	28 Ty	pe:	R	А	rea:	3	000.00 SqFt	;	PCI:	61				
Sample Co	mments:														
48 L&	TCR		M	1	23.00	Ft									
	ATHERIN	G	L		3000.00										
56 SW	ELLING		L		30.00	SqFt									
48 L &	TCR		L		358.00	Ft									
Sample Nu	mber: 13	30 Ty	pe:	R	A	rea:	3	000.00 SqFt	;	PCI:	70				
Sample Co	mments:														
48 L&	TCR		L		231.00	Ft									
48 L &	IUK														
	ATHERIN	G	L		3000.00										

Network:	CLW				Name	: CLE	EARWATER	AIRPARK				
Branch:	TW A		Name:	TAXIW	VAY A		Use:	TAXIWAY	Area:	149,02	33 SqFt	
Section:	140	(of 7	From: -				To: -		La	ast Const.:	1/1/2013
Surface:	AAC	Family:	C9N59-RL-T APC	W-AAC-	Zone:	:		Category	:	Ra	ank: P	
Area:		12,540 SqFt	Length:	:	400 Ft		Width:	30	Ft			
Slabs:		Slab Le	ngth:	Ft	5	Slab Width:		Ft	Joint	Length:	Ft	
Shoulder:		Street T	ype:		(Grade: 0			Lane	s: 0		
Section Co	omments:											
Work Dat	e: 1/1/2002	2 W	ork Type: New	v Constructio	n - Initia	1	C	ode: NU-IN	I	s Major M&F	R: True	
Work Dat	e: 1/1/2003	3 W	ork Type: Sur	face Seal - Co	oal Tar		C	Code: SS-CT	I	s Major M&F	R: False	
Work Dat	e: 1/1/2013	3 W	ork Type: MII	LL and OVER	RLAY		C	Code: ML-OV	I	s Major M&F	R: True	
Last Insp.	Date: 12/	/10/2018	Total	Samples: 4	1		Survey	ed: 1				
Condition	s: PCI:	80										
nspection	Comment	s:										
Sample Nu	umber: 40	01 Ty	pe: R	Α	rea:	3037	7.00 SqFt	PCI	: 80			
Sample Co	omments:											
18 L&	& T CR		L	74.00	Ft							
57 WE	EATHERIN	G	L	3037.00	SqFt							
5 DE	PRESSION	ſ	L	40.00	SqFt							
56 SW	/ELLING		L	10.00	SqFt							

Network:	CLW			Name	CLEARWATE	RAIRPARK		
Branch:	TW A		Name:	TAXIWAY A	Use:	TAXIWAY	Area:	149,033 SqFt
Section:	145	0	f 7	From: -		To: -		Last Const.: 1/1/2013
Surface:	AC	Family:	C9N59-RL-TV	V-AC Zone:		Category:		Rank: P
Area:		23,716 SqFt	Length:	700 Ft	Width:	30 Ft		
Slabs:		Slab Len	igth:	Ft S	Slab Width:	Ft	Joint Leng	g th: Ft
Shoulder:		Street Ty	ype:	(Grade: 0		Lanes:	0
Section Co	omments:							
Work Dat	e: 1/1/2013	W	ork Type: New	Construction - Initia	1	Code: NU-IN	Is Maj	or M&R: True
Last Insp.	Date: 12/	10/2018	TotalS	amples: 7	Survey	ed: 1		
Condition	s: PCI:	88						
Inspection	Comments	s:						
Sample Nu	umber: 13	8 Typ	pe: R	Area:	3000.00 SqFt	PCI: 88	8	
Sample Co	omments:							
52 RA	VELING		L	6.00 SqFt				
48 L&	& T CR		L	47.00 Ft				
57 WE	EATHERIN	G	L	2994.00 SqFt				

Network:	CLW			Ν	ame: CLI	EARWATER A	AIRPARK			
Branch:	TW A		Name:	TAXIWAY	А	Use:	TAXIWAY	Area:	149,033 SqFt	
Section:	150	0	f 7	From: -			To: -		Last Cons	t.: 1/1/2013
Surface:	AAC	Family:	C9N59-RL-T APC	W-AAC- Z	one:		Category:		Rank: P	
Area:	15	,000 SqFt	Length:	2,600) Ft	Width:	30 Ft			
Slabs:		Slab Ler	igth:	Ft	Slab Width:		Ft	Joint Le	ngth:	Ft
Shoulder:		Street T	ype:		Grade: 0			Lanes:	0	
Section Co	omments:									
Work Dat	e: 1/1/1970	W	ork Type: New	Construction - In	nitial	Co	de: NU-IN	Is M	lajor M&R: True	
Work Dat	e: 1/1/1991	W	ork Type: Ove	rlay		Со	de: OL-MR	Is M	ajor M&R: True	
Work Dat	e: 1/1/2013	W	ork Type: MIL	L and OVERLA	Y	Со	de: ML-OV	Is M	lajor M&R: True	
Last Insp.	Date: 12/10/	2018	Totals	Samples: 5		Surveyed	l: 1			
Condition Inspection	s: PCI: 9 Comments:	0								
Sample N	umber: 114	Туј	e: R	Area:	300	0.00 SqFt	PCI: 9	0		
Sample Co	omments:									
48 L&	& T CR		L	23.00 Ft						
	EATHERING		L	3000.00 SqF						

Network:	CLW				Nan	ne: CL	EARWATE	RAIR	PARK			
Branch:	TW A1		Name:	TAX	IWAY A	.1	Use	: TA	XIWAY	Area:	6,928 SqFt	
Section:	115	0	f 1	From:	-				To: -		Last Const.:	1/1/2013
Surface:	AAC	Family:	C9N59-RL APC	-TW-AAC-	Zon	e:			Category:		Rank: P	
Area:		6,928 SqFt	Lengt	h:	100 F	't	Width:		50 Ft			
Slabs:		Slab Ler	igth:	F	t	Slab Width:			Ft	Joint Length	: F	t
Shoulder:		Street T	ype:			Grade: 0				Lanes: 0		
Section Co	omments:											
Work Date	e: 1/1/1970	W	ork Type: B	UILT				Code:	IMPORTED	Is Major	M&R: True	
Work Date	e: 1/1/1991	W	ork Type: O	VERLAY				Code:	IMPORTED	Is Major	M&R: True	
Work Date	e: 1/1/1991	W	ork Type: O	VERLAY				Code:	IMPORTED	Is Major	M&R: True	
Work Date	e: 1/1/2003	W	ork Type: S	urface Seal -	Coal Tar			Code:	SS-CT	Is Major	M&R: False	
Work Date	e: 1/1/2013	W	ork Type: M	IILL and OV	ERLAY			Code:	ML-OV	Is Major	M&R: True	
Last Insp.	Date: 12/1	0/2018	Tot	alSamples:	2		Surve	yed:	1			
Conditions	s: PCI:	77										
Inspection	Comments:											
Sample Nu	imber: 101	Туј	pe: R		Area:	345	1.00 SqFt		PCI: 77			
Sample Co	omments:						-					
48 L&	t CR		L	66.00) Ft							
57 WE	EATHERING PRESSION		L L	3451.00								

Network:	CLW				Name	e: CLE	EARWATE	ER AIR	PARK			
Branch:	TW A2		Name:	TAXI	WAY A2		Use	: TA	XIWAY	Area:	6,567 SqFt	
Section:	120	0	f 1	From:	-				То: -		Last Const.:	1/1/2013
Surface:	AAC	Family:	C9N59-RL-T APC	W-AAC-	Zone	:			Category:		Rank: P	
Area:		6,567 SqFt	Length:	:	100 Ft		Width:		50 Ft			
Slabs:		Slab Ler	ngth:	Ft	:	Slab Width:			Ft	Joint Lengt	h: Ft	
Shoulder:		Street T	ype:			Grade: 0				Lanes:	0	
Section Co	omments:											
Work Date	e: 1/1/1970	W	ork Type: BU	ILT				Code:	IMPORTED	Is Majo	or M&R: True	
Work Date	e: 1/1/1991	W	ork Type: OV	ERLAY				Code:	IMPORTED	Is Majo	or M&R: True	
Work Date	e: 1/1/1991	W	ork Type: OV	ERLAY				Code:	IMPORTED	Is Majo	or M&R: True	
Work Date	e: 1/1/2003	W	ork Type: Sur	face Seal - C	oal Tar			Code:	SS-CT	Is Majo	or M&R: False	
Work Date	e: 1/1/2013	W	ork Type: MII	LL and OVE	RLAY			Code:	ML-OV	Is Majo	or M&R: True	
Last Insp.	Date: 12/1	10/2018	Total	Samples:	2		Surve	eyed:	1			
Conditions	s: PCI:	72										
Inspection	Comments	:										
Sample Nu	umber: 20	0 Ty	pe: R	A	Area:	3346	5.00 SqFt		PCI: 72	2		
Sample Co	omments:											
	EATHERING & T CR	Ĵ	L L	3346.00 334.00	1							

Network:	CLW				Name	e: CL	EARWATI	ER AIR	PARK				
Branch:	TW A3		Nan	ne: TAX	IWAY A3	3	Use	e: TA	XIWAY	Area:		6,967 SqFt	
Section:	125	0	f 1	From:	-				То: -			Last Const.	.: 1/1/2013
Surface:	AAC	Family:	C9N59-I APC	RL-TW-AAC-	Zone	:			Category:			Rank: P	
Area:		6,967 SqFt	Le	ngth:	100 Ft		Width:		50 Ft				
Slabs:		Slab Lei	ngth:	Ft		Slab Width:			Ft	Jo	int Length:		Ft
Shoulder:		Street T	ype:			Grade: 0				La	nes: 0		
Section Co	omments:												
Work Date	e: 1/1/1970	W	ork Type:	BUILT				Code:	IMPORTED		Is Major I	M&R: True	
Work Date	e: 1/1/1991	W	ork Type:	OVERLAY				Code:	IMPORTED		Is Major I	M&R: True	
Work Date	e: 1/1/1991	W	ork Type:	OVERLAY				Code:	IMPORTED		Is Major 1	M&R: True	
Work Date	e: 1/1/2003	W	ork Type:	Surface Seal -	Coal Tar			Code:	SS-CT		Is Major I	M&R: False	
Work Date	e: 1/1/2013	W	ork Type:	MILL and OV	ERLAY			Code:	ML-OV		Is Major I	M&R: True	
Last Insp.	Date: 12/1	10/2018]	otalSamples:	2		Surve	eyed:	2				
Conditions	s: PCI:	63											
Inspection	Comments	:											
Sample Nu	umber: 30	0 Ty	pe: F	ł	Area:	349	6.00 SqFt		PCI: 53				
Sample Co	omments:												
45 DE	PRESSION		L	760.00) SqFt								
57 WE	EATHERING	Ĵ	L	3496.00									
48 L&	k T CR		L	84.00) Ft								
Sample Nu	umber: 30	1 Ty	pe: F	ł	Area:	347	1.00 SqFt		PCI: 74				
Sample Co	omments:												
48 L&	t CR		L	223.00) Ft								
	PRESSION		L	20.00) SqFt								
57 WE	EATHERING	ĩ	L	3471.00) SqFt								

Network:	CLW				Name:	CLEAR	WATER	AIRPARK		
Branch:	TW CO	NN 34	Name:	TAXIWA RUNWA	Y CONNE Y 34	CTOR TO	Use:	TAXIWAY	Area:	1,446 SqFt
Section:	5105	0	f 1 F	rom: -				То: -		Last Const.: 1/1/1991
Surface:	AC	Family:	C9N59-RL-TW	-AC	Zone:			Category:		Rank: P
Area:		1,446 SqFt	Length:		50 Ft	Wi	idth:	30 Ft		
Slabs:		Slab Lei	ngth:	Ft	Slab V	Width:		Ft	Joint Len	gth: Ft
Shoulder:		Street T	ype:		Grad	e: 0			Lanes:	0
Section Co	mments:									
Work Date	e: 1/1/1991	w	ork Type: BUIL	Т			Co	ode: IMPORTED	Is Ma	ajor M&R: True
Work Date	e: 1/1/2003	W	ork Type: Surfa	ce Seal - Coal	Tar		Co	ode: SS-CT	Is Ma	ajor M&R: False
Work Date	e: 1/1/2014	W	ork Type: Surfa	ce Treatment -	Seal Coat		Co	ode: ST-SC	Is Ma	ajor M&R: False
Last Insp. 1	Date: 12/1	0/2018	TotalSa	mples: 1			Surveye	d: 1		
Conditions	: PCI:	47								
Inspection	Comments:									
Sample Nu	mber: 102	2 Ty	pe: R	Are	a:	1446.00	SqFt	PCI: 4	7	
Sample Co	mments:									
48 L&	T CR		L	28.00 Ft						
	OCK CR		L	750.00 Sc						
	OCK CR		М	70.00 Sc	-					
52 RAV	VELING		L	1440.00 Sc	- Ft					
52 RAV	VELING		М	6.00 Sc	Et					